HOME INSPECTION REPORT

Property: 742 Driftwood Way, Port Alder, CA 90000
Client: Morgan Example
Inspection date: March 14, 2025
Inspector: Jordan Avery Reyes, License HI-000000
Prepared by Coastline Home Inspections
Report number: CHI-2025-0314

Weather: Clear, 64 degrees F. The house was vacant and the utilities were on.
Year built: 1987. Approximate size: 1,850 sq ft. Foundation: raised, with crawlspace.

SUMMARY

This summary lists the items that need attention. It is not the whole report; read every section, including the limitations.

1.1.1 Roof – Covering: Cracked Tiles (Repair)
1.1.2 Roof – Flashing: Loose Step Flashing (Repair)
1.2.1 Exterior – Gutters: Downspout Discharges at Foundation (Maintenance)
1.3.1 Exterior – Siding: Wood Rot at Fascia Trim (Repair)
2.1.1 Electrical – Service Panel: Double-Tapped Breaker (Safety Hazard)
2.2.1 Electrical – Receptacles: No GFCI Protection in Kitchen (Safety Hazard)
2.3.1 Electrical – Smoke Alarms: Missing in Hallway (Safety Hazard)
2.3.2 Electrical – Lighting: Inoperable Garage Light (Monitor)
3.1.1 Plumbing – Water Heater: Age (Monitor)
3.1.2 Plumbing – Water Heater: Valve Leak (Repair)
3.1.3 Plumbing – Water Heater: No Expansion Tank (Maintenance)
3.2.1 Plumbing – Supply Lines: Galvanized Piping (Monitor)
3.3.1 Plumbing – Main Shutoff: Location (Maintenance)

1. ROOF AND EXTERIOR

1.1.1 Roof – Covering: Cracked Tiles

Severity: Repair

Four cracked concrete tiles were observed on the south slope above the garage. Cracked tiles can let water reach the underlayment and the roof sheathing.

Recommendation: Recommend a licensed roofing contractor replace the cracked tiles.

1.1.2 Roof – Flashing: Loose Step Flashing

Severity: Repair

Step flashing at the chimney is loose and the sealant along its top edge has failed. Staining on the attic sheathing below suggests past leaks.

Recommendation: Recommend a qualified contractor evaluate and repair.

1. ROOF AND EXTERIOR (continued)

1.2.1 Exterior – Gutters: Downspout Discharges at Foundation

Severity: Maintenance

The rear left downspout discharges next to the foundation, and the soil there slopes toward the house.

Recommendation: Recommend extending the downspout at least 4 feet from the house.

1.3.1 Exterior – Siding: Wood Rot at Fascia Trim

Severity: Repair

Soft, deteriorated wood was found at the fascia trim near the back door. The paint has peeled and the wood is exposed.

Recommendation: Recommend a qualified contractor evaluate and repair.

2. ELECTRICAL

2.1.1 Electrical – Service Panel: Double-Tapped Breaker

Severity: Safety Hazard

Two conductors are connected to a single-pole 20-amp breaker in the main panel. This breaker is not rated for two conductors.

Recommendation: Recommend a licensed electrician correct the double tap.

2.2.1 Electrical – Receptacles: No GFCI Protection in Kitchen

Severity: Safety Hazard

Kitchen counter receptacles to the right of the sink are not GFCI protected.

Recommendation: Recommend a licensed electrician install GFCI protection.

2. ELECTRICAL (continued)

2.3.1 Electrical – Smoke Alarms: Missing in Hallway

Severity: Safety Hazard

No smoke alarm was found in the hallway outside the bedrooms.

Recommendation: Recommend installing a smoke alarm in the hallway.

2.3.2 Electrical – Lighting: Inoperable Garage Light

Severity: Monitor

The garage ceiling light did not respond to the switch. The bulb may be burned out.

Recommendation: Recommend replacing the bulb and testing the fixture again.

3. PLUMBING

3.1.1 Plumbing – Water Heater: Age

Severity: Monitor

The 50-gallon gas water heater was manufactured in 2012 and is 13 years old, near the end of its typical service life.

Recommendation: Recommend budgeting for replacement.

3.1.2 Plumbing – Water Heater: Valve Leak

Severity: Repair

The temperature and pressure relief valve is dripping, and mineral deposits have formed at the discharge pipe.

Recommendation: Recommend a licensed plumber replace the relief valve.

3.1.3 Plumbing – Water Heater: No Expansion Tank

Severity: Maintenance

No thermal expansion tank is installed on the cold water supply line.

Recommendation: Recommend a licensed plumber install a thermal expansion tank.

3. PLUMBING (continued)

3.2.1 Plumbing – Supply Lines: Galvanized Piping

Severity: Monitor

Galvanized steel supply piping was observed in the crawlspace. Reduced water pressure was noted at the upstairs shower.

Recommendation: Recommend a licensed plumber evaluate the supply piping.

3.3.1 Plumbing – Main Shutoff: Location

Severity: Maintenance

The main water shutoff valve is located at the front of the house, left of the garage door.

Recommendation: Recommend labeling the valve so it can be found quickly.

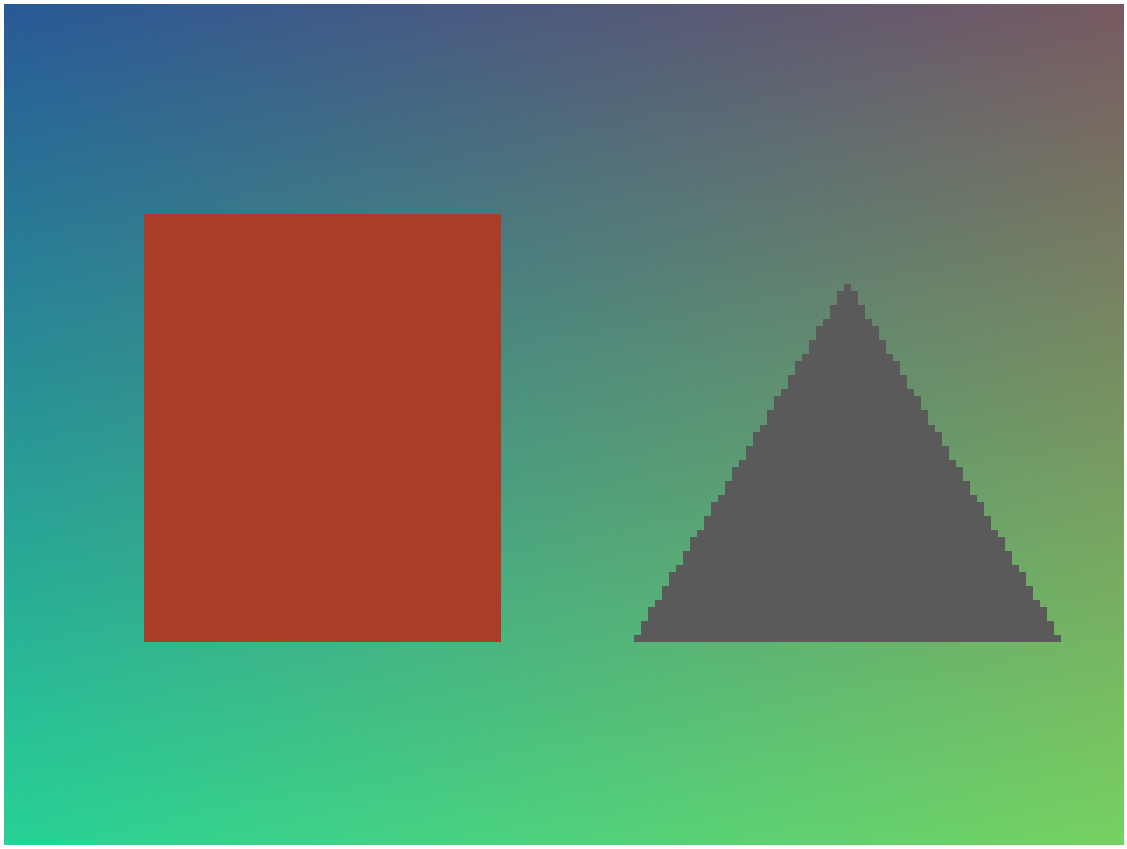

STANDARDS OF PRACTICE AND LIMITATIONS

This inspection was performed in accordance with the Standards of Practice of the Pacific Association of Home Inspectors (a fictional association). The inspection is a visual, non-invasive examination of the readily accessible systems and components of the home. The inspector is not required to determine the remaining life of any system or component, to move furniture or stored items, or to enter any area that is unsafe or not readily accessible.

The report describes the condition of the house on the day of the inspection. Conditions change over time, and items that were working on the day of the inspection may fail later. The client should have every item marked Repair or Safety Hazard evaluated by a licensed professional before the end of the contingency period.

INVOICE

Coastline Home Inspections
Invoice number: CHI-INV-20250314
Invoice date: March 14, 2025
Bill to: Morgan Example
Service address: 742 Driftwood Way, Port Alder, CA 90000

Home inspection, single-family (1,850 sq ft): $475.00
Sewer lateral video scope: $150.00
Total due: $625.00

Paid in full on March 14, 2025. Balance due: $0.00
Thank you for choosing Coastline Home Inspections.

INSPECTOR CERTIFICATION

I certify that I personally inspected the property named in this report and that I have no interest in the property or in any repairs. The report was completed on March 15, 2025.

Jordan Avery Reyes, Coastline Home Inspections

Tidewater Plumbing & Rooter, Inc.

License C36-000000 | (555) 010-0100 | Port Alder, CA

E S T I M A T E

Estimate No. TPR-58213
Date: March 20, 2025
Customer: Morgan Example
Job site: 742 Driftwood Way, Port Alder, CA 90000

D ES C R I PT I O N O F W O R K

1. Replace the water heater temperature and pressure relief valve: $185.00
2. Install a 2-gallon thermal expansion tank on the cold water line: $420.00

Subtotal: $605.00
Tax: $0.00
Total: $605.00

Tidewater Plumbing & Rooter, Inc.

License C36-000000 | (555) 010-0100 | Port Alder, CA

T E R M S A N D C O N D I T I O N S

This estimate is valid for 30 days. A 50% deposit is due before work begins and the balance is due on completion. All work carries a one-year labor warranty. Permits, if required, are included in the price.

Accepted by: _____ Date: _____

Bayside Electric Co.

License C10-000000 | (555) 010-0199

INVOICE

Invoice # BE-10442
Date: April 2, 2025
Customer: Morgan Example
Service address: 742 Driftwood Way, Port Alder, CA 90000

Work performed: Separated the double-tapped conductors in the main panel and installed a new 20-amp breaker. Installed a GFCI receptacle at the kitchen counter.

Labor (2.0 hours): $240.00
Materials: $100.00
Total: $340.00