

J&J Tool Gore Rule

1st Transfer the gore settings from the gore ruler as shown in figure 1.



Figure 1

2nd Use the square to draw 90° lines thru each mark. Lines should be at least 1" longer than ½ the heel measurement.

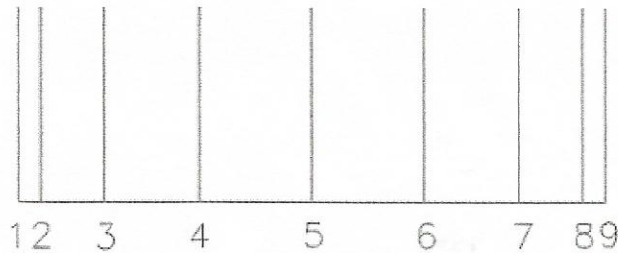


Figure 2

3rd Line #1 is the throat line. Add 3/8" for the bead to the throat measurement and then divide by 2. Transfer this length to line #1. Example: 2" throat + 3/8" bead = 2-3/8". Divide this by 2 to get 1-3/16". Transfer this to line #1 as shown below in figure 3.

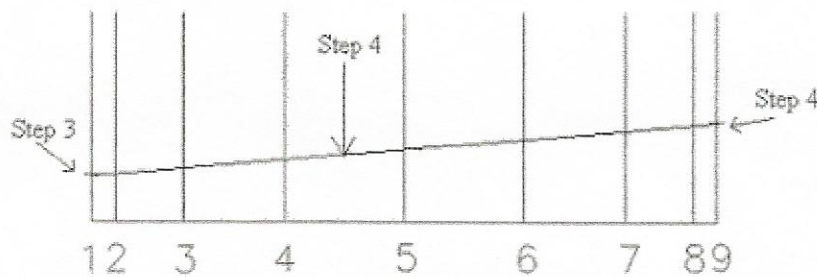


Figure 3

4th Line #9 is your heel line. Add 3/4" for the crimp to your heel measurement and then divide by 2. Transfer this length to line #9. Example: 6" heel + 3/4" crimp = 6-3/4". Divide this by 2 to get 3-3/8". Transfer this to line #9. Now draw a straight line thru these two marks as shown above in figure 3.

5th Find your circumference (3.142 X Diameter) and draw a line this length. Divide this line into 16 equal parts. Now we transfer the lengths from step 4 to our circumference line as shown below. Now the gore pattern is complete.

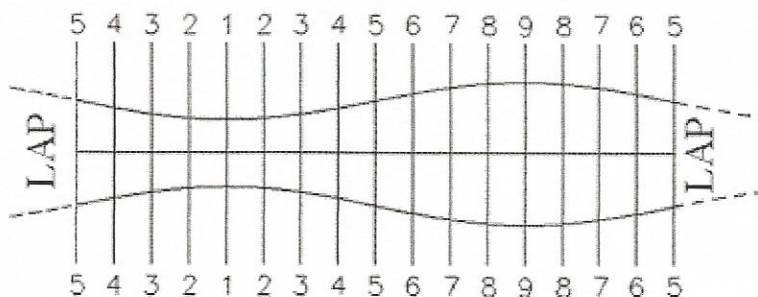


Figure 4