

ENTIRE COMBINATION METER DOES NOT OPERATE


WIRING DIAGRAM

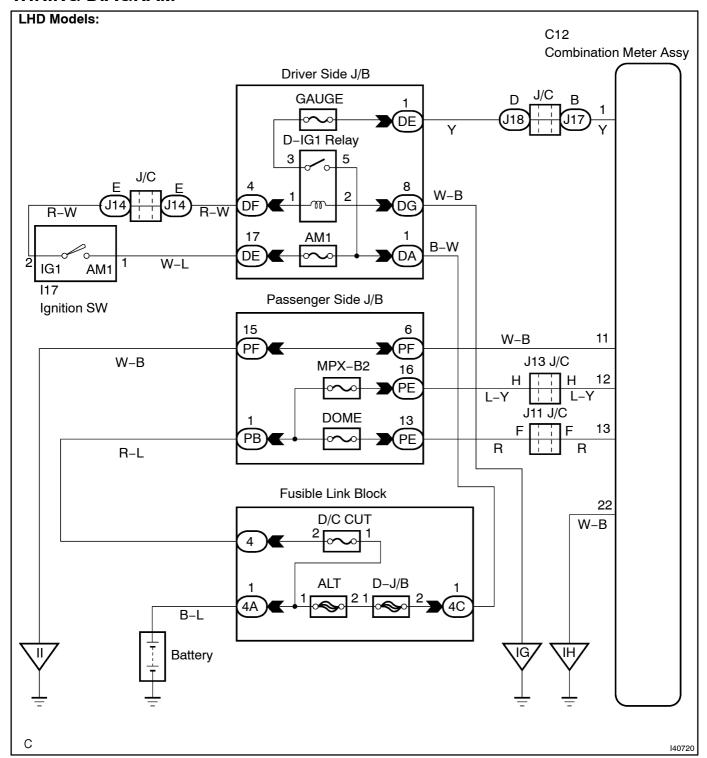

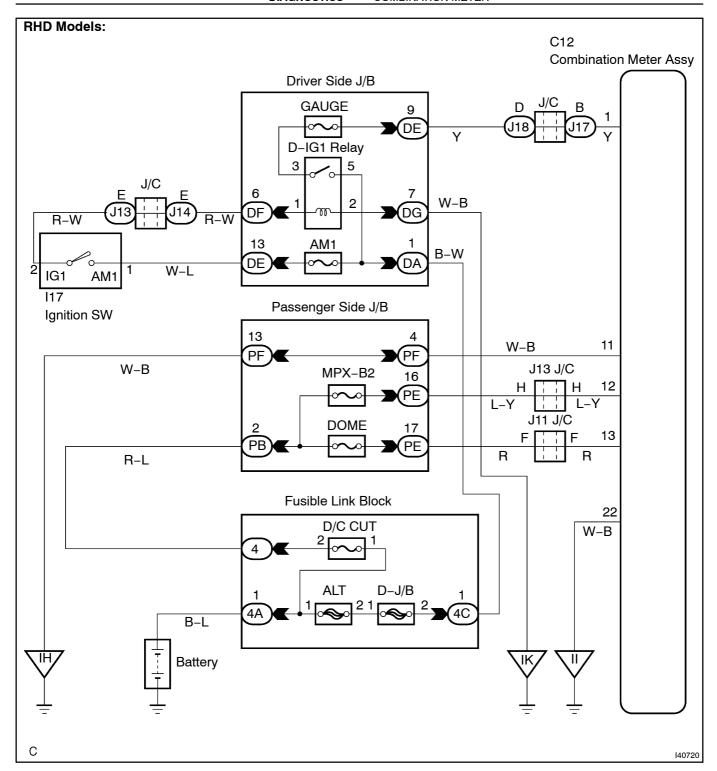

INSPECTION PROCEDURE

1 INSPECT COMBINATION METER ASSY

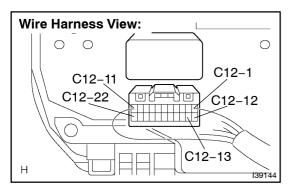

(a) Measure the resistance according to the value(s) in the table below.

Standard:

Terminal No	Condition	Specified condition
C12-11 - Body ground	Always	Below 1 Ω
C12-22 - Body ground	Always	Below 1 Ω

(b) Measure the voltage according to the value(s) in the table below.

Standard:

Terminal No	Condition	Specified condition	
C12-12 - Body ground	Always	10 to 14 V	
C12-13 - Body ground	Always	10 to 14 V	
C12-1 - Body ground	Ignition switch ACC or ON	10 to 14 V	

NG	REPAIR	OR	REPLACE	HARNESS	OR
	CONNEC	TOR			

OK

REPLACE[COMBINATION[METER[ASSY(SEE[PAGE[71-21)