





HP LaserJet Enterprise M607, M608, M609

HP LaserJet Managed E60055, E60065, E60075

HP LaserJet Managed E60155, E60165, E60175

Control Panel Message Document (CPMD)

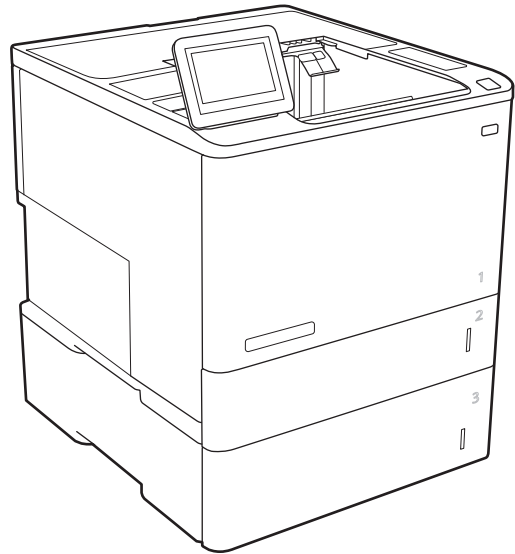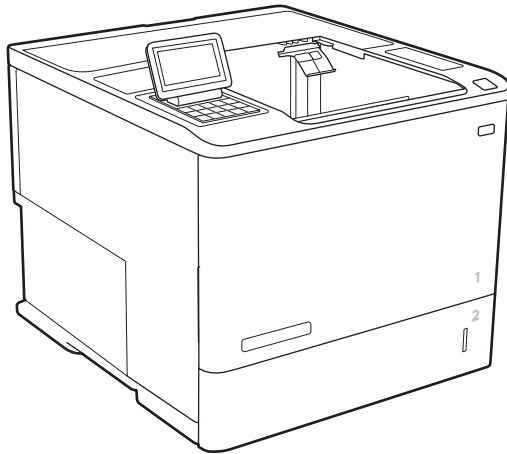

www.hp.com/support/ljM607
www.hp.com/support/ljM608
www.hp.com/support/ljM609
www.hp.com/support/ljE60055
www.hp.com/support/ljE60065

www.hp.com/support/ljE60075
www.hp.com/support/ljE60155
www.hp.com/support/ljE60165
www.hp.com/support/ljE60175



HP LaserJet Enterprise M607, M608, M608nk, M609, M610, M611, M612, HP LaserJet Managed E60055-E60075, E60155- E60175 printers - Control Panel Messages Document (CPMD)

SUMMARY

This document provides error-code troubleshooting information

Legal information

Copyright and License

© Copyright 2023 HP Development Company, L.P.

Reproduction, adaptation, or translation without prior written permission is prohibited, except as allowed under the copyright laws.

The information contained herein is subject to change without notice.

The only warranties for HP products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. HP shall not be liable for technical or editorial errors or omissions contained herein.

Edition 3, 12/2025

Trademark Credits

Adobe®, Adobe Photoshop®, Acrobat®, and PostScript® are trademarks of Adobe Systems Incorporated.

Apple and the Apple logo are trademarks of Apple Inc., registered in the U.S. and other countries.

macOS is a trademark of Apple Inc., registered in the U.S. and other countries.

AirPrint is a trademark of Apple Inc., registered in the U.S. and other countries.

Google™ is a trademark of Google Inc.

Microsoft®, Windows®, and Windows Server® are U.S. registered trademarks of Microsoft Corporation.

UNIX® is a registered trademark of The Open Group.

Table of contents

1 Document last updated	1
2 About this document.....	2
3 Control-panel message types.....	3
Error-code and control-panel-message troubleshooting overview	4
Error codes (types and structure)	4
4 How to search for printer documentation	7
WISE - How to access and use	8
Accessing WISE	8
Using WISE to search for error codes	11
Using WISE to access repair and replace videos for FRUs.....	14
5 Printer service information	18
6 Numerical control panel messages	19
10.WX.YZ error messages.....	20
10.wx.yz error messages.....	20
10.00.00 e-label Memory Error	21
10.00.10 e-label Missing Memory Error	24
10.00.15 Install Toner Cartridge	28
10.00.30 Used Supply In Use	29
10.00.35 Toner Cartridge Incompatible	29
10.00.59	30
10.00.60 Toner Cartridge low	30
10.00.69 Toner Cartridge very low	30
10.00.70 Printing past very low	30
10.23.15 Install Fuser kit	31
10.23.60 Fuser Kit low	37
10.23.70 Replace Fuser Kit	38
10.99.31 Non-HP supply in use.	40
10.99.34 Used supply in use.	40
10.99.40 Genuine HP supplies installed	40
10.99.41 Unsupported Supply in use	40
11.WX.YZ error messages.....	41
11.* errors	41
11.00.01 or 11.00.02 Internal clock error	41

13.WX.YZ error messages.....	47
13.* errors	47
13.00.0E	54
13.00.EE	55
13.00.FF	55
13.A1.A1	56
13.A1.D1	58
13.A1.FF	62
13.A3.D3	64
13.A3.Dz	91
13.A3.FF	97
13.A4.Dz	97
13.AA.EE Front Door Open	102
13.AB.EE Rear Door Open	103
13.B2.Az Jam in rear door	105
13.B2.D1 Jam in rear door	106
13.B2.D2 Jam in rear door	108
13.B2.Dz Jam in Tray x	123
13.B2.FF Jam in rear door	149
13.B4.FF Jam in rear door	151
13.B9.Az Fuser jam	153
13.B9.Cz	155
13.B9.Dz	157
13.B9.FF	160
13.D3.Dz	162
13.D3.FF	164
13.E1.D2	165
13.E1.D3 Fuser Area Jam	166
13.E1.Dz	168
13.FF.FF	169
13.60.Az	170
13.60.Dz	171
13.60.5z	172
13.60.6z	173
13.60.F0	174
20.WX.YZ error messages.....	176
20.* errors	176
20.00.00 Insufficient memory <device>	176
21.00.00 Page Too ComplexEvent log error message 21.00.00.	176
32.WX.YZ error messages.....	177
32.* errors	177
32.08.A1, 32.08.A2, 32.08.A3	177
32.1C.05	177
32.1C.06 (event code).....	177
32.1C.07 (event code).....	178
32.1C.08 (event code).....	178
32.1C.09 (event code).....	178
32.1C.0A (event code).....	178

32.1C.0D (event code)	179
32.1C.11 (event code)	179
32.1C.13, 32.1C.14	179
32.1C.15	179
32.1C.2E	179
32.1C.2F	180
32.1C.40	180
32.1C.41	180
32.1C.42	180
32.1C.43	180
32.1C.44	181
32.1C.45	181
32.1C.46	181
32.1C.47	181
32.1C.48	181
32.1C.49	182
32.1C.4A	182
32.1C.56	182
32.1C.57	182
32.1C.58	182
32.1C.60	183
32.1C.61	183
32.1C.62	183
32.1C.68	183
32.1C.69	183
32.1C.6A	184
32.1C.6D	184
33.WX.YZ error messages.....	185
33.* errors	185
33.01.xx	186
33.02.01 Used board/disk installed	187
33.02.02	187
33.03.02	187
33.03.03 Incompatible formatter installed.	189
33.03.05 EFI Boot error.....	189
33.03.06	192
33.04.01 Missing TPM	192
33.04.02 Missing TPM	193
33.04.03 Unknown TPM	193
33.04.05	193
33.05.0z SureStart errors	195
33.05.1x Whitelisting errors	196
33.05.2x Intrusion detection errors	196
33.05.5z Intrusion detection errors	197
33.06.01	198
40.WX.YZ error messages.....	199
40.* errors	199
40.00.01 USB I/O buffer overflow To continue, touch “OK”	199

40.00.02 Embedded I/O buffer overflow To continue, touch “OK”	199
40.00.03 EIO [x] buffer overflow To continue, touch “OK”	199
40.00.04 EIO [x] bad transmission To continue, touch “OK”	199
40.00.05 Embedded I/O bad transmission To continue, touch OK	200
40.08.0x USB storage accessory removed	200
40.0x.05 USB storage accessory removed	200
40.80.04 Failed to read NVRAM	200
41.WX.YZ error messages.....	201
41.01.YZ	201
41.02.00 Error	204
41.03.FZ Unknown Misprint Error	204
41.03.A2 Unexpected size in tray 2	206
41.03.FZ Unknown Misprint Error.....	221
41.03.YZ Unexpected size in tray <X>	232
41.04.YZ Printer Error	234
41.05.YZ Unexpected type in tray <X>	238
42.WX.YZ error messages.....	240
42.* errors	240
46.WX.YZ error messages.....	241
46.* error messages	241
47.WX.YZ error messages.....	242
47.* errors	242
47.00.xx	242
47.01.xx	243
47.02.xx	243
47.03.xx	244
47.04.xx	244
47.05.xx	245
47.06.xx	245
47.FC.yz Printer Calibration Failed To continue, touch “OK”	246
48.WX.YZ error messages.....	248
48.* errors	248
49.WX.YZ error messages.....	249
49.XX.YY Error To continue turn off then on	249
49.38.0C.....	250
49.38.07	251
50.WX.YZ error messages.....	253
50.* errors	253
50.1x.yz	253
50.2X.YZ	256
50.3X.YZ	259
50.4X.YZ	262
50.6X.YZ	264
50.7F.00	268
50.8X.YZ	271
50.9X.YZ	273
50.AX.YZ	276

50.BX.YZ	278
51.WX.YZ, 52.WX.YZ error messages.....	281
51.* errors	281
51.00.yz	281
52.00.00/52.00.20 Scanner Startup/Rotation error	282
53.WX.YZ error messages.....	283
53.A0.y0	283
53.A0.y1	283
53.A1.y0 Enter error message	284
53.A1.y1	284
53.A2.y0	285
53.A2.y1	286
53.B0.0z.....	286
53.B1.0z	287
53.B2.0z	288
53.B3.0z	288
53.C1.0z Tray "Z" size mismatch.	288
54.WX.YZ error messages.....	290
54.* errors	290
54.00.01 / 54.00.03	291
55.WX.YZ, 56.WX.YZ error messages.....	292
55.* errors	292
55.00.01, 55.00.03 or 55.00.04 DC Controller Error	292
55.00.05 Engine Firmware RFU Error	295
55.01.06, 55.02.06 DC controller error To continue turn off then on	295
56.* errors	296
56.00.YZ	297
56.00.01 Illegal Input Printer Error	297
57.WX.YZ error messages	298
57.* errors	298
57.00.01 Fan failure	298
57.00.02 Fan failure	300
57.00.03 Fan failure	301
57.00.04 Fan failure	304
58.WX.YZ error messages.....	306
58.* errors	306
58.00.02 Error	306
58.00.03 Error	307
58.00.04 Error	308
58.01.04 Error	309
58.02.04 Error	309
59.WX.YZ error messages.....	311
59.* errors	311
59.00.00 Motor error	311
59.00.30 or 59.00.40: Fuser error	313
59.00.50 or 59.00.60	317
59.00.90	320

59.00.C0	322
60.00.0Y error messages.....	324
60.* errors	324
60.01.02	324
60.01.03	327
60.01.04	328
60.01.05	329
60.01.06	330
62.WX.YZ error messages.....	332
62.* errors	332
62.00.00 No system To continue turn off then on	332
65.X0.AZ error messages	333
65.X0.A1 Output accessory disconnected	333
66.WX.YZ error messages.....	334
66.* errors	334
66.60.32 Device failure	334
66.70.YZ Device failure	334
66.80.01 and 66.80.02 Device failure	335
66.80.03 and 66.80.35 Device failure	335
66.80.17 Device failure	336
66.80.21, 66.80.22, 66.80.23, and 66.80.33 Device failure	336
66.80.77 and 66.80.0A Device failure	337
70.WX.YZ error messages.....	338
70.* errors	338
70.00.00 Error To continue turn off then on	338
80.WX.YZ, 81.WX.YZ, 82.WX.YZ error messages.....	340
80.0X.YZ Embedded Jetdirect Error	340
81.WX.YZ EIO Error To continue turn off then on	343
81.09.00 Error.....	345
82.0x.YZ Internal disk device failure	346
82.73.46, 82.73.47	350
90.WX.YZ error messages.....	351
90.* errors	351
90.15.00	351
90.15.01	351
98.0X.0Y error messages.....	353
98.00.0c	353
98.00.00, 98.00.01, or 98.01.00 Corrupt data in firmware volume	356
98.00.02 Corrupt data in the solutions volume	357
98.00.03 Corrupt data in the configuration volume	360
98.00.04 Corrupt data in the job data volume	361
98.03.11.....	361
99.WX.YZ error messages.....	363
99.* errors	363
99.00.01 Upgrade not performed file is corrupt	363
99.00.02 Upgrade not performed timeout during receive	364

99.00.03 Upgrade not performed error writing to disk	364
99.00.04 Upgrade not performed timeout during receive	367
99.00.05 Upgrade not performed timeout during receive	368
99.00.06 Upgrade not performed error reading upgrade	368
99.00.07 Upgrade not performed error reading upgrade	371
99.00.08 Upgrade not performed error reading upgrade	374
99.00.09 Upgrade canceled by user	378
99.00.10 Upgrade canceled by user	378
99.00.11 Upgrade canceled by user	378
99.00.12 Upgrade not performed the file is invalid	378
99.00.13 Upgrade not performed the file is invalid	378
99.00.14 Upgrade not performed the file is invalid	379
99.00.2X	379
99.01.xx	380
99.02.01	380
99.02.09	380
99.09.60 Unsupported disk	380
99.09.61 Unsupported disk	381
99.09.62 Unknown disk	381
99.09.63 Incorrect disk	382
99.09.64 Disk Nonfunctional	382
99.09.65 Disk data error	385
99.09.66 No boot device.	386
99.09.67 Disk is not bootable please download firmware	388
99.39.64 eMMC Nonfunctional	392
99.39.67 eMMC Not Bootable	392

7 Alphabetical control panel messages..... 393

Alphabetical error messages	394
Accept bad signature	394
Authentication required	394
Bad optional tray connection	394
Canceling...<jobname>	394
Cartridge low	394
Cartridge Memory Abnormal	395
Cartridge out	395
Checking engine	395
Checking paper path	395
Chosen personality not available To continue touch “OK”	395
Cleaning disk <X> complete Do not power off	396
Cleaning	396
Clearing activity log	396
Clearing event log	396
Clearing paper path	396
Close front door	396
Close Rear Door	398
Communication lost	400
Data received To print last page press “OK”	407
Data received To print last page press “OK”	407

Event log is empty	407
Expected drive missing	408
External device initializing	408
Fuser Kit low	408
Fuser Kit very low To continue, touch “OK”	408
Gateways failed	409
Genuine HP supply installed	409
Incompatible <Supply>	409
Incompatible supplies	409
Initializing... ..	409
Install fuser unit	409
Install Supplies	410
Internal disk device failure To clear touch “OK”	410
Internal disk file operation failed	411
Internal disk file system is full	411
Internal disk is write protected	411
Internal disk not found	411
Internal disk not initialized	411
Internal disk spinning up	412
Load Tray <X>: [Type], [Size] To use another tray, press “OK”	412
Loading program <XX> Do not power off	412
Manually feed output stack Then touch "OK" to print second side	412
Manually feed: <Type><Size>	413
No job to cancel	413
No USB drive or files found.....	413
NON HP Supply Installed	415
Output Bin Full	415
Paused... ..	416
Performing Paper Path Test	416
Please Wait... ..	416
Printing Cleaning Page... ..	416
Printing Configuration... ..	416
Printing Demo Page	416
Printing engine test... ..	417
Printing Event Log... ..	417
Printing File Directory... ..	417
Printing Font List... ..	417
Printing Menu Map... ..	417
Printing stopped... ..	417
Printing Supplies Status Page... ..	418
Printing Usage Page... ..	418
Processing... ..	418
Processing duplex job Do not grab paper until job completes	418
Processing job from tray <x>... Do not grab paper until job completes	418
Processing... copy <x> of <y>	418
RAM disk device failure To clear press “OK”	419
RAM disk file operation failed To clear press “OK”	419
RAM disk file system is full To clear press “OK”	419
RAM disk is write protected To clear press “OK”	419

RAM disk not initialized	419
Ready	420
Ready <IP Address>	420
Receiving Upgrade	420
Remove USB accessory	420
Replace <Supply>	420
Resend Upgrade	421
Restore Factory Settings	421
RFU Load Error Send full RFU on <X> Port	421
ROM disk device failed To clear press “OK”	421
ROM disk file operation failed To clear press “OK”	421
ROM disk file system is full To clear press “OK”	422
ROM disk is write protected To clear press “OK”	422
ROM disk not initialized To clear press “OK”	422
Sanitizing disk <X> complete Do Not power off	422
Size mismatch in Tray <X>	422
Sleep mode on	423
Supplies low	423
Too many jobs in queue	423
Tray 2 empty: [Type], [Size]	423
Tray <X> empty: [Type], [Size]	425
Tray <X> lifting	425
Tray <X> open	425
Tray <X> [type] [size]	426
Tray 2 overfilled or roller issue	426
Type mismatch Tray <x>	433
The unit has corrupt data	433
Unsupported drive installed To continue, touch “OK”	434
Unsupported supply in use OR Unsupported supply installed To continue, touch “OK”	434
Unsupported tray configuration	434
Unsupported USB accessory detected Remove USB accessory	435
USB accessory not functional	435
USB hubs are not fully supported Some operations may not work properly	435
USB is write protected To clear press “OK”	435
USB needs too much power Remove USB and then turn off and on	435
USB not initialized	436
USB storage accessory removed Clearing any associated data	436
USB storage device failure To clear press “OK”	436
USB storage file operation failed To clear press “OK”	437
USB storage file system is full To clear press “OK”	437
Used supply installed To continue, touch “OK” OR Used supply in use Description	437
Verifying, Please Wait	437
Waiting for tray <x> to lift	437

Index.....	439
------------	-----

1 Document last updated

The following is the last time this document was updated:

Last update: December 3, 2025

2 About this document

This document provides error-code troubleshooting information.



IMPORTANT: Procedures and part numbers change. For current information, use the browser-based format.

Verify PDF is the most current before use. PDF part numbers must be verified with web-based error code information or parts look-up before parts are ordered.

Choose the format that best meets your needs.

Table 2-1 Content format types

Format	Document title example	Recommended use
Web-based	Go to: Product Detail page > Error Code Look-up	Quick access to individual web-based error code troubleshooting TIP: Save Product Detail page URL location in favorites
Web-Base	Go To: WISE default Search page > Enter [Product] and error code	- Access to individual web-based error code troubleshooting - Web-based: Most up-to-date information available
PDF	[Product] - Control Panel Message Document (CPMD) PDF	- Use when support portals are NOT accessible at time of service - Use when a printable document is needed NOTE: Always refer to the printer service manual for removal and replacement procedures NOTE: For current information, use the Web-based format.

3 Control-panel message types

The control-panel messages and event code entries indicate the current printer status or situations that might require action.



NOTE: Event log errors do not appear on the control-panel display. Open the event log to view or print the event log errors.

A control-panel message displays temporarily and might require you (or the applicable user) to acknowledge the message by touching the **OK** button to resume printing or by touching the **Stop** button to cancel the job.

With certain messages, the job might not finish printing, or the print quality might be affected. If the message is related to printing and the auto-continue feature is on, the printer will attempt to resume printing after the message has appeared for 10 seconds without acknowledgement.

For some messages, restarting the printer might fix the problem. If a critical error persists, the printer might require service.

Error-code and control-panel-message troubleshooting overview

This section provides information on error codes and searching for information.

Error codes (types and structure)

Error codes and control-panel messages display on the printer control panel to indicate the current printer status or situations that might require action. Error codes are numerical, or alphanumerical, and have a set structure with six characters (example: 13.WX.YZ).

- The first two characters are numeric and represent the system component that is causing the error. For example, in error code 10 . 22 . 15, **10 = Supplies** for HP LaserJets.
- The remaining four characters (W, X, Y, and Z values) further define the error.

HP LaserJet and HP PageWide Enterprise error codes are documented in the control panel message document (CPMD) for each printer.

The CPMD is a comprehensive list of error codes, diagnostic and troubleshooting steps to clear or resolve the error, and other helpful information such as service mode pins and part numbers.

The CPMD is continually updated and republished with the latest information for the following error codes.

Table 3-1 ERROR CODES: The first two characters

Error code	System Component	System Error Description
10.WX.YZ	Supplies (LaserJet)	Supply error or supply memory error.
11.WX.YZ	Real-time clock	Internal error with the clock on the formatter.
13.WX.YZ	Jam (LaserJet)	Paper jam or open door jam error.
15.WX.YZ	Jam (PageWide)	Paper jam or open door jam error.
17.WX.YZ	Supplies (PageWide)	Supply error or supply memory error.
20.WX.YZ	Printer memory	Insufficient memory or buffering error.
21.WX.YZ	Page	Page complexity causing a decompression error when trying to process job.
30.WX.YZ	Scanner	Flatbed scanner error occurring inside the unit.
31.WX.YZ	Document feeder	Document feeder, scanner, or jam error.
32.WX.YZ	Backup, restore, or reset	Backup, restore, or reset notification or error.
33.WX.YZ	Security	Backup, Disk, EFI BIOS, Firmware integrity (SureStart), or Trusted Platform Module (TPM) notification or error.
40.WX.YZ	Input/Output (I/O)	Partition manager, secure erase, or USB accessory error.
41.WX.YZ	Fuser, Laser scanner, or Paper path	Miscellaneous error including general and misprint or mismatch errors typically involving (but not limited to) the fuser, the laser scanner, or the paper path.
42.WX.YZ	Firmware	Firmware failure involving the Event Log, Shell, System Manager, or other component.
44.WX.YZ	Firmware	Firmware failure involving a digital sending component.

Table 3-1 ERROR CODES: The first two characters (continued)

Error code	System Component	System Error Description
45.WX.YZ	OXPd/Web Kit (PageWide)	Informational notifications involving the OXPd Web Kit (communications log).
46.WX.YZ	Engine (LaserJet)	Engine communication error.
47.WX.YZ	Firmware	Job parser or printer calibration error.
48.WX.YZ	Firmware	PJA job accounting, job management, or job pipeline error.
49.WX.YZ	Firmware	Firmware communication error.
50.WX.YZ	Fuser (LaserJet)	Fuser error.
51.WX.YZ	Laser scanner (LaserJet)	Laser scanner beam error.
52.WX.YZ	Laser scanner (LaserJet)	Laser scanner startup error.
54.WX.YZ	Sensor	Sensor error (not jam related).
55.WX.YZ	DC controller (LaserJet)	DC controller communication error.
56.WX.YZ	Paper handling (LaserJet)	Paper input/output or accessory error.
57.WX.YZ	Fan	Fan error.
58.WX.YZ	Sensor	Engine sensor failure.
59.WX.YZ	Motor (LaserJet)	Motor error.
60.WX.YZ	Tray motor error (LaserJet)	Tray lifting or pick up error.
61.WX.YZ	Engine (PageWide)	Print engine error with the 8-bit data package.
62.WX.YZ	System (LaserJet) Print bar (PageWide)	LaserJet internal system error. PageWide print system error.
63.WX.YZ	Engine (LaserJet)	General engine error (electrical, communication, etc.).
65.WX.YZ	Connector	Output accessory connection error.
66.WX.YZ	Output accessory	Output accessory error.
67.WX.YZ	Input accessory	Input accessory connection error
69.WX.YZ	Duplexer	Duplexer error.
70.WX.YZ	DC controller (LaserJet)	DC controller firmware error.
76.WX.YZ	DC controller (LaserJet)	Power supply fluctuations causes formatter and DC controller communication issue and results them not to be in synchronization.
80.WX.YZ	Managed device	Embedded Jetdirect error.
81.WX.YZ	Near Field Communication (NFC)	Wireless, Bluetooth or internal EIO error.
82.WX.YZ	Memory (SSD, HDD, EMMC, etc.)	Disk hardware error.
90.WX.YZ	Internal diagnostics	Internal test of systems (i.e. disk, CPB, display) or interconnection error.
98.WX.YZ	SSD or HDD	SSD or Hard disk partition error.

Table 3-1 ERROR CODES: The first two characters (continued)

Error code	System Component	System Error Description
99.WX.YZ	Firmware installer	Remote Firmware Upgrade (RFU), firmware install (engine or accessory), or disk error.

4 How to search for printer documentation

The Control Panel Message Document (CPMD), error codes, and other support documentation for each printer is available on the HP portals.

For HP internal access to WISE, go to [WISE](#).

For HP channel partners access WISE, see [Accessing WISE for HP channel partners \(HP Partner Portal\) on page 8](#) or [Accessing WISE for HP channel partners \(CSDP\)](#).

WISE is available to call agents, service technicians, and HP internal users. The level of detail available depends on your access credentials. To learn how to find support content in WISE, [watch the video here](#).

WISE - How to access and use

Learn how to access and use Web-based Interactive Search Engines (WISE) to locate available support information. WISE is a repository of technical support documentation including service manuals, user guides, videos, and general support information.

Accessing WISE

Learn how to access Web-based Interactive Search Engines (WISE) if you are an HP channel partner or an internal HP user.

Accessing WISE for HP channel partners (HP Partner Portal)


Learn how to access WISE by accessing the HP Partner Portal if you are an HP Channel Partner.

 **NOTE:** If this is your first visit to the HP Partner Portal, you will be asked to create an account. Follow the setup directions using your HP Partner credentials.

 [View a video of how to access WISE for HP channel partners](#)


1. Sign-in to the HP Partner Portal (click <https://partner.hp.com> to access the sign-in page).

Figure 4-1 HP Partner Portal sign-in page

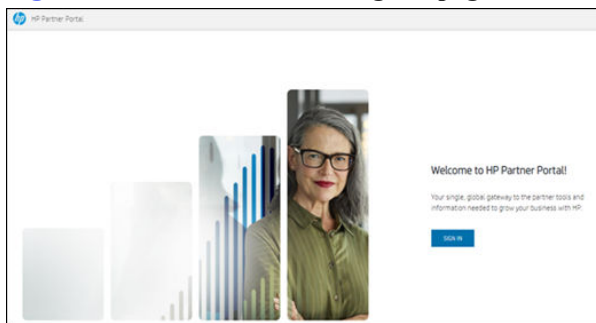


2. On the HP Partner Portal home page, click the **Services & Support** item.

Figure 4-2 HP Partner Portal home page

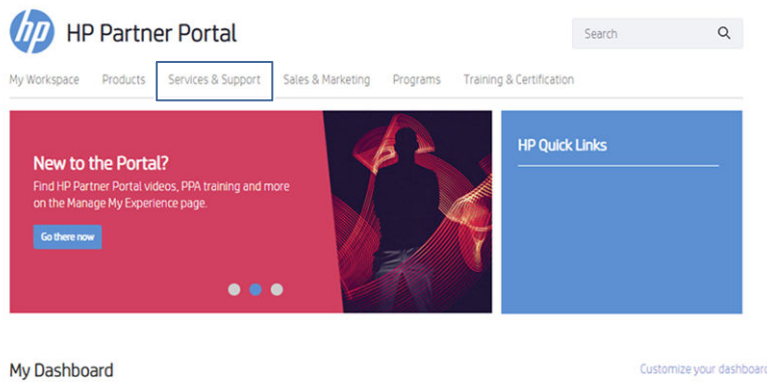


3. Select the **Technical Support (WISE)** item.

Figure 4-3 HP Partner Portal Service & Support page

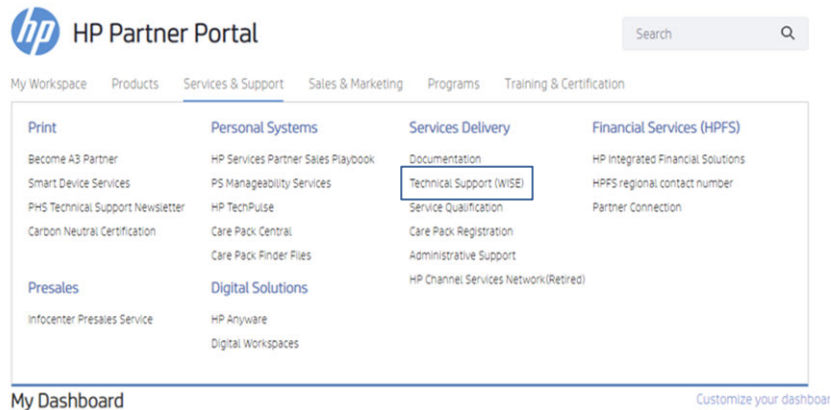


4. Select the **Technical Documentation** item.

Figure 4-4 HP Partner Portal Technical Support (WISE)page

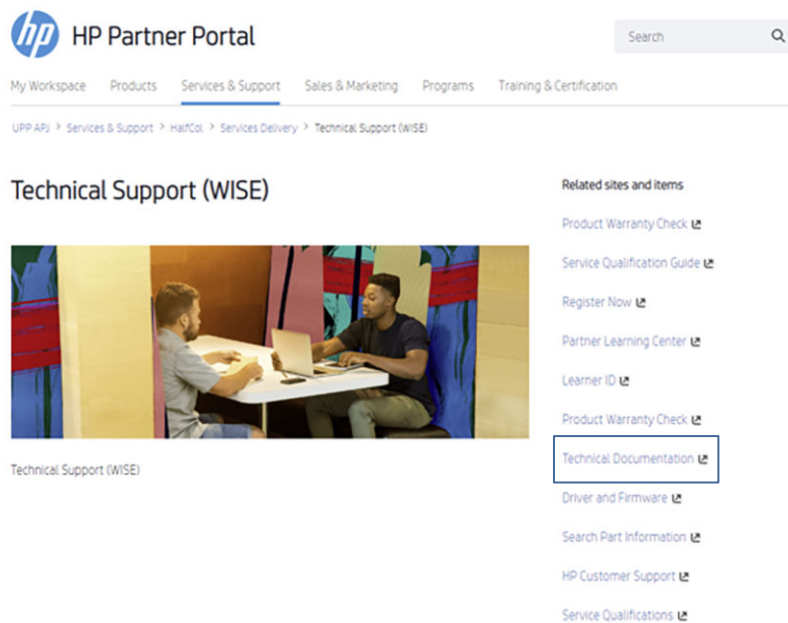

5. Use the WISE portal to search for printer information.

Figure 4-5 WISE portal home page

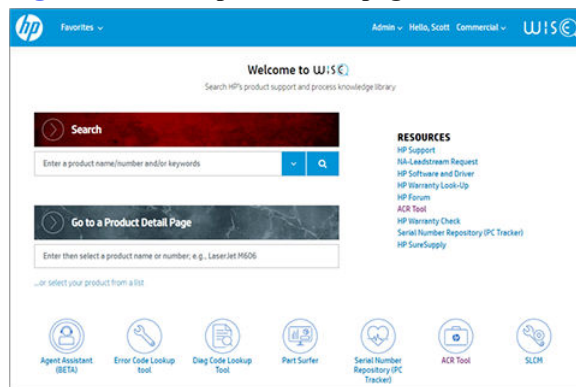

Accessing WISE for internal HP users

Learn how to access WISE if you are an internal HP user.

1. Open one of the Web-based Interactive Search Engines (WISE) URLs listed below.

Americas (AMS)

- [WISE - English](#)
- [WISE - Spanish](#)
- [WISE - Portuguese](#)
- [WISE - French](#)

Asia Pacific / Japan (APJ)


- [WISE - English](#)
- [WISE - Japanese](#)
- [WISE - Korean](#)
- [WISE - Chinese \(simplified\)](#)
- [WISE - Chinese \(traditional\)](#)
- [WISE - Thai](#)

Europe / Middle East / Africa (EMEA)


- [WISE - English](#)

2. Select **Commercial** from the drop-down menu.

Figure 4-6 Choose an experience

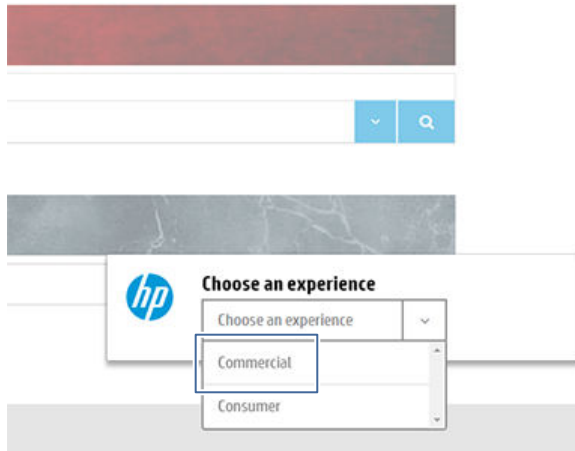

3. The WISE home page appears.

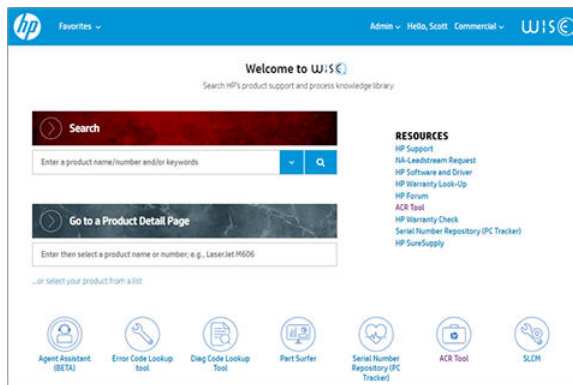

Play the video:



[View a video of how access WISE \(internal HP users\)](#)

Using WISE to search for error codes

Learn how to use WISE to look up error codes.



NOTE: The model used in the instructional videos is an example. The same steps apply to all printer models.

You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).

Search for error codes using the lookup widget

Learn how to search for a specific error code using the WISE Error Code Lookup widget.

1. Enter a printer model number (for example, M606) in the **Go to a Product Detail page** dialog box.



TIP: To find a Product Detail Page (PDP) from a list of products by product type, select the **...or select your product from a list** item just below the dialog box.

The screenshot shows two search-related elements. The top element is a search bar with a magnifying glass icon and the text 'Search'. Below it is a text input field with the placeholder 'Enter a product name/number and/or keywords' and a search icon. The bottom element is a link labeled 'Go to a Product Detail Page' with a right arrow icon. Below this link is a text input field with the placeholder 'Enter then select a product name or number; e.g., LaserJet M606' and a search icon. Below the input field is a small text link that says '...or select your product from a list'.

2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.


 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

The screenshot shows the 'Go to a Product Detail Page' link with a right arrow icon. Below the link is a text input field containing 'M606'. A drop-down list is open, showing several options. The first option, 'HP LaserJet Enterprise M606 series', is circled in blue. The other options are 'E6B73AR', 'E6B72A', 'E6B73V', 'E6B73A', and 'E6B72V'.

3. Type the error code (for example, 13.E1.D3) in the **Error Code Lookup** field, and then select the search icon.

The screenshot shows the 'Error Code Lookup' section. It has a title 'Error Code Lookup' and a subtitle 'Enter a specific error code in the field below, e.g. 13.h2.d2'. Below the subtitle is a text input field containing '13.E1.D3'. The input field is circled in blue, and a search icon is to its right. The input field is labeled with a '1' and the search icon with a '2'. Below the input field is a section titled 'Other Content' with a list of links: 'Advisories (0)', 'Bulletins (21)', 'Guides, Manuals, etc. (76)', 'Notices (1)', 'Product Change Not... (0)', 'Software-Drivers-F...', 'Top Issues (7)', and 'Videos (127)'.

4. The error code troubleshooting content displays in the **All Search Results** area.

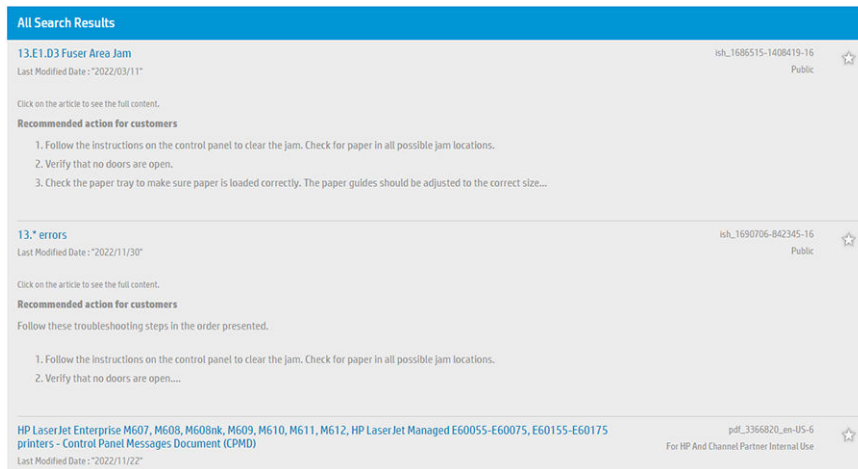


Play the video:

 [View a video of how to search for error codes using the Product Detail Page \(PDP\) or the Error Code Lookup tool.](#)

Search for error codes from the WISE home page


Learn how to search for a specific error code from the WISE home page.

1. On the WISE home page, enter a printer model number (for example, M606) in the **Search** dialog box.

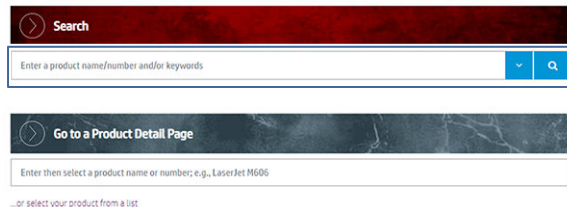

2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.


 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

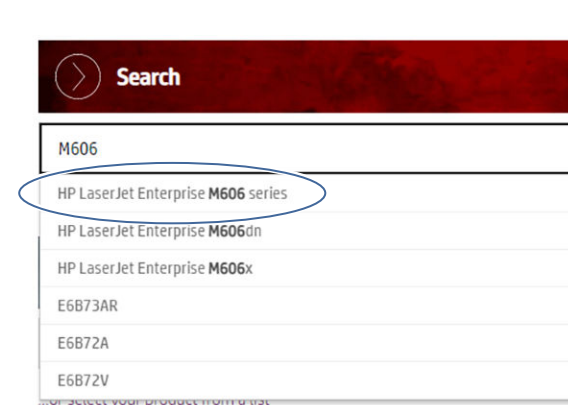

3. Type the error code (for example, 13.E1.D3) in the **Search** keyword field, and then select the search icon.



4. The error code troubleshooting content displays in the **All Search Results** area.

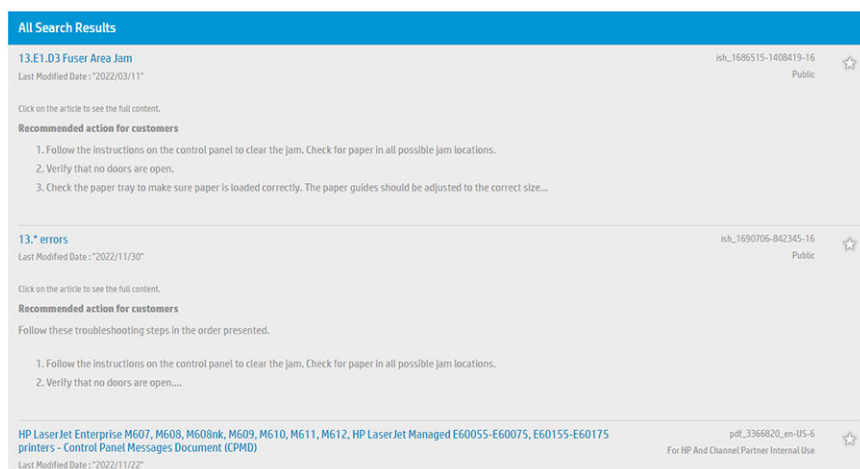

Using WISE to access repair and replace videos for FRUs

Learn how to use WISE to access repair and replace videos for FRUs.



NOTE: The model used in the instructional videos is an example. The same steps apply to all printer models.

You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).


Search for videos using the Product Detail Page (PDP)

Learn how to search WISE for product specific information. Quickly review the steps and then play the video.

1. Enter a printer model number (for example, M606) in the **Go to a Product Detail page** dialog box.




TIP: To find a Product Detail Page (PDP) from a list of products by product type, select the **...or select your product from a list** item just below the dialog box.

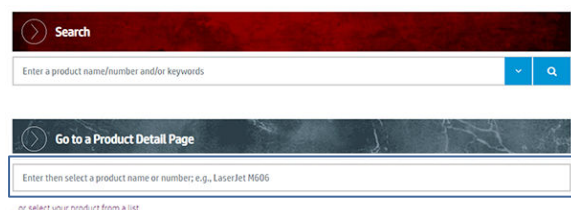


2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.

 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

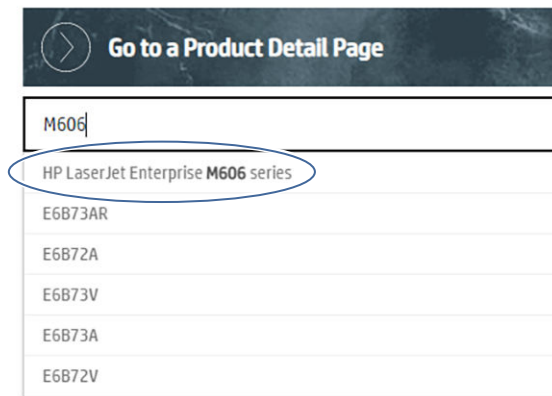


3. Select the link to **Videos** in the **Other Content** menu at the bottom-right of the screen.

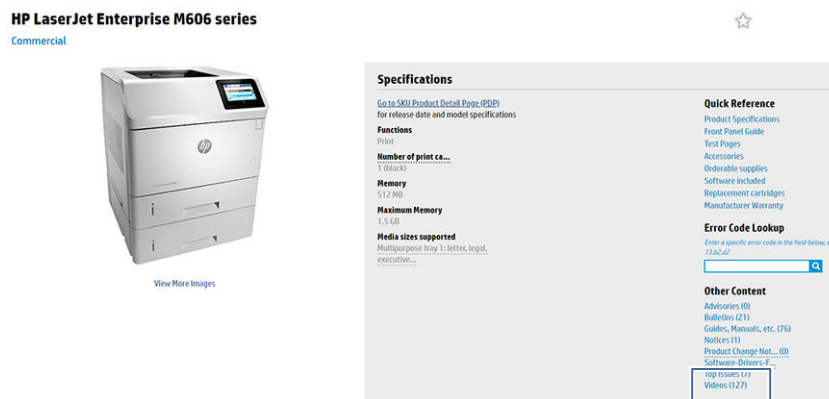

4. Select the desired video from the list of videos.

 **TIP:** Select the **Add Or Remove Hardware & Customer Self Repair** filter under **Troubleshooting** to limit the search results to repair and replace videos.

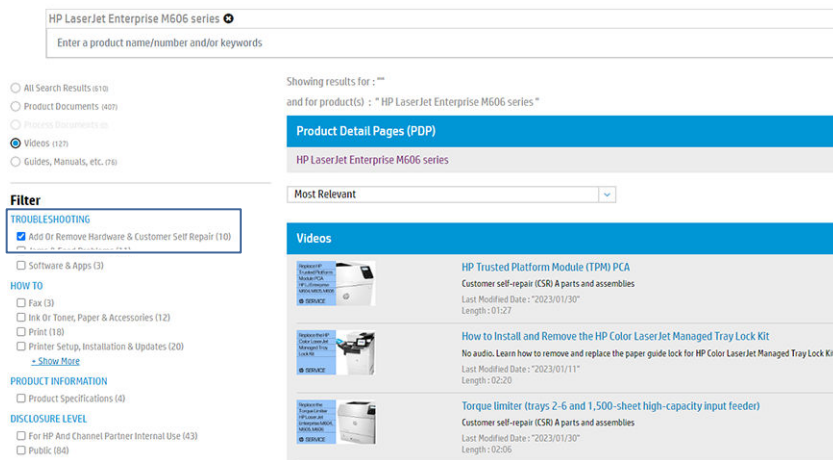

Play the video:




[View a video of how to search for the printer's Product Detail Page \(PDP\)](#)

Search for videos using the WISE search function

Learn how to search WISE using the model number. Quickly review the steps and then play the video.


1. On the WISE home page, enter a printer model number (for example, M606) in the **Search** dialog box.

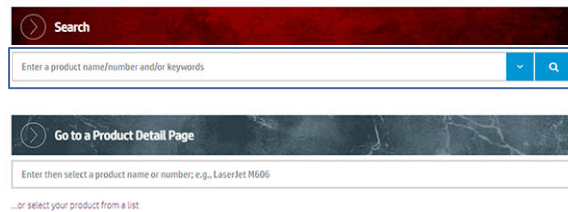


2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.




NOTE: Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

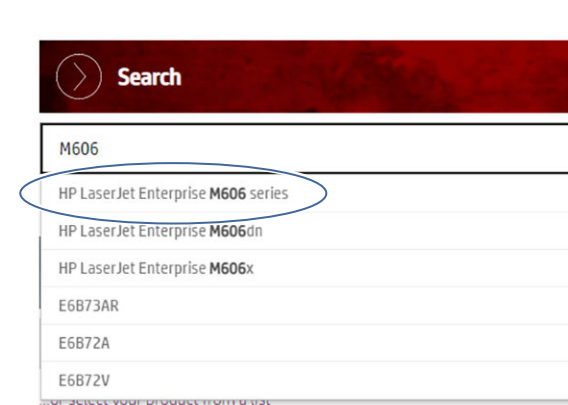


3. Select the search icon.

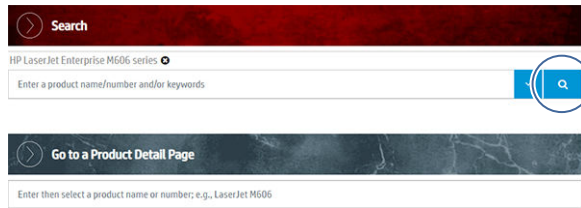

4. To refine the search results, select the radio button labeled **Videos** in the upper-right portion of the screen.

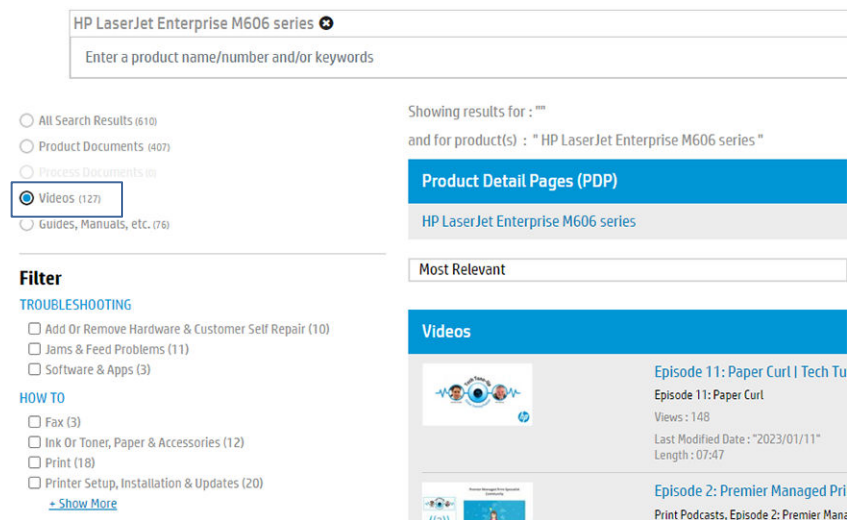

 **TIP:** To refine video search results, type a part name in the keyword search bar, and then select the search icon. For example, entering the word **fuser** to the keyword search bar returns videos related to repair and replacement of the fuser.

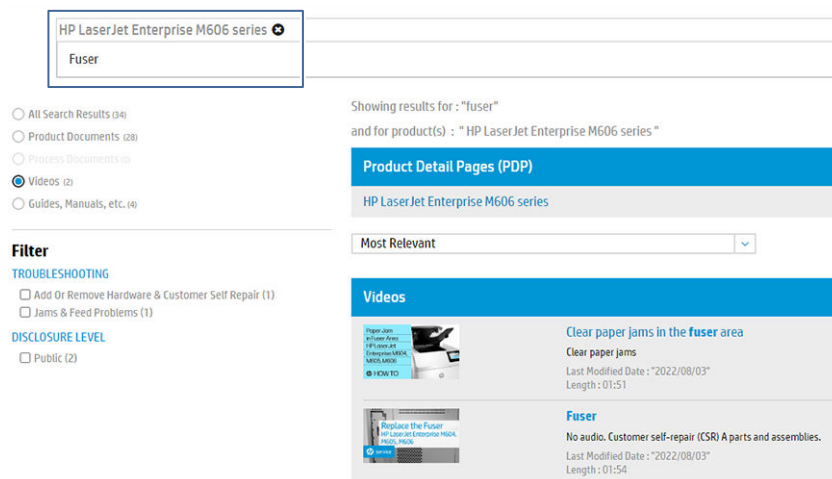

Play the video:



[View a video of how to perform a model number search](#)

5 Printer service information

The following information provides the document's last updated date and the printer service PIN.

Last update: December 3, 2025

Service mode PIN number:

M607, M608, M608nk, M609, M610, M611, M612, E60055, E60065, E60075, E60155, E60165, E60175:
05060717



NOTE: When possible, always update the printer firmware to the latest available version at [HP.com](https://www.hp.com) as part of the troubleshooting performed for any of the following errors.

6 Numerical control panel messages

Use the following numerical error message troubleshooting to resolve your issue.

10.WX.YZ error messages

10.wx.yz error messages

Errors in the 10.* family are related to toner cartridges and other supply items that require regular replacement as part of routine printer maintenance.

Order replacement supplies and install them as necessary. To order parts, go to <https://www.hp.com/buy/parts>.

Use the following list to identify the supply item affected:



NOTE: Not all printers have all of these supplies.

- 10.00.XX = Black toner cartridge
- 10.01.XX = Cyan toner cartridge
- 10.02.XX = Magenta toner cartridge
- 10.03.XX = Yellow toner cartridge
- 10.10.XX = Transfer roller
- 10.22.XX = Transfer Belt
- 10.23.XX = Fuser kit
- 10.31.XX = Toner collection unit
- 10.39.XX = Document feeder kit
- 10.99.XX = One or more supply items have been installed

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

To order parts, go to <https://www.hp.com/buy/parts>.

1. For toner cartridges:
 - a. Remove and reinstall the cartridge.
 - b. Check the electronic chip on the cartridge if it is visible. If the chip is damaged, replace the toner cartridge.
 - c. If print quality is unacceptable, or if printing cannot continue, replace the toner cartridge.
2. For the transfer kit:
 - a. Remove and then reinstall the transfer unit.
 - b. If print quality is unacceptable, or if printing cannot continue, replace the transfer kit.
3. For the fuser kit:

- a. Remove and then reinstall the fuser.

 **CAUTION:** The fuser might be hot.

- b. If print quality is unacceptable, or if printing cannot continue, replace the fuser kit.
4. For the toner collection unit:
 - a. Remove the toner collection unit and reinstall it.
 - b. If the toner collection unit is nearly full, replace it with a new one. Using a toner collection unit until it is overfilled can damage the printer.
 5. For the document feeder kit:
 - a. Open the document feeder top cover and inspect the rollers for obvious dirt or wear. Clean the rollers if necessary.
 - b. Install a new roller kit.

10.00.00 e-label Memory Error

e-label Memory Error

The printer is unable to read the toner cartridge data. The toner cartridge is present but defective.


When this error occurs, a question mark appears on the gas gauge of the supply or supplies with the error.

Recommended action for customers


1. Check the toner cartridge.
 - a. Open the front door.




- b. Slide out the toner tray.

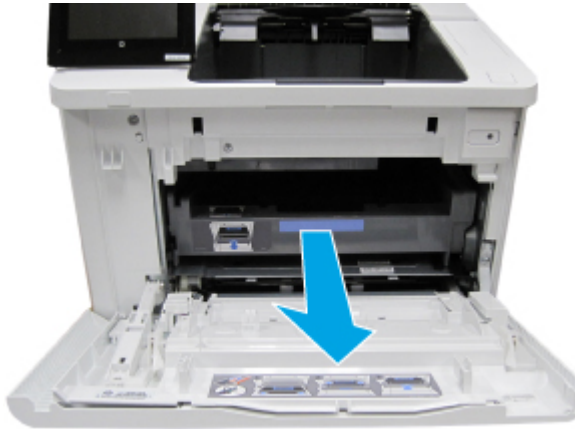

- c. Pull out and then up on the toner cartridge to remove it.

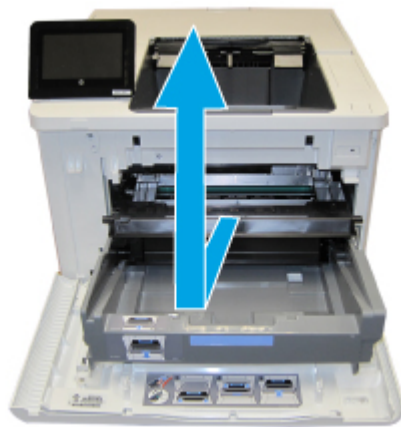

- d. Check and clean the e-label connection. If it is damaged, replace the toner cartridge.

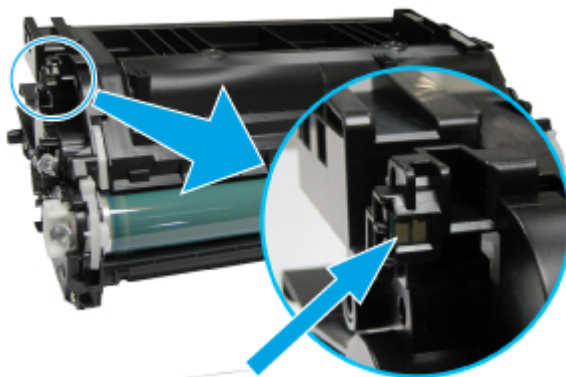

- e. Reinstall the toner cartridge and close the front door.
2. If the message displays again, turn the printer off, and then on.
 3. If the error persists, replace the toner cartridge.


4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians


1. Check the toner cartridge.
 - a. Open the front door.




- b. Slide out the toner tray.

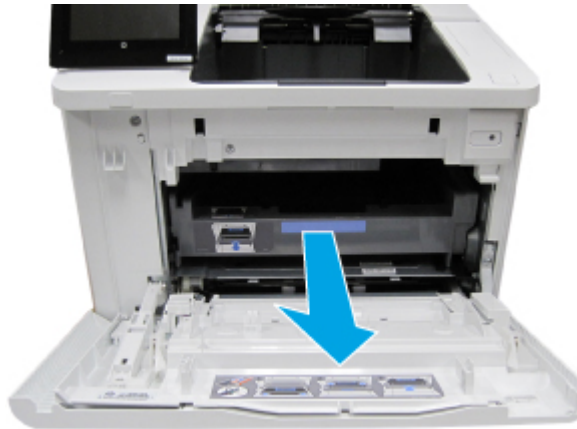


- c. Pull out and then up on the toner cartridge to remove it.

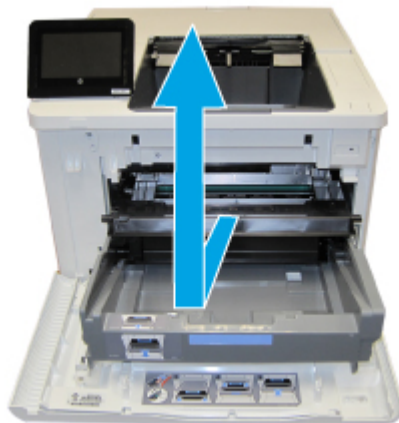

- d. Check and clean the e-label connection. If it is damaged, replace the toner cartridge.

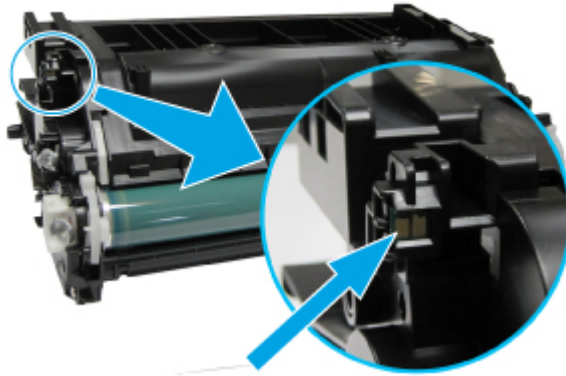

- e. Reinstall the toner cartridge and close the front door.
2. If the message displays again, turn the printer off, and then on.
3. Test the printer with another toner cartridge. Replace the toner cartridge as needed.
4. If the error persists, check the e-label contact in the printer. If the contact is damaged, elevate the issue using the Standard Support Process.

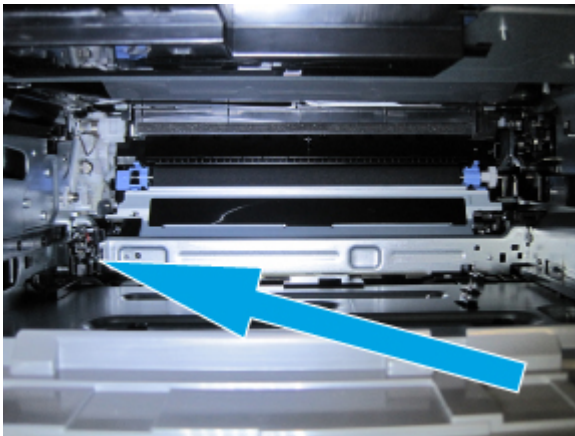

5. Turn the printer off. Disconnect and reconnect J501 on the DC controller to ensure it is seated correctly.
6. Turn the printer on. If the error persists, elevate the issue using the Standard Support Process.

10.00.10 e-label Missing Memory Error

The printer is unable to detect the e-label.

This message indicates that the printer has determined that the e-label is missing.

When this error occurs, a question mark appears on the gas gauge of the supply or supplies with the error.


Recommended action for customers

1. Check the toner cartridge.


- a. Open the front door.




- b. Slide out the toner tray.

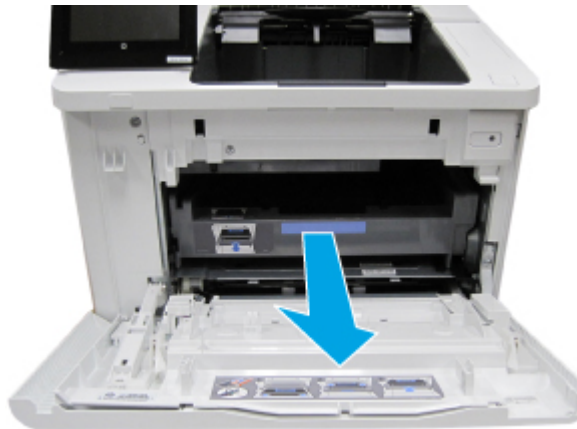

- c. Pull out and then up on the toner cartridge to remove it.

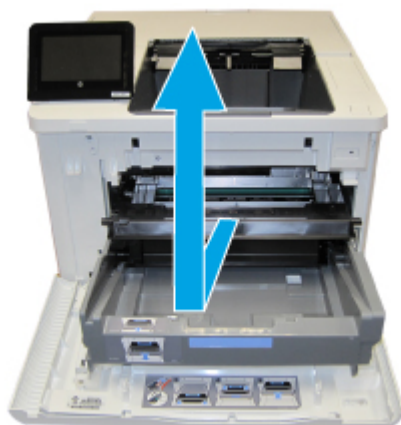

- d. Check and clean the e-label connection. If it is damaged, replace the toner cartridge.

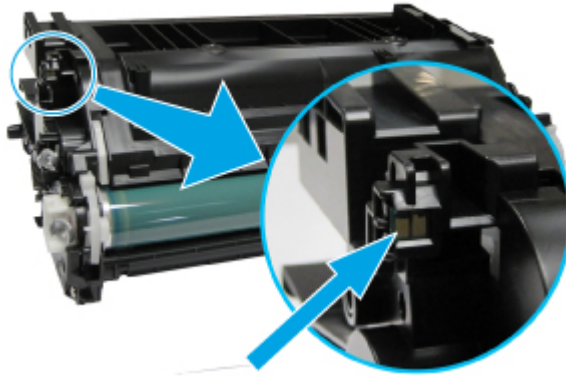


- e. Reinstall the toner cartridge and close the front door.
 2. If the message displays again, turn the printer off, and then on.
 3. If the error persists, replace the toner cartridge.
 4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians


1. Check the toner cartridge.
 - a. Open the front door.




- b. Slide out the toner tray.

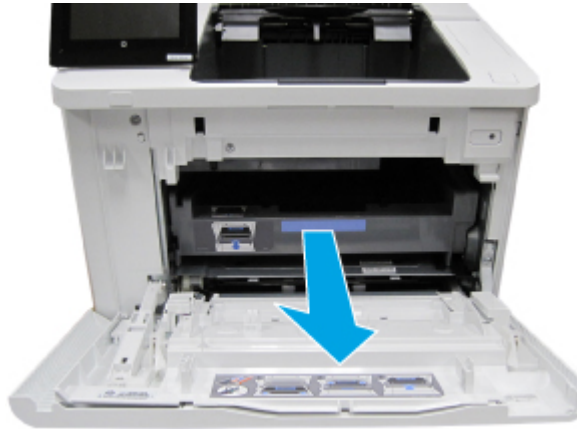

- c. Pull out and then up on the toner cartridge to remove it.

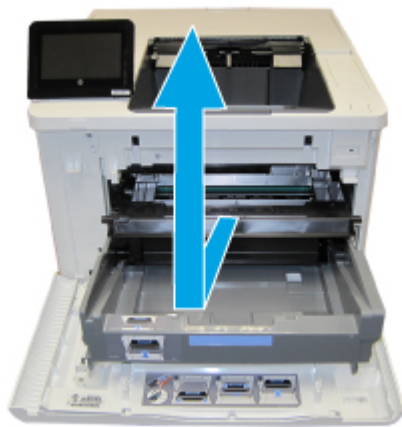


- d. Check and clean the e-label connection. If it is damaged, replace the toner cartridge.

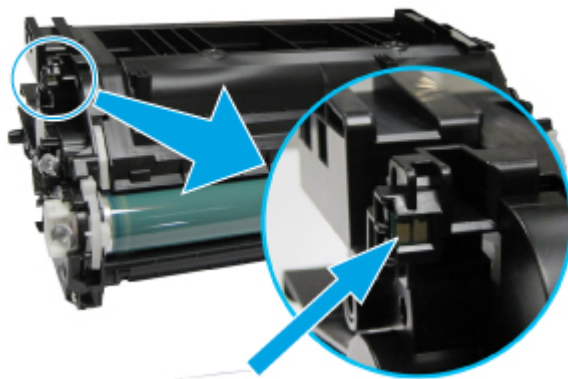

- e. Reinstall the toner cartridge and close the front door.
2. If the message displays again, turn the printer off, and then on.
 3. Test the printer with another toner cartridge. Replace the toner cartridge as needed.

4. If the error persists, check the e-label contact in the printer. If the contact is damaged, elevate the issue using the Standard Support Process.

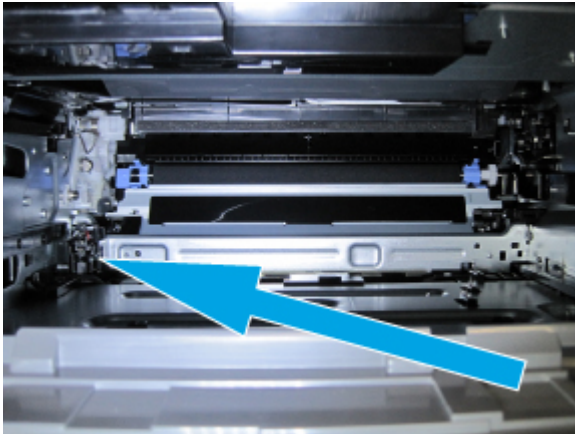

5. Turn the printer off. Disconnect and reconnect J501 on the DC controller to ensure it is seated correctly.
6. Turn the printer on. If the error persists, elevate the issue using the Standard Support Process.

10.00.15 Install Toner Cartridge

A supply is either not installed or not correctly installed in the printer.

The 10.00.15 is an event log only message, it will not show on the control panel. The only message to display will be **Install Toner Cartridge**.


Recommended action for customers

- Replace or reinstall the toner cartridge correctly to continue printing.

Recommended action for call-center agents and onsite technicians

1. Replace or reinstall the toner cartridge correctly to continue printing.
2. Test printer with a new toner cartridge.
3. If the error persists with a new toner cartridge check the toner cartridge contacts inside the printer.
 - a. Remove the toner cartridge.

- b. Check the contacts inside the printer.

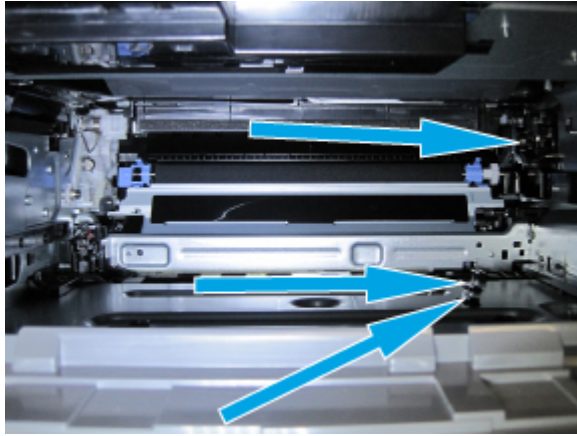

- c. Ensure the contacts are clean and aligned correctly.
- d. If the contacts are damaged and cannot be realigned, elevate the issue using the Standard Support Process.
- e. If the contacts are in good condition and clean and the error persists, replace the high voltage power supply.

HVPS part number: RM2-9335-000CN

For instructions: *Removal and replacement: High voltage power supply* See the Repair Service Manual for this product.

HVPS LCD models “ONLY” part number: RM2-9336-000CN

For instructions: *Removal and replacement: High voltage power supply* See the Repair Service Manual for this product.

10.00.30 Used Supply In Use

A used supply is in use (end of life).

Recommended action for customers

- No action necessary.

If you believe this is a genuine HP supply, go to www.hp.com/go/anticounterfeit.

Using a cartridge that is near its end-of-life can cause this event code.

Recommended action for call-center agents and onsite technicians

- No action necessary.

If you believe this is a genuine HP supply, go to www.hp.com/go/anticounterfeit.

Using a cartridge that is near its end-of-life can cause this event code.

10.00.35 Toner Cartridge Incompatible

The printer displays this message when the indicated supply is not compatible with this printer.

The 10.00.35 is an event log only message, it will not show on the control panel. The only message to display will be **Toner Cartridge Incompatible**.

Recommended action

- Install a supply that is designed for this printer.

10.00.59

Black cartridge has been replaced with non-new cartridge

This is an **Event Log Only** message.

Recommended action

There is no action needed for this message.

- No action necessary.

10.00.60 Toner Cartridge low

The printer indicates when a supply level is low. Actual toner cartridge life might vary. You do not need to replace the toner cartridge at this time unless print quality is no longer acceptable.

The 10.00.60 is an event log only message, it will not show on the control panel. The only message to display will be **Toner Cartridge low**.

Recommended action

- If the print quality is no longer acceptable, replace the toner cartridge.

 **NOTE:** Advise the customer that HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

10.00.69 Toner Cartridge very low

The printer indicates when a supply level is very low. Actual toner cartridge life might vary. You do not need to replace the toner cartridge at this time unless the print quality is no longer acceptable.

The 10.00.69 is an event log only message, it will not show on the control panel. The only message to display will be **Toner Cartridge very low**.

Recommended action

- If the print quality is no longer acceptable, replace the toner cartridge.

 **NOTE:** Advise the customer that HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

10.00.70 Printing past very low

The printer indicates when one of the supplies is very low. The actual remaining supply life might vary. You do not need to replace the toner cartridge at this time unless the print quality is no longer acceptable.

The 10.00.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message **Printing past very low**.

Recommended action

- If the print quality is no longer acceptable, the customer must order and pay for a new toner cartridge.

 **NOTE:** Advise the customer that HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

10.23.15 Install Fuser kit

The fuser is either not installed, or not correctly installed in the printer.

Recommended action for customers


Follow these troubleshooting steps in the order presented.

1. Turn off the printer.
2. Locate the fuser location. Remove, and then reinstall the fuser.


 **CAUTION:** The fuser might be hot. Always wait for the fuser to cool before removing.

- a. Depending on the location of the fuser, open the rear door or the right door to remove the fuser.


Figure 6-1 Fuser location

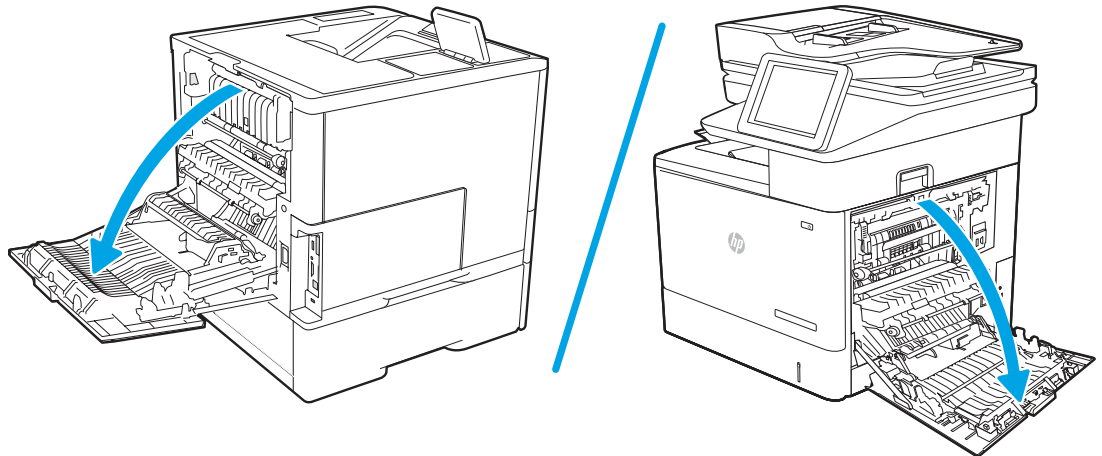

- b. Hold the blue handles on both sides of the fuser and pull it straight out of the printer to remove it.

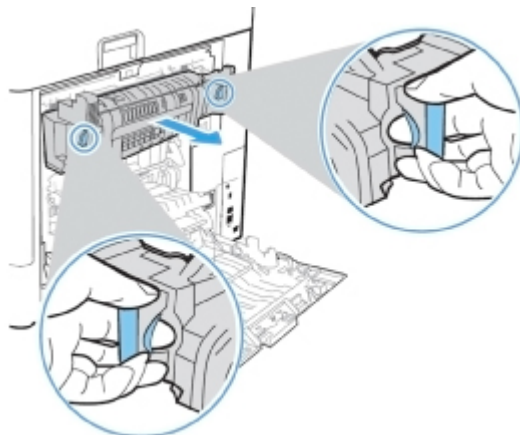

- c. Reseat the fuser, or install a new fuser.

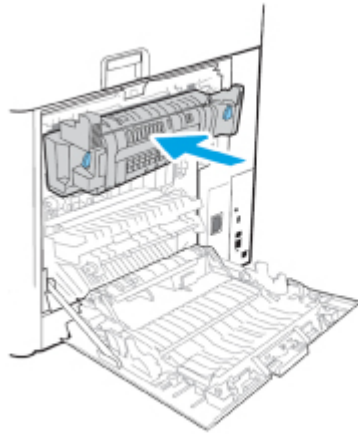

- d. Close the rear door or right door.

- 3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent


Follow these troubleshooting steps in the order presented.

- 1. Turn off the printer.
- 2. Locate the fuser location. Remove, and then reinstall the fuser.


⚠ CAUTION: The fuser might be hot.

- a. Depending on the location of the fuser, open the rear door or the right door to remove it.


Figure 6-2 Fuser location

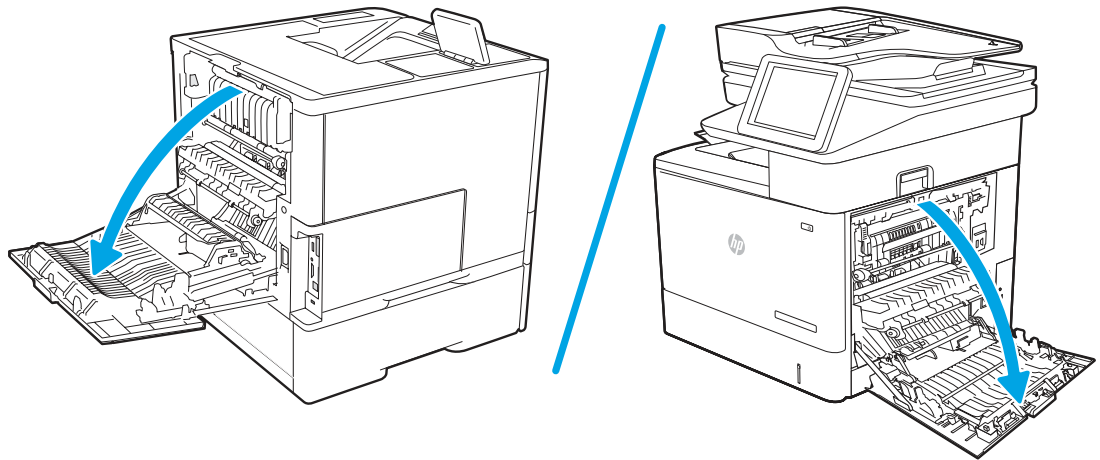

- b.** Grasp the blue handles on both sides of the fuser and pull it straight out from the printer to remove it.

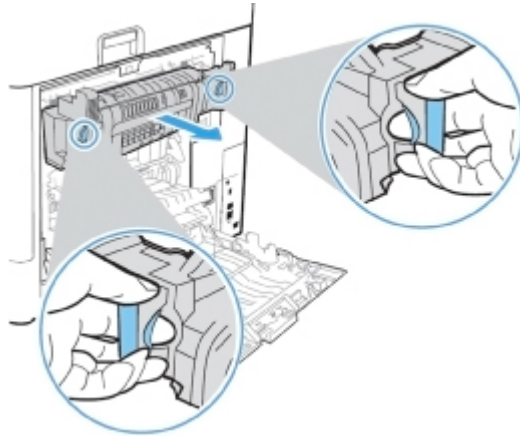

- c.** Reseat the fuser, or install a new fuser.

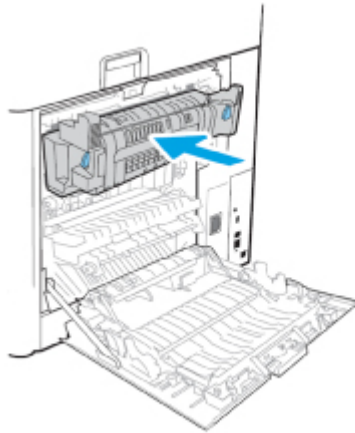


- d. Close the rear door or right door.
3. If the error persists, check the fuser connections.
 - a. Open the rear door.
 - b. Remove the fuser.

3. If the error persists, check the fuser connections.

- a.** Open the rear door.

- b.** Remove the fuser.

- c. Check the connection to the fuser in the printer.

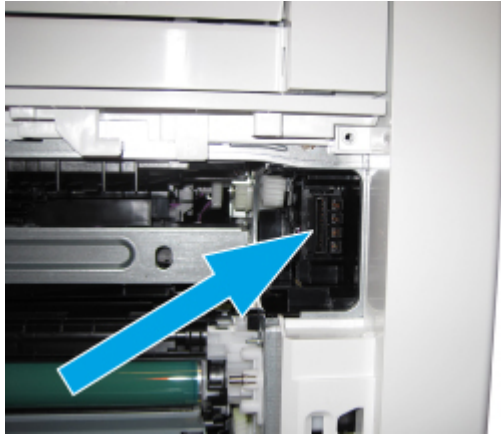

4. If the connector is damaged, elevate the case using the Standard Support Process.
5. If the connector is not damaged and the issue persists, replace the fuser.

Table 6-1 Fuser assembly part numbers

Description	Part number
110V Fuser assembly	RM2-1256-020CN
220V Fuser assembly	RM2-1257-020CN

- For **110V** Fuser assembly instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.
- For **220V** Fuser assembly instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.

1. Turn off the printer.
2. Locate the fuser location. Remove, and then reinstall the fuser.


 **CAUTION:** The fuser might be hot.

- a. Depending on the location of the fuser, open the rear door or the right door to remove it.


Figure 6-3 Fuser location

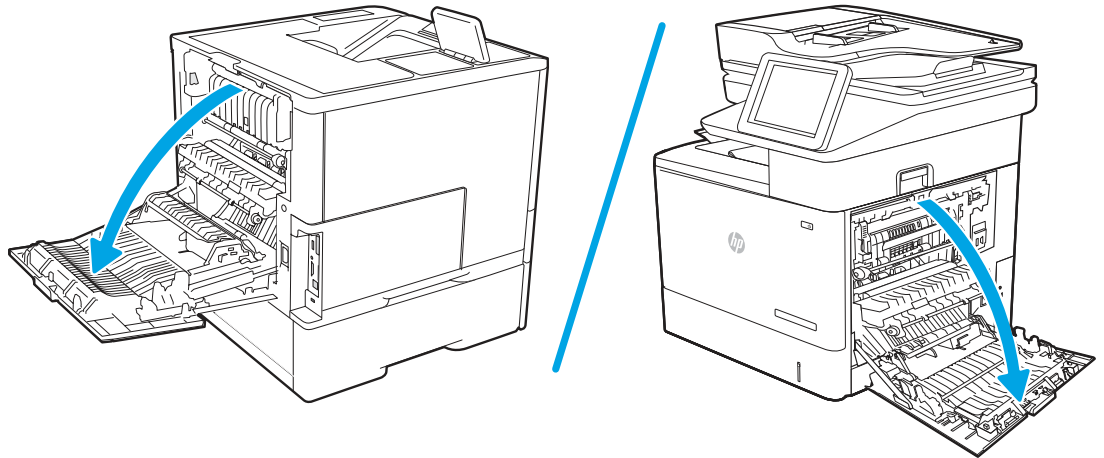

- b. Grasp the blue handles on both sides of the fuser and pull it straight out from the printer to remove it.

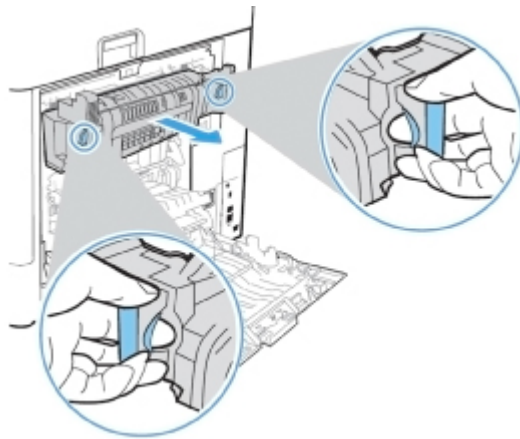


- c. Reseat the fuser, or install a new fuser.

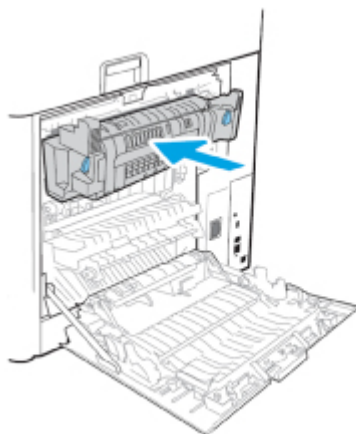

- d. Close the rear door or right door.
3. If the error persists, check the fuser connections.

- a. Remove the fuser.
- b. Check the connection on the fuser.

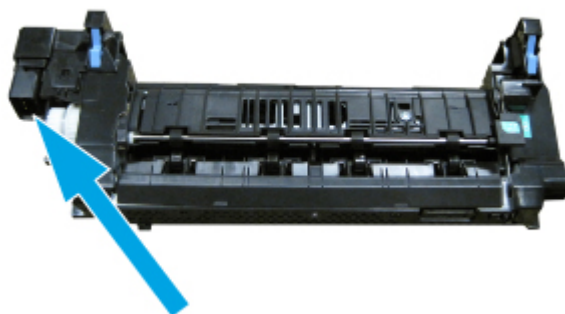

- c. If the fuser connector is damaged, replace the fuser.

Table 6-2 Fuser assembly part numbers

Description	Part number
110V Fuser assembly	RM2-1256-020CN
220V Fuser assembly	RM2-1257-020CN

For **110V** Fuser assembly instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

For **220V** Fuser assembly instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

- d. Check the connection to the fuser in the printer.



- e. If the connector is damaged, elevate the case using the Standard Support Process.
- f. Power off the printer.
- g. Disconnect and reconnect the J401 and J402 connections on the DC controller PCA.

- h. Turn on the printer, and then test if the issue persists.
4. If the issue persists, replace the DC controller PCA.

Make sure to order the correct part number for the printer model.

Table 6-3 DC Controller part numbers

Description	Part number
DC Controller PC board assembly	RM2-9494-000CN
For printer models: M607/M608/M609/E60055/E60065/E60075	
DC Controller	RM3-8461-000CN
For printer models: M610/M611/M612	
DC Controller PCA	RM3-7619-000CN
For printer models: E60155/ E60165/ E60175	


For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

10.23.60 Fuser Kit low


The printer indicates when a supply level is low.

Recommended action


- Replace the fuser kit.
 - a. Open the rear door.

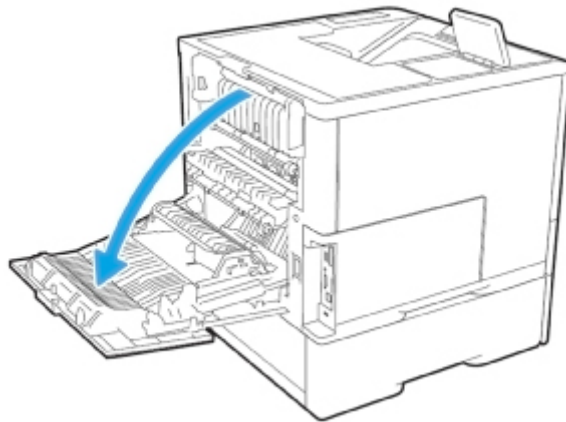

- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

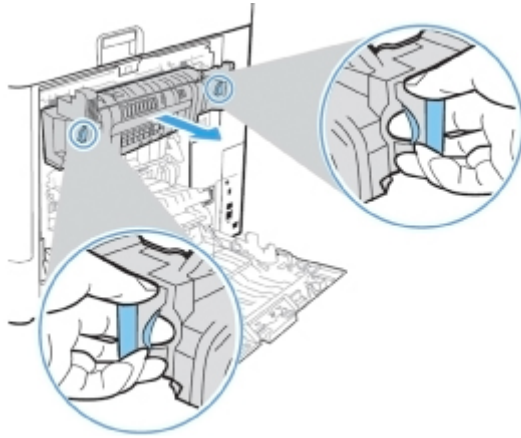

- c. Install a new fuser.

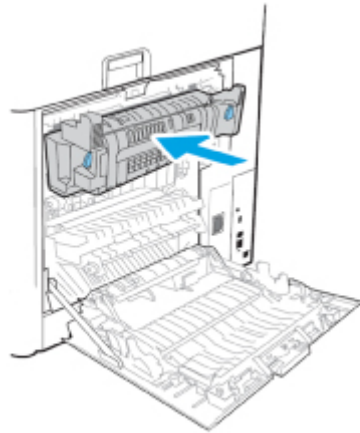

- d. Close the front door.

10.23.70 Replace Fuser Kit

The 10.23.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message **Replace Fuser Kit**.


The printer indicates when the fuser kit is at its estimated end of life. The actual life remaining might be different than the estimation.

The fuser kit does not need to be replaced now unless the print quality is no longer acceptable.


Recommended action

- Replace the fuser kit.


- a. Open the rear door.

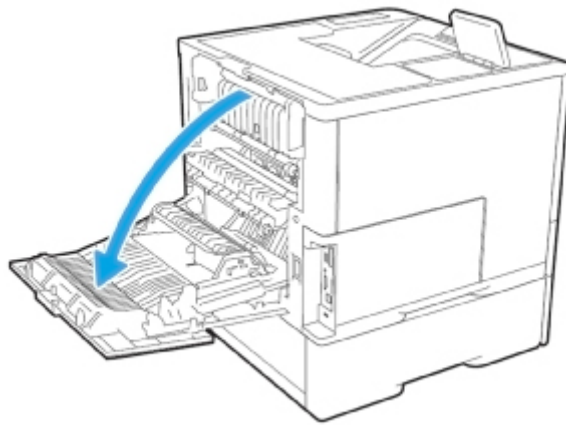

- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

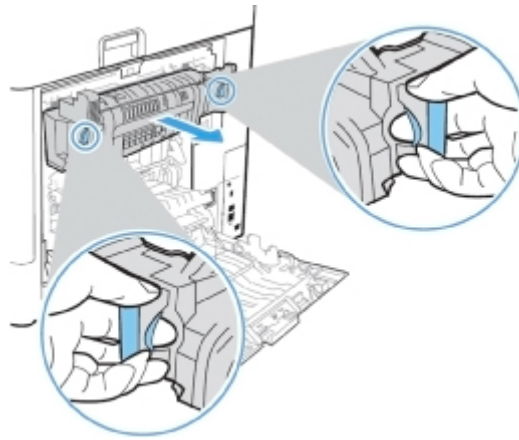

- c. Install a new fuser.

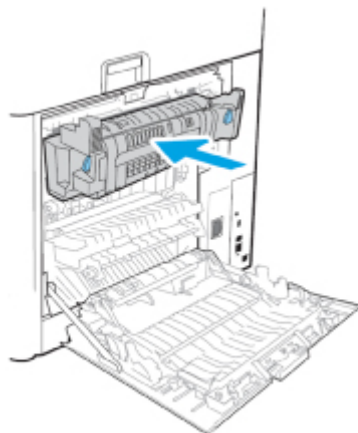

- d. Close the front door.

10.99.31 Non-HP supply in use.

The printer displays this message when a used supply (a remanufactured or refilled genuine HP or non-HP supply) has been installed.

The 10.99.31 is an event log only message, it will not show on the control panel. The only message to display will be **Used supply in use** message.

Recommended action

- The toner cartridge has been previously used. Touch the **OK** button to continue.

 **NOTE:** Removing a cartridge from one printer and then installing it in a different printer (for testing functionality) will cause this event code.

 **NOTE:** If it is believed the customer purchased a genuine HP supply, go to www.hp.com/go/anticounterfeit.

10.99.34 Used supply in use.

The printer displays this message when a used supply (a remanufactured or refilled genuine HP or non-HP supply) has been installed.

The 10.99.34 is an event log only message, it will not show on the control panel. The only message to display will be **Used supply in use**.

Recommended action

- The toner cartridge has been previously used. Touch the **OK** button to continue.

 **NOTE:** Removing a cartridge from one printer and then installing it in a different printer (for testing functionality) will cause this event code.

 **NOTE:** If it is believed the customer purchased a genuine HP supply, go to www.hp.com/go/anticounterfeit.

10.99.40 Genuine HP supplies installed

The printer displays this message when a new cartridge has been installed and all cartridges are Genuine HP.

Recommended action

- Touch the **OK** button to continue.

10.99.41 Unsupported Supply in use

The toner cartridge is for a different printer.

Recommended action

- Remove the toner cartridge, and then install the correct cartridge for this printer.

11.WX.YZ error messages

11.* errors

Errors in the 11.* family are related to the printer real-time clock.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Set the time and date on the printer control panel.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Set the time and date on the printer control panel.
2. If the error persists, remove and reinstall the formatter. Make sure it is fully seated.
3. If the error still persists, replace the formatter.

11.00.01 or 11.00.02 Internal clock error

The printer real time clock has experienced an error.

01=dead clock

02=dead real time clock

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. Set the time and date on the control panel.



NOTE: The control panel display menu options for the steps below might vary depending on the printer model and firmware version installed.


- a. From the Home screen on the product control panel, select **Settings**.
- b. Select **General**, and then select **Date/Time Settings**.
- c. Open the **Date/Time Format** menu, configure the date and time format, and then save the settings.

- d. Open the [Date/Time](#) menu and configure the date and time zone settings for the printer location.

 **NOTE:** If you are in an area that uses daylight savings time, select the [Adjust for Daylight Savings](#) check box.

- e. Select [Done](#) to save the settings.

Figure 6-4 Date/Time Settings

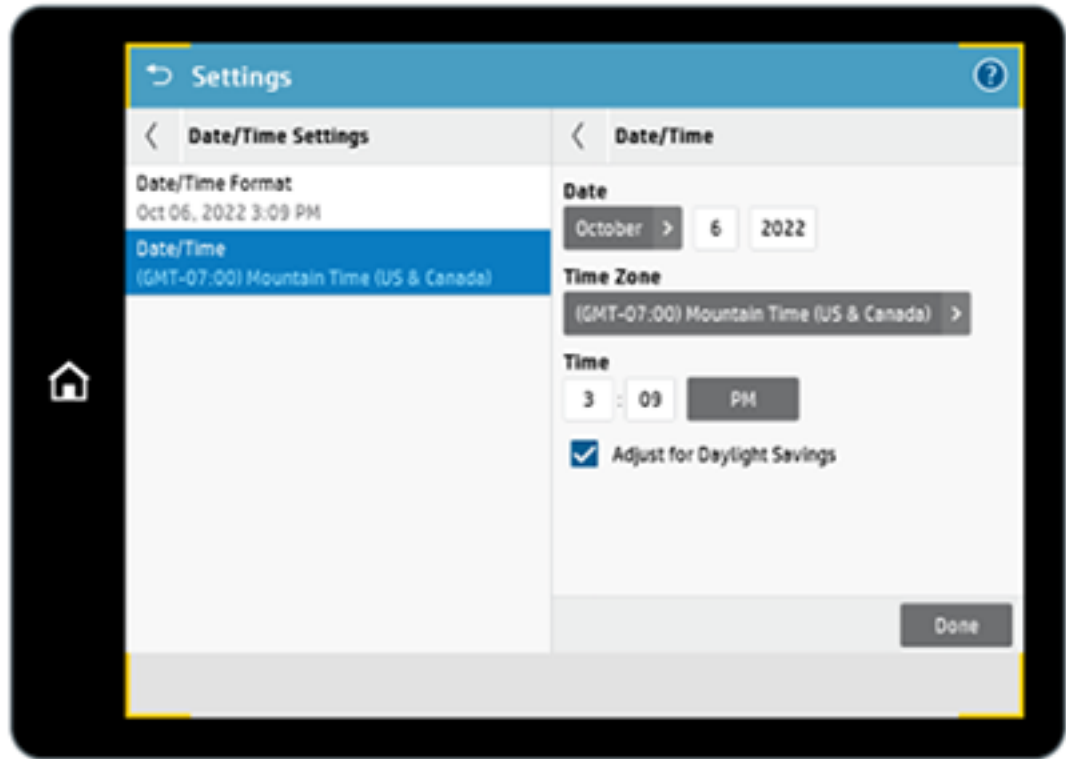

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. Set the time and date on the control panel.


 **NOTE:** The control panel display menu options for the steps below might vary depending on the printer model and firmware version installed.

- a. From the Home screen on the product control panel, select [Settings](#).
- b. Select [General](#), and then select [Date/Time Settings](#).
- c. Open the [Date/Time Format](#) menu, configure the date and time format, and then save the settings.
- d. Open the [Date/Time](#) menu and configure the date and time zone settings for the printer location.

 **NOTE:** If you are in an area that uses daylight savings time, select the [Adjust for Daylight Savings](#) check box.

- e. Select **Done** to save the settings.

Figure 6-5 Date/Time Settings

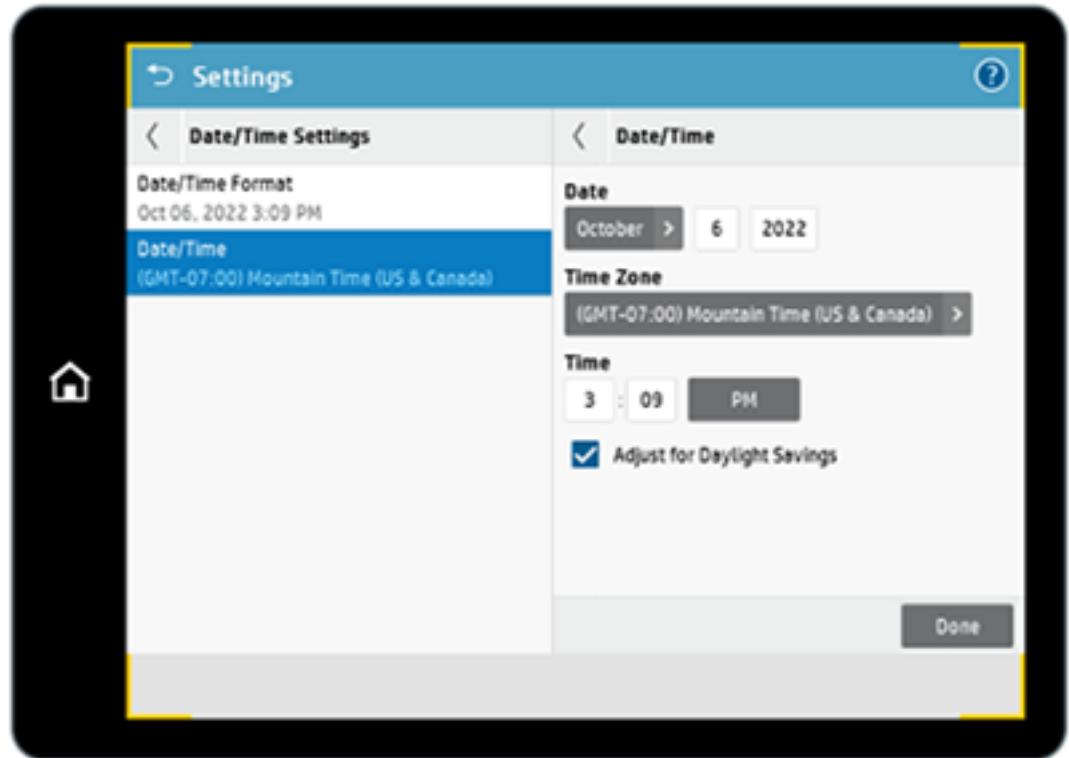

3. If the error persists, replace the formatter.

IMPORTANT: Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

Table 6-4 Formatter part numbers

Description	Part number
Formatter (main logic) PC board assembly	K0Q14-60001
For printer models: M608x/M609x	
Formatter (main logic) PC board assembly	K0Q14-60002
For printer models: M607n/dn, M608n/dn, M609n/dn, M610/M611/M612/E60055/E60065/E60075	
Formatter	7PS81-67901
For printer models: M611x/M612x (India/China)	
Formatter	7PS81-67902
For printer models: M611x/M612x	
Formatter	7PS81-67905
For printer models: M610n/dn, M611n/dn, M612n/dn (India/China)	

Table 6-4 Formatter part numbers (continued)

Description	Part number
Formatter	7PS81-67906
For printer models: M610n/dn, M611n/dn, M612n/dn	
Formatter (main logic) PC board assembly	3GY09-67902
For printer models: E60155/ E60165/ E60175	
Kit- Formatter	3GY09-67903
For printer models: E60155/ E60165/ E60175 (India/China)	

For instructions to remove and replace the formatter: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. Set the time and date on the control panel.



NOTE: The control panel display menu options for the steps below might vary depending on the printer model and firmware version installed.


- a. From the Home screen on the product control panel, select [Settings](#).
- b. Select [General](#), and then select [Date/Time Settings](#).
- c. Open the [Date/Time Format](#) menu, configure the date and time format, and then save the settings.
- d. Open the [Date/Time](#) menu and configure the date and time zone settings for the printer location.



NOTE: If you are in an area that uses daylight savings time, select the [Adjust for Daylight Savings](#) check box.

- e. Select **Done** to save the settings.

Figure 6-6 Date/Time Settings

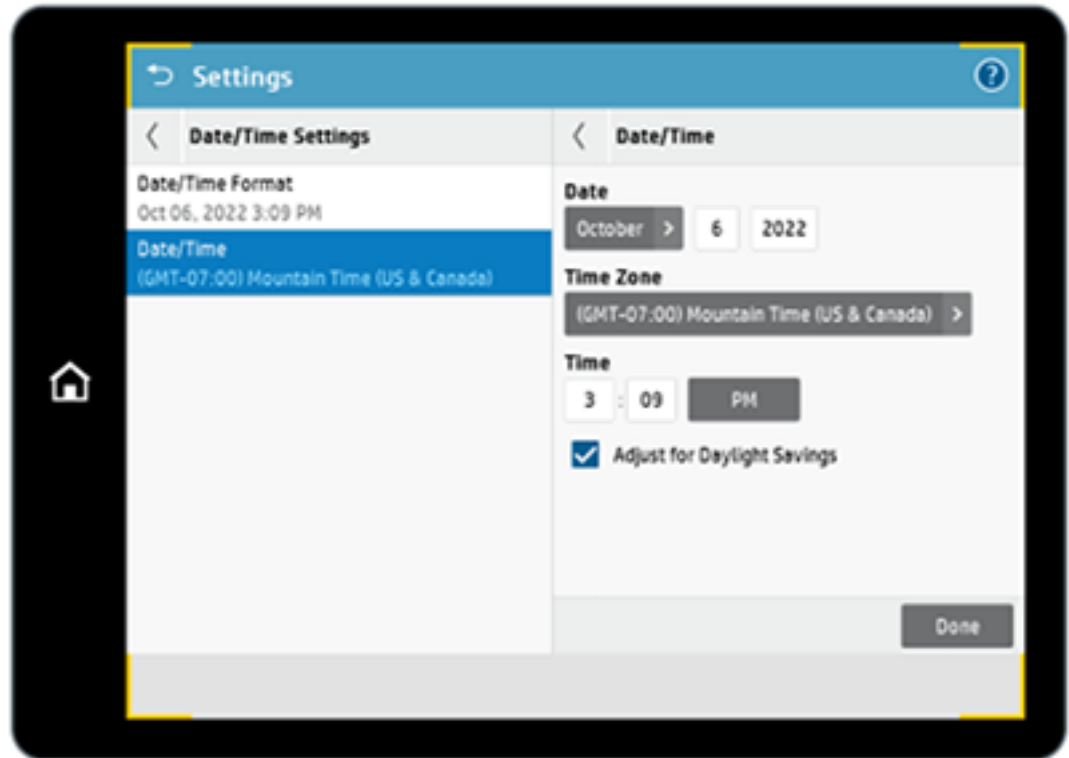

3. If the error persists, replace the formatter.

IMPORTANT: Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

Table 6-5 Formatter part numbers

Description	Part number
Formatter (main logic) PC board assembly	K0Q14-60001
For printer models: M608x/M609x	
Formatter (main logic) PC board assembly	K0Q14-60002
For printer models: M607n/dn, M608n/dn, M609n/dn, M610/M611/M612/E60055/E60065/E60075	
Formatter	7PS81-67901
For printer models: M611x/M612x (India/China)	
Formatter	7PS81-67902
For printer models: M611x/M612x	
Formatter	7PS81-67905
For printer models: M610n/dn, M611n/dn, M612n/dn (India/China)	

Table 6-5 Formatter part numbers (continued)

Description	Part number
Formatter	7PS81-67906
For printer models: M610n/dn, M611n/dn, M612n/dn	
Formatter (main logic) PC board assembly	3GY09-67902
For printer models: E60155/ E60165/ E60175	
Kit- Formatter	3GY09-67903
For printer models: E60155/ E60165/ E60175 (India/China)	

For formatter instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

13.WX.YZ error messages

13.* errors

Errors in the 13.* family are related to jams.

More than 1000 unique error codes are possible. Use the following information to understand the jam code. Not all codes apply to all printers.

Message format: 13.WX.YZ

- W represents the jam location.
- X represents the sensor or door that triggered the jam.
- Y represents the jam condition (delay, stay, wrap, etc.)
- Z represents the paper source, fuser mode, or destination

Table 6-6 Potential values for W and X

W	Jam location	X	Sensor or door
A	Input area	0	Envelope feeder
A	Input area	1	Tray 1 feed (unless Tray 1 feed is the registration sensor)
A	Input area	2	Tray 2 feed (unless Tray 2 feed is the registration sensor)
A	Input area	3	Tray 3 feed
A	Input area	4	Tray 4 feed NOTE: If available for specified printer
A	Input area	5	Tray 5 feed NOTE: If available for specified printer
A	Input area	6	Tray 6 feed NOTE: If available for specified printer
A	Input area	7	Optional tray exit sensor
A	Input area	A	Door 1
A	Input area	B	Door 2
A	Input area	C	Door 3 NOTE: If available for specified printer
A	Input area	D	Door 4 NOTE: If available for specified printer
A	Input area	E	Door 5 NOTE: If available for specified printer
A	Input area	F	Multiple sensors or doors
B	Image area	0	Media sensor for forbidden transparencies

Table 6-6 Potential values for W and X (continued)

W	Jam location	X	Sensor or door
B	Image area	2	Registration/top of page
B	Image area	3	Top of page
B	Image area	4	Loop
B	Image area	5	Fuser input
B	Image area	9	Fuser output
B	Image area	A	Door 1
B	Image area	B	Door 2
B	Image area	F	Multiple sensors or doors
C	Switchback area (between the fuser and the output bin)	1	Intermediate switchback sensor
C	Switchback area (between the fuser and the output bin)	2	Switchback media stay sensor
C	Switchback area (between the fuser and the output bin)	3	Paper delivery sensor
D	Duplex area	1	Duplex switchback
D	Duplex area	2	Duplex delivery
D	Duplex area	3	Duplex refeed
D	Duplex area	A	Door 1 (if different than the imaging area)
D	Duplex area	B	Door 2 (if different than the imaging area)
D	Duplex area	F	Multiple sensors or doors
E	Output or intermediate paper transport unit (IPTU) area	1	Output bin full sensor
E	Output or intermediate paper transport unit (IPTU) area	2	IPTU feed sensor 1
E	Output or intermediate paper transport unit (IPTU) area	3	IPTU sensor 2
E	Output or intermediate paper transport unit (IPTU) area	4	IPTU sensor 3
E	Output or intermediate paper transport unit (IPTU) area	5	IPTU bin full sensor 4
E	Output or intermediate paper transport unit (IPTU) area	6	Output sensor
E	Output or intermediate paper transport unit (IPTU) area	A	Door 1
E	Output or intermediate paper transport unit (IPTU) area	F	Multiple sensors or doors
F	Multiple subsystems (occurs when paper is stuck in several areas)	F	Multiple sensors or doors
I	Jetlink input device	4	Tray 4 feed sensor

NOTE: If available for specified printer

Table 6-6 Potential values for W and X (continued)

W	Jam location	X	Sensor or door
1	Jetlink Input device	5	Tray 5 feed sensor NOTE: If available for specified printer
1	Jetlink Input device	6	Tray 6 feed sensor NOTE: If available for specified printer
1	Jetlink Input device	7	Tray 7 feed sensor NOTE: If available for specified printer
1	Jetlink Input device	8	Tray 8 feed sensor NOTE: If available for specified printer
1	Jetlink Input device	9	Tray 9 feed sensor NOTE: If available for specified printer
1	Jetlink Input device	A	Door 1
1	Jetlink Input device	B	Door 2
1	Jetlink Input device	F	Multiple sensors or doors
2	Buffer pass unit	0	Buffer pass inlet sensor
2	Buffer pass unit	9	Buffer pass exit sensor
2	Buffer pass unit	A	Door 1
3	Page insert unit	0	Page insertion inlet sensor
3	Page insert unit	1	Page insertion tray 1 feed sensor
3	Page insert unit	2	Page insertion tray 2 feed sensor
3	Page insert unit	3	Page insertion tray 3 feed sensor
3	Page insert unit	4	Page insertion tray 4 feed sensor
3	Page insert unit	7	Output path feed sensor
3	Page insert unit	9	Page insertion exit sensor
3	Page insert unit	A	Door 1
4	Punch unit	0	Puncher inlet sensor
4	Punch unit	1	Puncher jam sensor
4	Punch unit	9	Puncher exit sensor
4	Punch unit	A	Door 1
5	Folding unit	0	Folder inlet sensor
5	Folding unit	1	Folder sensor
5	Folding unit	9	Folder exit sensor
5	Folding unit	A	Door 1
6	Stacker unit	0	Stacker inlet sensor
6	Stacker unit	4	Stacker outlet sensor

Table 6-6 Potential values for W and X (continued)

W	Jam location	X	Sensor or door
6	Stacker unit	7	Stacker switchback entrance sensor
6	Stacker unit	8	Stacker switchback registration sensor
6	Stacker unit	9	Stacker switchback lower sensor
7	Multi-bin mailbox (MBM) unit	0	MBM inlet sensor
7	Multi-bin mailbox (MBM) unit	1	MBM middle sensor
7	Multi-bin mailbox (MBM) unit	9	Stapler sensor
7	Multi-bin mailbox (MBM) unit	A	Door 1
7	Multi-bin mailbox (MBM) unit	B	Door 2
7	Multi-bin mailbox (MBM) unit	C	Door 3
7	Multi-bin mailbox (MBM) unit	F	Multiple sensors or doors
8	Stapler/stacker (SS) unit	0	SS inlet sensor
8	Stapler/stacker (SS) unit	1	SS Bin Z
8	Stapler/stacker (SS) unit	3	SS unit middle sensor
8	Stapler/stacker (SS) unit	4	SS unit outlet sensor 1
8	Stapler/stacker (SS) unit	5	SS unit outlet sensor 2
8	Stapler/stacker (SS) unit	9	Stapler sensor
8	Stapler/stacker (SS) unit	A	Door 1
8	Stapler/stacker (SS) unit	B	Door 2
9	Booklet maker unit	0	Booklet maker input sensor
9	Booklet maker unit	2	Booklet maker feed sensor 2
9	Booklet maker unit	2	Booklet maker feed sensor 3
9	Booklet maker unit	4	Booklet maker delivery sensor
9	Booklet maker unit	5	Booklet maker vertical paper path sensor
9	Booklet maker unit	6	Booklet unit front staple sensor
9	Booklet maker unit	7	Booklet unit rear staple sensor
9	Booklet maker unit	8	Booklet unit outlet sensor
9	Booklet maker unit	A	Door 1
9	Booklet maker unit	B	Door 2
9	Booklet maker unit	C	Door 3
9	Booklet maker unit	F	Multiple sensors or doors
0	Unknown	0	Unknown

Table 6-7 Potential values for Y (jam condition)

Y	Jam condition
0	Unknown
1	Unexpected sheet (duplex)
2	Staple jam
3	Jam caused by an open door (duplex)
4	Stay jam (the page never left the tray – duplex)
A	Stay jam (the page never left the tray – simplex)
B	Multifeed
C	Wrap
D	Delay (the page did not reach the sensor within the expected time – simplex)
E	Door open
F	Residual (paper is detected in the paper path when it should not be there)

The information represented by the value for Z depends on where the paper is in the paper path.

Table 6-8 Potential values for Z (source, fuser mode, or destination)

Paper location	Z	Source, fuser mode, or destination
When paper has not reached the fuser, Z represents the paper source.	1	Tray 1
Z represents the paper source.	2	Tray 2
Z represents the paper source.	3	Tray 3
Z represents the paper source.	4	Tray 4 If available for specified printer
Z represents the paper source.	5	Tray 5 If available for specified printer
Z represents the paper source.	6	Tray 6 If available for specified printer
Z represents the paper source.	D	Duplexer
Z represents the paper source.	E	Envelope feeder
When paper has reached the fuser, is in the duplex path, or in the output path, Z represents the fuser mode. Jams can occur when there is a mismatch between the actual paper and the fuser mode setting.	0	Photo 1, 2, or 3 Designated 2 or 3
Z represents the fuser mode.	1	Normal (automatically sensed rather than based on the paper type set at the control panel)
Z represents the fuser mode.	2	Normal (based on the paper type set at the control panel)

Table 6-8 Potential values for Z (source, fuser mode, or destination) (continued)

Paper location	Z	Source, fuser mode, or destination
Z represents the fuser mode.	3	Light 1, 2, or 3
Z represents the fuser mode.	4	Heavy 1
Z represents the fuser mode.	5	Heavy 2
Z represents the fuser mode.	6	Heavy 3
Z represents the fuser mode.	7	Glossy 1
Z represents the fuser mode.	8	Glossy 2
Z represents the fuser mode.	9	Glossy 3
Z represents the fuser mode.	A	Glossy Film
Z represents the fuser mode.	B	Transparency
Z represents the fuser mode.	C	Label
Z represents the fuser mode.	D	Envelope 1, 2, or 3
Z represents the fuser mode.	E	Rough
When paper has entered the output bin, Z represents the output bin, numbered from top to bottom.	0	Unknown bin
Z represents the output bin	1	Bin 1
Z represents the output bin	2	Bin 2
Z represents the output bin	3	Bin 3
Z represents the output bin	4	Bin 4
Z represents the output bin	5	Bin 5
Z represents the output bin	6	Bin 6
Z represents the output bin	7	Bin 7
Z represents the output bin	8	Bin 8
Z represents the output bin	9	Bin 9
All paper locations	E	Door open jam
All paper locations	F	Residual jam
All paper locations	0	Forbidden OHT jam (when Y=2)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size, and the tray should not be filled above the maximum fill marks or tabs.

4. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
5. Use a damp, lint-free cloth to clean the rollers in the appropriate tray. Replace rollers that are worn.
6. Open all doors and covers and ensure the paper path is completely clear of paper or obstructions.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

To prevent future paper jams in the printer, follow these recommendations:

- Use only paper that meets HP specifications for this printer.

For more information, refer to the printer User Guide or search for the "HP LaserJet Printers - Print Media Guide" (c06117757) [Or click here: HP LaserJet Print Media Guide](#).
- Make sure the printing environment is within recommended specifications.
- Do not use paper that is wrinkled, folded, or damaged.
- Do not overload the tray with paper.
- Make sure that the paper guides in the tray are adjusted correctly for the size of paper.
- Make sure that the tray is fully inserted in the printer.
- If printing on heavy, embossed, or perforated paper, use the manual feed feature and feed sheets one at a time.
- Open the [Trays](#) menu on the printer control panel. Verify that the tray is configured correctly for the paper type and size.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size, and the tray should not be filled above the maximum fill marks or tabs.
4. Verify that the paper meets specifications for this printer.
5. Use a damp, lint-free cloth to clean the rollers in the appropriate tray. Replace rollers that are worn.
6. If the issue persists, open the [Administration > Troubleshooting > Diagnostic Tests > Component Test](#) menu, and perform the appropriate pickup/feed motor drive test. Replace the pickup assembly if the test fails.
7. Verify the sensors are functioning correctly. If the sensors fail the test, first verify that all connections on the DC controller are correctly seated. If possible, replace the sensor or assembly it is associated with.
8. If the sensors pass the test, look for blockage or damaged parts and replace any damaged parts.
9. If the error persists, elevate the case using the Standard Support Process.

13.00.0E

A jam occurred when feeding envelopes from the envelope feeder cassette.

Recommended action for customers

1. Ensure that only high-quality envelopes are used.
2. Verify that the envelopes are loaded into the envelope feeder cassette in the correct orientation.
3. Remove the tray that holds the envelope feeder cassette by pulling up and lifting slightly.
4. If any envelopes have started to feed, remove and reinsert the envelopes.

Figure 6-7 A partially fed envelope



5. Remove any jammed or damaged envelopes.
6. Reinsert and close the tray.
7. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Remove the tray that holds the envelope feeder cassette by pulling up and lifting slightly.
2. Ensure that the customer is using high-quality envelopes, and that the envelopes are loaded in the correct orientation.

3. If the envelopes are loaded or have started to feed, remove and reinsert the envelopes.

Figure 6-8 A partially fed envelope



4. Remove any jammed or damaged envelopes.
5. Reinsert and close the tray.

13.00.EE

Unknown door open.

Recommended action for customers

1. Ensure that all of the doors and covers are closed.
2. If the error persists, please contact customer support.

13.00.FF

Residual jam.

This error has no specific sensor designated. It could be any sensor in the paper feed path and the required jam access point has not been accessed.

Recommended action for customers

1. Check the printer for a jam.
2. Remove any paper present or obstructions in the paper path.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Check the printer for a jam.
2. Remove any paper present or obstructions in the paper path.
3. View event log to determine if other jam errors are occurring and troubleshoot those errors.

4. Use the manual sensors test to isolate a faulty door switch or sensor.
 - a. From the home screen on the printer control panel, touch “[Support Tools](#)”.
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - c. Select from the following tests:
 - [All Sensors](#)
 - [Input Tray Sensors](#) (choose from the group of sensors to test)
 - [Output Bin Sensors](#)
 - [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#) (reset the selected sensor’s state)
5. Replace parts as determined by sensor tests, obstructions or broken parts.

13.A1.A1

Paper stay jam from tray 1.

Paper did not leave the Tray 1 feed sensor (PS4750) in the designated amount of time when printing from Tray 1.

FOR CUSTOMERS: For more troubleshooting steps, please see the following document: [HP LaserJet Enterprise M607-M609, HP LaserJet Managed E60055-E60075 - Clear a 13.A1.FF paper jam](#) - c06183416

Recommended action for customers

1. Clear the paper jam.
 - a. Remove any jammed paper from tray 1.
 - b. Remove tray 2, and press the green jam access button, and the tray 1 jam access door will drop down.
 - c. Remove any jammed paper.
 - d. Reinstall tray 2 and allow the printer to attempt to clear the jam message.
 - e. Close the left and rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

 **NOTE:** For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

3. Ensure that the Tray 1 pickup, feed, and separation rollers are installed correctly and show no dirt, damage, or wear.

4. Clean or replace the pickup, feed, and separation rollers as needed.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Remove any jammed paper from tray 1.
 - b. Remove tray 2, and press the green jam access button, and the tray 1 jam access door will drop down.
 - c. Look for and clear any jammed paper or obstructions in the access area.
 - d. Reinstall tray 2 allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.



NOTE: For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

3. Ensure that the tray 1 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup, feed, and separation rollers as needed.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

5. Check the paper feed guide lower assembly for broken parts or damage. Replace lower feed guide assembly and photo sensor.

Paper feed guide lower assembly part number: RM2-6748-000CN

Photo Interrupter part number: WG8-5935-000CN

Recommended action for onsite technicians

1. Clear the paper jam.
 - a. Remove any jammed paper from tray 1.
 - b. Remove tray 2, and press the green jam access button, and the tray 1 jam access door will drop down.
 - c. Look for and clear any jammed paper or obstructions in the access area.
 - d. Reinstall tray 2 allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.



NOTE: For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

3. Ensure that the tray 1 pickup, feed, and separation rollers are installed correctly and show no damage or wear.

4. Clean or replace the pickup, feed, and separation rollers as needed.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

5. Check the paper feed guide lower assembly for broken parts or damage. Replace lower feed guide assembly as needed.

Paper feed guide lower assembly part number: RM2-6748-000CN

6. Enter the component test menu to run diagnostics on the printer.
 - a. From the home screen on the printer control panel, touch [Support Tools](#).
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Components Test](#)
7. Test tray 1 feed clutch CL1.
 - a. From the components test menu, touch the [Tray 1 feed clutch](#).

Instruct the customer to listen for a click noise near the front left side, indicating that the solenoid is firing. If the customer has difficulty hearing it, check Repeat, and test again
 - b. If the clutch does not function correctly, ensure connector J202 on the DC controller PCA is securely and correctly seated.
 - c. If the solenoid continues to fail, replace the clutch.

Part number: RM2-9456-000CN

13.A1.D1

Paper delay jam from tray 1.

Paper did not reach the Tray 1 feed sensor (PS4750) in the designated amount of time when printing from Tray 1.

FOR CUSTOMERS: For more troubleshooting steps, please see the following document: [HP LaserJet Enterprise M607-M609, HP LaserJet Managed E60055-E60075 - Clear a 13.A1.FF paper jam](#) - c06183416

Recommended action for customers

1. Clear the paper jam.
 - a. Remove any jammed paper from tray 1.
 - b. Remove tray 2, and press the green jam access button, and the tray 1 jam access door will drop down.
 - c. Clear any jammed paper or obstructions in the access area.
 - d. Reinstall tray 2 allow the printer to attempt to clear the jam message.

2. Ensure that the type and quality of the paper being used meets the HP specifications for the printer.

 **NOTE:** For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

3. Ensure that the Tray 1 pickup, feed, and separation rollers are installed correctly and show no dirt, damage, or wear.
4. Clean or replace the pickup, feed, and separation rollers as needed.


 **NOTE:** Clean the rollers with a dampened lint free cloth or paper.

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Remove any jammed paper from tray 1.
 - b. Remove tray 2, and press the green jam access button, and the tray 1 jam access door will drop down.
 - c. Look for and clear any jammed paper or obstructions in the access area.
 - d. Reinstall tray 2 allow the printer to attempt to clear the jam message.
2. Check the spring lever on tray 1 to see if it is dislodged.

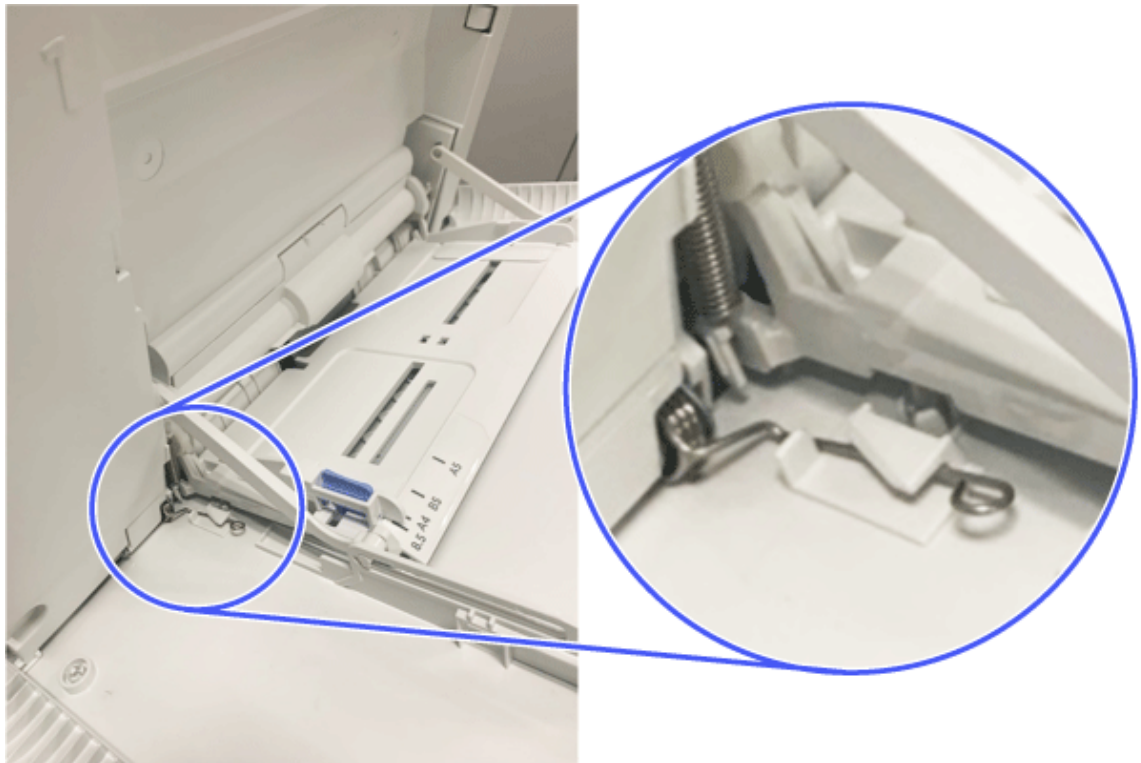

If lever is not as shown in image refer to the following document: *HP LaserJet M607, M608, M609, M610, M611, M612, E60055, E60065, E60075, E60155, E60165, E60175 - 13.A1.D1 Caused by Spring Lever being Dislodged*

3. Ensure that the type and quality of the paper being used meets the HP specifications for the printer.

 **NOTE:** For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

4. Ensure that the tray 1 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.


 **NOTE:** Clean the rollers with a dampened lint free cloth or paper.

6. If the rollers have already been replaced, replace the front door assembly
Front door assembly part number: RM2-4277-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Remove any jammed paper from tray 1.
2. Check the spring lever on tray 1 to see if it is dislodged.

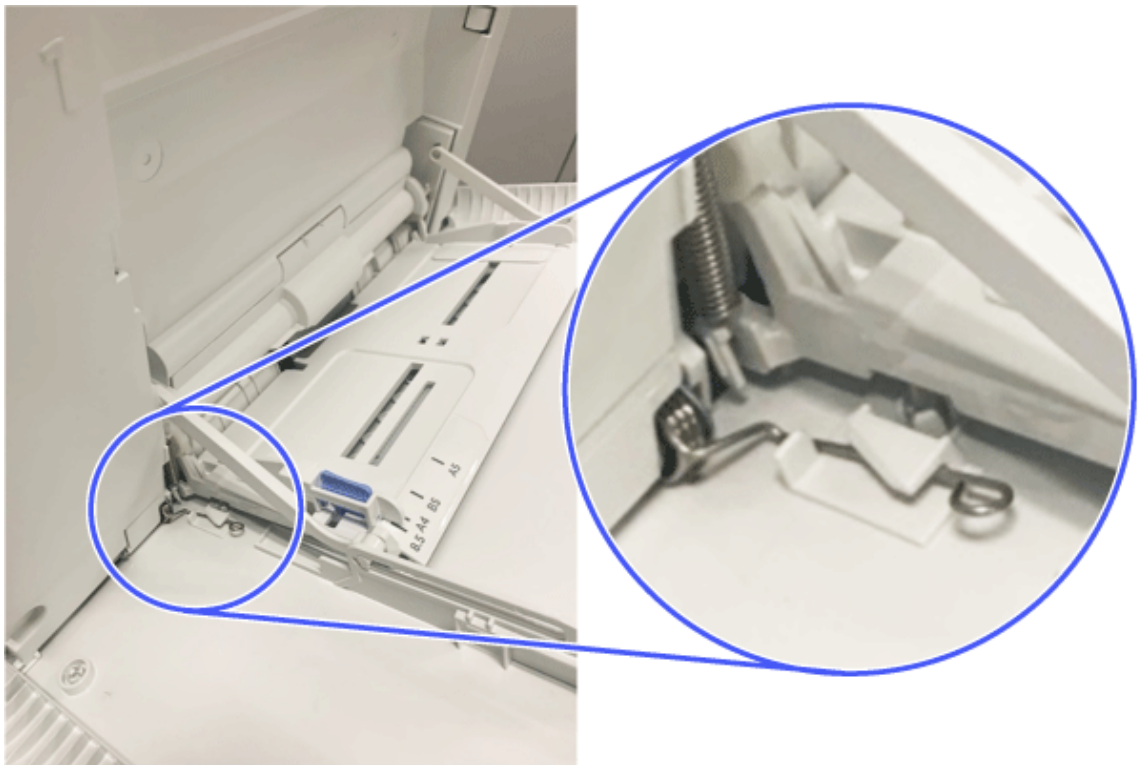

If lever is not as shown in image refer to the following document: *HP LaserJet M607, M608, M609, M610, M611, M612, E60055, E60065, E60075, E60155, E60165, E60175 - 13.A1.D1 Caused by Spring Lever being Dislodged*


3. Clear the paper jam.
 - a. Remove tray 2, and press the green jam access button, and the tray 1 jam access door will drop down.
 - b. Look for and clear any jammed paper or obstructions in the access area.
 - c. Reinstall tray 2 allow the printer to attempt to clear the jam message.
4. Ensure that the type and quality of the paper being used meets the HP specifications for the printer.

 **NOTE:** For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

5. Ensure that the tray 1 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
6. Clean or replace the pickup, feed, and separation rollers as needed.

 **NOTE:** Clean the rollers with a dampened lint free cloth or paper.

7. Use the manual sensor test to check the tray 1 paper feed sensor (PS4750).
 - a. From the home screen on the printer control panel, touch “Support Tools”.
 - b. Open the following menus:
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - c. Select from the following tests:
 - All, Sensors , Engine Sensors
 - Done (return to the Troubleshooting menu)
 - Reset (reset the selected sensor’s state)
 - d. Block the tray 1 feed sensor to test.

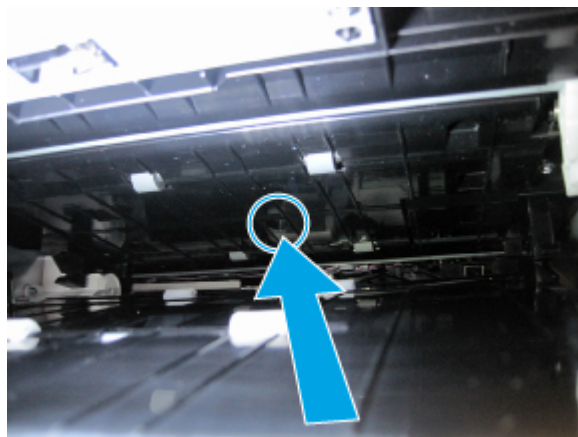

- e. If the sensor does not function correctly, replace the sensor.

Part number: WG8-5935-000CN

8. Check the paper feed guide assembly for broken parts or damage. Replace the lower feed guide assembly as needed.

Paper feed guide lower assembly part number: RM2-6748-000CN

9. Enter the component test menu to run diagnostics on the printer.

- a. From the home screen on the printer control panel, touch [Support Tools](#).

- b. Open the following menus:

- [Troubleshooting](#)
- [Diagnostic Tests](#)
- [Components Test](#)

10. Test the tray 1 solenoid SL1.

- a. From the [Components Test](#) menu, touch [Tray 1 pickup solenoid](#).

Instruct the customer to listen for a click noise near the front left side, indicating that the solenoid is firing. If the customer has difficulty hearing it, check Repeat, and test again

- b. If the solenoid does not function correctly, ensure connector J11 on the DC controller PCA is securely and correctly seated.

- c. If the solenoid continues to fail, replace the front door assembly.

Part number: RM2-4277-000CN

For instructions: *Removal and replacement: Front door assembly* See the Repair Service Manual for this product.

11. Test tray 1 feed clutch CL1.

- a. From the [Components Test](#) menu, touch [Tray 1 feed clutch](#).

Instruct the customer to listen for a click noise around the formatter cover, indicating that the clutch is firing. If the customer has difficulty hearing it, check Repeat, and test again

- b. If the clutch does not function correctly, ensure connector J202 on the DC controller PCA is securely and correctly seated.

- c. If the solenoid continues to fail, replace the clutch.

Part number: RM2-9456-000CN

13.A1.FF

Power on jam at the Tray 1 feed sensor.

The Tray 1 feed sensor (PS4750) detects residual media present in the Tray 1 paper feed guide assembly.

FOR CUSTOMERS: For more troubleshooting steps, please see the following document: [HP LaserJet Enterprise M607-M609, HP LaserJet Managed E60055-E60075 - Clear a 13.A1.FF paper jam](#) - c06183416

Recommended action for customers

1. Clear the paper jam in Tray 1.
 - a. Open Tray 1.
 - b. If there is any jammed paper visible in Tray 1, gently pull the paper straight out to remove it, and then close Tray 1.
2. Clear the paper jam in the Tray 1 paper feed guide assembly.
 - a. Open tray 2 and lift it up slightly to pull the tray completely out of the printer.
 - b. Press the jam plate release button to lower the jam clearing plate.
 - c. If any jammed paper or obstructions are in the paper path, gently pull any jammed paper straight out to remove the damaged paper.
 - d. Raise the jam clearing plate back into the correct position.
 - e. Reinstall Tray 2 in the printer and close the tray.
3. Clear the paper jam in the rear door.
 - a. Open the rear door.
 - b. If any jammed paper or obstructions are in the paper path, remove any damaged pages, and then close the rear door.
4. Ensure that the type and quality of the paper used meets the HP specifications for the printer.
5. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam in Tray 1 and in the Tray 1 paper feed guide assembly.
 - a. If there is any jammed paper visible in Tray 1, gently pull the paper straight out to remove it, and then close Tray 1.
 - b. Pull Tray 2 completely out of the printer.
 - c. Press the jam plate release button to lower the jam clearing plate, and then pull out any jammed paper straight out.
 - d. Raise the jam clearing plate fully back into position.
 - e. Reinstall Tray 2 in the printer.
2. Check for any jammed paper or obstruction inside the rear door.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
3. Use the Manual sensor test to check and isolate the Tray 1 paper feed sensor (PS4750).
 - a. From the Home screen on the printer control panel, touch [Support Tools](#)


- b. Open the following menus:
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
- c. Touch [All sensors](#), select [Engine sensors](#), and then touch the [Reset](#) button.



NOTE: Make sure to reset the selected sensor's state.

- d. Block the tray 1 Feed Sensor to test.

Figure 6-9 Location of the Tray 1 feed sensor

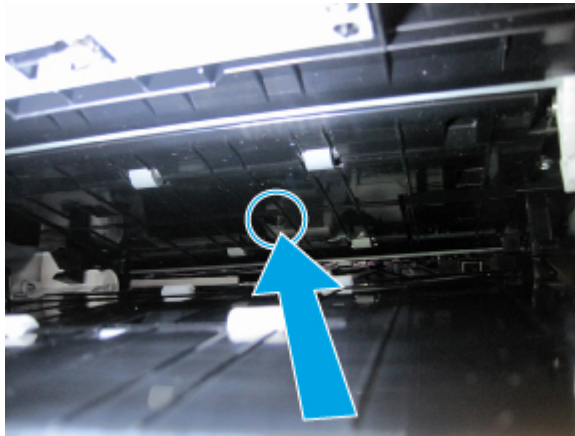

- e. If the sensor does not function correctly, replace the sensor.

Fuser output sensor (SRS):

WG8-5935-000CN

4. Check the paper feed guide assembly for broken parts or damage. Replace the lower feed guide assembly , if required.

Paper feed lower guide assembly part number:

RM2-6748-000CN

13.A3.D3

Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray 3.

This is a paper delay jam from tray 3.

550-sheet paper feeder: Recommended action for customers

Use the following steps to resolve the error.

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the front and rear door.

- c. Remove any paper present or obstructions in the paper path.
 - d. Close the front and rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

 **NOTE:** For supported sizes and types, go to [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) (c05495788).

3. If the error persists, ensure the tray guides are adjusted correctly to the paper size and the tray is not over filled above the maximum fill mark or the tab on the tray.

Figure 6-10 Paper tray guides


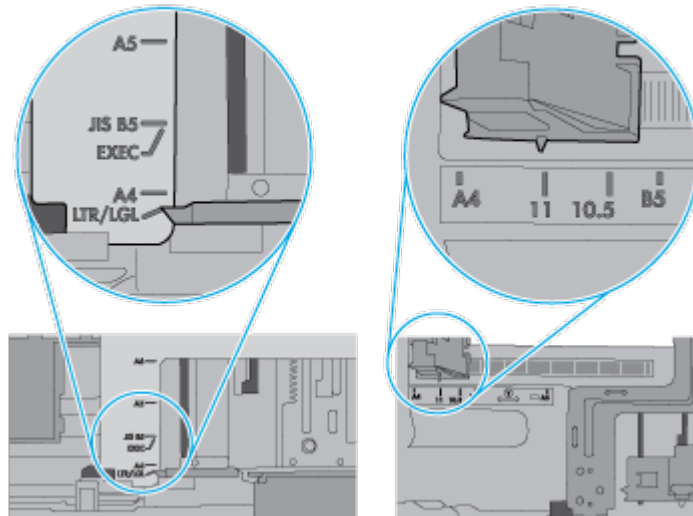


Figure 6-11 Paper height guides

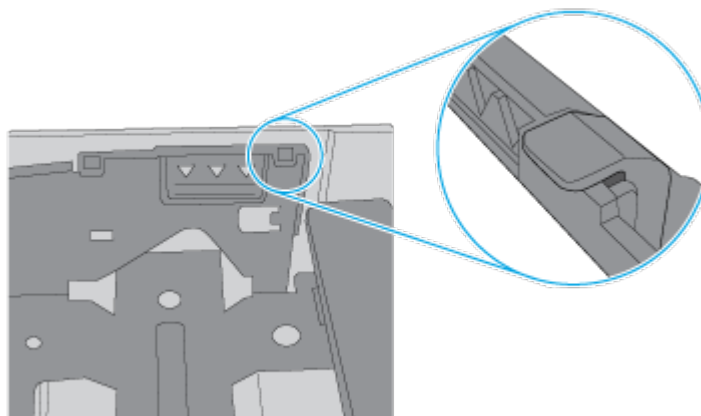

4. Ensure that the tray 3 pickup, feed, and separation rollers are installed correctly and are not worn or damaged.

- a. Check if the rollers are installed correctly.

Figure 6-12 Pick roller not locked in

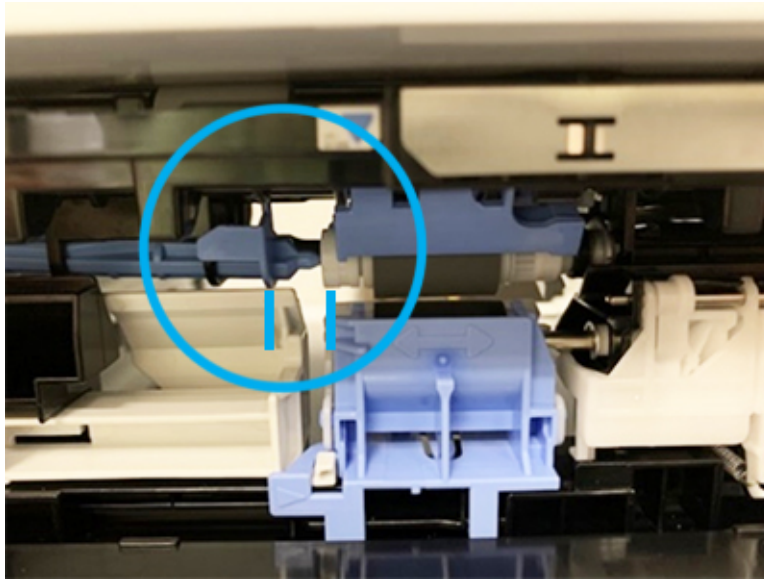


Figure 6-13 Separating roller not installed correct



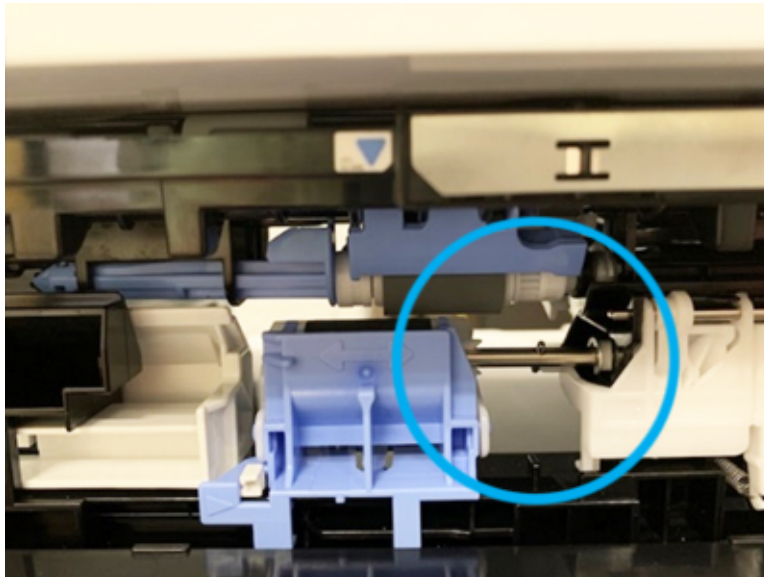


Figure 6-14 Separation roller not install and locked in correctly

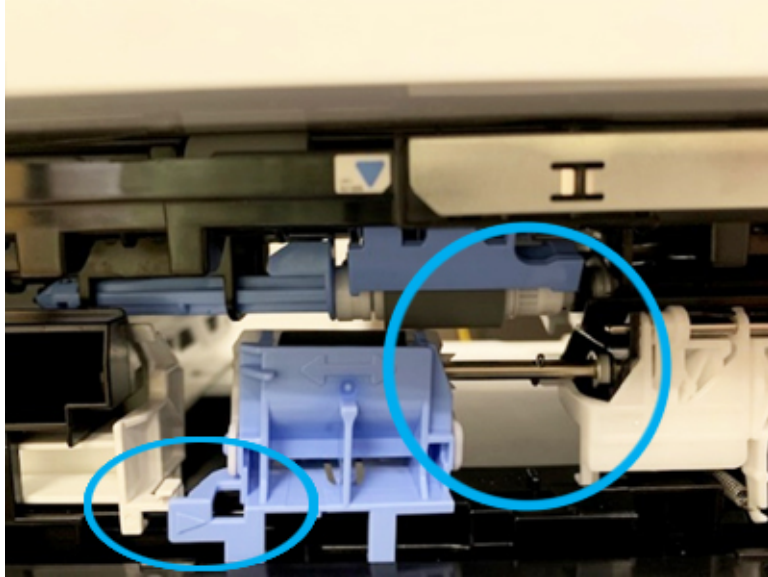

- b. If either roller is installed incorrectly, make sure to install it correctly as shown in the image below.

Figure 6-15 Rollers installed correctly

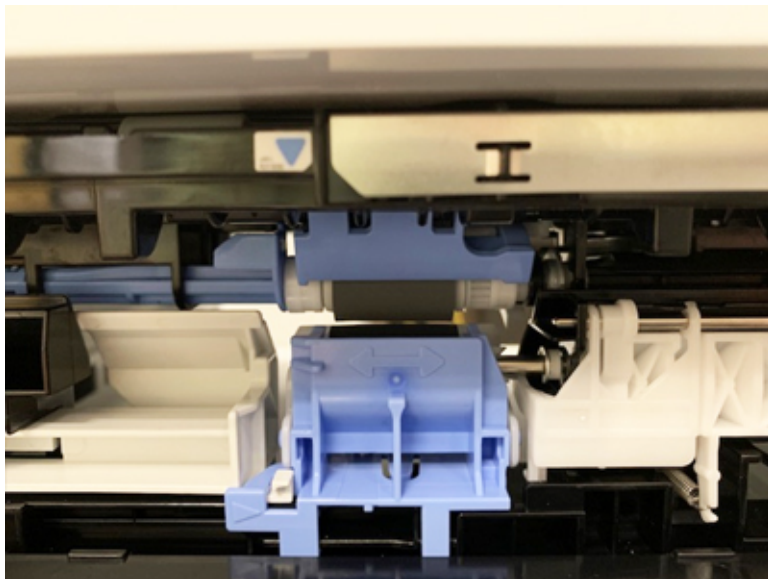

5. Clean or replace the pickup, feed, and separation rollers as needed.



NOTE: Clean the rollers with a dampened lint-free cloth.

6. If the error persists even after checking the rollers, replace the tray 3 roller kit.

Tray 2-x roller assembly part number: J8J70-67906

For instructions: *Removal and replacement: Tray 2-x roller kit* See the Repair Service Manual for this product.

7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

2,100-sheet paper feeder: Recommended action for customers

Use the following steps to resolve the error.

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the front and rear door.
 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the front and rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.



NOTE: For supported sizes and types, go to [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) (c05495788).

3. If the error persists, ensure the tray guides are adjusted correctly to the paper size and the tray is not over filled above the maximum fill mark or the tab on the tray.

Figure 6-16 2100 sheet tray guide



Figure 6-17 2100 sheet tray fill mark



4. Open the optional paper feeder and push the green tab (jam access door) on the right side down to expose the pickup rollers. Clear any paper present or obstructions in the paper path. Grasp any jammed paper with both hands and pull it straight out to remove it out of the printer.



5. Ensure that the tray 3 pickup, feed, and separation rollers are installed correctly and are not worn or damaged.

- a. Check if the rollers are installed correctly.

Figure 6-18 Pick roller not locked in

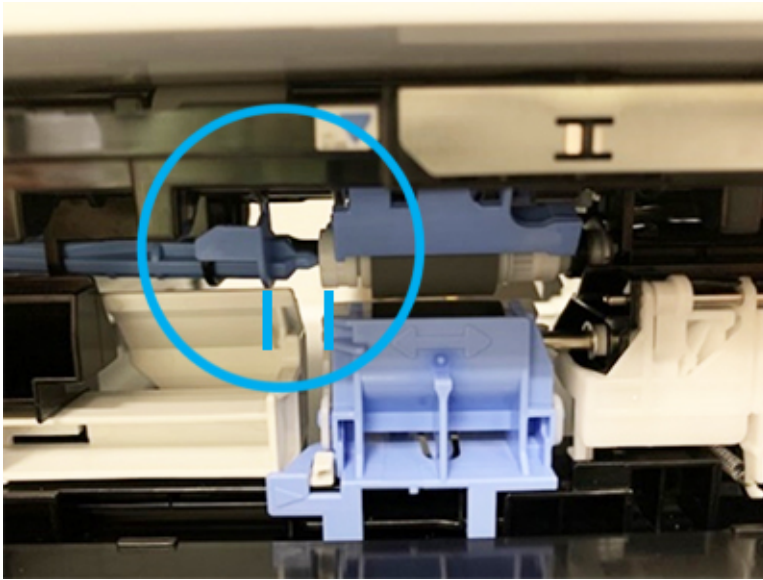


Figure 6-19 Separating roller not installed correct



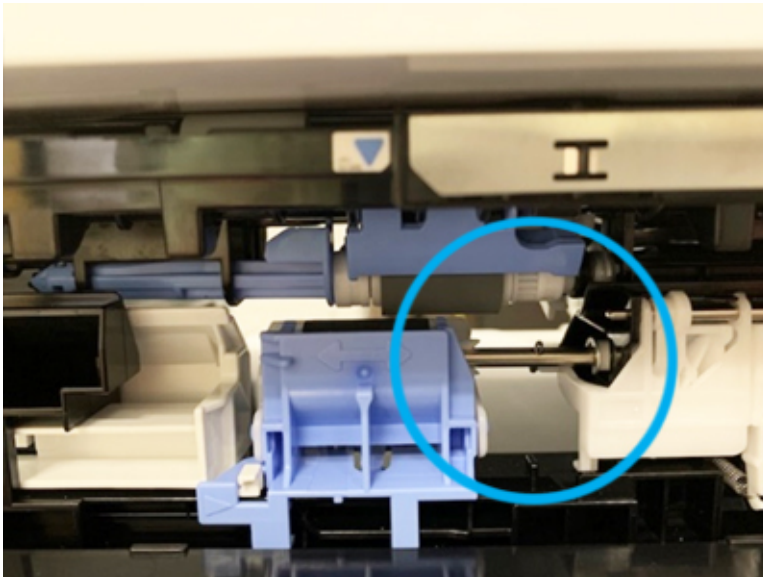


Figure 6-20 Separation roller not install and locked in correctly

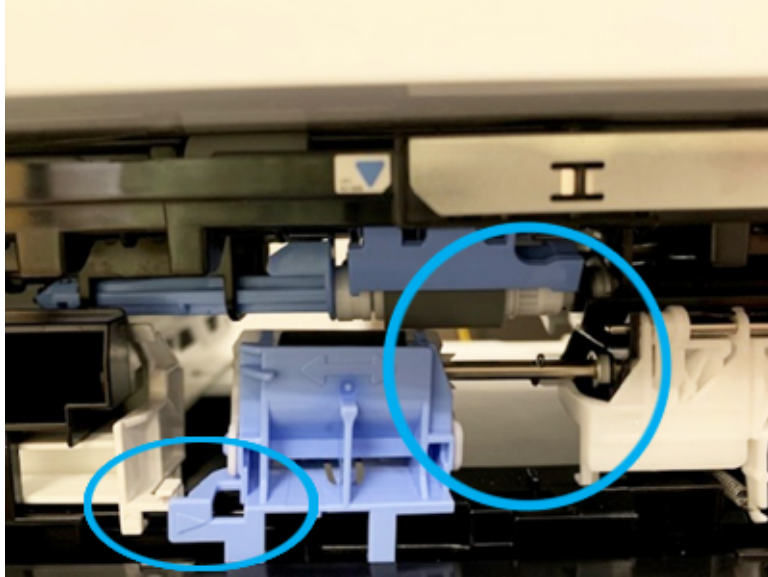

- b. If either roller is installed incorrectly, make sure to install it correctly as shown in the image below.

Figure 6-21 Rollers installed correctly

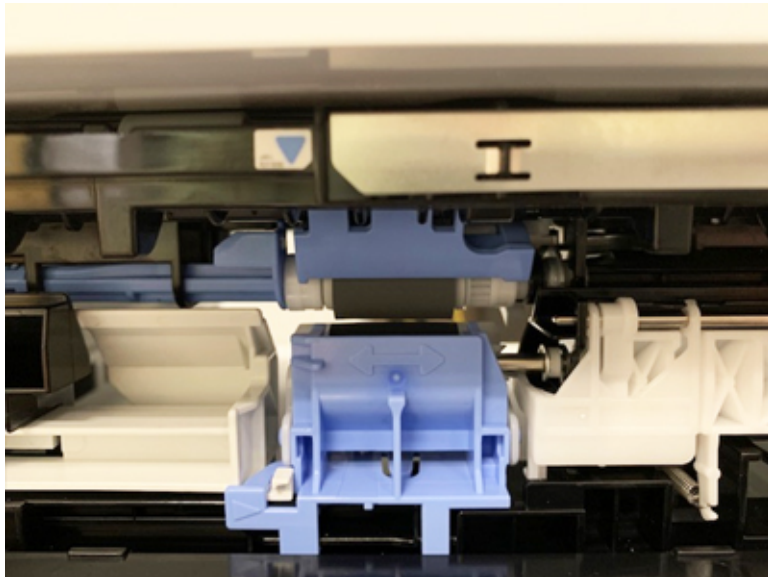

- c. If the rollers are dirty, clean the rollers.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

- d. If the error persists even after check the rollers, replace the rollers.

Tray 2-x roller assembly part number: J8J70-67906

For instructions: *Removal and replacement: Tray 2-x roller kit* See the Repair Service Manual for this product.


6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

550-sheet paper feeder: Recommended action for call-center agents

Use the following steps to resolve the error.

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the front and rear door.
 - c. Remove any paper present or obstructions in the paper path.
 - d. Close the front and rear door to allow the printer to attempt to clear the jam message.
2. If the issue persists, run a paper path test from all other paper trays to isolate the paper jam to Tray 3.
 - a. From the Home screen on the product control panel, select [Support Tools](#).
 - b. Open the following menus:
 - i. [Troubleshooting](#)
 - ii. [Diagnostic Tests](#)
 - iii. [Paper Path Test](#)
 - c. Enter the [Number of Copies](#) to be printed, select the [Paper Tray](#) source and other desired paper test options.
 - d. Select [OK](#) or [Start](#) to run the test.

Figure 6-22 Paper path test on the printer control panel

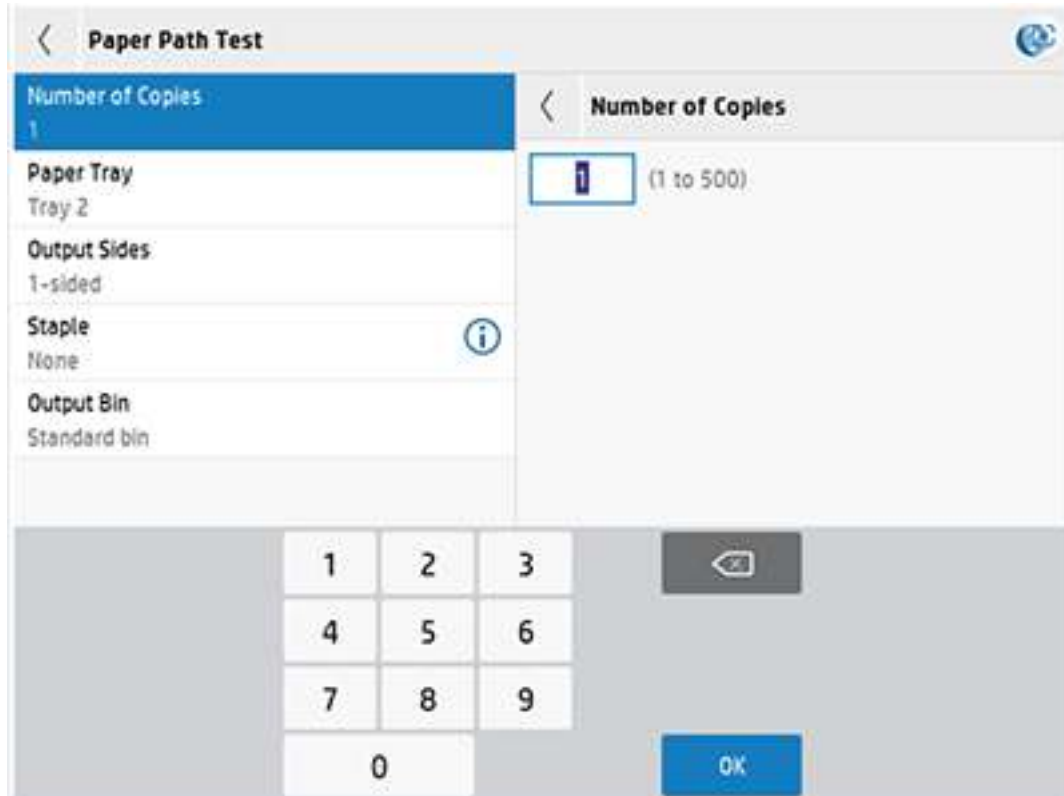

3. If the issue persists from Tray 3, ensure the type and quality of the paper being used meets the HP specifications for the printer.

 **NOTE:** For supported sizes and types, go to [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) (c05495788).

4. If the error persists, ensure the tray guides are adjusted correctly for the paper size and the tray is not over filled above the maximum fill mark or tabs.

Figure 6-23 Paper tray guides


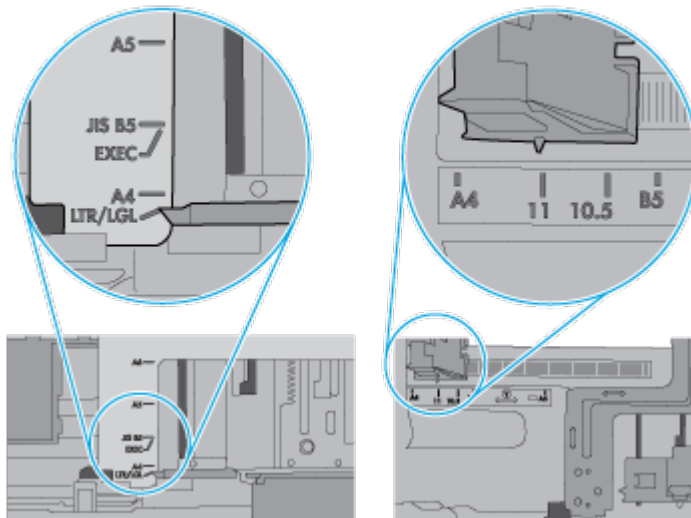


Figure 6-24 Paper height guides

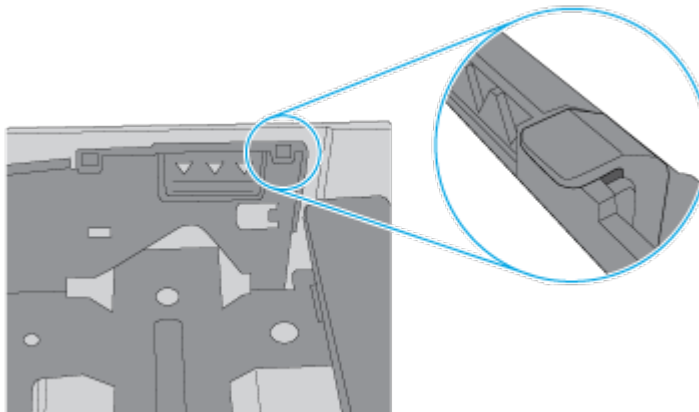

5. If the issue persists, ensure Tray 3 pickup, feed, and separation rollers are installed correctly and show no damage or wear.

- a. Check if the rollers are installed correctly.

Figure 6-25 Pick roller not locked in

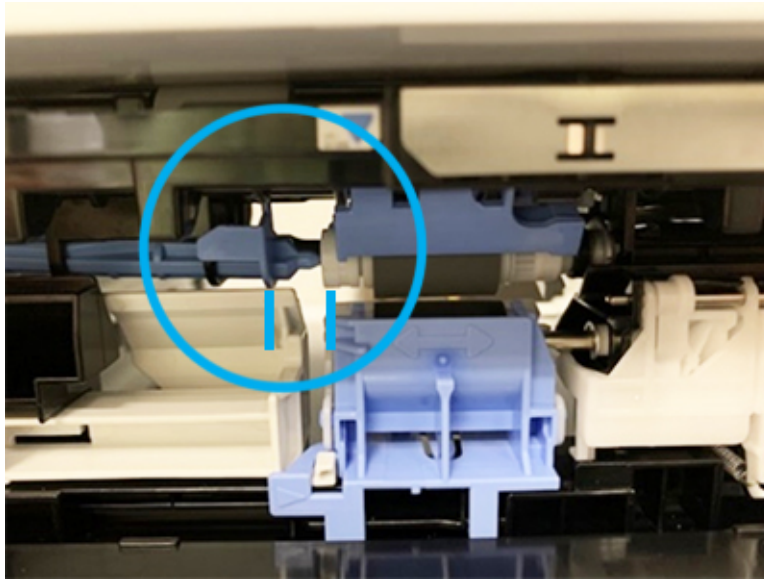


Figure 6-26 Separating roller not installed correct



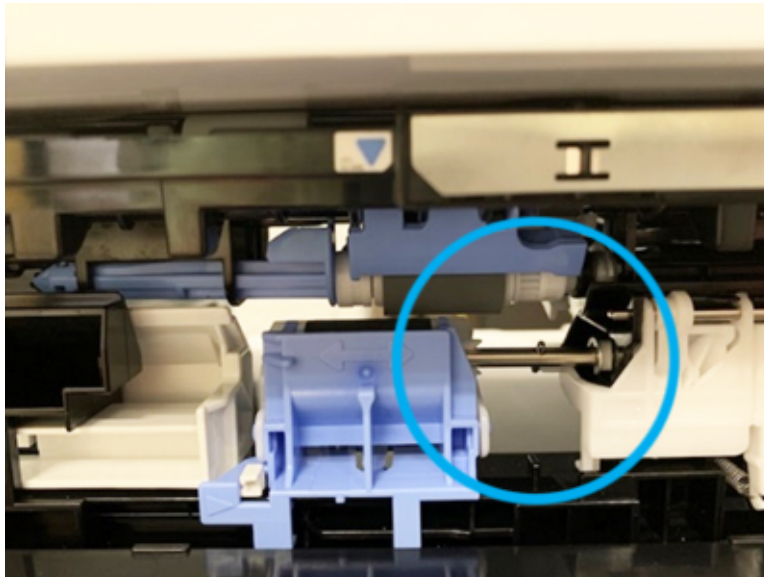


Figure 6-27 Separation roller not install and locked in correctly

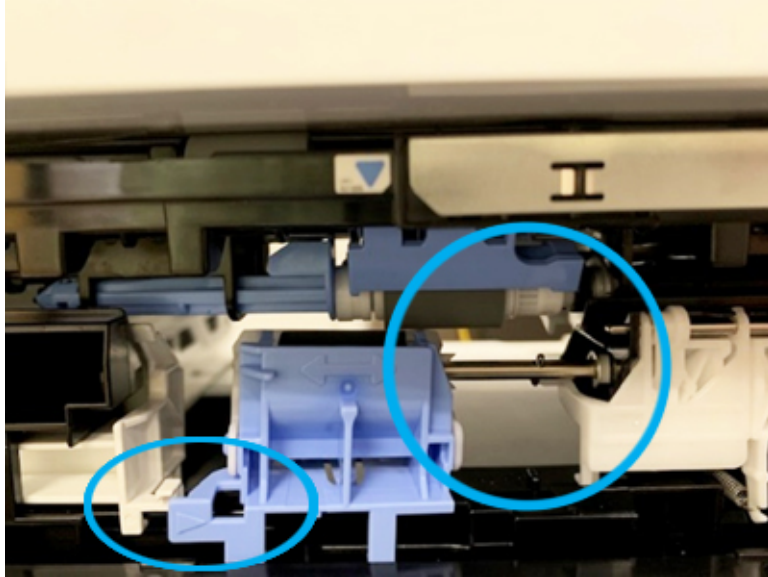

- b. If either roller is installed incorrectly, make sure to install it correctly. See the image below.

Figure 6-28 Rollers installed correctly

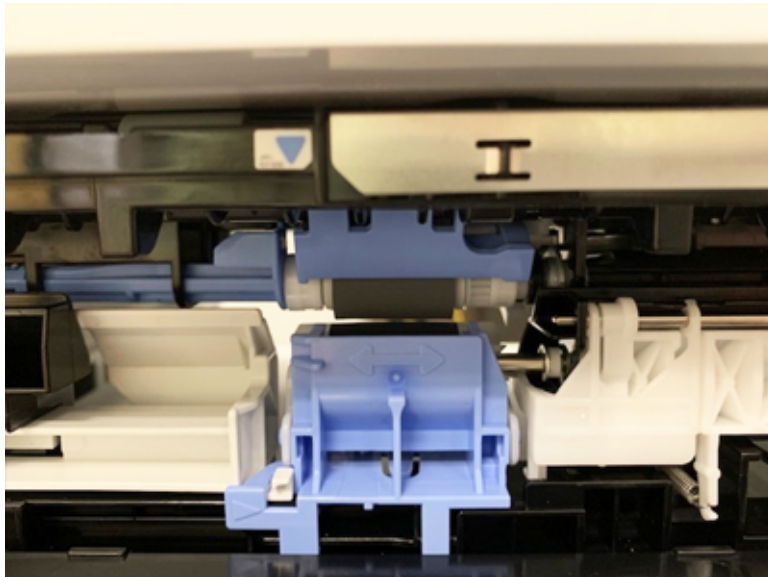

6. Clean or replace the pickup, feed, and separation rollers as needed.



NOTE: Clean the rollers with a dampened lint free cloth.

7. If the error still persists, replace the tray 3 roller kit.

Tray 2-x roller assembly part number: J8J70-67906

For instructions: *Removal and replacement: Tray 2-x roller kit* See the Repair Service Manual for this product.

2,100-sheet paper feeder: Recommended action for call-center agents

Use the following steps to resolve the error.

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the front and rear door.
 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the front and rear door to allow the printer to attempt to clear the jam message.
2. If the issue persists, run a paper path test from all other paper trays to isolate the paper jam to Tray 3.
 - a. From the Home screen on the product control panel, select [Support Tools](#).
 - b. Open the following menus:
 - i. [Troubleshooting](#)
 - ii. [Diagnostic Tests](#)
 - iii. [Paper Path Test](#)
 - c. Enter the [Number of Copies](#) to be printed, select the [Paper Tray](#) source and other desired paper test options.
 - d. Select [OK](#) or [Start](#) to run the test.

Figure 6-29 Paper path test on the printer control panel

The screenshot shows the 'Paper Path Test' menu on a printer control panel. The menu is divided into two main sections. The left section contains settings for the test: 'Number of Copies' (set to 1), 'Paper Tray' (set to Tray 2), 'Output Sides' (set to 1-sided), 'Staple' (set to None), and 'Output Bin' (set to Standard bin). The right section contains a 'Number of Copies' input field with a value of 1 and a range of (1 to 500). At the bottom of the screen is a numeric keypad with buttons for digits 0 through 9, a back arrow button, and an 'OK' button.

3. If the issue persists from Tray 3, ensure the type and quality of the paper being used meets the HP specifications for the printer.



NOTE: For supported sizes and types, go to [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) (c05495788).

4. If the error persists, ensure the tray guides are adjusted correctly for the paper size and the tray is not over filled above the maximum fill mark or tabs.


Figure 6-30 2100 sheet tray guide



Figure 6-31 2100 sheet tray fill mark



5. Open the optional paper feeder and push the green tab (jam access door) on the right side down to expose the pickup rollers. Clear any paper present or obstructions in the paper path. Grasp any jammed paper with both hands and pull it straight out to remove it out of the printer.

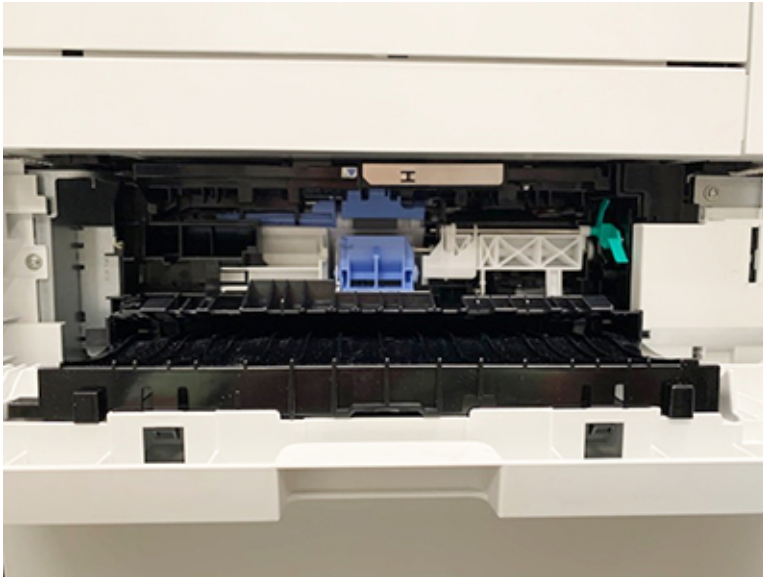

6. Ensure Tray 3 pickup, feed, and separation rollers are installed correctly and are not worn or damaged.
 - a. Check if the rollers are installed correctly.

Figure 6-32 Pick roller not locked in

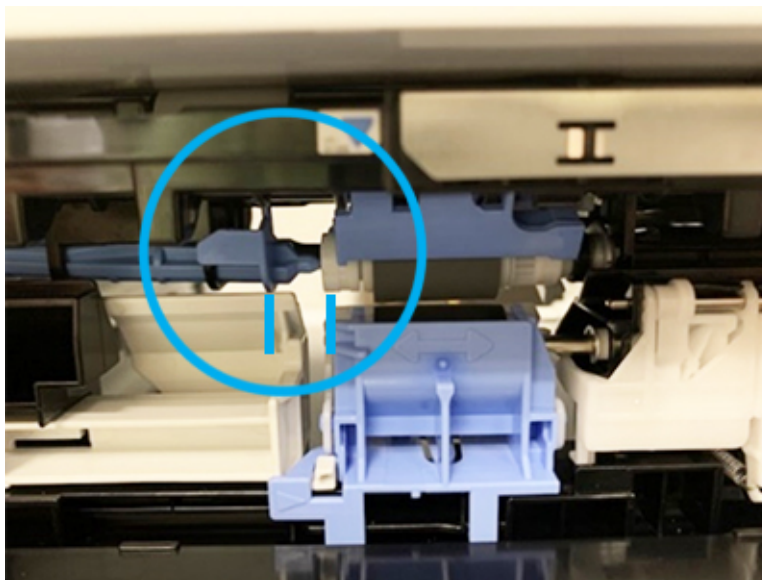


Figure 6-33 Separating roller not installed correct



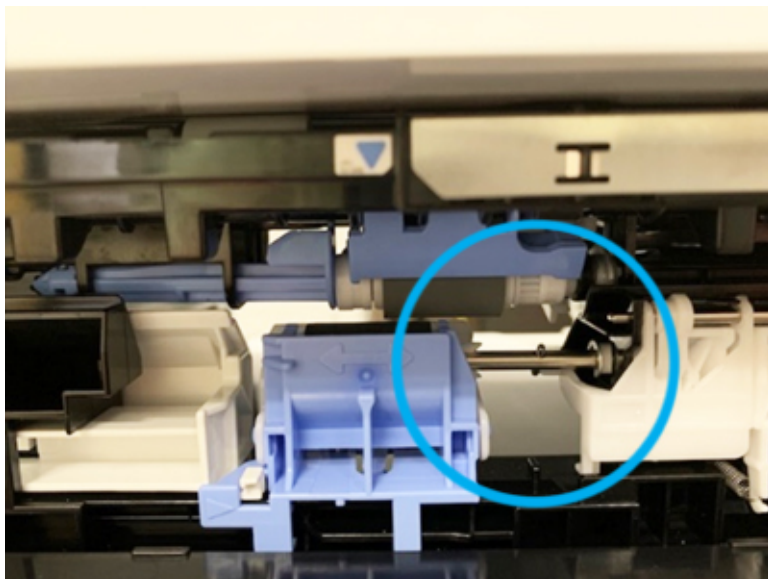


Figure 6-34 Separation roller not install and locked in correctly

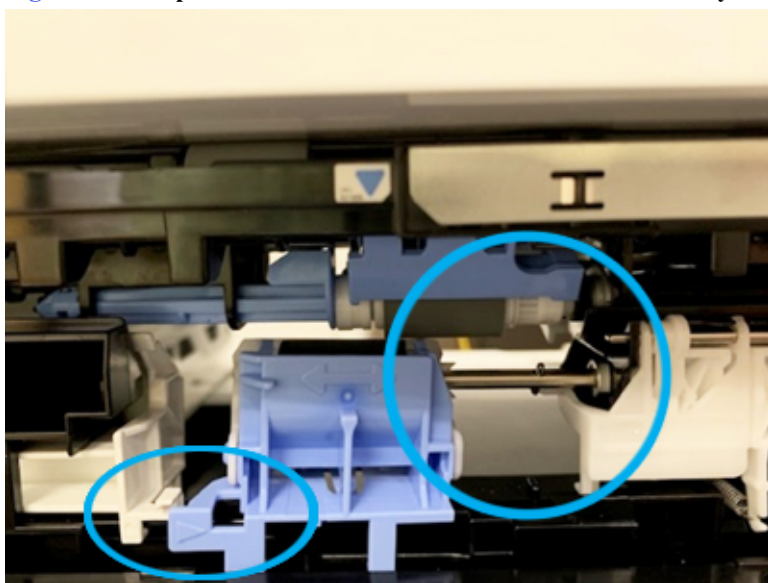

- b. If either roller is installed incorrectly, make sure to install it correctly. See the image below.

Figure 6-35 Rollers installed correctly

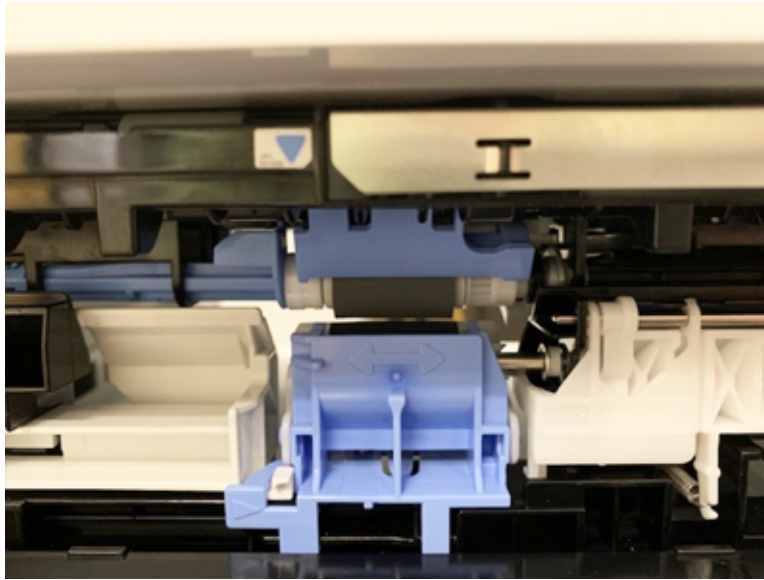

- c. If the rollers are dirty, clean the rollers.



NOTE: Clean the rollers with a dampened lint free cloth.

- d. If the error still persists, replace the Tray 2-x roller kit.

Tray 2-x roller assembly part number: J8J70-67906

For instructions: *Removal and replacement: Tray 2-x roller kit* See the Repair Service Manual for this product.


550-sheet paper feeder: Recommended action for onsite technicians

Use the following steps to resolve the error.

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the front and rear door.
 - c. Remove any paper present or obstructions in the paper path.
 - d. Close the front and rear door to allow the printer to attempt to clear the jam message.
2. If the issue persists, run a paper path test from all other paper trays to isolate the paper jam to Tray 3.
 - a. From the Home screen on the product control panel, select [Support Tools](#).
 - b. Open the following menus:
 - i. [Troubleshooting](#)
 - ii. [Diagnostic Tests](#)
 - iii. [Paper Path Test](#)

- c. Enter the [Number of Copies](#) to be printed, select the [Paper Tray](#) source and other desired paper test options.
- d. Select [OK](#) or [Start](#) to run the test.

Figure 6-36 Paper path test on the printer control panel

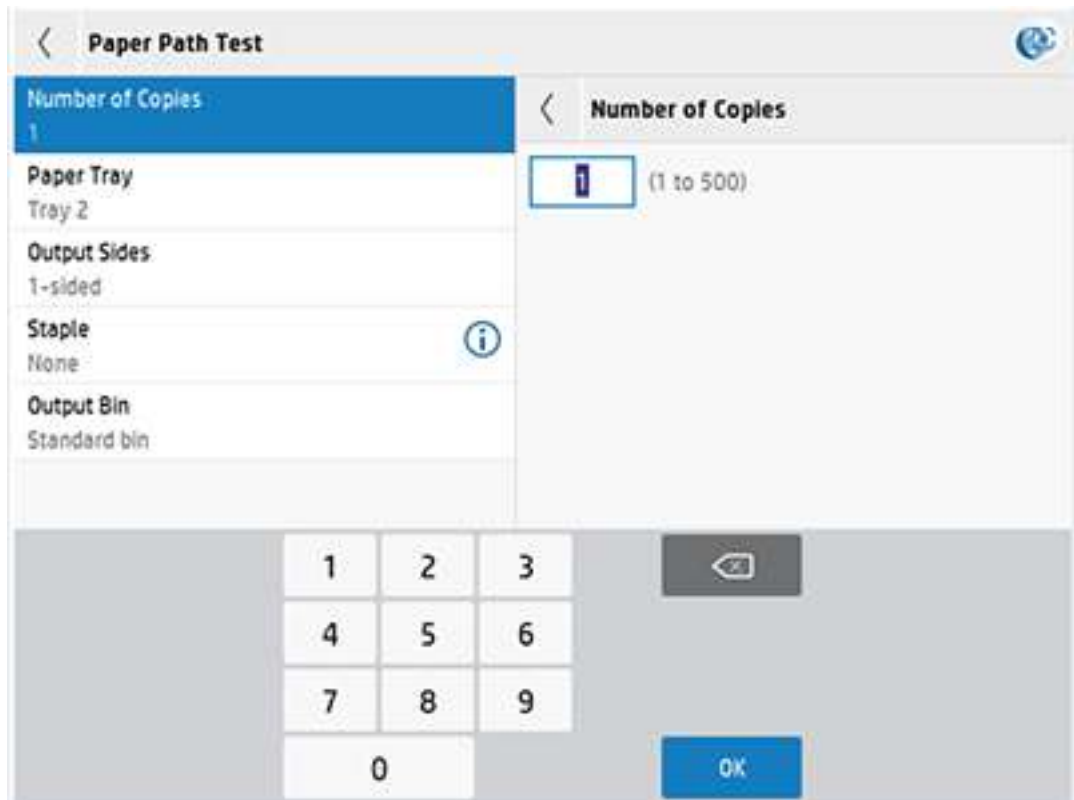

3. If the issue persists from Tray 3, ensure the type and quality of the paper being used meets the HP specifications for the printer.

 **NOTE:** For supported sizes and types, go to [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) (c05495788).

4. If the error persists, ensure the tray guides are adjusted correctly for the paper size and the tray is not over filled above the maximum fill mark or tabs on the tray.

Figure 6-37 Paper tray guides


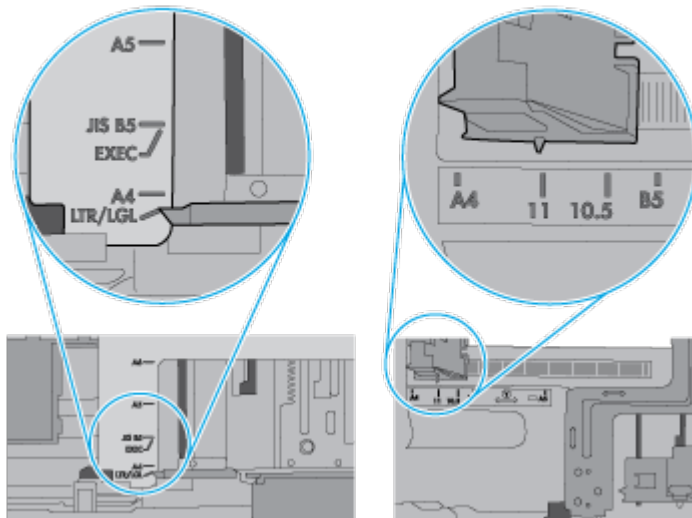


Figure 6-38 Paper height guides

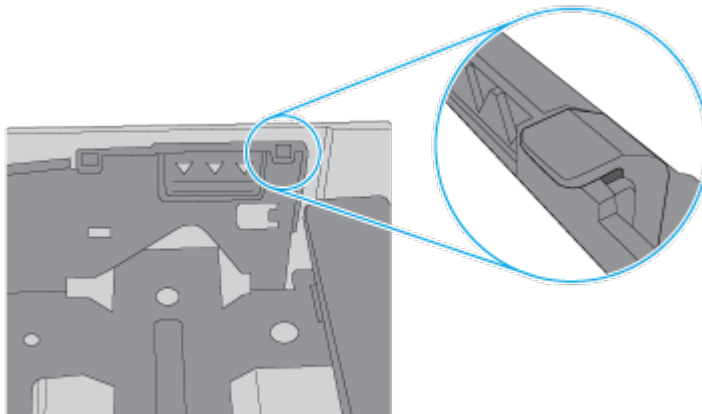

5. Ensure that the tray 3 pickup, feed, and separation rollers are installed correctly and are not worn or damaged.

- a. Check if the rollers are installed correctly.

Figure 6-39 Pick roller not locked in

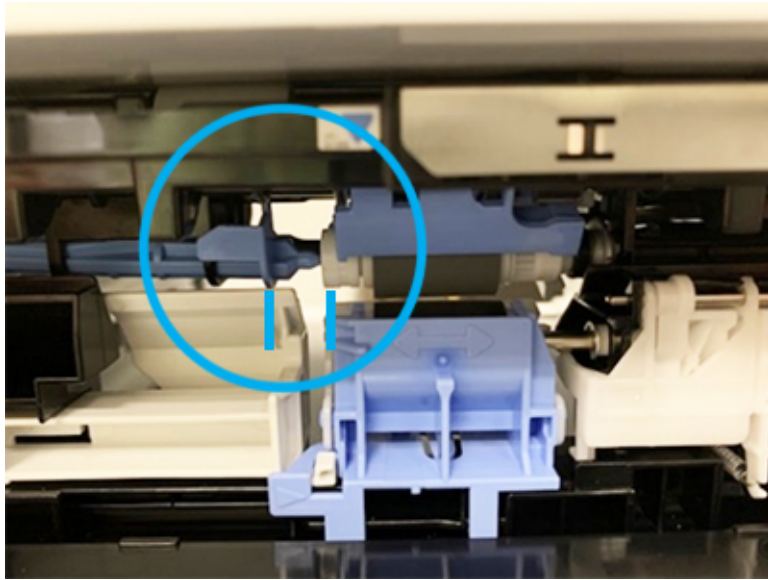


Figure 6-40 Separating roller not installed correct



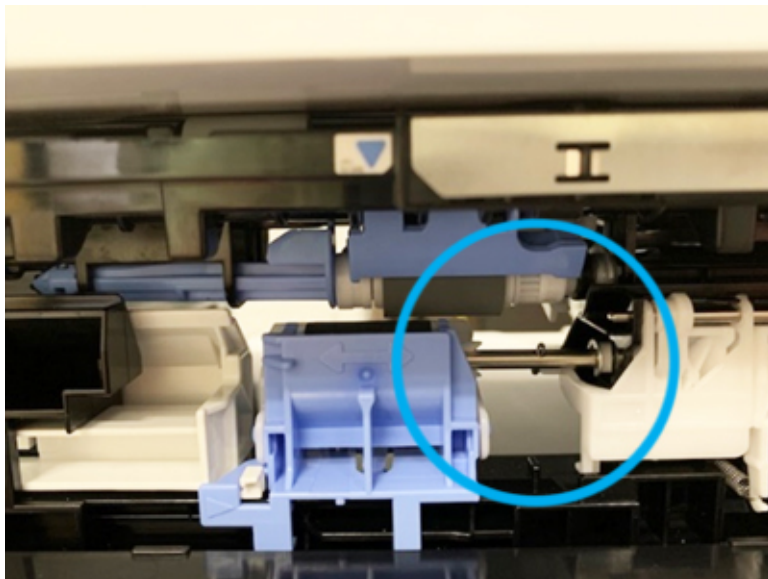


Figure 6-41 Separation roller not install and locked in correctly

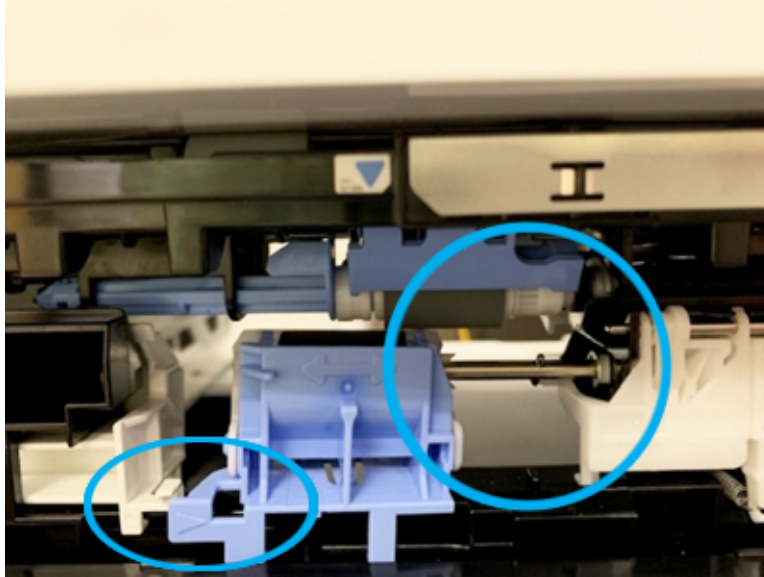

- b. If either roller is installed incorrectly, make sure to install it correctly as shown in the image below.

Figure 6-42 Rollers installed correctly

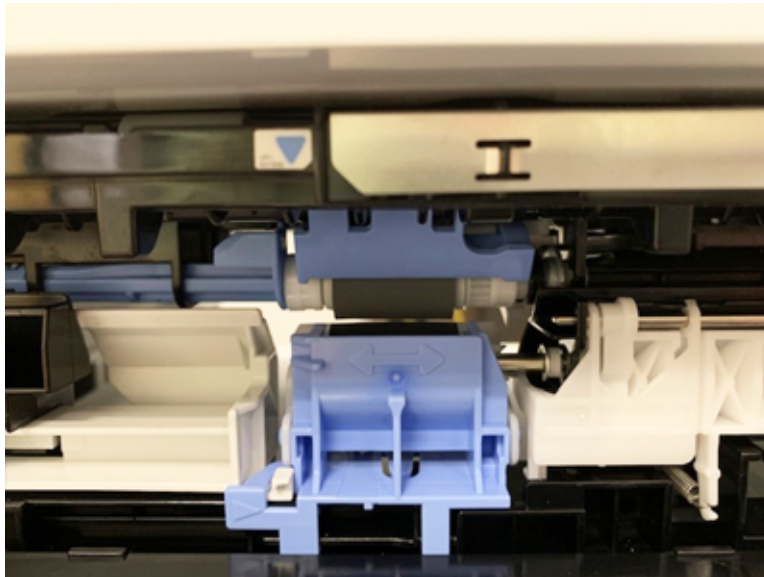

- 6. Clean or replace the pickup, feed, and separation rollers as needed.



NOTE: Clean the rollers with a dampened lint-free cloth.

- 7. If the error persists even after checking the rollers, replace the rollers.

Tray 2-x roller assembly part number: J8J70-67906

For instructions: *Removal and replacement: Tray 2-x roller kit* See the Repair Service Manual for this product.

- 8. If the issue persists, run a component test to check the functionality of Tray 3 pickup solenoid.

- a. From the home screen on the printer control panel, select [Support Tools](#).

b. Open the following menus:


- i. Troubleshooting
- ii. Diagnostic Tests
- iii. Components Test

c. Select [Start](#) to start the Tray 3 pickup solenoid test.

Check if you hear an audible click sound during the tray 3 pickup solenoid test.

- If you hear an audible "click" sound, the test passes as it activates the specified solenoid.
- If you do not hear an audible click sound, the test fails to activate the specified solenoid.

Figure 6-43 Component Test: Tray 3 pickup solenoid

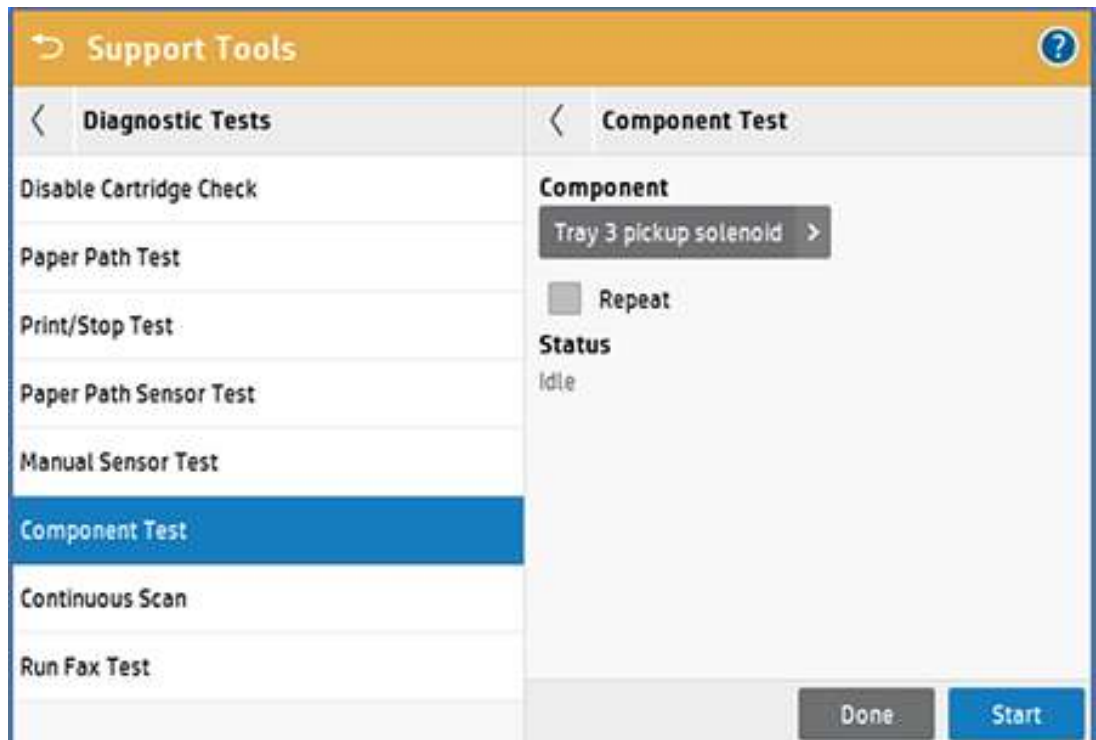

9. If the [Tray 3 pickup solenoid](#) component test fails, replace the Tray 3 paper pickup assembly.

Table 6-9 Tray 3 paper pickup assembly part number (Assy-550)

Description	Part number
Assy-550 optional Paper pickup	RM2-0878-020CN

For instructions: *Removal and replacement: 1X550 Paper pickup assembly* See the Repair Service Manual for this product.


10. If the error persists, elevate the issue using your country/region support process.

2,100-sheet paper feeder: Recommended action for onsite technicians

Use the following steps to resolve the error.

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the front and rear door.
 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the front and rear door to allow the printer to attempt to clear the jam message.
2. If the issue persists, run a paper path test from all other paper trays to isolate the paper jam to Tray 3.
 - a. From the Home screen on the product control panel, select [Support Tools](#).
 - b. Open the following menus:
 - i. [Troubleshooting](#)
 - ii. [Diagnostic Tests](#)
 - iii. [Paper Path Test](#)
 - c. Enter the [Number of Copies](#) to be printed, select the [Paper Tray](#) source and other desired paper test options.
 - d. Select [OK](#) or [Start](#) to run the test.

Figure 6-44 Paper path test on the printer control panel

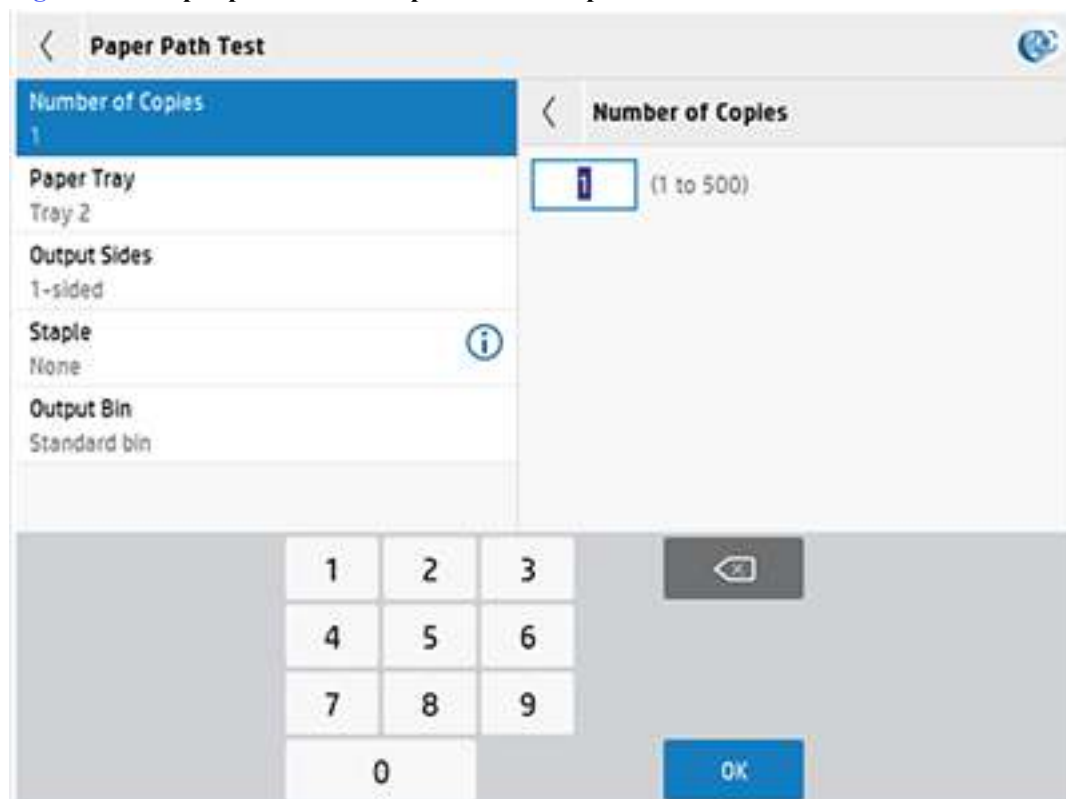

3. If the issue persists from Tray 3, ensure the type and quality of the paper being used meets the HP specifications for the printer.



NOTE: For supported sizes and types, go to [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) (c05495788).

4. If the error persists, ensure the tray guides are adjusted correctly for the paper size and the tray is not over filled above the maximum fill mark or tabs on the tray.

Figure 6-45 2100 sheet tray guide



Figure 6-46 2100 sheet tray fill mark



5. Open the optional paper feeder and push the green tab (jam access door) on the right side down to expose the pickup rollers. Clear any paper present or obstructions in the paper path. Grasp any jammed paper with both hands and pull it straight out to remove it out of the printer.



6. Ensure that the tray 3 pickup, feed, and separation rollers are installed correctly and are not worn or damaged.
 - a. Check if the rollers are installed correctly.

Figure 6-47 Pick roller not locked in

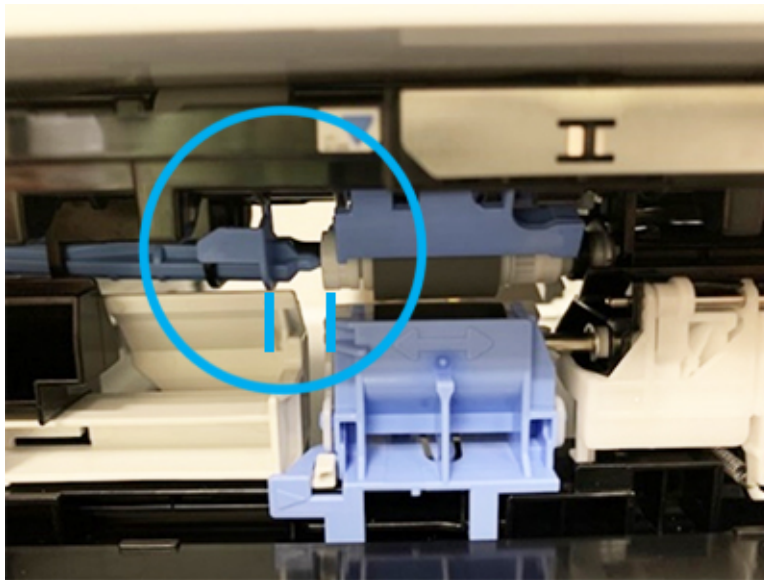


Figure 6-48 Separating roller not installed correct



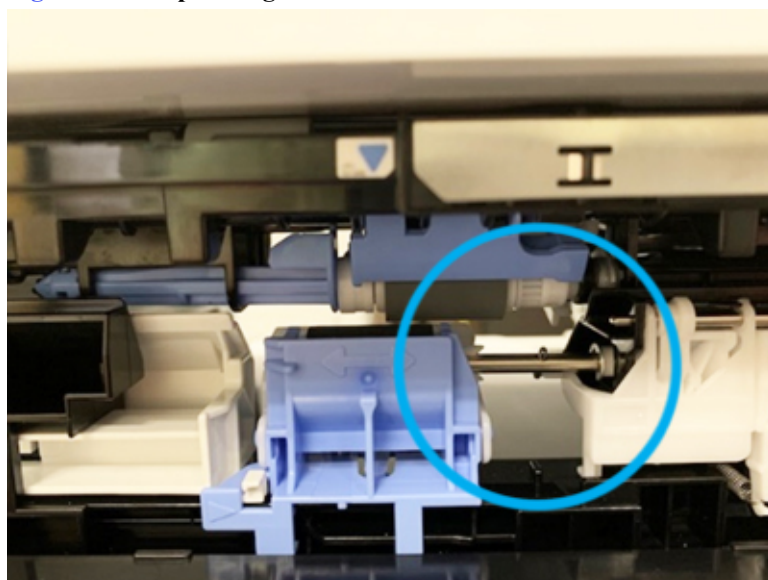


Figure 6-49 Separation roller not install and locked in correctly

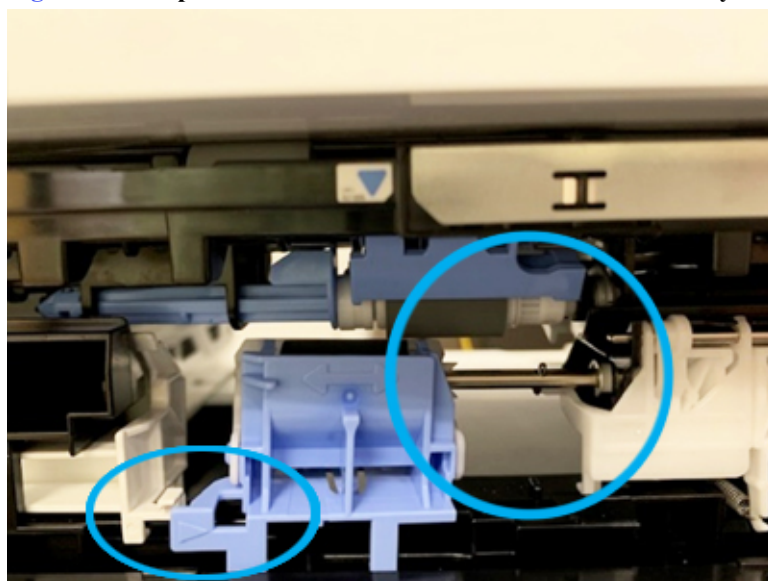

- b. If either roller is installed incorrectly, make sure to install it correctly as shown in the image below.

Figure 6-50 Rollers installed correctly

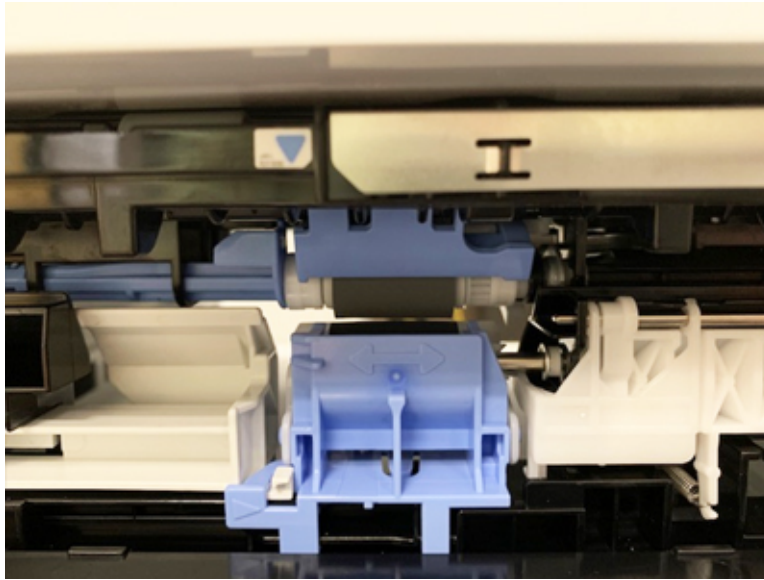

- c. If the rollers are dirty, clean the rollers.



NOTE: Clean the rollers with a dampened lint-free cloth.

- d. If the error persists even after check the rollers, replace the rollers.

Tray 2-x roller assembly part number: J8J70-67906

For instructions: *Removal and replacement: Tray 2-x roller kit* See the Repair Service Manual for this product.

- 7. If the issue persists, run a component test to check the functionality of Tray 3 pickup solenoid.

- a. From the home screen on the printer control panel, select [Support Tools](#).

- b. Open the following menus:

- i. [Troubleshooting](#)

- ii. [Diagnostic Tests](#)


- iii. [Components Test](#)

- c. Select [Start](#) to start the Tray 3 pickup solenoid test.

Check if you hear an audible click sound during the tray 3 pickup solenoid test.

- If you hear an audible "click" sound, the test passes as it activates the specified solenoid.
- If you do not hear an audible click sound, the test fails to activate the specified solenoid.

Figure 6-51 Component Test: Tray 3 pickup solenoid

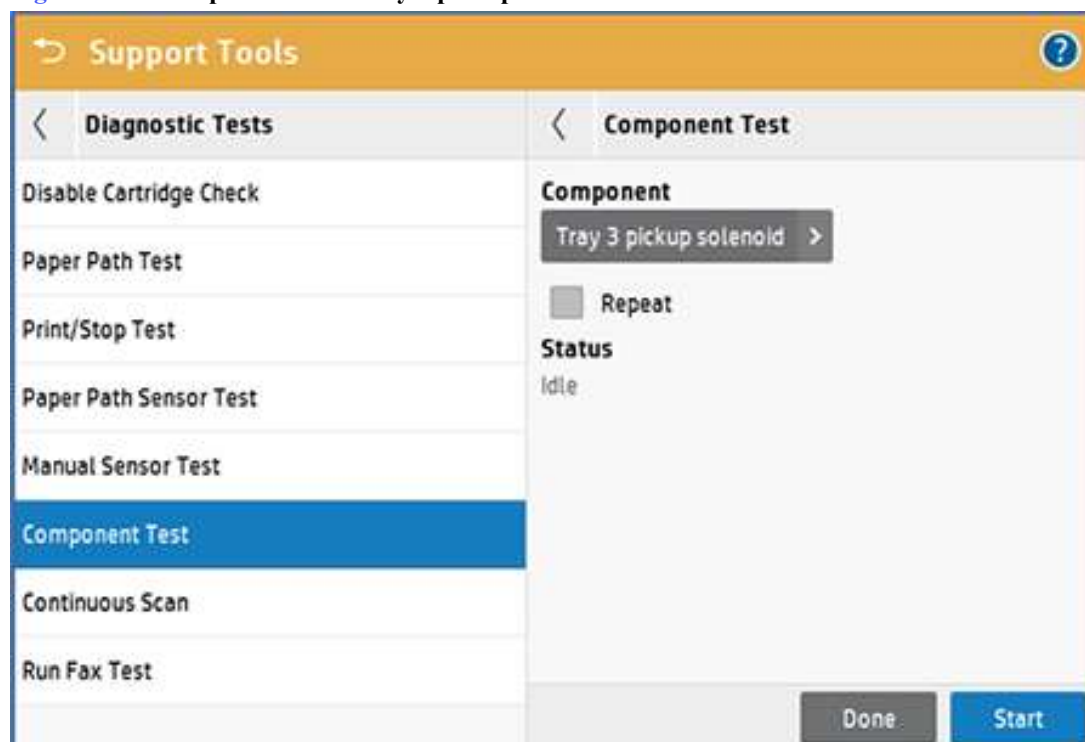

8. If the [Tray 3 pickup solenoid](#) component test fails, replace the Tray 3 paper pickup assembly.

Table 6-10 Tray 3 paper pickup assembly part number (Assy-2,100)

Description	Part number
Assy-2,100 Paper pickup	RM2-1169-010CN

For instructions: *Removal and replacement: 2100 Tray 3 pickup assembly* See the Repair Service Manual for this product.

9. If the error persists, elevate the issue using your country/region support process.

13.A3.Dz

Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray X.

The 550 sheet feeders can be stacked for 3 extra trays. These trays have the same sensors and connectors.

- **13.A3.D4** Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray 4.
- **13.A3.D5** Paper did not reach the Tray 3 feed sensor in the designated amount of time when printing from Tray 5.

550-sheet paper feeder: Recommended action for customers

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.

- b. Open the front and rear door.
 - c. Remove any paper present or obstructions in the paper path.
 - d. Close the front and rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-52 Paper tray guides


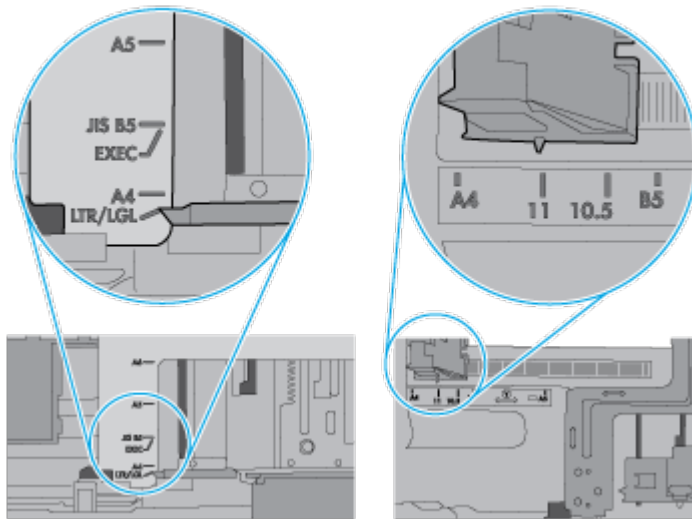


Figure 6-53 Paper height guides



4. Ensure that the tray 3 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.

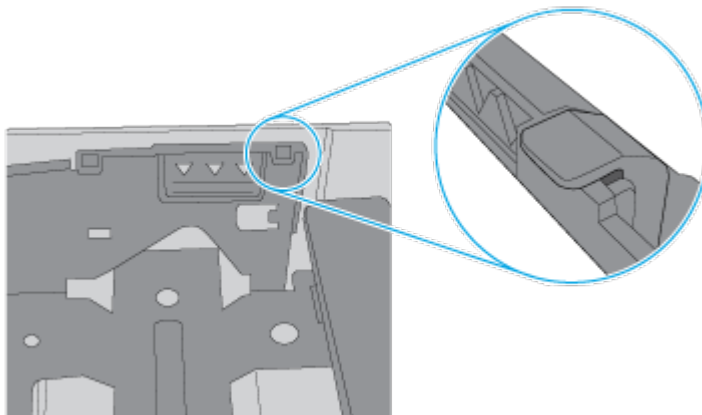

NOTE: Clean the rollers with a dampened lint free cloth or paper.

6. If the error persists, please contact customer support.

2,100-sheet paper feeder: Recommended action for customers

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the front and rear door.
 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the front and rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
4. Ensure that the tray 3 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

6. If the error persists, please contact customer support.

550-sheet paper feeder: Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the front and rear door.
 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the front and rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-54 Paper tray guides


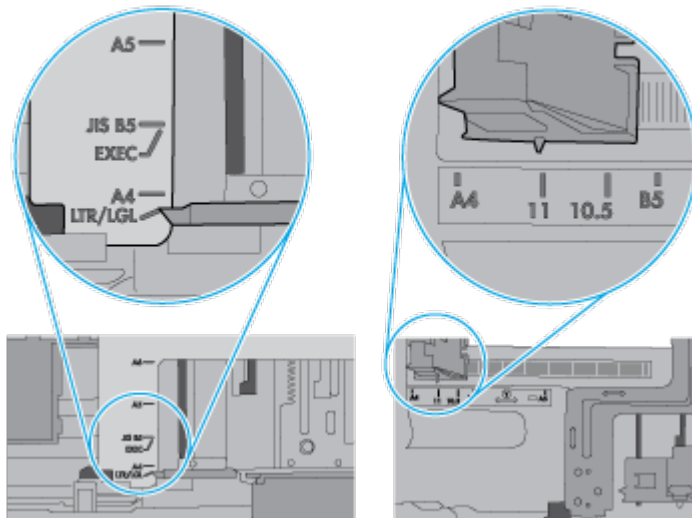


Figure 6-55 Paper height guides

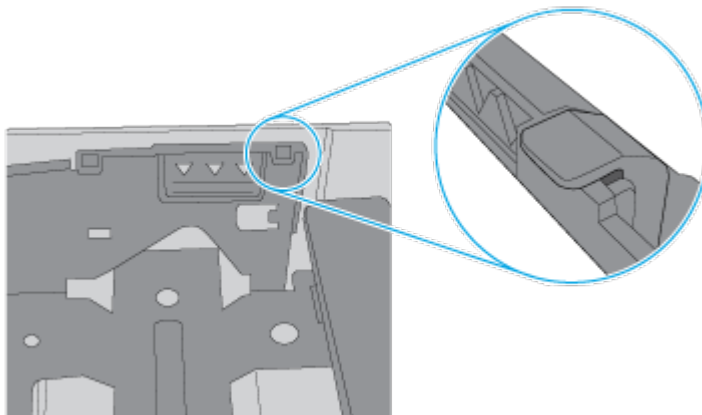

4. Ensure that the tray 3 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.


 **NOTE:** Clean the rollers with a dampened lint free cloth or paper.

Part number: J8J70-67906

For instructions: *Removal and replacement: Pickup and separation rollers* See the Repair Service Manual for this product.

6. Perform a print test from tray 2 to ensure the printer main motor and gear drive is functioning correctly.
7. Check the printer entrance from tray 3.

- a. Open the rear door and inspect the tray 3 input area for obstructions and clear paper path as needed.

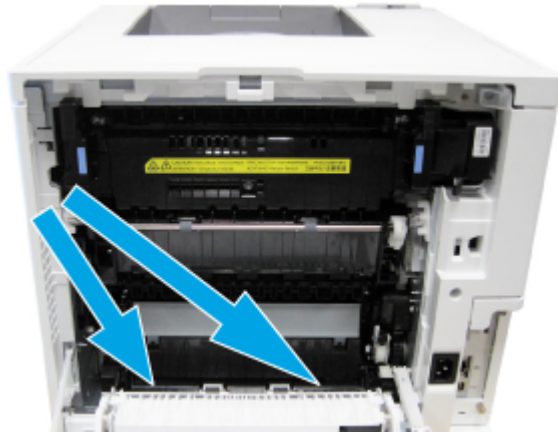

- b. Ensure the input feed rollers are clean and free of debris. Clean rollers as needed.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

8. Replace the tray 3 paper pickup assembly.

Part number: RM2-0878-000CN

For instructions: *Removal and replacement: 1X550 Paper pickup assembly* See the Repair Service Manual for this product.



NOTE: Before replacing parts, ensure all connections on the paper feeder controller for tray 3 are correctly and securely connected.

9. If the error persists, replace the tray 3 feeder drive assembly.

Part number: RM2-0875-000CN

For instructions: *Removal and replacement: 1X550 feeder drive assembly* See the Repair Service Manual for this product.



NOTE: Before replacing parts, ensure all connections on the paper feeder controller for tray 3 are correctly and securely connected.

10. If replacing the previous parts does not resolve the error, replace the 550 sheet feeder.

Part number: LOH18-67901

2,100-sheet paper feeder: Recommended action for call-center agents and onsite technicians


1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the front and rear door.
 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the front and rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

3. If the error persists, ensure that the tray width and length guides are set to the correct paper size for the paper being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
4. Ensure that the tray 3 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup, feed, and separation rollers as needed.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

6. Perform a print test from tray 2 to ensure the printer main motor and gear drive is functioning correctly.
7. Check the printer entrance from tray 3.
 - a. Open the rear door and inspect the tray 3 input area for obstructions and clear paper path as needed.

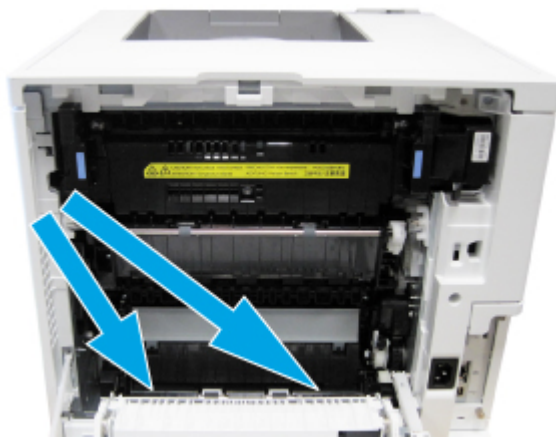

- b. Ensure the input feed rollers are clean and free of debris. Clean rollers as needed.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

8. Replace the tray 3 paper pickup assembly.

Part number: RM2-1169-000CN

For instructions: *Removal and replacement: 2100 Tray 3 pickup assembly* See the Repair Service Manual for this product.

Before replacing parts, ensure all connections on the paper feeder controller for tray 3 are correctly and securely connected.

9. If the error persists, replace the tray 3 feeder drive assembly.

Part number: RM2-0875-000CN

For instructions: *Removal and replacement: 2100 Tray 3 drive assembly* See the Repair Service Manual for this product.



NOTE: Before replacing parts, ensure all connections on the paper feeder controller for tray 3 are correctly and securely connected.

13.A3.FF

Residual paper jam in Tray X.

This jam occurs when residual paper is detected at the tray X feed sensor.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the front and rear door.
 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the front and rear door to allow the printer to attempt to clear the jam message.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Open tray 3 and remove any jammed paper, and then close the tray.
2. Ensure that the tray 3 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
3. Clean or replace the pickup, feed, and separation rollers as needed.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

Part number: J8J70-67906

For instructions: *Removal and replacement: Pickup and separation rollers* See the Repair Service Manual for this product.

4. Replace the tray 3 paper pickup assembly.

Part number: RM2-1169-000CN

For instructions: *Removal and replacement: 2100 Tray 3 pickup assembly* See the Repair Service Manual for this product.

5. If the issue persists, elevate the case using the Standard Support Process.

13.A4.Dz

Paper delay jam in Tray 4.

The 550 sheet feeders can be stacked for 3 extra trays. These trays have the same sensors and connectors.

13.A4.D4 Paper did not reach the Tray 4 feed sensor in the designated amount of time when printing from Tray 4.

13.A4.D5 Paper did not reach the Tray 4 feed sensor in the designated amount of time when printing from Tray 5.

Recommended action for customers

Use the following steps to resolve the error.

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the front door and lower right door.
 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the front door and lower right door to allow the printer to attempt to clear the jam message.
2. Close the front door and lower right door to allow the printer to attempt to clear the jam message.
3. Ensure the type and quality of the paper being used meets the HP specifications for the printer.



NOTE: For supported sizes and types, go to [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) (c05495788).

4. If the error persists, ensure that the tray guides are adjusted correctly to the paper size and that the tray is not over filled above the maximum fill mark or the tab on the tray.

Figure 6-56 Paper tray guides


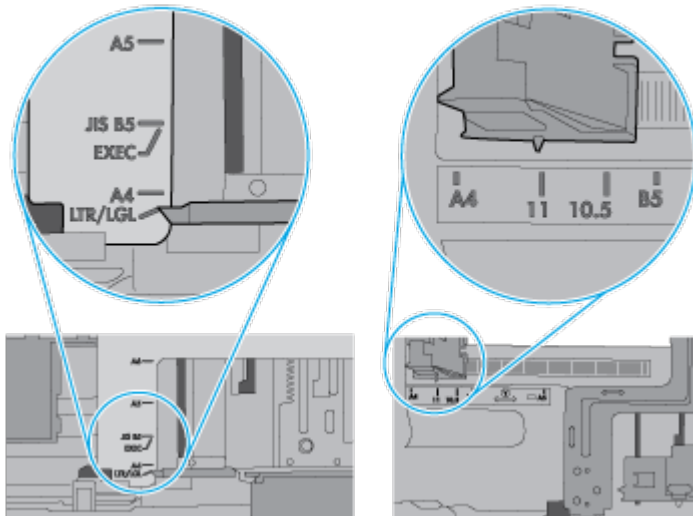


Figure 6-57 Paper height guides

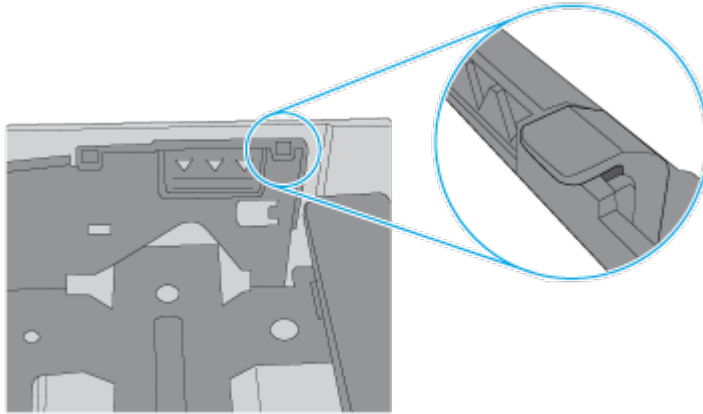

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Use the following steps to resolve the error.

1. Clear the paper jam.
 - a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the front door and lower right door.
 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the front door and lower right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.



NOTE: For supported sizes and types, go to [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) (c05495788).

3. If the error persists, ensure the tray guides are adjusted correctly to the paper size and the tray is not over filled above the maximum fill mark or the tab on the tray.

Figure 6-58 Paper tray guides


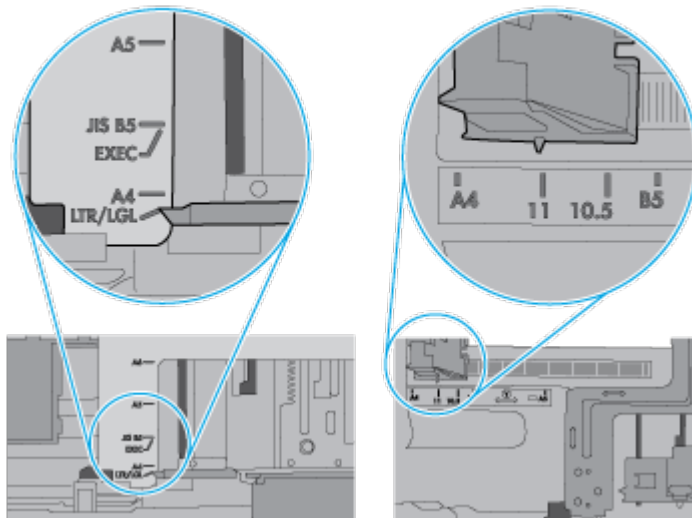


Figure 6-59 Paper height guides

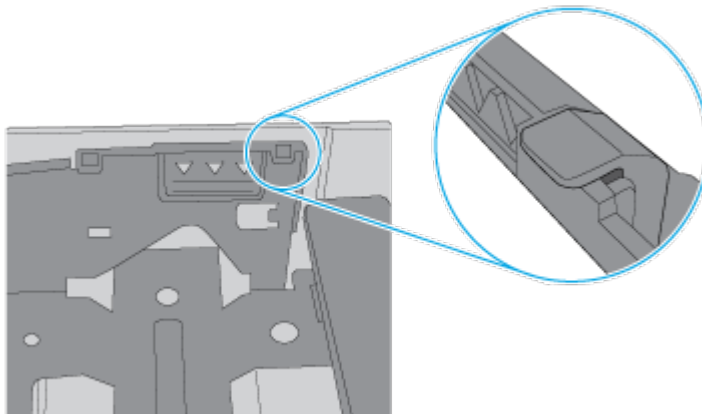

4. Ensure that the tray pickup, feed, and separation rollers are installed correctly and are not worn or damaged.
5. If the issue persists, clean the pickup, feed, and separation rollers with a dampened lint-free cloth.
6. If the issue persists, replace the Tray 2-x roller kit.

Part number: J8J70-67906

For instructions: *Removal and replacement: Pickup and separation rollers* See the Repair Service Manual for this product.

Recommended action for service technicians

Use the following steps to resolve the error.

1. Clear the paper jam.

- a. Open the tray and remove any jammed paper, and then close the tray.
 - b. Open the front door and lower right door.
 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Close the front door and lower right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

 **NOTE:** For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

3. If the error persists, ensure the tray guides are adjusted correctly to the paper size and the tray is not over filled above the maximum fill mark or the tab on the tray.

Figure 6-60 Paper tray guides


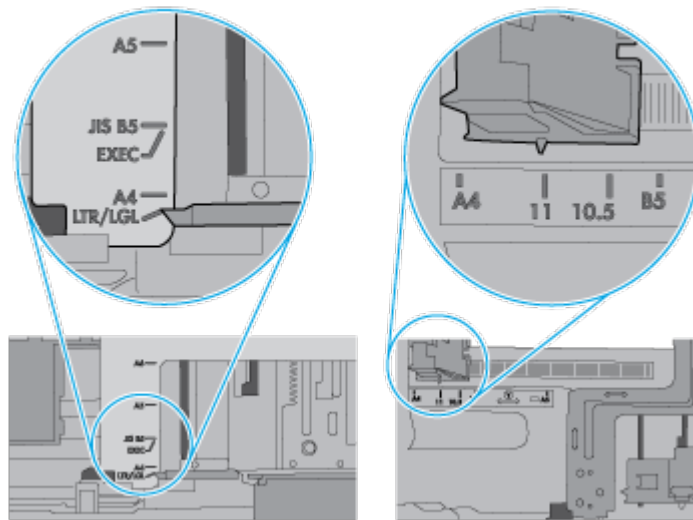


Figure 6-61 Paper height guides

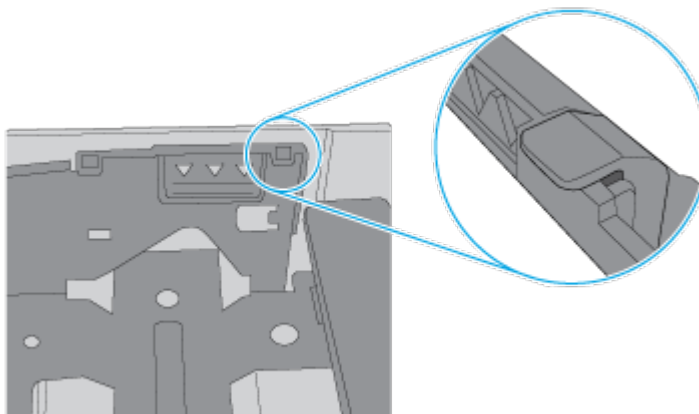

4. Ensure that the tray pickup, feed, and separation rollers are installed correctly and are not damaged or worn.

5. If the issue persists, clean the pickup, feed, and separation rollers with a dampened lint-free cloth.
6. If the issue persists, replace the Tray 2-x roller kit.

Part number: J8J70-67906

For instructions: *Removal and replacement: Pickup and separation rollers* See the Repair Service Manual for this product.

7. If the printer has multiple 550 sheet feeders, rearrange their positions and then test again.
8. If the issue persists and follows a specific 550-sheet feeder, disconnect and reconnect the connectors at the sensor (J2042 and J2046), feed motor (J2507), and on the paper feeder controller PCA (J5503, J5525) for tray 3.

9. If the issue persists, replace the paper pickup assembly for tray 4.

Part number: RM2-0878-020CN

For instructions: *Removal and replacement: 1X550 Paper pickup assembly* See the Repair Service Manual for this product.

10. If the issue persists, elevate the issue using your country/region support process.

13 . AA . EE Front Door Open

The front door was opened during printing.

Recommended action for customers


- Close the front door to allow the printer to attempt to clear the jam.

Recommended action for call-center agents and onsite technicians

1. Close the front door to allow the printer to attempt to clear the jam.
2. Check the projection part on the front door that defeats the front door interlocks. If broken replace the front door assembly.

Part number: RM2-4277-000CN

For instructions: *Removal and replacement: Front door assembly* See the Repair Service Manual for this product.

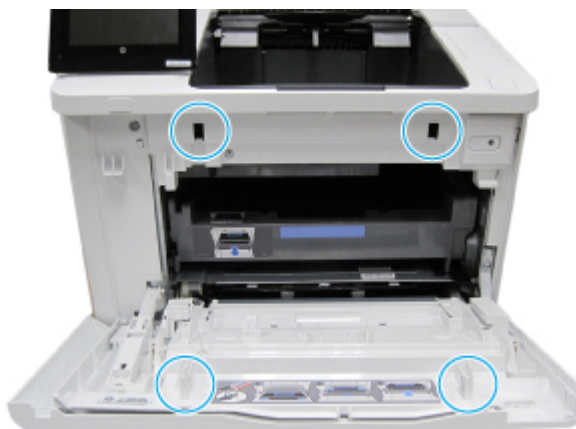


3. Check SW1 using manual sensor test.
 - a. From the home screen on the printer control panel, touch “Support Tools”.
 - b. Open the following menus:
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - c. Select from the following tests:
 - All Sensors , Engine Sensors
 - Done (return to the Troubleshooting menu)
 - Reset (reset the selected sensor’s state)
 - d. Test SW2 using folded paper or another object to defect the interlock. If the switch test fails, replace the laser shutter assembly.

Part number: RM2-6755-000CN



NOTE: Before replacing any parts check connector J308 on the DC controller.

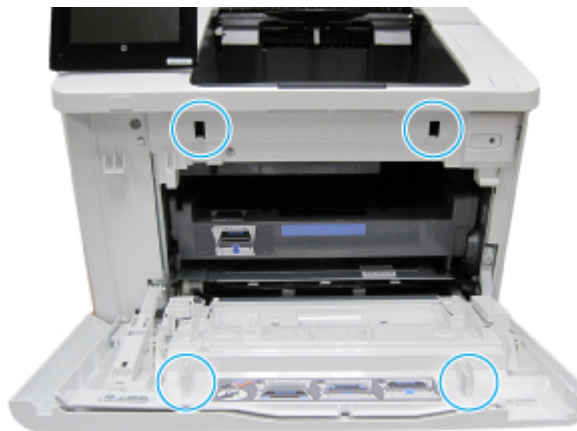

13 .AB .EE Rear Door Open

The rear door was opened during printing.

Recommended action for customers

- Close the rear door to allow the printer to attempt to clear the jam.

Recommended action for call-center agents and onsite technicians

1. Close the rear door to allow the printer to attempt to clear the jam.
2. Check the projection part on the rear door that defeats the rear door interlocks. If broken replace the rear door assembly.

Rear door part number: RM2-6746-000CN

For instructions: *Removal and replacement: Rear door assembly* See the Repair Service Manual for this product.

Rear door (LCD Simplex) part number: RM2-1249-000CN

For instructions: *Removal and replacement: Rear door assembly* See the Repair Service Manual for this product.



3. Check SW1 using manual sensor test.

- a. From the home screen on the printer control panel, touch “[Support Tools](#)”.
- b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
- c. Select from the following tests:
 - [All Sensors](#) , [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#) (reset the selected sensor’s state)
- d. Test SW1 using folded paper or another object to defect the interlock. If the switch test fails, replace the laser shutter assembly.

Part number: RM2-6755-000CN



NOTE: Before replacing any parts check connector J321 on the DC controller.



13.B2.Az Jam in rear door

Paper stay jam in the rear door at the image area.

Paper present at registration sensor (PS4550) after a specified time limit has passed.

- **13.B2.A1**

This jam occurs when the registration sensor (PS4550) detects paper present longer than the expected time based on the paper size when printing from Tray 1.

- **13.B2.A2**

This jam occurs when the registration sensor (PS4550) detects paper present longer than the expected time based on the paper size when printing from Tray 2.

- **13.B2.A3**

This jam occurs when the registration sensor (PS4550) detects paper present longer than the expected time based on the paper size when printing from Tray 3.

- **13.B2.AD**

This jam occurs when the registration sensor (PS4550) detects paper present longer than the expected time based on the paper size when printing from the duplexer.

If using adhesive or self-sealing media, please see the instructions in *A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper* (ish_3199741-3199797-16).

Recommended action for customers

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present behind the primary transfer assembly, and behind the lower jam access cover.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper behind the primary transfer assembly, and behind the lower jam access cover.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.



NOTE: For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

3. Toggle the registration sensor (PS4550) to ensure that it moves freely.
4. Test the registration sensor (PS4550) using the paper path sensor test.
 - a. From the home screen on the printer control panel, touch [Support Tools](#).
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Paper Path Sensor Test](#)
 - c. Test the registration sensor by rotating the registration assembly and verifying that the count increases on the registration sensor. If the sensor does not function, replace the registration assembly.



NOTE: Before replacing any parts check connector J15 on the DC controller.

Part number: RM2-4218-000CN

For instructions: *Removal and replacement: Registration assembly* See the Repair Service Manual for this product.

5. If the sensors are functioning, run a few pages to check where the leading edge of the paper stops.
6. Check the paper feed guide assembly for broken parts or damage. Replace the lower feed guide assembly as needed.

Paper feed guide lower assembly part number: RM2-6748-000CN

7. If the issue persists, elevate the case using the Standard Support Process.

13.B2.D1 Jam in rear door

Paper delay jam in the rear door at the image area.

Paper passed Tray 1 feed sensor PS4750 but did not reach registration sensor (PS4550) in specified time when printing from Tray 1.

Watch [HP LaserJet Enterprise M607, M608, M609 - 13.B2, 13.B9 rear door and fuser area paper jam](#) for more troubleshooting steps.

If using adhesive or self-sealing media, please see the instructions in A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper. (ish_3199741-3199797-16).

Recommended action for customers

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper behind the primary transfer assembly, and behind the lower jam access cover.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

 **NOTE:** For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

3. Ensure that the Tray 1 pickup and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup, feed, and separation rollers as needed.

 **NOTE:** Clean the rollers with a dampened lint free cloth or paper.

5. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper behind the primary transfer assembly, and behind the lower jam access cover.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.

 **NOTE:** For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

3. Ensure that the Tray 1 pickup and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup, feed, and separation rollers as needed.

 **NOTE:** Clean the rollers with a dampened lint free cloth or paper.

5. Toggle the registration sensor (PS4550) to ensure that it moves freely.
6. Test the registration sensor (PS4550) using the paper path sensor test.
 - a. From the home screen on the printer control panel, touch [Support Tools](#).

- b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Paper Path Sensor Test](#)
- c. Test the registration sensor by rotating the registration assembly and verifying that the count increases on the registration sensor. If the sensor does not function, replace the registration assembly.



NOTE: Before replacing any parts check connector J15 on the DC controller.

Part number: RM2-4218-000CN

For instructions: *Removal and replacement: Registration assembly* See the Repair Service Manual for this product.

7. If the sensors are functioning, run a few pages to check where the leading edge of the paper stops.
8. Check the paper feed guide assembly for broken parts or damage. Replace the lower feed guide assembly as needed.

Paper feed guide lower assembly part number: RM2-6748-000CN

9. Enter the component test menu to run diagnostics on the printer.
 - a. From the home screen on the printer control panel, touch [Support Tools](#).
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Components Test](#)

10. Test Tray 1 feed clutch CL1.

- a. From the [Components Test](#), touch [Tray 1 feed clutch](#).

Instruct the customer to listen for a click noise around the formatter cover, indicating that the clutch is firing. If the customer has difficulty hearing it, check Repeat, and test again.

- b. If the clutch does not function correctly, ensure connector J202 on the DC controller PCA is securely and correctly seated.
- c. If the solenoid continues to fail, replace the clutch.

part number: RM2-9456-000CN

11. If the issue persists, elevate the case using the Standard Support Process.

13.B2.D2 Jam in rear door

Paper delay jam at the image area.

Paper did not reach the registration sensor (PS4550) in specified time when printing from Tray 2.

For a public document with video, go to: [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Clear a "13.B2.D2 Jam in rear door" or "Tray 2 Overfill or Roller Issue" error message](#)

Watch [HP LaserJet Enterprise M607, M608, M609 - 13.B2, 13.B9 rear door and fuser area paper jam](#) for more troubleshooting steps.

If using adhesive or self-sealing media, please see the instructions in *A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.* (ish_3199741-3199797-16).

Recommended action for customers

1. Pull Tray 2 completely out of the printer to remove it.
2. Ensure that the protective orange plastic shipping locks are removed, if present.
3. Remove any jammed or damaged sheets of paper from the tray.
4. Check for any paper jam inside the printer .

Grasp the jammed paper with both hands and pull it straight out to remove it out of the printer.

5. Ensure that the paper type and quality used meets the HP specifications for the printer.



NOTE: For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

6. Watch the 3 minute video and follow the steps:

[How to Troubleshoot Paper Jam Errors | HP LaserJet Enterprise M607-M612, Managed E600xx-E601xx | HP](#)

7. If the error persists after following the video steps, replace the tray feed and separation rollers.

- Part number: J8J70-67906
- Part description: Tray 2 roller assembly
- For instructions, go to [Removal and replacement: Trays 2-x rollers](#)

8. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Pull Tray 2 completely out of the printer to remove it.
2. Ensure that the protective orange plastic shipping locks are removed, if present.
3. Remove any jammed or damaged sheets of paper from the tray.
4. Check for any paper jam inside the printer.

Grasp the jammed paper with both hands and pull it straight out to remove it out of the printer.

5. Ensure that the paper type and quality used meets the HP specifications for the printer.



NOTE: For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

6. Have the customer check the event log from the printer for any current instances of 53.B0.0z. If these event codes are present, they indicate that the feed and separation rollers for the tray are near the end of life and need to be replaced.

If 53.B0.0z events are present, replace the feed and separation rollers for the tray.




NOTE: z = A variable number or letter between 0-1 or A-F

Tray 2 roller assembly part number: J8J70-67906

For instructions: *Removal and replacement: Tray 2 tray rollers* See the Repair Service Manual for this product.

7. Ensure that the tray width and length guides are set to the correct paper size for the paper installed into the tray.

Figure 6-62 Tray 2 paper guides

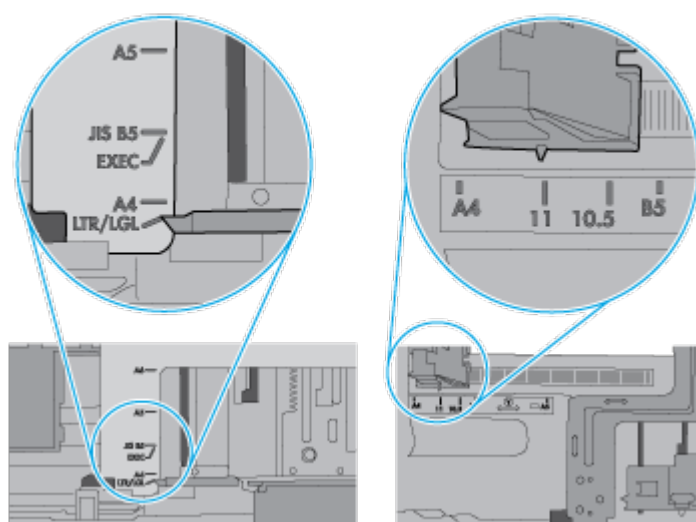

8. Ensure that the paper tray meets the tray capacity specifications or the stack of paper in the tray is not above the fill mark (line below the three triangles) as indicated in the image.

Figure 6-63 Paper height guides

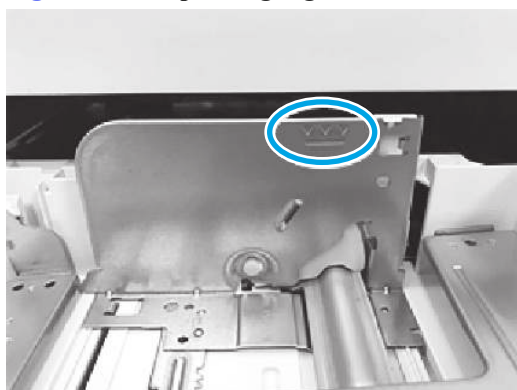


Figure 6-64 Overfilled tray




Figure 6-65 Stack of paper not overfilled in Tray 2



9. Unplug the printer cord and rotate the printer so that the rear door of the printer is in front of you.
10. Open the rear door and clear any paper present or obstructions in the paper path.
Grasp any jammed paper with both hands and pull it straight out to remove it out of the printer.


11. Raise the primary transfer assembly.

Figure 6-66 Raise the transfer assembly

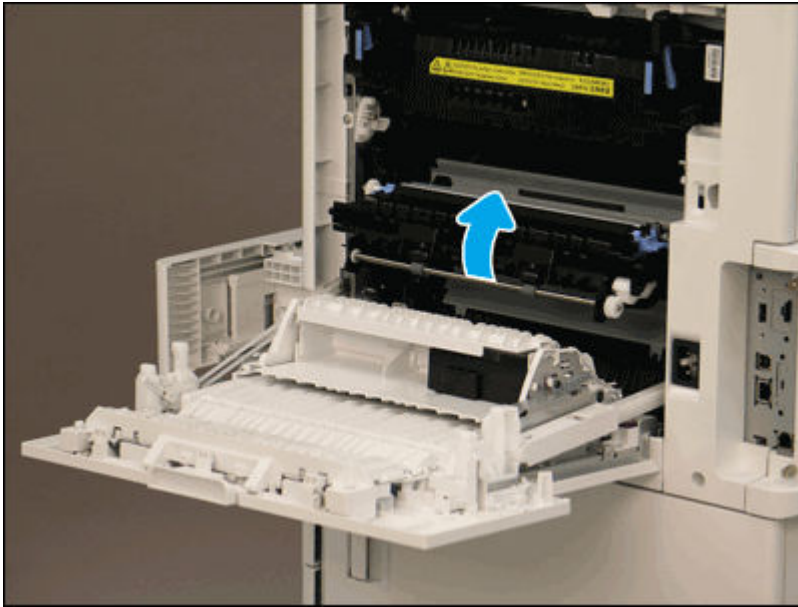

12. Pull the green tab located in the upper left-hand side to open the lower-access cover.

Figure 6-67 Open the lower-access cover

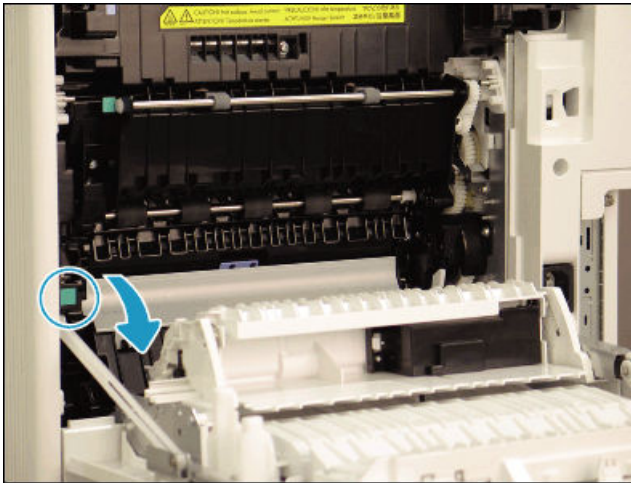

13. If any jammed paper is visible inside the lower-access cover, pull it straight out to remove it.



NOTE: If the paper is pulled toward a side, it might dislodge the rollers.

14. Ensure that the feed and separation rollers are installed correctly.

- If the flap of the blue roller tab is down, the rollers are not installed correctly.
- If the flap of the blue roller tab is up, the rollers are installed correctly.



NOTE: If the blue tab is **DOWN**, it will cause a 13.B2.D2 and/or a Tray 2 Overfilled or roller Issue message.

Figure 6-68 Feed rollers flap is down and not installed correctly


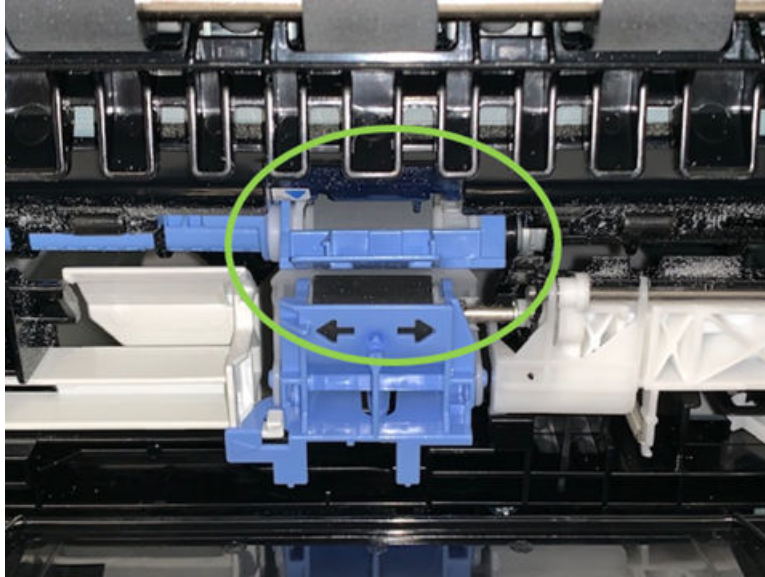


Figure 6-69 Feed rollers flap is up and installed correctly

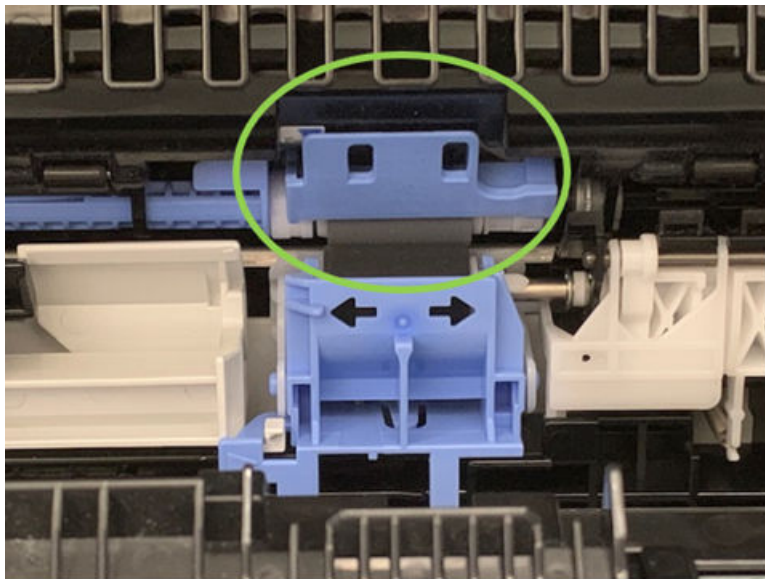

15. Remove any visible lint or dust from each of the feed, pickup, and separation rollers using a clean lint-free cloth moistened with warm water.
16. If the pickup, feed, or separation rollers are dislodged, make sure to note that the rollers were dislodged in the CDAX case notes.
17. If the pickup, feed, and separation rollers are damaged or worn out, replace the rollers.
 - Part number: J8J70-67906
 - Part description: Tray 2 roller assembly
 - For instructions, go to [Removal and replacement: Trays 2-x rollers](#)

Figure 6-70 Worn out roller surface


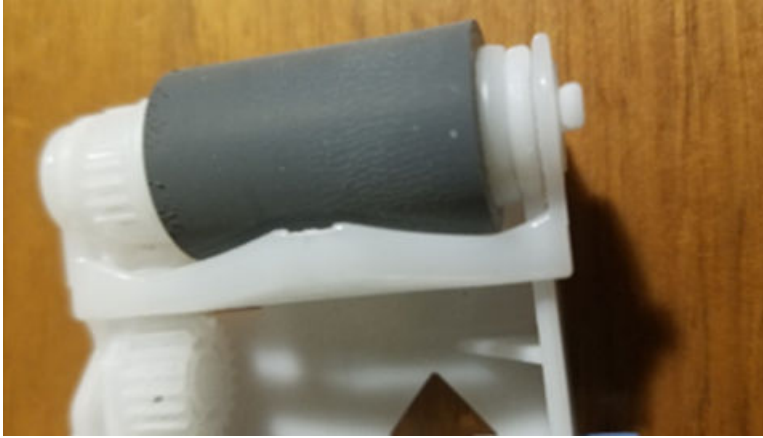


Figure 6-71 New roller surface

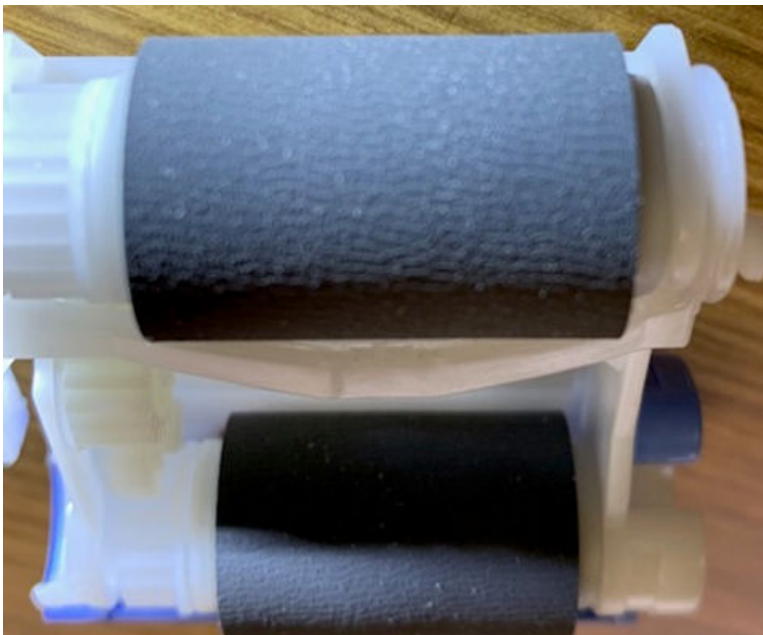

18. Reinstall Tray 2.
19. If the issue persists, dispatch a service technician.


Recommended action for onsite technicians

1. Pull the specified tray completely out of the printer to remove it.

2. Ensure that the protective orange plastic shipping locks are removed from tray, if present.



3. Remove any jammed or damaged sheets of paper from the opening of tray or tray assembly.
4. Check for any jammed or damaged sheet of paper inside the printer. If paper is present, remove it from the printer.

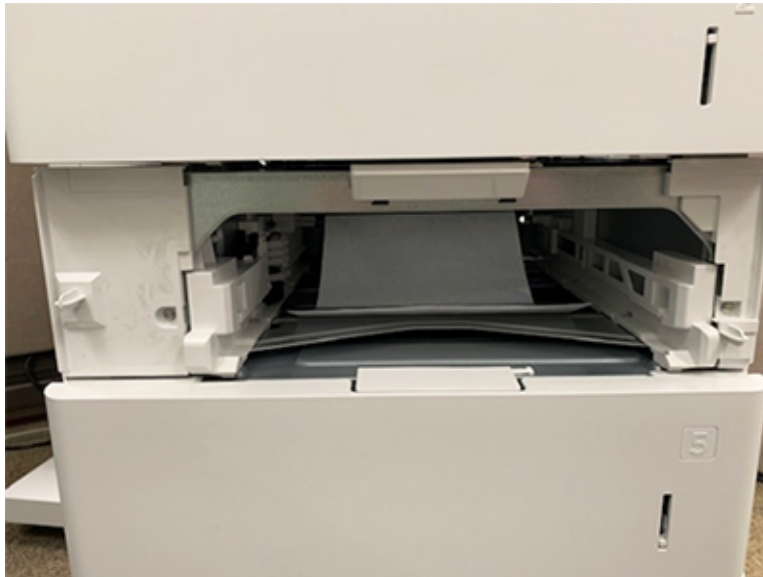

5. Check the event log from the printer for any current instances of 53.B0.0z. If these event codes are present, they indicate that the feed and separation rollers for the tray are near the end of life and need to be replaced.


If 53.B0.0z events are present, replace the feed and separation rollers for the tray.

 **NOTE:** z = A variable number or letter between 0-1 or A-F


Tray 2 roller assembly part number: J8J70-67906


For instructions: *Removal and replacement: Tray 2 tray rollers* See the Repair Service Manual for this product.

6. Turn off the printer and unplug the printer cord and rotate the printer so that the rear door of the option tray is in front of you.

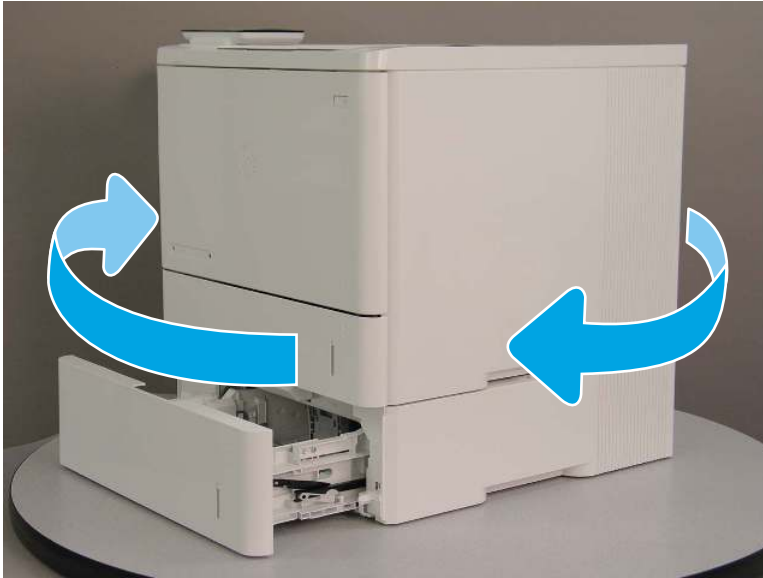

7. Open the rear door to the optional paper feeder and push the green tab (jam access door) on the right side down to expose the pickup rollers. Clear any paper present or obstructions in the paper path.

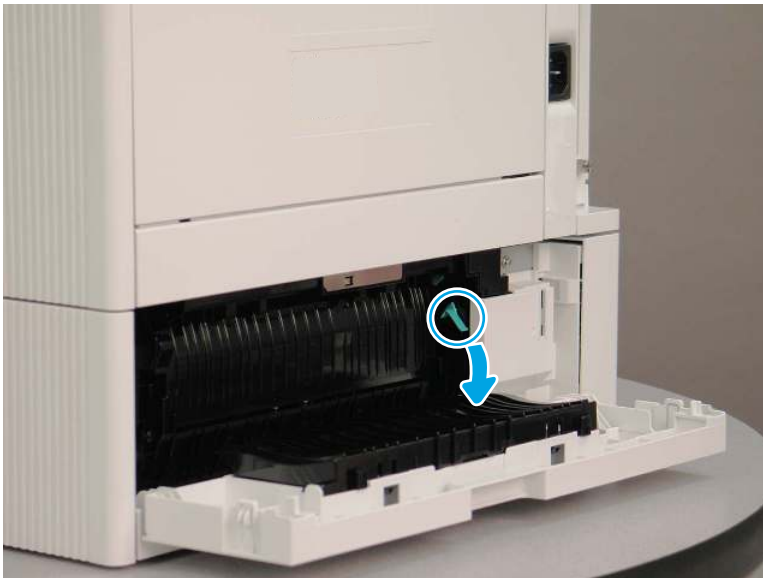

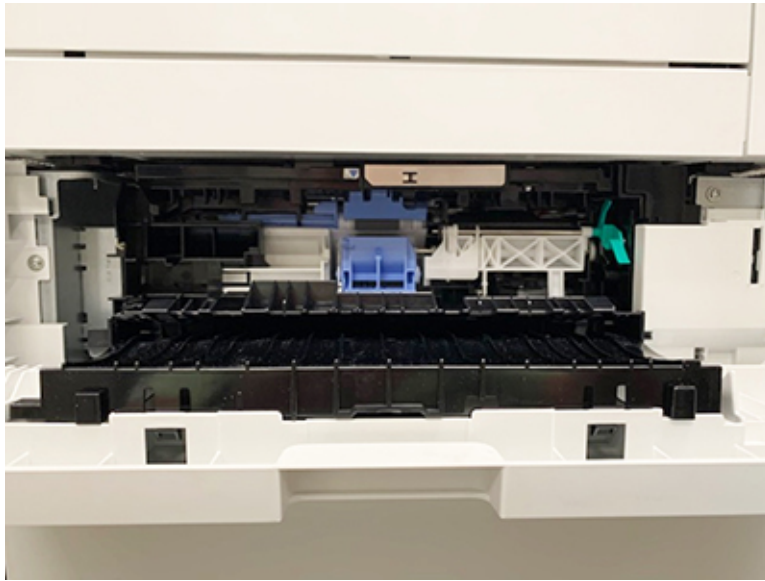

8. Grasp any jammed paper with both hands and pull it straight out to remove it out of the printer.
9. Ensure that the feed and separation rollers are installed correctly and show no damage.
 - a. Check if the rollers are installed correctly.

Figure 6-72 Pick roller not locked in

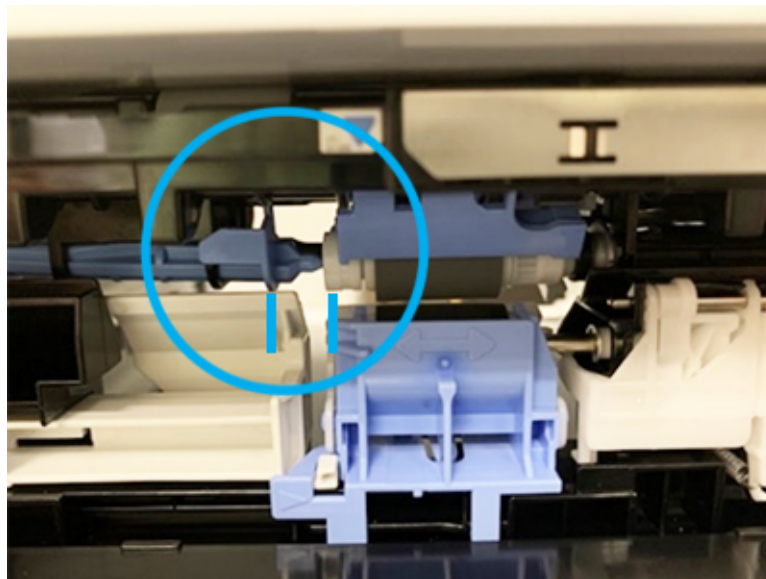


Figure 6-73 Separating roller not installed correct



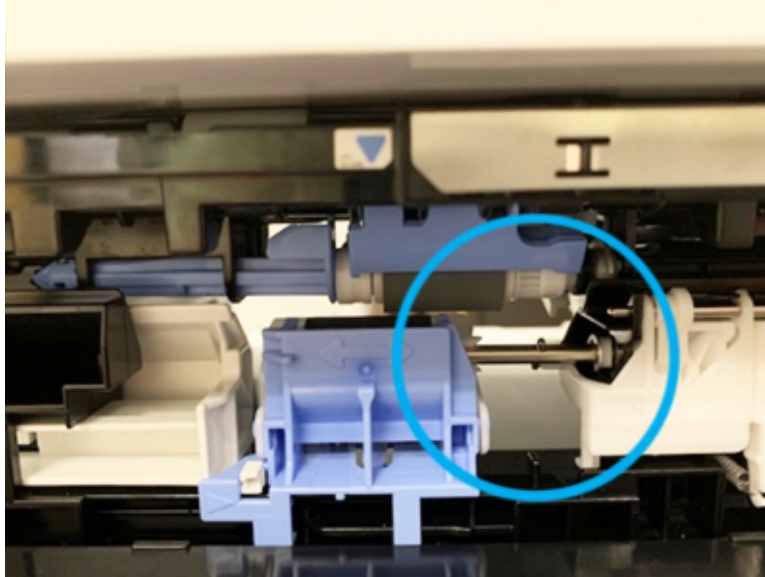


Figure 6-74 Separation roller not install and locked in correctly

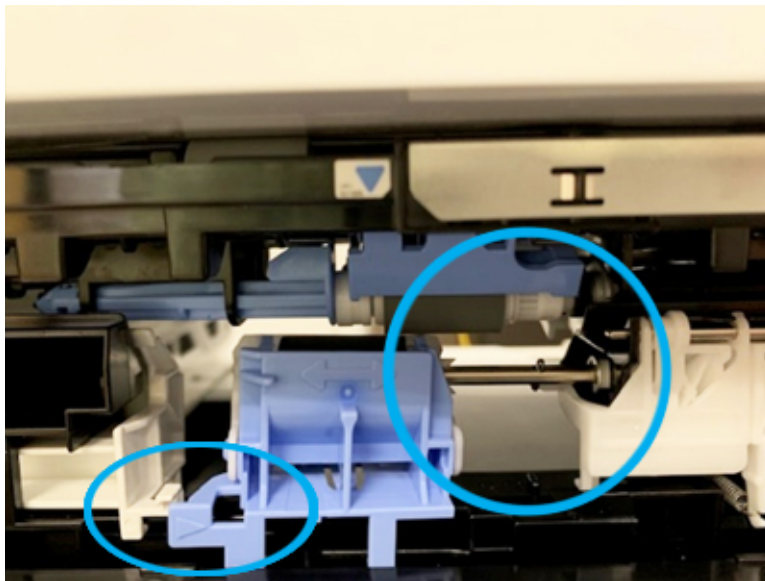

- b. If either roller is installed incorrectly, make sure to install it correctly as shown here.

Figure 6-75 Rollers installed correctly

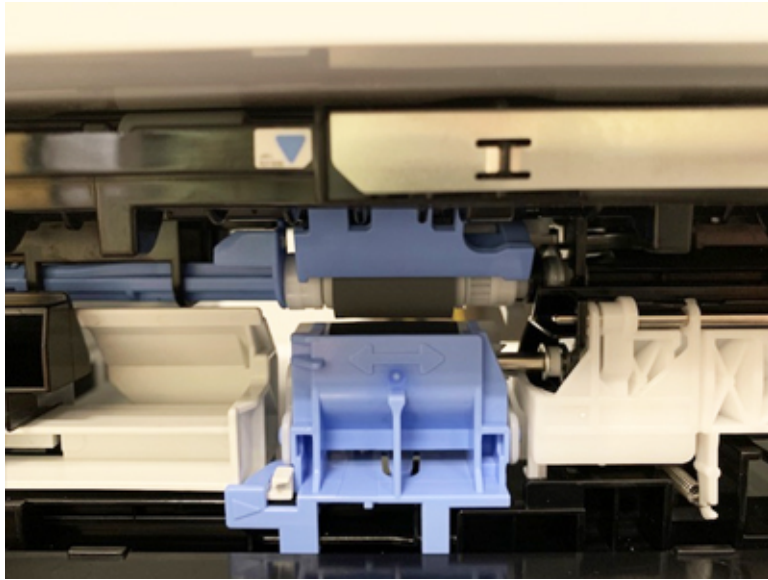

- c. If the rollers are dirty, clean the rollers.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

- d. If the error persists even after check the rollers, replace the rollers.

Tray 2-x roller assembly part number: J8J70-67906

For instructions: *Removal and replacement: Tray 2-x roller kit* See the Repair Service Manual for this product.

10. Ensure that the type and quality of the paper being used meets the HP specifications for the printer.



NOTE: For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

11. Remove all paper loaded in tray, ensure that the tray width and length guides are set to the correct paper size for the paper installed into the tray.

Figure 6-76 1x550 Tray guides

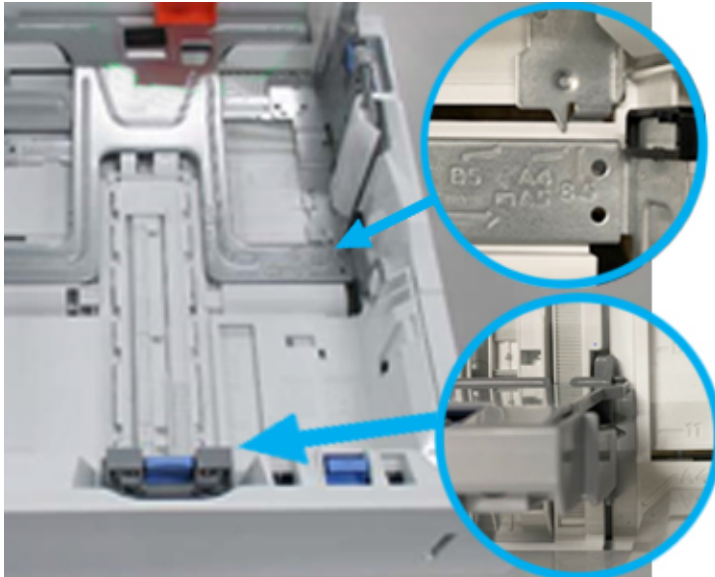


Figure 6-77 2100 sheet tray guide



12. Ensure that the paper in the tray meets the tray capacity specifications or the stack of paper in the tray and is not above the fill mark (line below the three triangles) as indicated in the image.

Figure 6-78 1x550 tray fill mark example 1

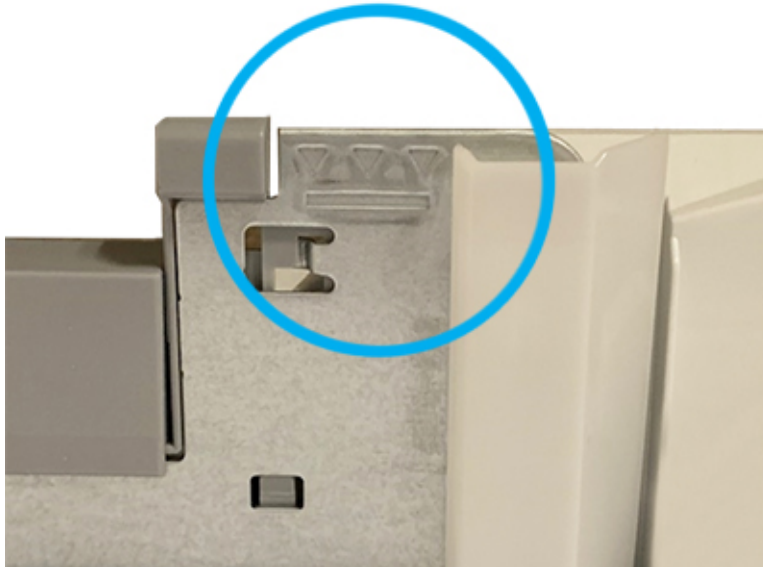


Figure 6-79 1x550 tray fill marks example 2

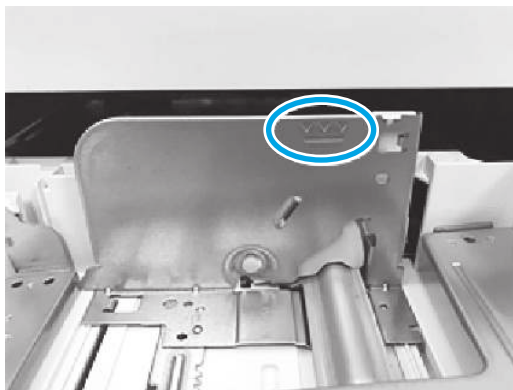


Figure 6-80 2100 sheet tray fill mark



Figure 6-81 1x550 tray over filled


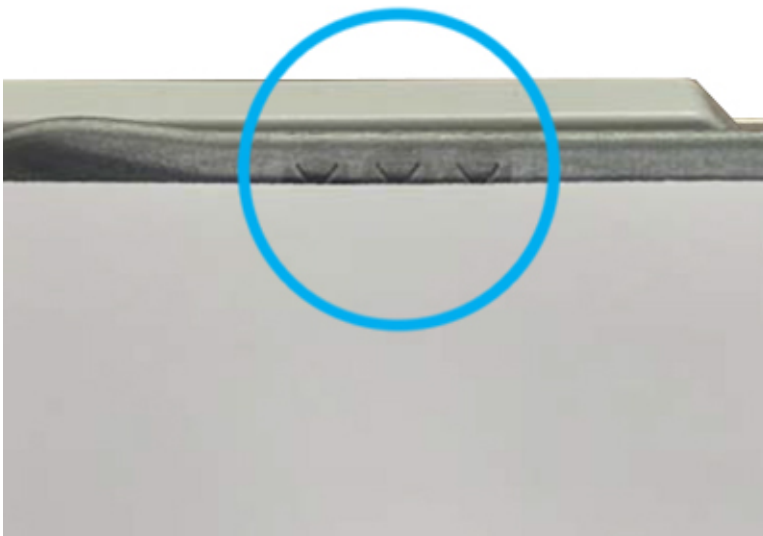


Figure 6-82 1x550 filled correctly



13. Run the following tests from the printer troubleshooting menu:

- **Tray x-Pickup Solenoid**
 - a. From the Home screen on the printer control panel, touch **Support Tools**.
 - b. Open the following menus:
 - i. **Troubleshooting**
 - ii. **Diagnostic Tests**
 - iii. **Components Test**
 - c. Select the **Tray 2-Pickup Solenoid** option, select the **Repeat** check box, and then press the **Start** button.
 - d. Listen to hear a clicking noise to confirm the solenoid is functioning.

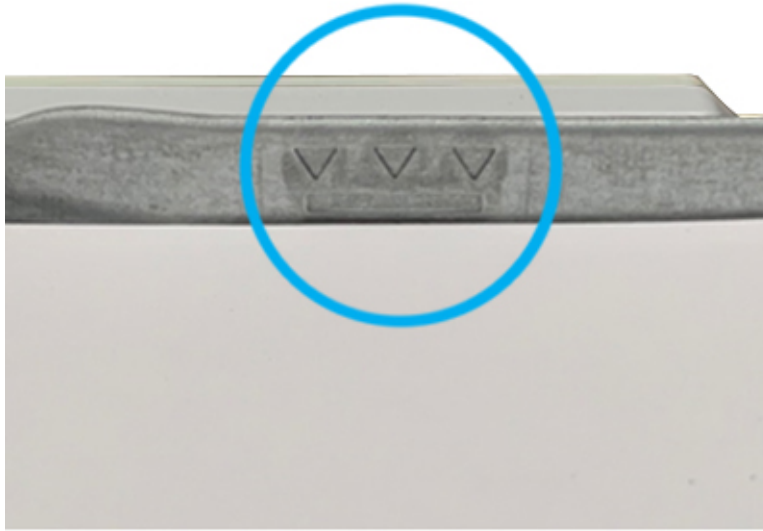

NOTE: The solenoid click sound is a very low volume and will click "on" and "off".

14. If the test fails, replace the paper pickup assembly.

- Part number: RM2-4260-000CN
- For instructions, go to *Removal and replacement: Paper pickup assembly* See the Repair Service Manual for this product.

15. If the issue persists, elevate the case using the Standard Support Process.

13.B2.Dz Jam in Tray x

Paper delay jam at the image area.

Paper did not reach the registration sensor (PS4550) in specified time when printing from an optional paper tray.

Watch [HP LaserJet Enterprise M607, M608, M609 - 13.B2, 13.B9 rear door and fuser area paper jam](#) for more troubleshooting steps.

If using adhesive or self-sealing media, please see the instructions in *A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.* (ish_3199741-3199797-16).

- **13.B2.D3:** Jam when printing from Tray 3
- **13.B2.D4:** Jam when printing from Tray 4
- **13.B2.D5:** Jam when printing from Tray 5
- **13.B2.D6:** Jam when printing from Tray 6


Recommended action for customers

1. Pull the specified tray completely out of the printer to remove it.
2. Ensure that the protective orange plastic shipping locks are removed from tray, if present.




3. Remove any jammed or damaged sheets of paper from the opening of tray or tray assembly.


4. Check for any jammed or damaged sheet of paper inside the printer. If paper is present, remove it from the printer.

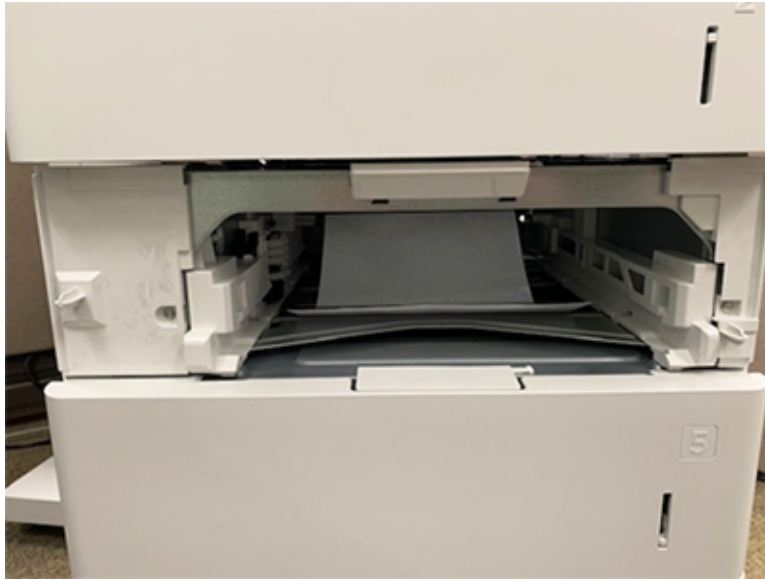

5. Turn off the printer and unplug the printer cord and rotate the printer so that the rear door of the option tray is in front of you.

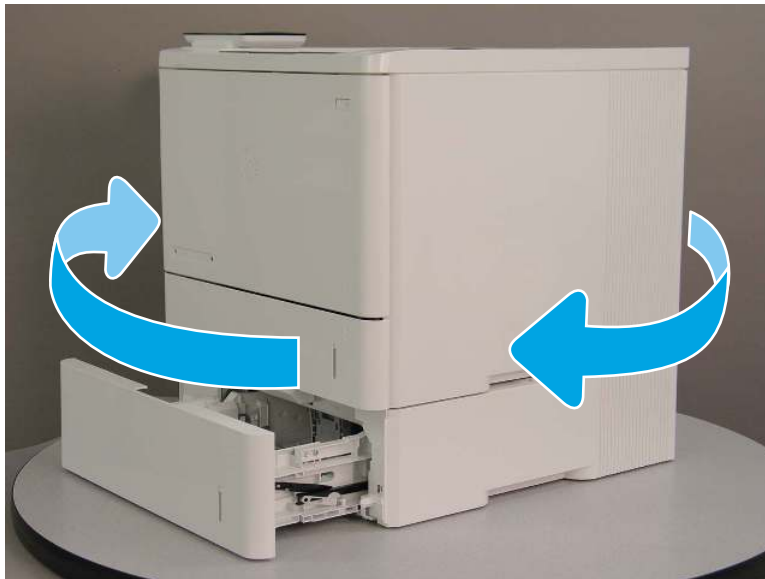

6. Open the rear door to the optional paper feeder and push the green tab (jam access door) on the right side down to expose the pickup rollers. Clear any paper present or obstructions in the paper path.

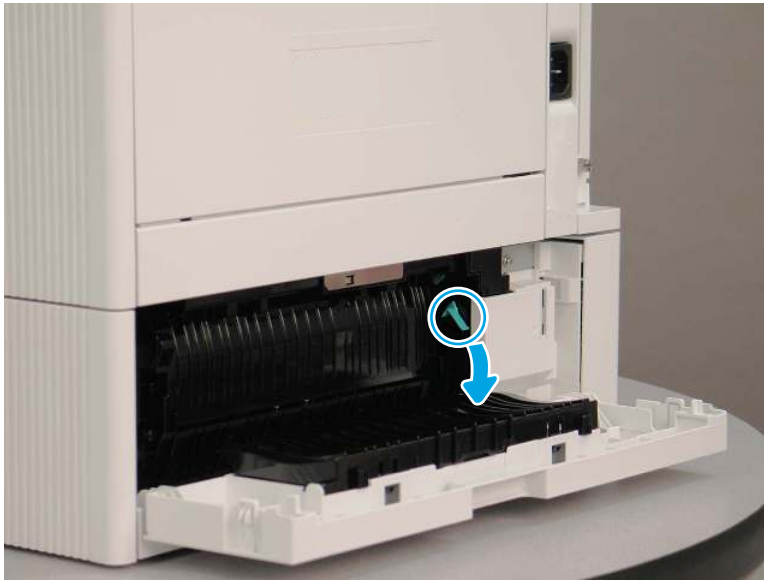

7. Grasp any jammed paper with both hands and pull it straight out to remove it out of the printer.
8. Ensure that the feed and separation rollers are installed correctly and show no damage.

- a. Check if the rollers are installed correctly.

Figure 6-83 Pick roller not locked in

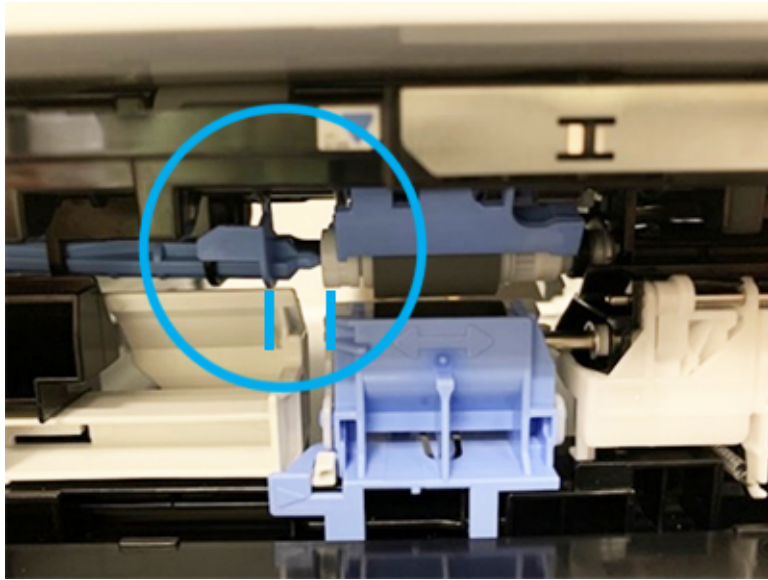


Figure 6-84 Separating roller not installed correct



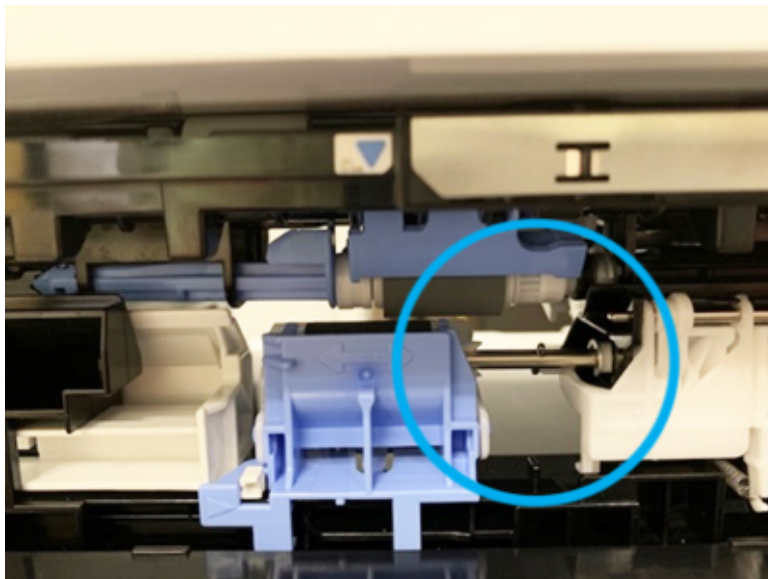


Figure 6-85 Separation roller not install and locked in correctly

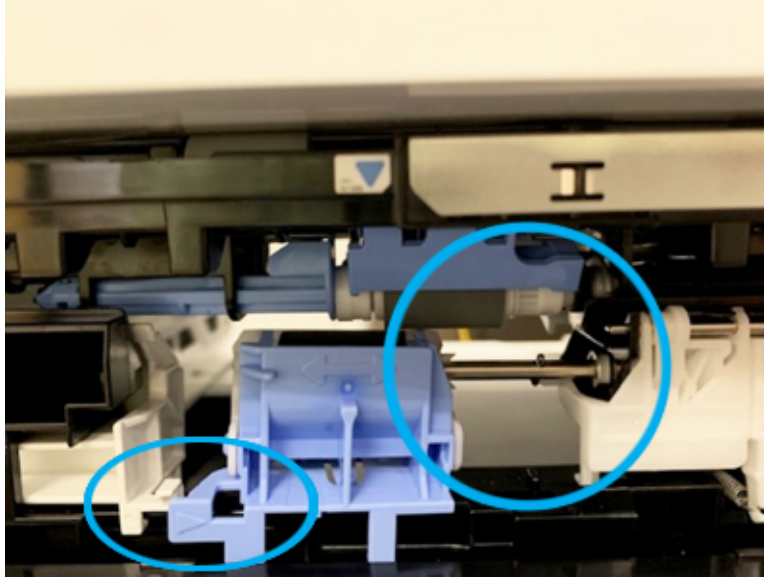

- b. If either roller is installed incorrectly, make sure to install it correctly as shown here.

Figure 6-86 Rollers installed correctly

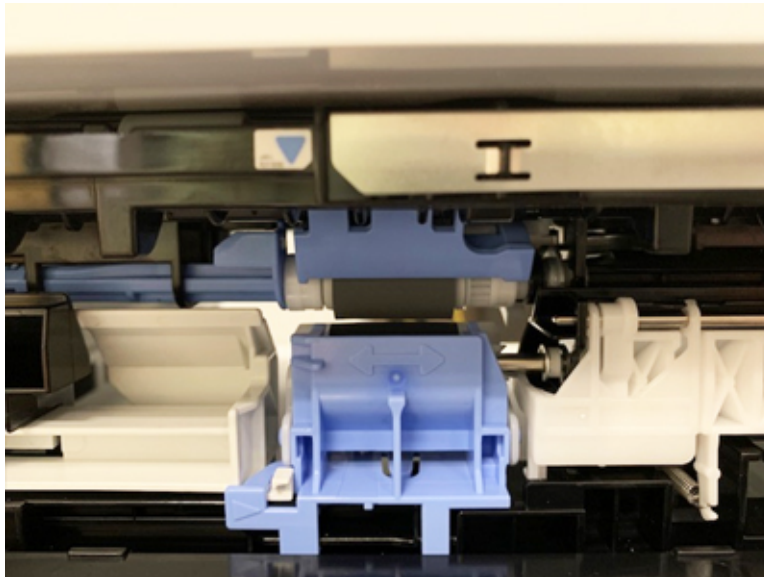

- c. If the rollers are dirty, clean the rollers.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

- d. If the error persists even after check the rollers, replace the rollers.

Tray 2-x roller assembly part number: J8J70-67906

For instructions: *Removal and replacement: Tray 2-x roller kit* See the Repair Service Manual for this product.

9. Ensure that the type and quality of the paper being used meets the HP specifications for the printer.

 **NOTE:** For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

10. Remove all paper loaded in tray, ensure that the tray width and length guides are set to the correct paper size for the paper installed into the tray.

Figure 6-87 1x550 Tray guides

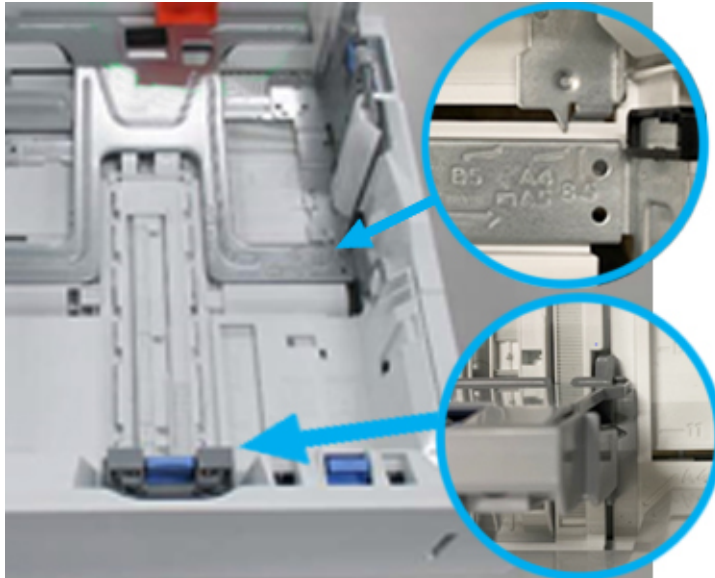


Figure 6-88 2100 sheet tray guide



11. Ensure that the paper in the tray meets the tray capacity specifications or the stack of paper in the tray and is not above the fill mark (line below the three triangles) as indicated in the image.

Figure 6-89 1x550 tray fill mark example 1

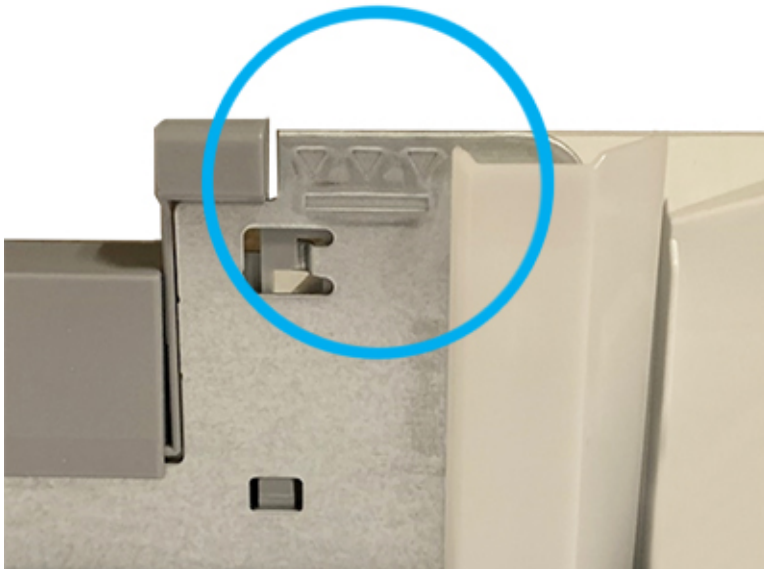


Figure 6-90 1x550 tray fill marks example 2

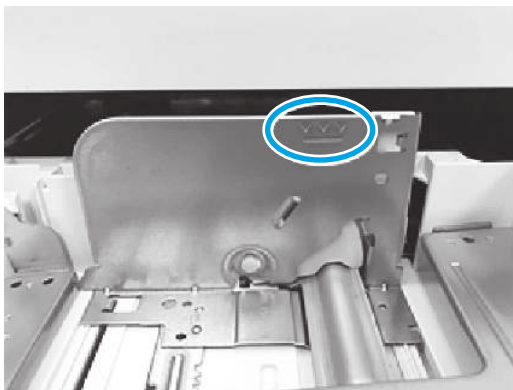


Figure 6-91 2100 sheet tray fill mark



Figure 6-92 1x550 tray over filled


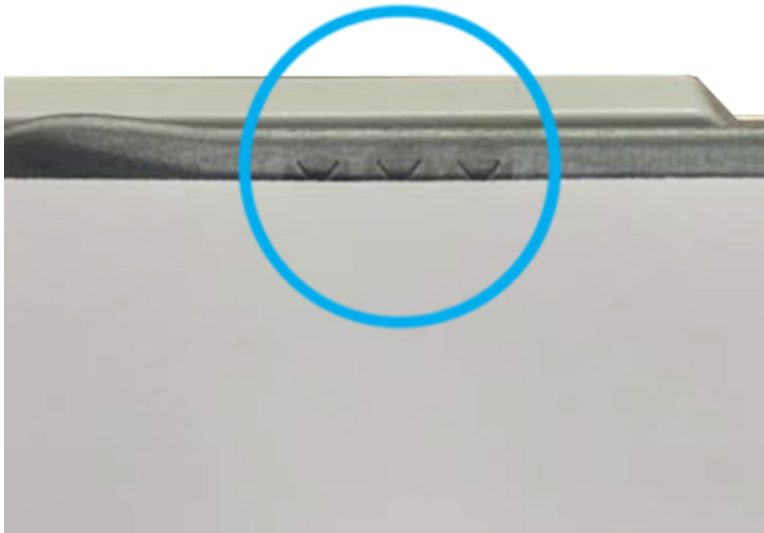


Figure 6-93 1x550 filled correctly

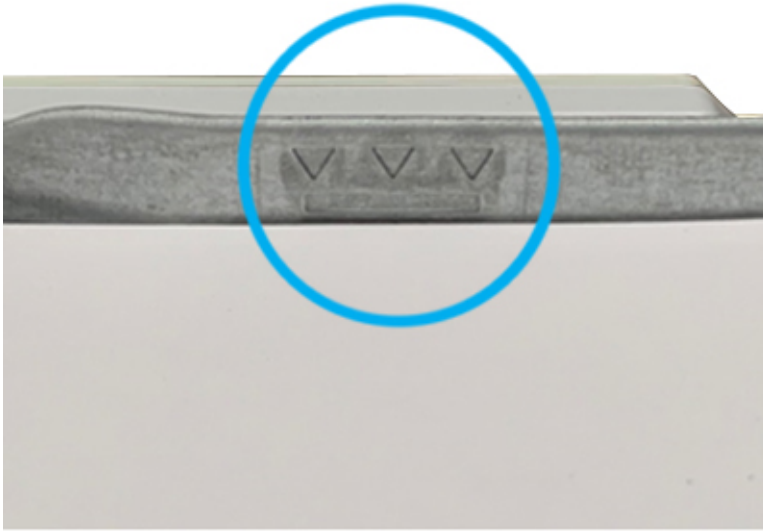

12. Reinstall the paper tray.
13. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center agents

1. Pull the specified tray completely out of the printer to remove it.
2. Ensure that the protective orange plastic shipping locks are removed from tray, if present.




3. Remove any jammed or damaged sheets of paper from the opening of tray or tray assembly.


4. Check for any jammed or damaged sheet of paper inside the printer. If paper is present, remove it from the printer.

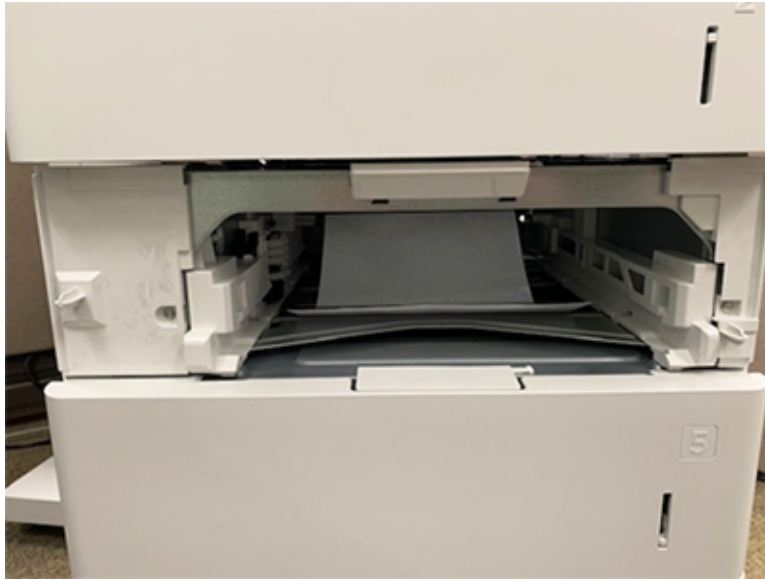

5. Turn off the printer and unplug the printer cord and rotate the printer so that the rear door of the option tray is in front of you.

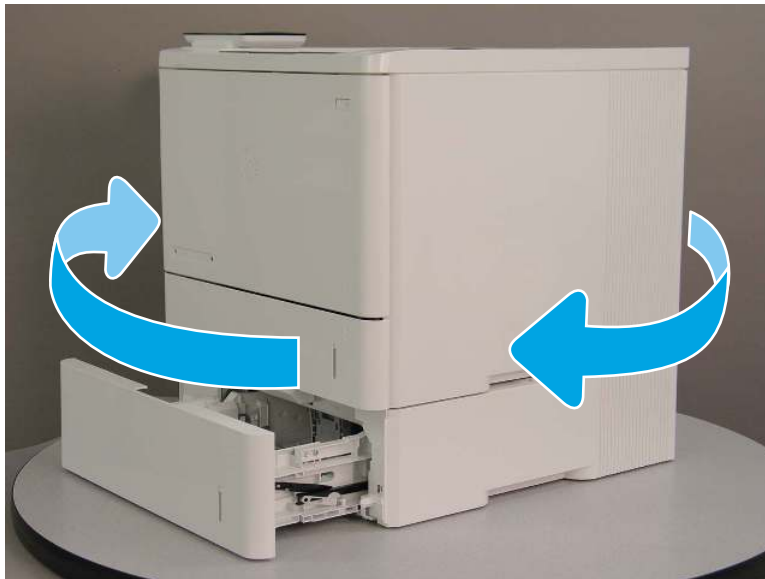

6. Open the rear door to the optional paper feeder and push the green tab (jam access door) on the right side down to expose the pickup rollers. Clear any paper present or obstructions in the paper path.

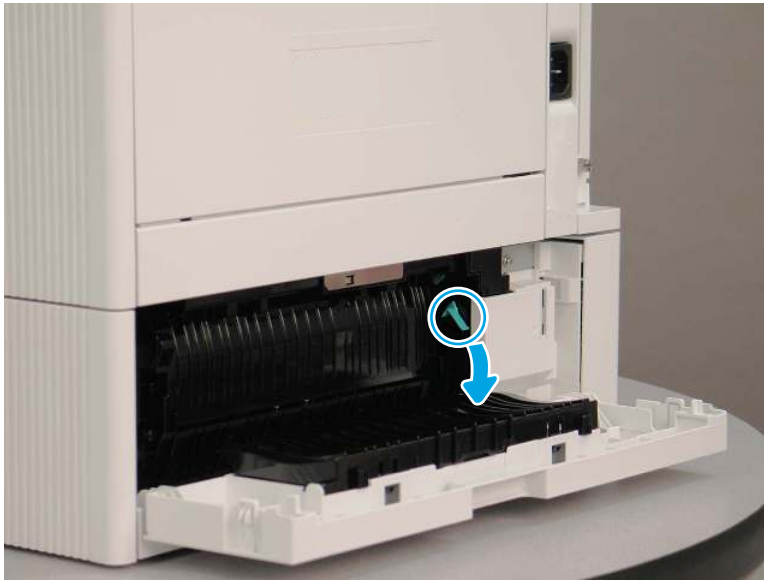

7. Grasp any jammed paper with both hands and pull it straight out to remove it out of the printer.
8. Ensure that the feed and separation rollers are installed correctly and show no damage.

- a. Check if the rollers are installed correctly.

Figure 6-94 Pick roller not locked in

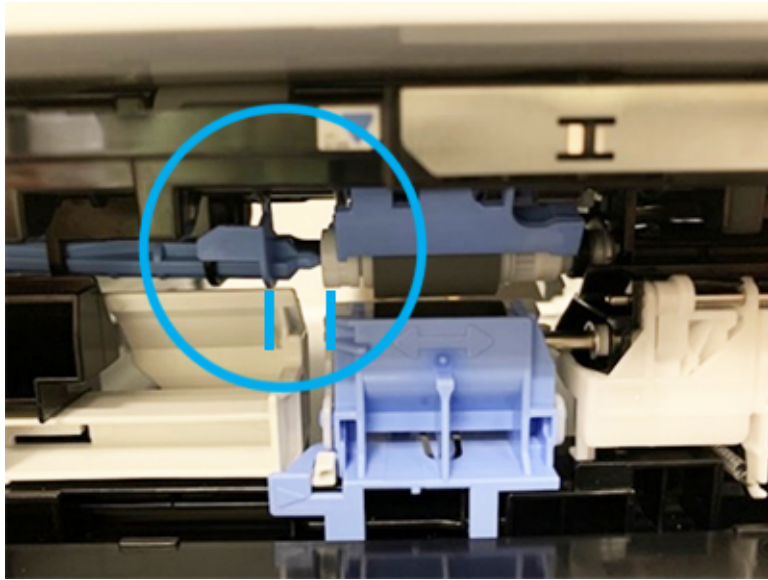


Figure 6-95 Separating roller not installed correct



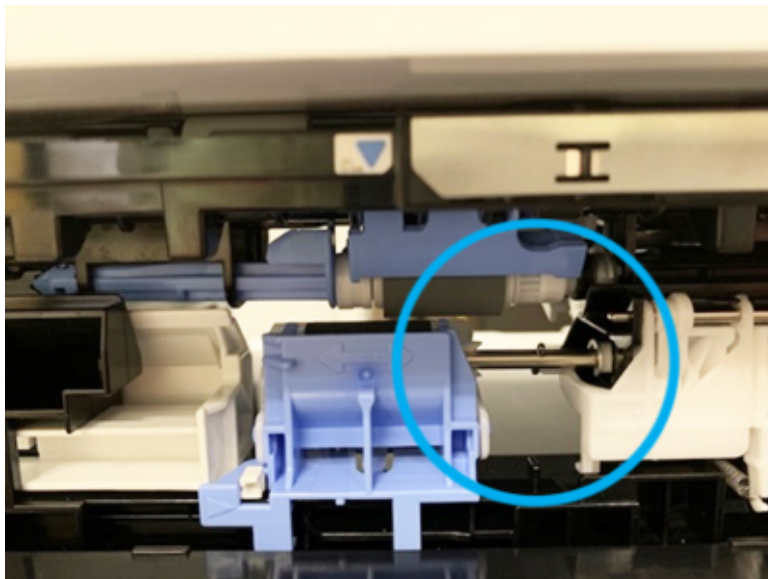


Figure 6-96 Separation roller not install and locked in correctly

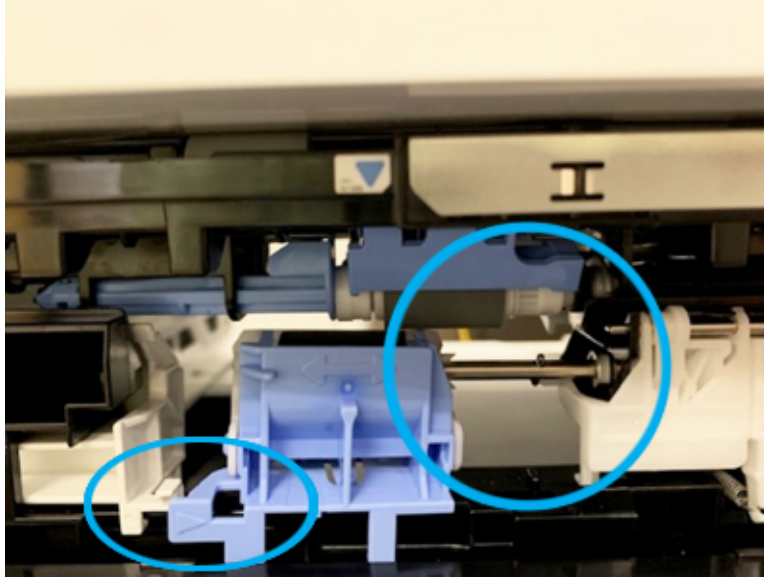

- b. If either roller is installed incorrectly, make sure to install it correctly as shown here.

Figure 6-97 Rollers installed correctly

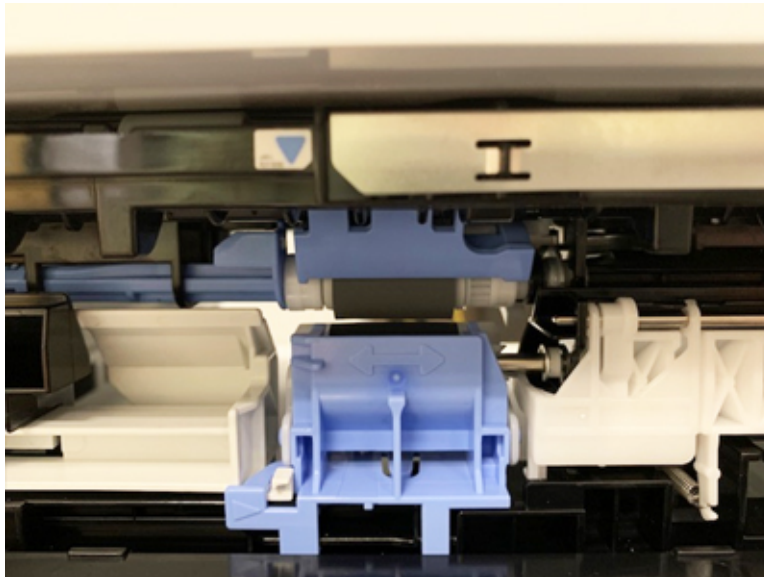

- c. If the rollers are dirty, clean the rollers.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

- d. If the error persists even after check the rollers, replace the rollers.

Tray 2-x roller assembly part number: J8J70-67906

For instructions: *Removal and replacement: Tray 2-x roller kit* See the Repair Service Manual for this product.

9. Ensure that the type and quality of the paper being used meets the HP specifications for the printer.

 **NOTE:** For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

10. Remove all paper loaded in tray, ensure that the tray width and length guides are set to the correct paper size for the paper installed into the tray.

Figure 6-98 1x550 Tray guides

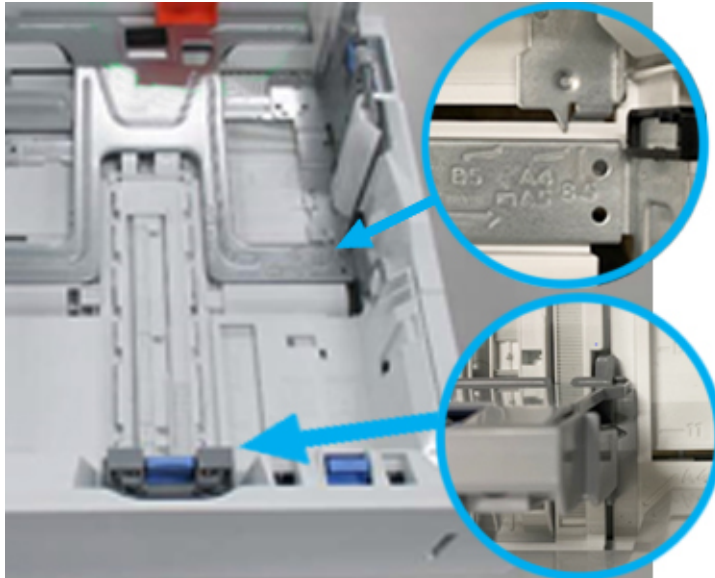


Figure 6-99 2100 sheet tray guide



11. Ensure that the paper in the tray meets the tray capacity specifications or the stack of paper in the tray and is not above the fill mark (line below the three triangles) as indicated in the image.

Figure 6-100 1x550 tray fill mark example 1

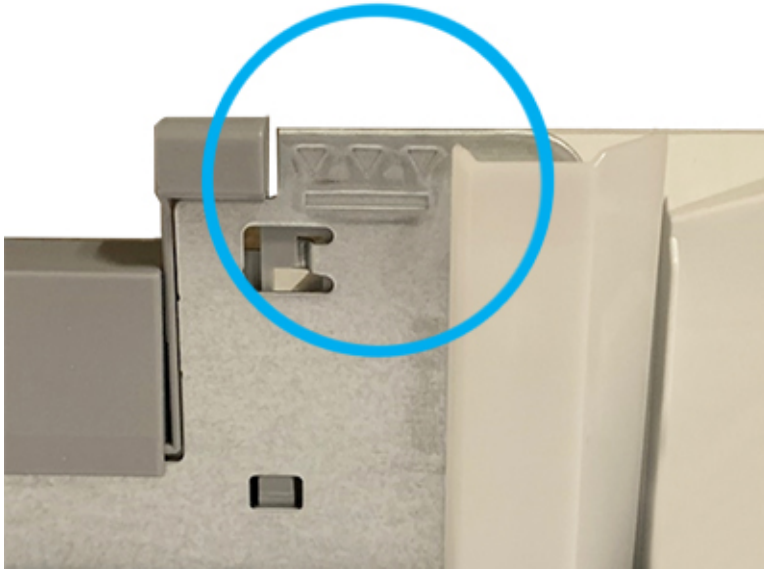


Figure 6-101 1x550 tray fill marks example 2

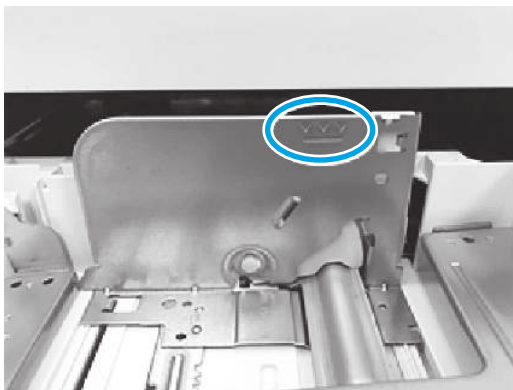


Figure 6-102 2100 sheet tray fill mark



Figure 6-103 1x550 tray over filled


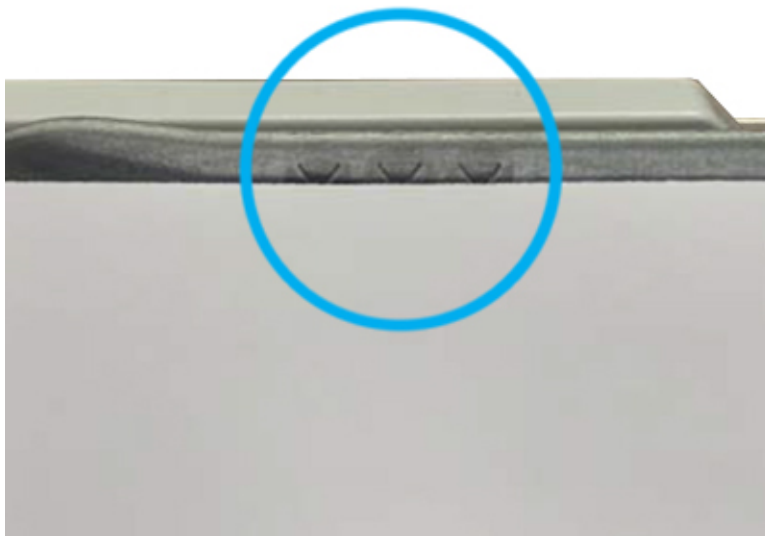


Figure 6-104 1x550 filled correctly

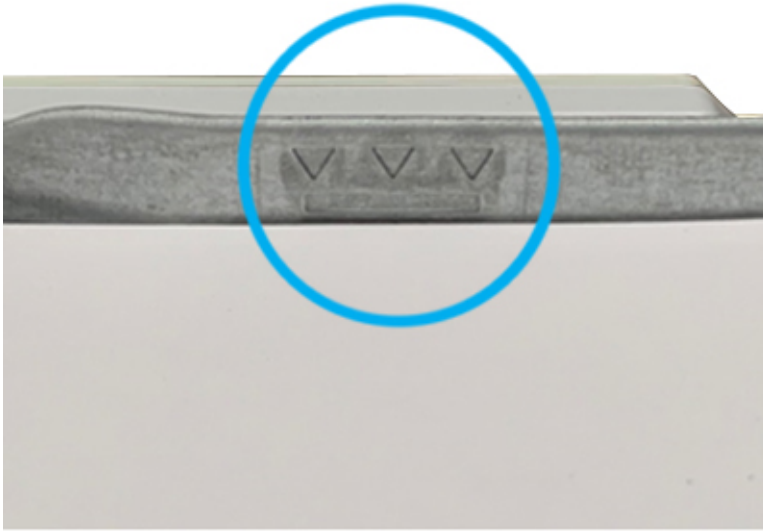

12. Reinstall the paper tray.
13. If the error persists, dispatch a service technician to troubleshoot the issue.


Recommended action for onsite technicians

1. Pull the specified tray completely out of the printer to remove it.
2. Ensure that the protective orange plastic shipping locks are removed from tray, if present.



3. Remove any jammed or damaged sheets of paper from the opening of tray or tray assembly.

4. Check for any jammed or damaged sheet of paper inside the printer. If paper is present, remove it from the printer.

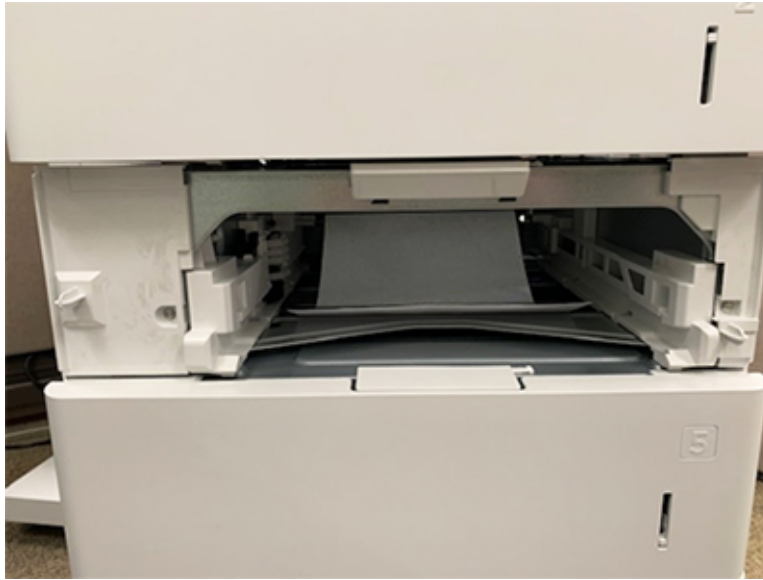

5. Check the event log from the printer for any current instances of 53.B0.0z. If these event codes are present, they indicate that the feed and separation rollers for the tray are near the end of life and need to be replaced.

If 53.B0.0z events are present, replace the feed and separation rollers for the tray.




NOTE: z = A variable number or letter between 0-1 or A-F


Tray 2 roller assembly part number: J8J70-67906

For instructions: *Removal and replacement: Tray 2 tray rollers* See the Repair Service Manual for this product.

6. Turn off the printer and unplug the printer cord and rotate the printer so that the rear door of the option tray is in front of you.

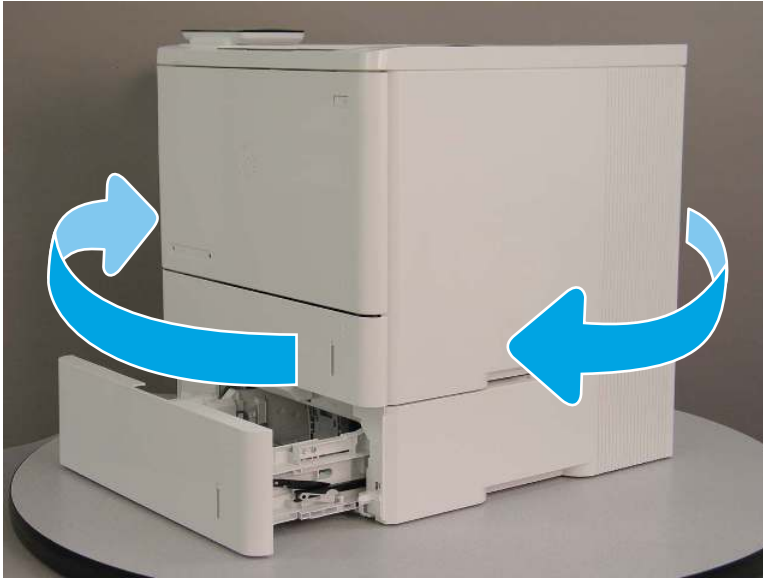

7. Open the rear door to the optional paper feeder and push the green tab (jam access door) on the right side down to expose the pickup rollers. Clear any paper present or obstructions in the paper path.

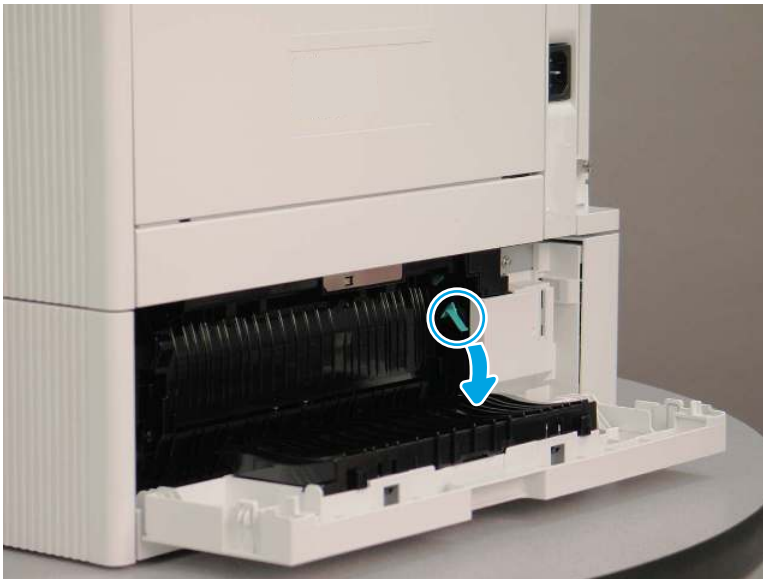



8. Grasp any jammed paper with both hands and pull it straight out to remove it out of the printer.
9. Ensure that the feed and separation rollers are installed correctly and show no damage.
 - a. Check if the rollers are installed correctly.

Figure 6-105 Pick roller not locked in

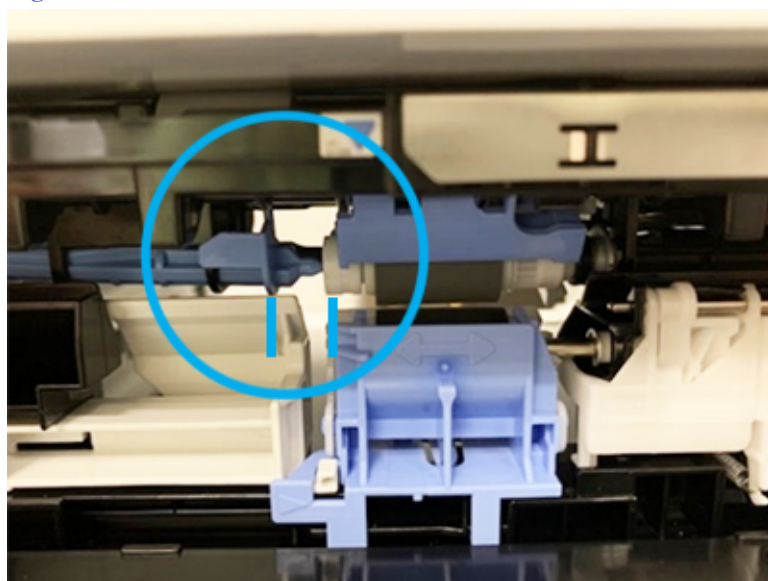


Figure 6-106 Separating roller not installed correct



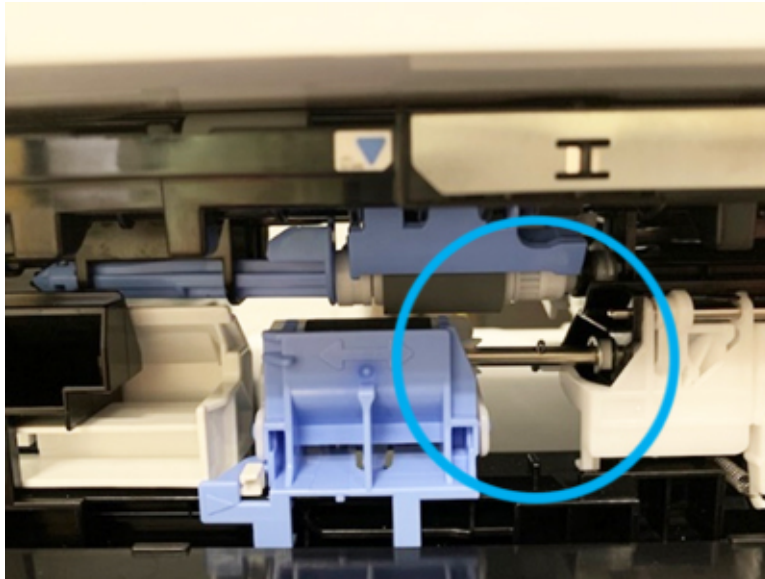


Figure 6-107 Separation roller not install and locked in correctly

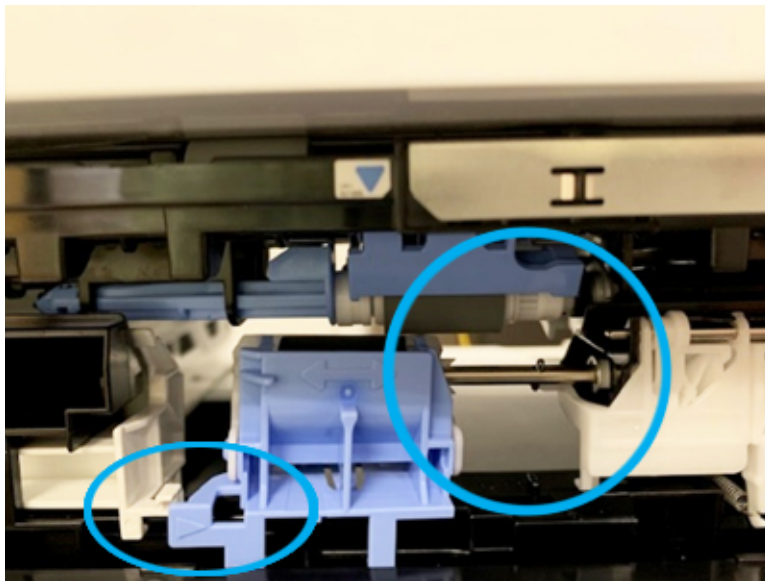

- b. If either roller is installed incorrectly, make sure to install it correctly as shown here.

Figure 6-108 Rollers installed correctly

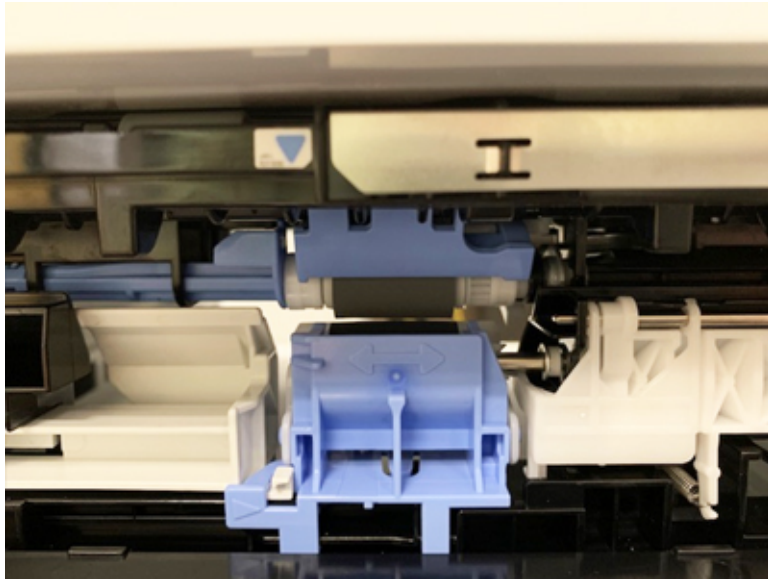

- c. If the rollers are dirty, clean the rollers.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

- d. If the error persists even after check the rollers, replace the rollers.

Tray 2-x roller assembly part number: J8J70-67906

For instructions: *Removal and replacement: Tray 2-x roller kit* See the Repair Service Manual for this product.

10. Ensure that the type and quality of the paper being used meets the HP specifications for the printer.



NOTE: For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

11. Remove all paper loaded in tray, ensure that the tray width and length guides are set to the correct paper size for the paper installed into the tray.

Figure 6-109 1x550 Tray guides

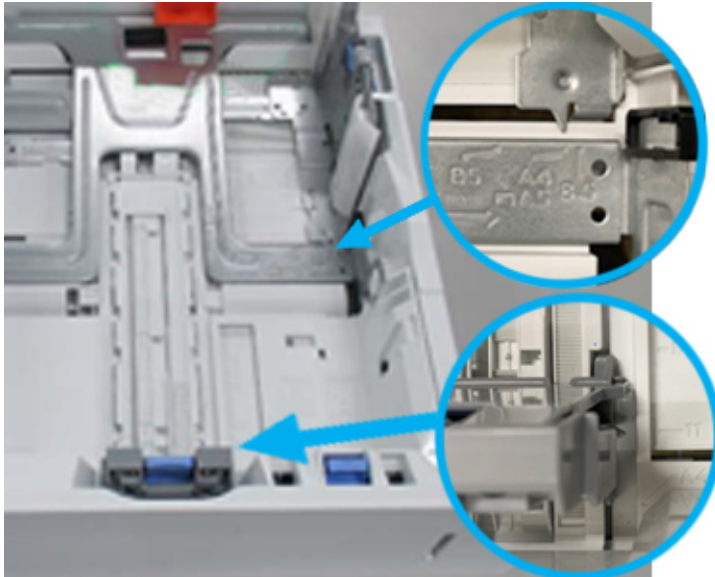


Figure 6-110 2100 sheet tray guide



12. Ensure that the paper in the tray meets the tray capacity specifications or the stack of paper in the tray and is not above the fill mark (line below the three triangles) as indicated in the image.

Figure 6-111 1x550 tray fill mark example 1

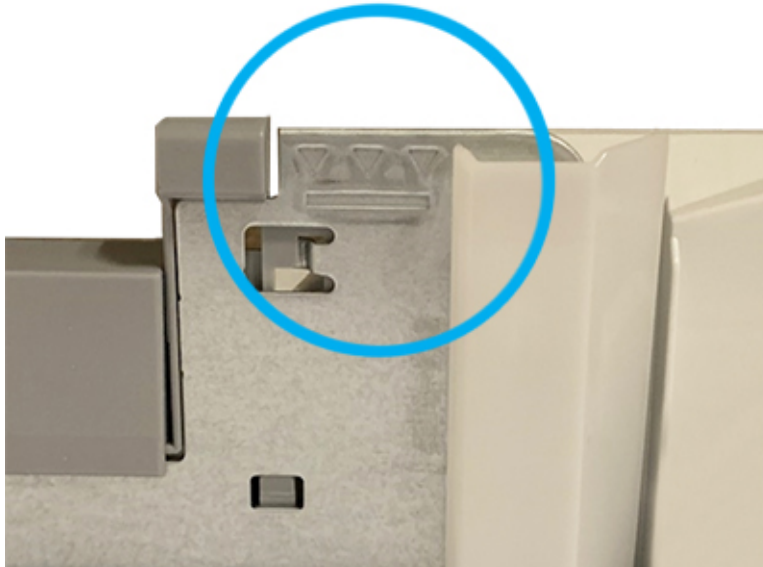


Figure 6-112 1x550 tray fill marks example 2

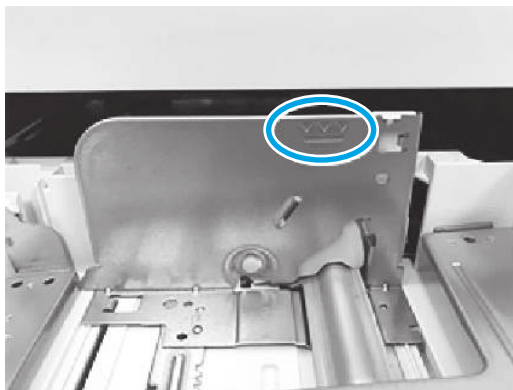


Figure 6-113 2100 sheet tray fill mark



Figure 6-114 1x550 tray over filled


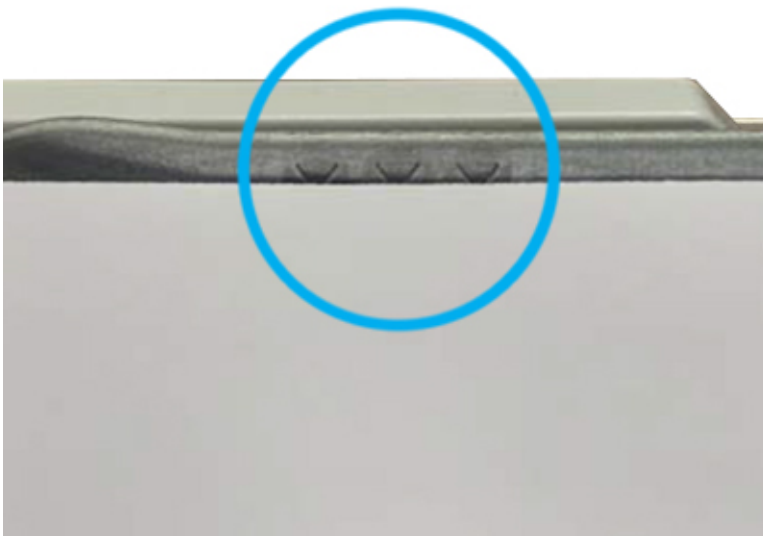


Figure 6-115 1x550 filled correctly

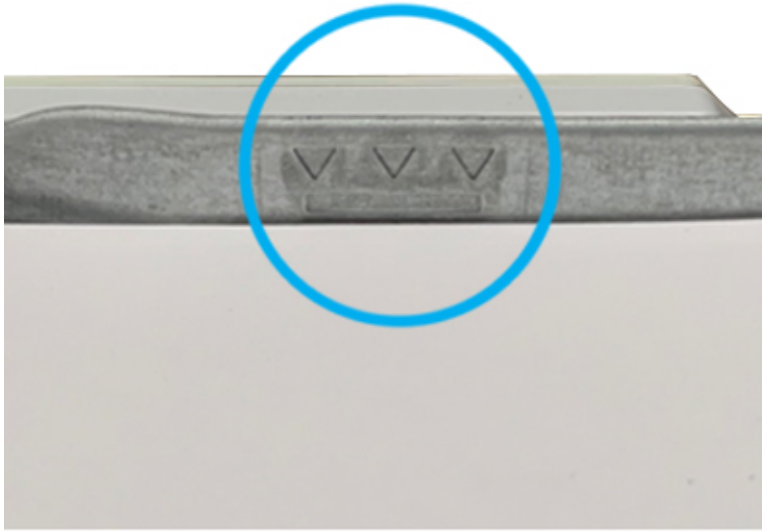

13. Run the following tests from the printer troubleshooting menu:

- **Tray x-Pickup Solenoid**

- a. From the Home screen on the printer control panel, touch **Support Tools**.

- b. Open the following menus:

- i. **Troubleshooting**

- ii. **Diagnostic Tests**

- iii. **Components Test**

- c. Select the **Tray 2-Pickup Solenoid** option, select the **Repeat** check box, and then press the **Start** button.

- d. Listen to hear a clicking noise to confirm the solenoid is functioning.



NOTE: The solenoid click sound is a very low volume and will click "on" and "off".

14. If the test fails, replace the paper pickup assembly.

- Part number: RM2-4260-000CN

- For instructions, go to *Removal and replacement: Paper pickup assembly* See the Repair Service Manual for this product.

15. If the issue persists, elevate the case using the Standard Support Process.

13.B2.FF Jam in rear door

Paper residual jam at image area.

Paper present at PS4550, at power on or after clearing a jam.

If using adhesive or self-sealing media, please see the instructions in *A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.* (ish_3199741-3199797-16).

Recommended action for customers

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Toggle the registration/TOP sensor (PS4550) to ensure that it moves freely.
3. Test the registration/TOP sensor (PS4550) using the manual sensor test.
 - a. From the home screen on the printer control panel, touch **“Support Tools”**.
 - b. Open the following menus:
 - **Troubleshooting**
 - **Diagnostic Tests**
 - **Manual Sensor Test**
 - c. Select from the following tests:
 - **All Sensors , Engine Sensors**
 - **Done** (return to the **Troubleshooting** menu)
 - **Reset** (reset the selected sensor’s state)
 - d. Test the registration/TOP sensor to verify that the sensor is functioning correctly. If the sensor does not function, replace the registration assembly.



NOTE: Before replacing any parts check connector J15 on the DC controller.

Part number: RM2-4218-000CN

For instructions: *Removal and replacement: Registration assembly* See the Repair Service Manual for this product.

13.B4.FF Jam in rear door

Paper residual jam at image area.

Paper present at fuser loop sensor PS4500 at power on or after clearing a jam.

If using adhesive or self-sealing media, please see the instructions in *A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.* (ish_3199741-3199797-16).

Recommended action for customers

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Remove the fuser and check for paper and the correct movement of the sensors PS4500.

 **CAUTION:** The fuser might be hot.

3. Test the fuser loop sensor PS4500. If the sensor fails the test, replace the sensor.



Part number: WG8-5935-000CN

 **NOTE:** If onsite, Performing a reseal of the transfer assembly might resolve this issue.

If needed Part number:

Transfer assembly (duplex) - RM2-6776-010CN


Transfer assembly (simplex) - RM2-1248-000CN

4. Check the condition and position of the fuser pressure relief sensor. If the sensor is damaged or missing, replace the fuser.

Table 6-11 Part number

Part Description	Part Number
Fuser output sensor (SR5)	WG8-5935-000CN

Figure 6-116 An undamaged fuser pressure relief sensor

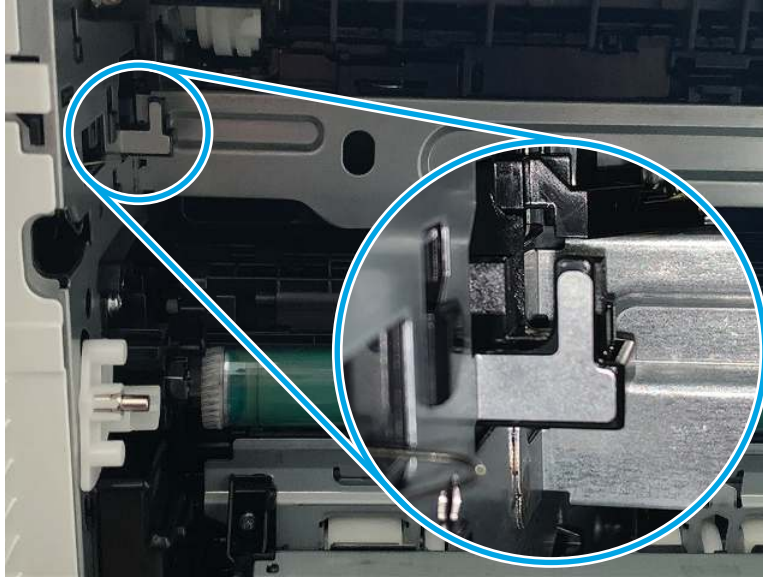

5. Inspect the fuser flag for damage. If the flag is damaged or missing, replace the fuser.

Table 6-12 Part numbers

Part Description	Part Number
110V Fuser	RM2-1256-010CN
220V Fuser	RM2-1257-010CN

For instructions: *Removal and replacement: Fuser assembly*

Figure 6-117 An undamaged fuser alienation flag on the left side of the fuser



13.B9.Az Fuser jam

Paper stay jam in the fuser area.

Paper present at PS4650 after specified time limit.

This jam code can be caused by:

- An accordion paper jam at the fuser exit.
- Something blocking the paper before reaching the output rollers.

- The output bin rollers are not turning. Because there is very little distance from the fuser exit to the output bin, paper stopped at the rollers can cause a fuser jam.
- A sticky fuser exit flag. If the flag is stuck or even delayed momentarily in the activated position it can cause this jam.
- Self-sealing or adhesive media is being used. Please see the instructions in *A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.* (ish_3199741-3199797-16).
- **13.B9.A1** jam is detected when printing from Tray 1.
- **13.B9.A2** jam is detected when printing from Tray 2.
- **13.B9.A3** jam is detected when printing from Tray 3.
- **13.B9.A4** jam is detected when printing from Tray 4.
- **13.B9.A5** jam is detected when printing from Tray 5.
- **13.B9.AD** jam is detected when printing from the duplexer.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. Check the fuser delivery sensor for correct functionality and movement. Replace the fuser as needed.

 **CAUTION:** The fuser might be hot.

110V part number: RM2-1256-020CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-020CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.



NOTE: Before replacing any parts check connector J401 and J402 on the DC controller.

4. Verify there is no debris from a previous jam stuck in the fuser, or the rollers leading into and out of the fuser.
5. Confirm that the output bin rollers are turning.
6. Check the transfer roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts. Replace the transfer roller or transfer assembly as needed.

Transfer roller part number: RM2-6800-000CN

For instructions: *Removal and replacement: Secondary transfer roller* See the Repair Service Manual for this product.

Transfer assembly part number: RM2-6776-000CN

For instructions: *Removal and replacement: Transfer assembly* See the Repair Service Manual for this product.

Transfer assembly (LCD simplex model) part number: RM2-1248-000CN

For instructions: *Removal and replacement: Transfer assembly* See the Repair Service Manual for this product.

7. Enter the component test menu to run diagnostics on the printer.
 - a. From the home screen on the printer control panel, touch “[Support Tools](#)”.
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Components Test](#)
8. Touch [Fuser motor](#) to test the motor. If the test fails replace the fuser drive assembly.

Part number: RM2-6763-000CN

For instructions: *Removal and replacement: Fuser drive* See the Repair Service Manual for this product.

9. Replace the fuser.

110V part number: RM2-1256-020CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-020CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

13.B9.Cz

Fuser wrap jam.

This jam occurs when the paper disappears from the fuser output sensor before a designated amount of time after the paper reached the fuser output sensor (PS4650).

It is determined that the paper is being wrapped around the fuser roller.

Z = Fuser mode

- **13.B9.C1** Fuser wrap jam when **Auto Sense (Normal)**.
- **13.B9.C2** Fuser wrap jam when **Normal**.
- **13.B9.C3** Fuser wrap jam when **Light 1** or **Light 2**.
- **13.B9.C4** Fuser wrap jam when **Heavy 1**.
- **13.B9.C5** Fuser wrap jam when **Heavy 2**.
- **13.B9.C6** Fuser wrap jam when **Heavy Paper 3**.
- **13.B9.C7** Fuser wrap jam when **Glossy Paper 1**.
- **13.B9.C8** Fuser wrap jam when **Glossy Paper 2**.
- **13.B9.C9** Fuser wrap jam when **Glossy Paper 3**.
- **13.B9.CB** Fuser wrap jam when **Transparency**.
- **13.B9.CC** Fuser wrap jam when **Label**.
- **13.B9.CD** Fuser wrap jam when **Envelope 1** or **Envelope 2**.

If using adhesive or self-sealing media, please see the instructions in *A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.* (ish_3199741-3199797-16).

Recommended action for customers

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Remove the fuser, and remove any paper wrapped around the fuser roller.

 **CAUTION:** The fuser might be hot.

 - c. Look for and clear any paper present or obstructions in the paper path.
 - d. Reinstall the fuser.
 - e. Close the rear door to allow the printer to attempt to clear the jam message.
2. Print a cleaning page to ensure that all of the toner is removed from the fuser roller.
3. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the rear door.

- b. Remove the fuser, and remove any paper wrapped around the fuser roller.

 **CAUTION:** The fuser might be hot.

- c. Look for and clear any paper present or obstructions in the paper path.
 - d. Reinstall the fuser.
 - e. Close the rear door to allow the printer to attempt to clear the jam message.
2. Print a cleaning page to ensure that all of the toner is removed from the fuser roller.
 3. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
 4. If the error persists, replace the fuser.

110V part number: RM2-1256-020CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-020CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

13.B9.Dz

Fuser delivery delay jam.

Paper did not reach the fuser sensor PS4650 within the specified time.

- **13.B9.D1** Fuser delivery delay jam when printing from Tray 1.
- **13.B9.D2** Fuser delivery delay jam when printing from Tray 2.
- **13.B9.D3** Fuser delivery delay jam when printing from Tray 3.
- **13.B9.D4** Fuser delivery delay jam when printing from Tray 4.
- **13.B9.D5** Fuser delivery delay jam when printing from Tray 5.
- **13.B9.DD** Fuser delivery delay jam when printing with the Duplexer.

The following are possible causes and areas that should be investigated.

- The paper jam is found wrapped around the fuser roller. In this case it is a sign of a worn out fuser.
- The paper jam is found in the transfer area. This could be caused by transfer area damage.
- A fuser drive or delivery issue.
- Self-sealing or adhesive media is being used. Please see the instructions in : A "*13.BY.XY paper jam*" or "*41.03.XY Size Mismatch*" message displays on the printer control panel when printing on self-adhesive paper. (ish_3199741-3199797-16).

Recommended action for customers

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.

- c. Close the rear door to allow the printer to attempt to clear the jam message.
- 2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
- 3. Ensure that the tray 1 pickup and separation rollers are installed correctly and show no damage or wear.
- 4. Clean or replace the pickup, feed, and separation rollers as needed.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

- 5. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- 1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
- 2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
- 3. Determine where the jam is located and remove the jam.
 - a. Open the rear door and check for paper present in the paper path.
 - b. Remove the fuser and check for paper or obstructions.
- 4. If the paper is stopped before fuser, perform the following steps.
 - a. Thoroughly check the duplex paper path and the transfer area for any issues with the rollers, jammed paper, or any obstructions that might be causing the jam.
 - b. Check the transfer roller at the transfer area, ensure that everything is correctly seated and that there are no damaged parts. Replace the transfer roller or transfer assembly as needed.

Transfer roller part number: RM2-6800-000CN

For instructions: *Removal and replacement: Secondary transfer roller* See the Repair Service Manual for this product.

Transfer assembly part number: RM2-6776-000CN

For instructions: *Removal and replacement: Secondary transfer roller* See the Repair Service Manual for this product.

Transfer assembly (LCD simplex model) part number: RM2-1248-000CN

For instructions: *Removal and replacement: Secondary transfer roller* See the Repair Service Manual for this product.

- c. Inspect the transfer feed assembly for debris or damage. Replace the rear door sub assembly as needed.

Rear door part number: RM2-6746-000CN

For instructions: *Removal and replacement: Rear door assembly* See the Repair Service Manual for this product.

Rear door (LCD Simplex) part number: RM2-1249-000CN

For instructions: *Removal and replacement: Rear door assembly* See the Repair Service Manual for this product.

5. If the paper is stopped in or at the fuser, perform the following steps.

 **CAUTION:** The fuser might be hot.

- a. Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

110V part number: RM2-1256-020CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-020CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

- b. Test the fuser sensor (PS4650) using the manual sensor test.

i. From the home screen on the printer control panel, touch “[Support Tools](#)”.

ii. Open the following menus:

- [Troubleshooting](#)
- [Diagnostic Tests](#)
- [Manual Sensor Test](#)

iii. Select from the following tests:

- [All Sensors](#) , [Engine Sensors](#)
- [Done](#) (return to the [Troubleshooting](#) menu)
- [Reset](#) (reset the selected sensor’s state)

iv. Test the fuser sensor to verify that the sensor is functioning correctly. If the sensor does not function, replace the fuser assembly.



NOTE: Before replacing any parts check connector J401 and J402 on the DC controller.

110V part number: RM2-1256-020CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-020CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

- c. Enter the component test menu to run diagnostics on the printer.

i. From the home screen on the printer control panel, touch “[Support Tools](#)”.

ii. Open the following menus:

- [Troubleshooting](#)

- Diagnostic Tests
 - Components Test
- d. Touch **Fuser motor** to test the motor. If the test fails replace the fuser drive assembly.
- Part number: RM2-6763-000CN
- For instructions: *Removal and replacement: Fuser drive* See the Repair Service Manual for this product.
- e. Replace the fuser.
- 110V part number: RM2-1256-020CN
- For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.
- 220V part number: RM2-1257-020CN
- For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

13.B9.FF

Residual paper jam at the fuser output sensor.

Paper is present at PS4650 at power on or after clearing a jam.

If using adhesive or self-sealing media, please see the instructions in A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper. (ish_3199741-3199797-16).

Recommended action for customers

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Verify the paper meets the HP printer specifications.

3. Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

 **CAUTION:** The fuser might be hot.

4. Test the fuser sensor (PS4650) using the manual sensor test.
 - a. From the home screen on the printer control panel, touch “[Support Tools](#)”.
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - c. Select from the following tests:
 - [All Sensors](#) , [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#) (reset the selected sensor’s state)
 - d. Test the fuser sensor to verify that the sensor is functioning correctly. If the sensor does not function, replace the fuser assembly.

 **NOTE:** Before replacing any parts check connector J401 and J402 on the DC controller.

110V part number: RM2-1256-020CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-020CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

5. Enter the component test menu to run diagnostics on the printer.
 - a. From the home screen on the printer control panel, touch “[Support Tools](#)”.
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Components Test](#)
6. Touch [Fuser motor](#) to test the motor. If the test fails replace the fuser drive assembly.

Part number: RM2-6763-000CN

For instructions: *Removal and replacement: Fuser drive* See the Repair Service Manual for this product.

7. Replace the fuser.

110V part number: RM2-1256-020CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-020CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

13.D3.Dz

Late to duplex re-feed jam.

- **13.D3.D1** The fuser is printing in fuser mode **Auto Sense** special case distinguished from "typed" Normal.
- **13.D3.D2** The fuser is printing in fuser mode **Normal**.
- **13.D3.D3** The fuser is printing in fuser mode **Light 1** or **Light 2**.
- **13.D3.D4** The fuser is printing in fuser mode **Heavy 1**.
- **13.D3.D5** The fuser is printing in fuser mode **Heavy 2**.
- **13.D3.D6** The fuser is printing in fuser mode **Heavy Paper 3**.
- **13.D3.D7** The fuser is printing in fuser mode **Glossy Paper 1**.
- **13.D3.D8** The fuser is printing in fuser mode **Glossy Paper 2**.
- **13.D3.D9** The fuser is printing in fuser mode **Glossy Paper 3**.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Perform the continuous paper path test in simplex mode of at least 50 pages to ensure that issue is occurring while duplex printing only.
3. Test duplexing from multiple trays to see if issue is tray specific or not.

If the jam occurs from only one specific tray, troubleshoot the tray for pick and feed issues.

- a. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
- b. Ensure the tray is set correctly. If Tray 1 is set to ANY size ANY type, set it to the size the customer is trying to print on.

- c. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
 - d. Ensure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear. Clean or replace the rollers as needed.
 4. Test the duplex sensor (PS4700) using the manual sensor test.
 - a. From the home screen on the printer control panel, touch “Support Tools”.
 - b. Open the following menus:
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - c. Select from the following tests:
 - All Sensors , Engine Sensors
 - Done (return to the Troubleshooting menu)
 - Reset (reset the selected sensor’s state)
 - d. Test the duplex sensor to verify that the sensor is functioning correctly. If the sensor does not function, replace the rear door sub assembly.



NOTE: Before replacing any parts check connector J309 on the DC controller.

Rear door part number: RM2-6746-000CN

For instructions: *Removal and replacement: Rear door assembly* See the Repair Service Manual for this product.

Rear door (LCD Simplex) part number: RM2-1249-000CN

For instructions: *Removal and replacement: Rear door assembly* See the Repair Service Manual for this product.

5. Enter the component test menu to run diagnostics on the printer.
 - a. From the home screen on the printer control panel, touch “Support Tools”.
 - b. Open the following menus:
 - Troubleshooting
 - Diagnostic Tests
 - Components Test
6. Run the Duplex refeed clutch solenoid. If the tests fail, replace the delivery assembly.

Paper delivery assembly part number: RM2-6787-000CN

For instructions: *Removal and replacement: Paper delivery assembly* See the Repair Service Manual for this product.

Paper delivery assembly (LCD Simplex models) part number: RM2-4234-000CN

For instructions: *Removal and replacement: Paper delivery assembly* See the Repair Service Manual for this product.

7. Check the rear door assembly and rollers for any damage or debris. Replace the rear door assembly as needed.

Rear door part number: RM2-6746-000CN

For instructions: *Removal and replacement: Rear door assembly* See the Repair Service Manual for this product.

Rear door (LCD Simplex) part number: RM2-1249-000CN

For instructions: *Removal and replacement: Rear door assembly* See the Repair Service Manual for this product.

13.D3.FF

A power on jam has occurred at the duplex refeed sensor.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Test the duplex sensor (PS4700) using the manual sensor test.
 - a. From the home screen on the printer control panel, touch “[Support Tools](#)”.
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - c. Select from the following tests:
 - [All Sensors](#) , [Engine Sensors](#)

- **Done** (return to the [Troubleshooting](#) menu)
 - **Reset** (reset the selected sensor's state)
- d. Test the duplex sensor to verify that the sensor is functioning correctly. If the sensor does not function, replace the rear door sub assembly.



NOTE: Before replacing any parts check connector J309 on the DC controller.

Rear door part number: RM2-6746-000CN

For instructions: *Removal and replacement: Rear door assembly* See the Repair Service Manual for this product.

Rear door (LCD Simplex) part number: RM2-1249-000CN

For instructions: *Removal and replacement: Rear door assembly* See the Repair Service Manual for this product.

3. Replace the rear door assembly as needed.

Rear door part number: RM2-6746-000CN

For instructions: *Removal and replacement: Rear door assembly* See the Repair Service Manual for this product.

Rear door (LCD Simplex) part number: RM2-1249-000CN

For instructions: *Removal and replacement: Rear door assembly* See the Repair Service Manual for this product.

13.E1.D2

Output delivery delay jam. Paper did not reach the output bin full sensor in time.

- **13.E1.D2** The fuser is printing in fuser mode **Normal**.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.



NOTE: For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Clear the paper jam.
 - a. Open the rear door.

- b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.



NOTE: For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

3. Check the delivery roller and assembly for any damage or debris. Replace the delivery assembly as needed.

Paper delivery assembly (LCD simplex model) part number: RM2-6790-000CN

Paper delivery assembly (LCD duplex model) part number: RM2-6787-000CN

4. Check the fuser for damage or wear. Replace the fuser as needed.

Fuser Kit 110v part number: RM2-1256-020cn

Fuser Kit 220v part number: RM2-1257-020cn

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.



NOTE: For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

3. Check the delivery roller and assembly for any damage or debris. Replace the delivery assembly as needed.

Paper delivery assembly (LCD simplex model) part number: RM2-6790-000CN

Paper delivery assembly (LCD duplex model) part number: RM2-6787-000CN

For instructions (M607, M608, M609): *Removal and replacement: Paper delivery assembly* See the Repair Service Manual for this product.

4. Check the fuser for damage or wear. Replace the fuser as needed.

Fuser Kit 110v part number: RM2-1256-020cn

Fuser Kit 220v part number: RM2-1257-020cn

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

13.E1.D3 Fuser Area Jam

Output delivery delay jam. Paper did not reach the output bin full sensor in time.

Recommended action for customers

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size, and the tray should not be filled above the maximum fill marks or tabs.
4. Verify that the paper meets specifications for this printer.
5. Use a damp, lint-free cloth to clean the rollers in the appropriate tray. Replace rollers that are worn.
6. Open all doors and covers and ensure the paper path is completely clear of paper or obstructions.
7. If the error persists, please contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Turn the printer off.
2. Remove the toner cartridge and turn the printer on.

If the message "install toner cartridge appears without the 59 error, reinstall the toner cartridge.
3. If the error returns with the tone cartridge installed, try a new cartridge if available. If not replace the toner cartridge.



NOTE: Check the part number on the installed toner cartridge to ensure the correct capacity cartridge is ordered.

4. If the error persists, replace the Developing Drive Assembly (PS4850).

Developer drive assembly part number: RM2-6756-000CN

M607, M608, M608nk, M609, M610, M611, M612, E60055-E60075, E60155-E60175

For instructions: *Remove and replace: Developer drive assembly* See the Repair Service Manual for this product.

M631, M632, M633, M634, M635, M636, M637, E62555-E62575, E62655-E62675

For instructions: *Remove and replace: Developer drive assembly* See the Repair Service Manual for this product.

Recommended action for onsite technicians

1. Turn the printer off.
2. Remove the toner cartridge and turn the printer on.

If the message "install toner cartridge appears without the 59 error, reinstall the toner cartridge.
3. If the error returns with the tone cartridge installed, try a new cartridge if available. If not replace the toner cartridge.



NOTE: Check the part number on the installed toner cartridge to ensure the correct capacity cartridge is ordered.

4. Check connection J301 on the DC Controller.
5. Check the connection on the Developing Drive Assembly.
6. If the error persists, replace the Developing Drive Assembly (PS4850).

Developer drive assembly part number: RM2-6756-000CN

M607, M608, M608nk, M609, M610, M611, M612, E60055-E60075, E60155-E60175

For instructions: *Remove and replace: Developer drive assembly* See the Repair Service Manual for this product.

M631, M632, M633, M634, M635, M636, M637, E62555-E62575, E62655-E62675

For instructions: *Remove and replace: Developer drive assembly* See the Repair Service Manual for this product.

13.E1.Dz

Output delivery delay jam. Paper did not reach the output bin full sensor in time.

- **13.E1.D1** The fuser is printing in fuser mode **Auto Sense** special case distinguished from "typed" Normal.
- **13.E1.D2** The fuser is printing in fuser mode **Normal**.
- **13.E1.D3** The fuser is printing in fuser mode **Light 1** or **Light 2**.
- **13.E1.D4** The fuser is printing in fuser mode **Heavy 1**.
- **13.E1.D5** The fuser is printing in fuser mode **Heavy 2**.
- **13.E1.D6** The fuser is printing in fuser mode **Heavy Paper 3**.
- **13.E1.D7** The fuser is printing in fuser mode **Glossy Paper 1**.
- **13.E1.D8** The fuser is printing in fuser mode **Glossy Paper 2**.
- **13.E1.D9** The fuser is printing in fuser mode **Glossy Paper 3**.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the upper right door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, please contact HP customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the upper right door.
 - b. Look for and clear any paper present or obstructions in the paper path.

- c. Close the upper right door to allow the printer to attempt to clear the jam message.
 2. Check the delivery roller and assembly for any damage or debris. Replace the delivery assembly as needed.

Paper delivery assembly (LCD simplex model) part number: RM2-6790-000CN

Paper delivery assembly (LCD duplex model) part number: RM2-6787-000CN

For instructions (M607, M608, M609): *Removal and replacement: Paper delivery assembly* See the Repair Service Manual for this product.

3. Check the fuser for damage or wear. Replace the fuser as needed.

Fuser Kit 110v part number: RM2-1256-000cn

Fuser Kit 220v part number: RM2-1257-000cn

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

13.FF.FF

A power on residual paper jam has occurred.

This error has no specific sensor designated. It could be any sensor in the paper feed path.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the rear door.
 - b. Look for and clear any paper present or obstructions in the paper path.
 - c. Close the rear door to allow the printer to attempt to clear the jam message.
2. Check for obstructions in the paper path. View the event log to determine if other jam errors are occurring and troubleshoot those errors.
3. Check sensors and switches to isolate a faulty door switch or sensor.
 - a. From the home screen on the printer control panel, touch “[Support Tools](#)”.
 - b. Open the following menus:
 - [Troubleshooting](#)

- [Diagnostic Tests](#)
- [Manual Sensor Test](#)
- c. Select from the following tests:
 - [All Sensors](#) , [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#) (reset the selected sensor's state)
- d. Test the all sensors and switches to verify that they are functioning correctly.
- e. Replace parts as determined by sensor tests, damage, or obstructions.



NOTE: Before replacing any parts check **ALL** connectors on the DC controller.

13.60.Az

Paper stay jam inside inner rear door of the multi-bin mailbox (MBM). The paper is stopped ant the MBM entry sensor.

- **13.60.A0** Jam printing unknown output bin.
- **13.60.A1** Jam printing to output Bin 1.
- **13.60.A2** Jam printing to output Bin 2.
- **13.60.A3** Jam printing to output Bin 3.
- **13.60.A4** Jam printing to output Bin 4.
- **13.60.A5** Jam printing to output Bin 5.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the output device inner rear door.
 - b. Remove all paper found.
 - c. Close the output inner rear door.
 - d. Open the printer rear door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

 - f. Remove all paper found and then reinstall the fuser.
 - g. Close the printer rear door.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the output device inner rear door.
 - b. Remove all paper found.
 - c. Close the output devices inner rear door.
 - d. Open the printer rear door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

 - f. Remove all paper found and then reinstall the fuser.
 - g. Close the printer rear door.
2. If the issue persists, replace the inner cover bottom assembly.

Part number: RM2-1036-000CN

13.60.Dz

Paper delay jam inside inner rear door or the multi-bin mailbox (MBM). The paper did not reach the MBM entry sensor in the designated time.

- **13.60.D0** Jam printing unknown output bin.
- **13.60.D1** Jam printing to output Bin 1.
- **13.60.D2** Jam printing to output Bin 2.
- **13.60.D3** Jam printing to output Bin 3.
- **13.60.D4** Jam printing to output Bin 4.
- **13.60.D5** Jam printing to output Bin 5.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the output device inner rear door.
 - b. Remove all paper found.
 - c. Close the output device inner rear door.
 - d. Open the printer rear door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

 - f. Remove all paper found and then reinstall the fuser.

- g. Close the printer rear door.
- 2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the output device inner rear door.
 - b. Remove all paper found.
 - c. Close the output device inner rear door.
 - d. Open the printer rear door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

 - f. Remove all paper found and then reinstall the fuser.
 - g. Close the printer rear door.
2. Check the printer delivery assembly for obstructions or damage. Replace the printer delivery assembly as needed.
 Paper delivery assembly (LCD Simplex models) part number: RM2-4234-000CN
3. If the issue persists, replace the inner cover bottom assembly.
 Part number: RM2-1036-000CN

13.60.5z

“Paper is too short” jam inside inner rear door or the multi-bin mailbox (MBM).

- **13.60.51** A jam is detected when printing to output 1.
- **13.60.52** A jam is detected when printing to output Tray 2.
- **13.60.53** A jam is detected when printing from Tray 3.
- **13.60.54** A jam is detected when printing from Tray 4.
- **13.60.55** A jam is detected when printing from Tray 5.
- **13.60.5D** A jam is detected when printing from the duplexer.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the output device inner rear door.
 - b. Remove all paper found.
 - c. Close the output device inner rear door.
 - d. Open the printer rear door.

- e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

- f. Remove all paper found and then reinstall the fuser.
- g. Close the printer rear door.

2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the output device inner rear door.
 - b. Remove all paper found.
 - c. Close the output device inner rear door.
 - d. Open the printer rear door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

- f. Remove all paper found and then reinstall the fuser.
 - g. Close the printer rear door.
2. If the issue persists, replace the inner cover bottom assembly.

Part number: RM2-1036-000CN

13.60.6z

Inter page gap jam inside inner rear door or the multi-bin mailbox (MBM).

- **13.60.61** A jam is detected when printing to output 1.
- **13.60.62** A jam is detected when printing to output Tray 2.
- **13.60.63** A jam is detected when printing from Tray 3.
- **13.60.64** A jam is detected when printing from Tray 4.
- **13.60.65** A jam is detected when printing from Tray 5.
- **13.60.6D** A jam is detected when printing from the duplexer.

Recommended action for customers

1. Clear the paper jam.
 - a. Open the output device inner rear door.
 - b. Remove all paper found.
 - c. Close the output device inner rear door.

- d. Open the printer rear door.
- e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

- f. Remove all paper found and then reinstall the fuser.
- g. Close the printer rear door.

- 2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

- 1. Clear the paper jam.
 - a. Open the output device inner rear door.
 - b. Remove all paper found.
 - c. Close the output device inner rear door.
 - d. Open the printer rear door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

- f. Remove all paper found and then reinstall the fuser.
- g. Close the printer rear door.

- 2. If the issue persists, replace the inner cover bottom assembly.

Part number: RM2-1036-000CN

13.60.F0

Paper jam inside inner rear door of the multi-bin mailbox at power on.

Recommended action for customers

- 1. Clear the paper jam.
 - a. Open the output device inner rear door.
 - b. Remove all paper found.
 - c. Close the output device inner rear door.
 - d. Open the printer rear door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

- f. Remove all paper found and then reinstall the fuser.
- g. Close the printer rear door.

2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Clear the paper jam.
 - a. Open the output device inner rear door.
 - b. Remove all paper found.
 - c. Close the output device inner rear door.
 - d. Open the printer rear door.
 - e. Remove the fuser unit.

 **CAUTION:** The fuser might be hot.

- f. Remove all paper found and then reinstall the fuser.
 - g. Close the printer rear door.
2. If the issue persists, replace the inner cover bottom assembly.

Part number: RM2-1036-000CN

20.WX.YZ error messages

20.* errors

Errors in the 20.* family are related to the printer memory. The page might require more memory than the printer has available.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the **OK** button to continue.
2. Reduce the page complexity.
3. Add product memory.

20.00.00 Insufficient memory <device>

Event log message 20.00.00.

The printer does not have enough memory to print the page.

The printer received more data than can fit in the available memory. The customer might have tried to transfer too many macros, soft fonts, or complex graphics.

Recommended action

- Touch the **OK** button to print the transferred data. Some data might be lost. Reduce the page complexity or add printer memory.

21.00.00 Page Too ComplexEvent log error message 21.00.00.

The printer displays this message to indicate that the page decompression process was too slow for the printer.

Recommended action

- Touch the **OK** button to continue. There may be some data loss on the page that was being formatted when the error occurred.

32.WX,YZ error messages

32.* errors

Errors in the 32.* family are related to either product start events or to backup and restore events.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Retry the job.

32.08.A1, 32.08.A2, 32.08.A3

An event related to starting the printer.

[32.08.A1](#) (event code)

Shutdown event. Boot after abnormal shutdown.

[32.08.A2](#) (event code)

Boot from normal shutdown event.

[32.08.A3](#) (event code)

Regular boot event.

Recommended action

There is no action needed for this message.

- No action necessary.

32.1C.05

The restore job ticket was submitted with invalid credentials.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

32.1C.06 (event code)

The backup job ticket was submitted with invalid credentials.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

32.1C.07 (event code)

Backup restore permissions error.

There was an error during the creation, read, or write of the restore file.

Recommended action

Follow these troubleshooting steps in the order presented.

- Retry the job.

32.1C.08 (event code)

Not enough disk space to perform backup/restore, or a network share issue.

There was an error during the creation, read, or write of the backup file.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Retry the job.
2. Remove stored jobs and retry.
3. If the error persists, try using a larger capacity storage device for the share location and check the network share settings.
4. Check the network share or try setting up a new shared network drive or folder.

32.1C.09 (event code)

Tried to restore a backup file that was not valid for this printer.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

Recommended action

Follow these troubleshooting steps in the order presented.

- Use a valid backup file.

32.1C.0A (event code)

Backup file is invalid.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Use a valid backup file.
2. Reboot, and then observe the state of the printer.
3. If the error persists, perform a partition clean from the **Preboot** menu.

32.1C.0D (event code)

Backup/restore failed, auto-reboot failed, or the printer might be busy.

Recommended action

Follow these troubleshooting steps in the order presented.

- Reboot, and then retry the backup/restore.

32.1C.11 (event code)

Backup/restore time-out while communicating with the engine.

The backup operation was aborted because the printer is busy.

Recommended action

Follow these troubleshooting steps in the order presented.

- Wait until the printer is idle, and then try again.

32.1C.13, 32.1C.14

Not enough space exists to perform the backup.

The backup was aborted because the disk is at a critical level or full.

Scheduled backup failure.

Recommended action

Follow these troubleshooting steps in the order presented.

- Free up disk space, and then try again.

32.1C.15

The restore operation was aborted because the backup file was created by a previous version of firmware no longer supported by the feature.

Recommended action

Follow these troubleshooting steps in the order presented.

- Use the current backup file.

32.1C.2E

The restore operation was aborted because the printer is busy.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Wait until the printer is idle, and then retry.
2. Turn the printer off then on, and then retry.

32.1C.2F

Reset failure.

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn the printer off, and then on. Retry the job.

32.1C.40

The backup operation completed successfully (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.41

The backup operation encountered an error (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.42

The backup operation completed, but with a warning message (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.43

A component in the backup file is not supported by the current version of firmware and will not be restored (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.44

A component in the backup file is not transferable to another printer and will not be restored (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.45

Some data was not included in the backup file (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.46

An expected component could not be found and was thus not backed up. Because components should be known on backups, this code is a warning (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.47

Some data was not restored from the backup file (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.48

The backup job ticket was submitted using an invalid network path.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exists.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.

32.1C.49

The backup job ticket was submitted with a bad encryption.



NOTE: This would only apply to a web services call to perform a backup with a blank PIN

Recommended action

Follow these troubleshooting steps in the order presented.

- Verify that the encryption personal identification number (PIN) meets the restrictions for the printer.

32.1C.4A

An error occurred when creating the temporary directories used to store the backup files in transition to and from the compressed (ZIP) file.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Retry the job.
2. If this does not resolve the issue, turn the printer off then on again and retry the job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

32.1C.56

Reset aborted. Backup/restore in progress (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.57

Reset aborted (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.58

Unknown reset error (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.60

The restore operation completed successfully (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.61

The restore operation encountered an error.

Recommended action

Follow these troubleshooting steps in the order presented.

- Review the printer's event log to see specific details about the failure.

32.1C.62

The restore operation completed, but with a warning message.

Recommended action

Follow these troubleshooting steps in the order presented.

- Review the error log to see specific details about the failure.

32.1C.68

The restore job ticket was submitted using an invalid network path.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exist.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.
4. Check that the path includes the compressed .ZIP file name as part of the path.

32.1C.69

The restore job ticket was submitted with a bad encryption personal identification number (PIN).

Recommended action

Follow these troubleshooting steps in the order presented.

- Verify the encryption personal identification number (PIN) is the same PIN used to encrypt the backup file.

32.1C.6A

An error occurred when creating the temporary directories used to store the restore files in transition to and from the compressed (ZIP) file.

Recommended action

Follow these troubleshooting steps in the order presented.

- Retry the job.

32.1C.6D

An unusual error occurred when running the restore operation.

Recommended action

Follow these troubleshooting steps in the order presented.

- Retry the job.

33.WX.YZ error messages

33.* errors

Errors in the 33.* family are related to the printer's storage system or the formatter. The component might have been previously installed in another printer and is therefore locked to that other printer. Or, the component might be incorrect for this printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, investigate if the solid state drive (SSD) or hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original SSD/HDD and/or formatter, and then turn the printer on.
3. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer and contact your HP-authorized service or support provider, or contact customer support at <http://www.hp.com/go/contactHP>.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the issue persists, investigate if the solid state drive (SSD) or hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original SSD or HDD and/or formatter, and then turn the printer on.
3. If the formatter/SSD or HDD were recently replaced and the original is unavailable verify the correct formatter/SSD or HDD are installed by referencing the part numbers.
4. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer. Reference support content for the specific error and take the necessary action.
5. If the error cannot be cleared and you are unable to get the complete error code from the printer, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

6. If the error persists, download and from the **Preboot** menu install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

7. If the error persists, elevate the case using the Standard Support Process.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the issue persists, investigate if the solid state drive (SSD) or hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original SSD or HDD and/or formatter, and then turn the printer on.
3. If the formatter/SSD or HDD were recently replaced and the original is unavailable verify the correct formatter/SSD or HDD are installed by referencing the part numbers.
4. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer. Reference support content for the specific error and take the necessary action.
5. If the error cannot be cleared and you are unable to get the complete error code from the printer, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

6. If the error persists, download and from the **Preboot** menu install the latest version of printer firmware.
Go to [HP FutureSmart - Latest Firmware Versions](#).
For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).
7. If the error persists, elevate the case using the Standard Support Process.

33.01.xx

A save or restore process has occurred.

- **33.01.01** (event code)

A restore process has occurred.

- **33.01.02** (event code)

A save process has occurred.

- **33.01.03** (event code)

Save recover functionality OK after previously being disabled.

Recommended action

See recommended action.

- No action necessary.

33.02.01 Used board/disk installed

Used board or disk installed.

An encrypted board or disk with existing data previously locked to a different printer has replaced the original. If you continue, data is permanently lost.

 **IMPORTANT:** Do not install used formatter boards in HP LaserJet, HP PageWide Enterprise or Managed printers. Only replace the formatter when specifically directed to do so during troubleshooting using the Control Panel Message Document (CPMD). If you see the 33.02.01 event code, it means a used board has been installed, and the settings may be incorrect.

For more information go to, or search for: [HP LaserJet Enterprise, HP LaserJet Managed, HP PageWide Enterprise, HP PageWide Managed - 33.02.01 error or printer name and/or product number changes after replacing the formatter](#) (c06360930).

Recommended action

 **NOTE:** Used formatter boards should NEVER be installed in HP LaserJet or HP PageWide Enterprise or Managed printers. The formatter should only be replaced if directed during troubleshooting using the Control Panel Message Document (CPMD). The 33.02.01 event code indicates that a used board has been installed and that the parameters might be incorrect. For more information see [HP LaserJet Enterprise, HP LaserJet Managed, HP PageWide Enterprise, HP PageWide Managed - 33.02.01 error or printer name and/or product number changes after replacing the formatter](#) (c06360930).

1. If the firmware has just been upgraded, see: [HP FutureSmart - '33.02.01 Used board/disk installed' error received after updating the firmware from HP FutureSmart 4.8.1 or 4.9 to a newer version](#)
2. Update the printer firmware to the latest firmware version.
3. Press **OK** on the control panel or remotely by using the new Remote Control Panel feature in the Embedded Web Server. The printer will return to a ready state.
4. If the issue persists, reinstall the used board or disk into its original printer.
5. To save the data on the board or disk, turn the printer off. Replace the board or disk with another board or disk.
6. To delete the data on the board or disk and continue, touch the **OK** button.

33.02.02

Save Recover Status Error

The save or recover is disabled, (one or both disabled) (**Event Log Only**)

Recommended action

There is no action needed for this message.

- No action necessary.

33.03.02

Data size mismatch. Unable to recover DCC NVRAM.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agent

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the DC Controller PCA.



NOTE: Make sure to order the correct part number for the printer model.

Table 6-13 DC Controller part numbers

Description	Part number
DC Controller PC board assembly For printer models: M607/M608/M609/E60055/E60065/ E60075	RM2-9494-000CN
DC Controller For printer models: M610/M611/M612	RM3-8461-000CN
DC Controller PCA For printer models: E60155/ E60165/ E60175	RM3-7619-000CN

For DC Controller removal and replacement instructions: *DC Controller PCA* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the connectors from the DC controller are seated correctly.
3. If the error persists, replace the DC Controller PCA.



NOTE: Make sure to order the correct part number for the printer model.

Table 6-14 DC Controller part numbers

Description	Part number
DC Controller PC board assembly For printer models: M607/M608/M609/E60055/E60065/ E60075	RM2-9494-000CN

Table 6-14 DC Controller part numbers (continued)

Description	Part number
DC Controller	RM3-8461-000CN
For printer models: M610/M611/M612	
DC Controller PCA	RM3-7619-000CN
For printer models: E60155/ E60165/ E60175	

For DC Controller removal and replacement instructions: *DC Controller PCA* See the Repair Service Manual for this product.

33.03.03 Incompatible formatter installed.

This is an EFI BIOS event to prevent booting with the wrong formatter installed.

Recommended action

- Turn the printer off, and then install the correct formatter in the printer.

 **NOTE:** If it is believed that this formatter is the correct part number and model for this printer, install a replacement formatter, and then return the formatter in question to HP for evaluation.

33.03.05 EFI Boot error

EFI BIOS event showing that a replacement formatter Recover attempt was unsuccessful.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-agent

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the error persists, ensure to use the **Backup/Restore** feature to save the printer settings, and then perform a **Partial Clean** procedure using the **Preboot** menu.

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the “1/8” under the logo.
- c. Use the arrow buttons to highlight **Administrator**, and then press the **OK** button.

- d. Use the arrow buttons to highlight **Partial Clean**, and then press the **OK** button.
- e. Press the **OK** button again.
- f. Press or touch the Home button to return to the main Pre-boot menu and highlight **Continue**, and then press the **OK** button.

The printer will automatically reboot and should return to a Ready state.

For detailed instructions to perform a Partial Clean procedure, go to: [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#) (c03398779).

3. If the error persists, download and install the latest printer firmware available at [HP Customer Support - Software and Driver Downloads](#) (<https://support.hp.com/drivers>).

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware*.

4. If the error persists, replace the formatter.

Table 6-15 Formatter part numbers

Description	Part number
Formatter (main logic) PC board assembly For printer models: M608x/M609x	K0Q14-60001
Formatter (main logic) PC board assembly For printer models: M607n/dn, M608n/dn, M609n/dn, M610/M611/M612/E60055/E60065/E60075	K0Q14-60002
Formatter For printer models: M611x/M612x (India/China)	7PS81-67901
Formatter For printer models: M611x/M612x	7PS81-67902
Formatter For printer models: M610n/dn, M611n/dn, M612n/dn (India/China)	7PS81-67905
Formatter For printer models: M610n/dn, M611n/dn, M612n/dn	7PS81-67906
Formatter (main logic) PC board assembly For printer models: E60155/ E60165/ E60175	3GY09-67902
Kit- Formatter For printer models: E60155/ E60165/ E60175 (India/China)	3GY09-67903

For instructions to remove and replace the formatter: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.

2. If the error persists, remove and reinstall the formatter.
3. If the error persists, ensure to use the **Backup/Restore** feature to save the printer settings, and then perform a **Partial Clean** procedure using the **Preboot** menu.

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the “1/8” under the logo.
- c. Use the arrow buttons to highlight **Administrator**, and then press the **OK** button.
- d. Use the arrow buttons to highlight **Partial Clean**, and then press the **OK** button.
- e. Press the **OK** button again.
- f. Press or touch the Home button to return to the main Pre-boot menu and highlight **Continue**, and then press the **OK** button.

The printer will automatically reboot and should return to a Ready state.

For detailed instructions to perform a Partial Clean procedure, go to: [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#) (c03398779).

4. If the error persists, download and install the latest printer firmware available at [HP Customer Support - Software and Driver Downloads](#) (<https://support.hp.com/drivers>).

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware*.

5. If the error persists, replace the formatter.

 **IMPORTANT:** Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

Table 6-16 Formatter part numbers

Description	Part number
Formatter (main logic) PC board assembly	K0Q14-60001
For printer models: M608x/M609x	
Formatter (main logic) PC board assembly	K0Q14-60002
For printer models: M607n/dn, M608n/dn, M609n/dn, M610/M611/M612/E60055/E60065/E60075	
Formatter	7PS81-67901
For printer models: M611x/M612x (India/China)	
Formatter	7PS81-67902
For printer models: M611x/M612x	
Formatter	7PS81-67905
For printer models: M610n/dn, M611n/dn, M612n/dn (India/China)	

Table 6-16 Formatter part numbers (continued)

Description	Part number
Formatter	7PS81-67906
For printer models: M610n/dn, M611n/dn, M612n/dn	
Formatter (main logic) PC board assembly	3GY09-67902
For printer models: E60155/ E60165/ E60175	
Kit- Formatter	3GY09-67903
For printer models: E60155/ E60165/ E60175 (India/China)	

For instructions to remove and replace the formatter: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

6. If the error persists, elevate the issue using the Standard Support Process.

33.03.06

The memory PCA was not detected on startup.

Recommended action

1. Turn the printer off, and then on again.
2. If the error persists, turn the printer off, disconnect the power cord, and remove the formatter cover. Press firmly on the memory PCA cable connection to the formatter.
3. If the error persists, replace the memory PCA assembly.

Part number: RM2-7645-000CN

33.04.01 Missing TPM

A Trusted Platform Module is missing from a printer that previously had a TPM installed.

TPM accessory (optional): This system is using a TPM module installed as an accessory to protect data and it is not present. The original TPM must be returned or you can select the [Stop Using](#) option in the preboot TPM sub-menu. All data will be cryptographically erased and a reload of firmware from USB might be required.

TPM Standard (Standard on product): This system is using a TPM module installed at the factory to protect data and it is not present. Verify that the TPM is seated firmly on the formatter, in case of shifting during shipment. If the TPM has been removed for a formatter replacement, put the original TPM on the board. If the original TPM cannot be reinstalled or has become damaged, **DO NOT** replace any parts. Replace the printer.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Reinstall the missing TPM module into the printer.



NOTE: If the TPM accessory was installed, you can also go to the [Administration](#) menu and under TPM, select the [Stop Using](#) option if you no longer want to use the TPM accessory.

3. Restart the printer.

33.04.02 Missing TPM

The wrong TPM is installed on a printer that previously had a different TPM installed.

TPM Optional device: This system is using a TPM module to protect data and it is not present. The original TPM module must be returned or you may select the **Stop Using** option in the preboot TPM sub-menu.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Reinstall the original TPM module into the printer.
3. Restart the printer.
4. Go to the [Administration](#) menu and under TPM and select the [Enable and Use](#) option.



NOTE: To no longer use the TPM device, go to the [Administration](#) menu and under TPM and select the [Stop Using](#) option.

33.04.03 Unknown TPM

A used TPM has been installed on a printer that has not previously had a TPM installed.

TPM Optional device: This system is using a TPM module to protect data and it is not present. The TPM module currently installed is used to protect data in another device. The original TPM module must be returned or you can start using this TPM module by selecting the [Enable and Use](#) option in the preboot TPM sub-menu. You can also stop using a TPM altogether.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and remove the TPM module. The printer will not be protected.
2. If choosing to protect the printer with the used TPM, refer to the "Install a new or re-enable an existing TPM after disabling a previous TPM" section of the <http://h10032.www1.hp.com/ctg/Manual/c04499622> (c04499622).

33.04.05

TPM (Trusted Platform Module) Security Error

This system contains a TPM module that is not supported on the device or belongs to another device.

TPM is unique for each device.

For units that shipped with a TPM on board standard (most newer models): If the original TPM installed in the factory is unavailable or damaged, DO NOT replace any parts. Follow the recommended action.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order they are listed.

The technician will need to re-establish the trusted platform module state in the printer.



NOTE: Never replace the TPM on a unit that shipped with one. The TPM that can be ordered is only available for adding a level of security on a device that never had a TPM paired from the factory. A new TPM cannot be installed for security reasons.

1. Do **not** replace the formatter or HDD. It will not solve this issue.
2. Perform a Format Disk procedure, select **Continue** in the Pre-boot menu, and then reboot the device.
 - If the unit boots to a 33.04.05 error, reseal the eMMC or HDD.
 - If the unit continues to boot to a 33.04.05 error, continue to the next step.
3. Perform a Format Disk procedure again, and then reboot the device.
 - If the unit boots to a 99.09.67 error, reboot the device, and then update the firmware. This should resolve the issue.
 - If the unit continues to boot to a 33.04.05 error, continue to the next steps.
4. Remove the TPM and eMMC or HDD, open **Startup Options**, and then perform a Cold Reset.



WARNING! When removing the TPM, take extreme care as the connector on the TPM board can become dislodged and break. If this happens, a printer replacement will be required.

5. Reinstall the eMMC or HDD, open the Pre-boot menu, select **Manage Disk**, select **Boot Device**, and then select **Erase Unlock**.
 - If unit boots to a 99.09.67 error, reboot the device, and then update the firmware. This should resolve the issue.
 - If the unit continues to boot to a 33.04.05 error, continue to the next step.
6. Reseat the TPM and eMMC or HDD, perform a Format Disk, open Diagnostics, and then run diagnostics for all components.
 - If the Diagnostics fail, elevate the case to ATS and include all details.
 - If Diagnostics passes, continue to the next steps.
7. Remove the TPM and eMMC or HDD, open **Startup Options**, and then perform a Cold Reset.
8. Reinstall the eMMC or HDD, open the Pre-boot menu, select **Manage Disk**, select **Boot Device**, select **Erase Unlock**, and then reboot the device.
 - If the unit boots to a 99.09.67 error, reboot and then update the firmware. This should resolve the issue.
 - If the unit continues to boot to a 33.04.05 error, continue to the next step.

9. Include the following information in the CDAX case notes, and then elevate the case to ATS. No additional feedback is needed.



NOTE: Ensure that all original printer parts are installed on the unit at the time of elevation.

- Printer serial number.
- Collect the Diagnostic log file (.jdp file).
- Information when the 33.04.05 error displayed on the printer control panel.
- Parts replaced prior to the error displaying on the printer control panel.

33.05.0z SureStart errors

A SureStart error has occurred.

The printer detected and recovered from a corrupted version of BIOS.

- **33.05.01** Boot code corrupt (event code)
- **33.05.02** Boot code corrupt (event code)
- **33.05.03** Boot code corrupt (event code)

The newly downloaded firmware failed to cryptographically validate the BIOS code.

- **33.05.04** Security alert
- **33.05.04** Upgrade corrupt (event code)
- **33.05.05** Security alert
- **33.05.05** Boot code corrupt (event code)
- **33.05.06** Security alert
- **33.05.06** Upgrade corrupt (event code)
- **33.05.07** Security alert
- **33.05.07** Upgrade corrupt (event code)
- **33.05.08** Invalid boot attempt (event code)
- **33.05.09** Downgrade attempted (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- **For 33.05.01, 33.05.02, and 33.05.03 errors:** No action is necessary.
- **For all other errors:** Download a firmware bundle to the printer from the Preboot menu.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)



NOTE: For more information on SureStart, search for: "SureStart Whitelisting and Intrusion Detection Troubleshooting Manual" (c04863614) [or, Click here: HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#).

33.05.1x Whitelisting errors

An error occurred with a firmware file digital signature or an error with the certificate used to validate the firmware file certificate.

- **33.05.10** Security alert
- **33.05.10** Firmware verification Error: XX (Event code)
- **33.05.11** Security alert
- **33.05.11** Firmware verification Error: XX (Event code)
- **33.05.12** Security alert
- **33.05.12** Firmware verification Error: XX (Event code)

Recommended action

Follow these troubleshooting steps in the order presented.

1. Perform a [Format Disk](#) procedure.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

2. If the device does not reboot to [Ready](#), download a firmware bundle to the device from the Preboot menu.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)



NOTE: Performing a Format Disk procedure is required before downloading a firmware bundle.

For more information on SureStart, go to: (Doc ID: c04863614). [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#)

33.05.2x Intrusion detection errors

The intrusion detection system has encountered an error.

The intrusion detection memory process determined an unauthorized change in system memory.

- **33.05.21** Security alert
- **33.05.21** Potential intrusion (Event code)

The intrusion detection memory process heartbeat was not detected.

- **33.05.22** Security alert
- **33.05.22** Cannot scan for potential intrusions (Event code)

The intrusion detection memory process did not initialize.

- **33.05.23** Security alert
- **33.05.23** Intrusion detection not initialized (Event code)
- **33.05.24** Intrusion detection initialization error (Event code)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.



NOTE: Selecting [Continue](#) from the Preboot menu will not resolve the error. The printer must be turned off, and then on to clear the error allowing the printer to reboot to a [Ready](#) state.

Information on the Intrusion Detection error.

For more information on SureStart, go to: [HP SureStart - Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

33.05.5z Intrusion detection errors

The intrusion detection system has encountered an error.

The intrusion detection memory process determined an unauthorized change in system memory.

- **33.05.51** Security alert
- **33.05.51** Potential intrusion (Event code)

The intrusion detection memory process heartbeat was not detected.

- **33.05.52** Security alert
- **33.05.52** Cannot scan for potential intrusions (Event code)

The intrusion detection memory process did not initialize.

- **33.05.53** Security alert
- **33.05.53** Intrusion detection not initialized (Event code)
- **33.05.54** Intrusion detection initialization error (Event code)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.



NOTE: Selecting **Continue** from the Preboot menu will not resolve the error. The printer must be turned off, and then on to clear the error allowing the printer to reboot to a **Ready** state.

Information on the Intrusion Detection error.

For more information on SureStart, go to: [HP SureStart - Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

33.06.01

The firmware is not able to detect the correct memory chip on the formatter.

This issue occurs because the wrong formatter was installed in the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Remove the formatter that was installed and reinstall the original or order the correct formatter for the printer.
3. Reinstall all the parts including HDD/eMMC, TPM and any additional accessories.
4. Reload firmware from a USB stick using the pre-boot menu if necessary.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

40.WX.YZ error messages

40.* errors

Errors in the 40.* family are related to input/output accessories, such as USB storage devices, Jetdirect cards, or EIO cards or on-board network functions.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the **OK** button to clear the error.
2. Remove and then reinstall the accessory.

40.00.01 USB I/O buffer overflow To continue, touch “OK”

The USB buffer has overflowed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to print the transferred data (some data might be lost).
2. Check the host configuration.

40.00.02 Embedded I/O buffer overflow To continue, touch “OK”

The product has experienced a JetDirect buffer overflow.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to print the transferred data (some data might be lost).
2. Check the host configuration.

40.00.03 EIO [x] buffer overflow To continue, touch “OK”

Too much data was sent to the EIO card in the specified slot (x). An incorrect communications protocol might be in use.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to print the transferred data (some data might be lost).

40.00.04 EIO [x] bad transmission To continue, touch “OK”

The connection between the product and the USB device has been broken.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to clear the error message and continue printing.
2. Remove, and then reinstall the USB device.

40.00.05 Embedded I/O bad transmission To continue, touch OK

The USB device has been removed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to clear the error message (data will be lost).
2. Install the USB device.

40.08.0x USB storage accessory removed

The USB storage accessory has been removed.

x = 0 or 1; information code.

Secure file erase is enabled.

Recommended action

See recommended action.

- No action necessary.

40.0x.05 USB storage accessory removed

The USB storage accessory was removed.

x = 1, 2, 3, 5, or 6; information code.

Recommended action

See recommended action.

- No action necessary.

40.80.04 Failed to read NVRAM

Cannot read contract-requested value from NVRAM

Either the value was not populated or NVRAM was unreadable

Recommended action

- Turn printer off, and then on.

41.WX.YZ error messages

41.01.YZ

Event log error message: 41.01.YZ.

An unknown misprint error occurred on the printer.

Y = Type, Z = Tray

- Y = 0: Photo Paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light Paper 1, 2, or 3 mode
- Y = 4: Heavy Paper 1
- Y = 5: Heavy Paper 2
- Y = 6: Heavy Paper 3
- Y = 7: Glossy Paper 1
- Y = 8: Glossy Paper 2
- Y = 9: Glossy Paper 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = 0: From unknown tray
- Z = 1: From Tray 1
- Z = 2: From Tray 2
- Z = 3: From Tray 3
- Z = 4: From Tray 4
- Z = 5: From Tray 5
- Z = 6: From Tray 6
- Z = 7: From Tray 7
- Z = 8: From Tray 8
- Z = 9: From Tray 9

- Z = D: From duplex

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. If the error is not cleared, turn off the printer, and then turn on the printer.
3. If the error persists, attempt to remove and reinstall the toner cartridge.



IMPORTANT: Ensure that the printer is using genuine HP supplies.

- a. Press the cartridge door release button to open the door.
- b. Pull out the cartridge drawer.
- c. Grasp the handle of the toner cartridge and pull it up to remove the toner cartridge from the printer.
- d. Check if genuine HP toner cartridges are installed.

A genuine HP toner cartridge has the word “HP” on it, or has the HP logo on it. For more information on identifying HP cartridges go to <http://www.hp.com/go/learnaboutsupplies>.

- e. Insert the toner cartridge in the cartridge drawer.
 - f. Close the toner cartridge drawer.
 - g. Close the cartridge door.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agent

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. Touch **OK** to use another tray.
3. If the error is not cleared, turn off the printer, and then turn on the printer.
4. If the error persists, reseal the toner cartridge.



IMPORTANT: Ensure that the printer is using genuine HP supplies.

- a. Press the cartridge door release button to open the door.
- b. Pull out the cartridge drawer.
- c. Grasp the handle of the toner cartridge and pull it up to remove the toner cartridge from the printer.
- d. Check if genuine HP toner cartridges are installed.

A genuine HP toner cartridge has the word “HP” on it, or has the HP logo on it. For more information on identifying HP cartridges go to <http://www.hp.com/go/learnaboutsupplies>.

- e. Insert the toner cartridge in the cartridge drawer.

- f. Close the toner cartridge drawer.
 - g. Close the cartridge door.
5. If the error persists, replace the laser/scanner assembly.

Table 6-17 Laser scanner assembly part number

Description	Part number
Laser scanner assembly	RM2-0906-000CN

For instructions to remove and replace the laser scanner assembly: *Removal and replacement: Laser/scanner assembly* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. Touch **OK** to use another tray.
3. If the error is not cleared, turn off the printer, and then turn on the printer.
4. If the error persists, reseal the toner cartridge.



IMPORTANT: Ensure that the printer is using genuine HP supplies.

- a. Press the cartridge door release button to open the door.
- b. Pull out the cartridge drawer.
- c. Grasp the handle of the toner cartridge and pull it up to remove the toner cartridge from the printer.
- d. Check if genuine HP toner cartridges are installed.

A genuine HP toner cartridge has the word “HP” on it, or has the HP logo on it. For more information on identifying HP cartridges go to <http://www.hp.com/go/learnaboutsupplies>.

- e. Insert the toner cartridge in the cartridge drawer.
 - f. Close the toner cartridge drawer.
 - g. Close the cartridge door.
5. Inspect the toner cartridge high-voltage contacts are clean and not damaged.
 6. If the error persists, check the wire harness from the laser scanner to the DC controller is seated correctly.
 7. If the error persists, replace the laser/scanner assembly.

Table 6-18 Laser scanner assembly part number

Description	Part number
Laser scanner assembly	RM2-0906-000CN

For instructions to remove and replace the laser scanner assembly: *Removal and replacement: Laser/scanner assembly* See the Repair Service Manual for this product.

8. Replace the DC controller PCA.



NOTE: Make sure to order the correct part number for the printer model.

Table 6-19 DC Controller part numbers

Description	Part number
DC Controller PC board assembly	RM2-9494-000CN
For printer models: M607/M608/M609/E60055/E60065/E60075	
DC Controller	RM3-8461-000CN
For printer models: M610/M611/M612	
DC Controller PCA	RM3-7619-000CN
For printer models: E60155/ E60165/ E60175	

For removal and replacement instructions: *DC Controller PCA* See the Repair Service Manual for this product.

41.02.00 Error

A beam detected misprint error occurred.

Recommended action

1. To clear the error message, touch **OK**.
2. If the error persists, turn the printer off, and then on.
3. If the error returns, check the wire harness from the laser/scanner to the DC controller.
4. Check the following connectors on DC controller J126 and J127.
5. If the error persists, replace the laser/scanner assembly.

Part number: RM2-0906-000CN

For instructions: *Removal and replacement: Laser/scanner assembly* See the Repair Service Manual for this product.

41.03.FZ Unknown Misprint Error

This is a general misprint error. Either the paper is loaded off-center with the guides in the tray, or a paper width sensor failure occurred from an unknown tray.

The error will be one of the following:

- **41.03.F0**
- **41.03.F1**
- **41.03.F2**

- 41.03.F3
- 41.03.F4
- 41.03.F5
- 41.03.FD

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Remove the paper and the reload the tray. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
2. Try the print job again. Watch the paper tray feed mechanism to see if it is functioning correctly.
3. If the error persists, print a Configuration Page and note the paper size for the tray in question.
4. If the size is not reported correctly, run the tray size sensor test.
 - a. From the home screen on the printer control panel, touch “Support Tools”.
 - b. Open the following menus:
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - c. Select from the following tests:
 - All Sensors , Engine Sensors
 - Done (return to the Troubleshooting menu)
 - Reset (reset the selected sensor’s state)
 - d. Test the failing tray paper size sensors.
 - e. If the tray size sensors test passes, check the back of the paper cassette for damage and ensure that when the tray guides are moved the sensors windows on the backside of the tray change. If the tray is damaged, replace the paper tray.

Tray 2 part number: RM2-6766-000CN

For instructions: *Removal and replacement: Tray 2 cassette* See the Repair Service Manual for this product.

Tray 3, 4 or 5 550 optional paper feeder part number: RM2-0866-000CN

- f. If the tray size sensors test fails, check the cable connections between the tray size sensor and the DC Controller.
- g. If the cable connections are plugged in correctly and the cables are not damaged, replace the tray size sensor assembly for the failing tray.

Tray 2 and tray 3,4 or 5 550 optional paper feeder part number: RM2-1255-000CN

Tray 3 2,100 sheet feeder part number: RM2-1162-000CN

5. If the error persists, replace the DC Controller.

DC Controller part numbers:

RM2-9494-000CN (M607/M608/M609/E60055/E60065/E60075)

RM3-7619-000CN (E60155/E60165/E60175)

RM3-8461-000CN (M610/M611/M612)

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

41.03.A2 Unexpected size in tray 2

Size mismatch. Detected media too long from Tray 2



NOTE: If using adhesive or self-sealing media, please see the instructions in *A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.* (ish_3199741-3199797-16).

Recommended action for customers

1. Touch **OK** to use another tray.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.




NOTE: For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

3. Print a configuration page to verify the size and type the trays are set to.

4. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-118 Tray 2 paper guides

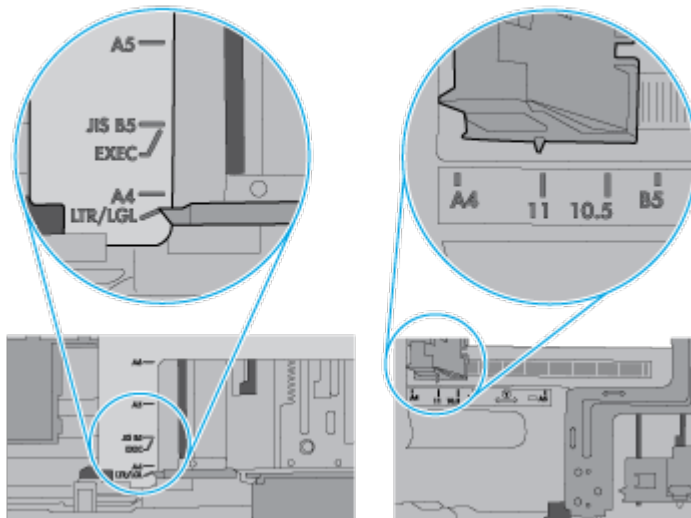

5. Ensure that the paper tray meets the tray capacity specifications or the stack of paper in the tray is not above the fill mark (line below the three triangles) as indicated in the image.

Figure 6-119 Paper height guides

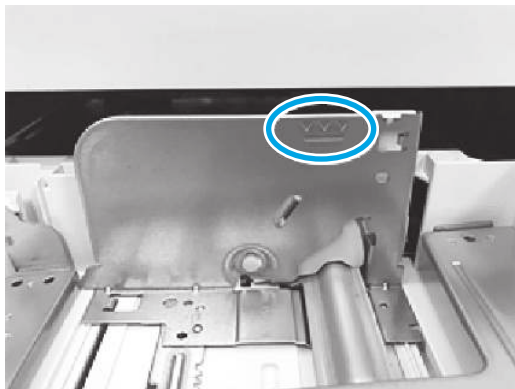


Figure 6-120 Overfilled tray



Figure 6-121 Stack of paper not overfilled in Tray 2



6. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
7. If the paper is jammed, ensure it is completely removed.
8. Verify that the toner cartridge and the transfer roller are seated correctly.
9. Ensure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear.
 - a. Check if the rollers are installed correctly.

Figure 6-122 Pick roller not locked in

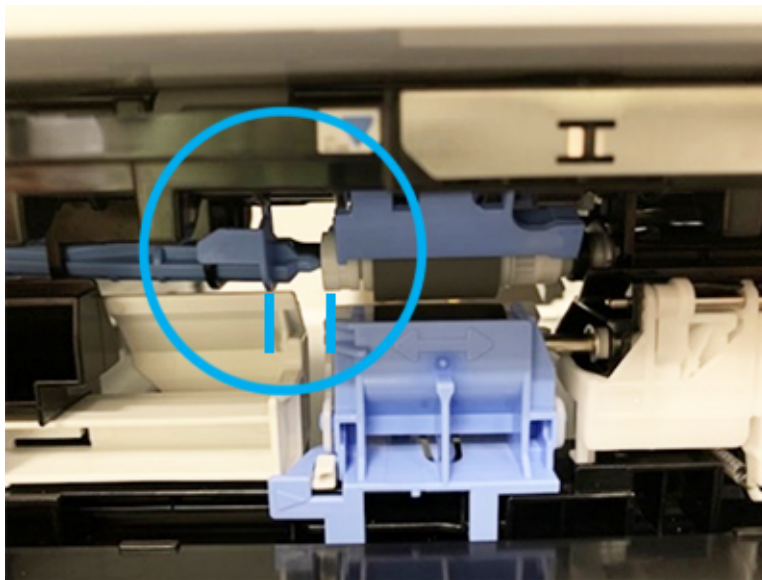


Figure 6-123 Separating roller not installed correct



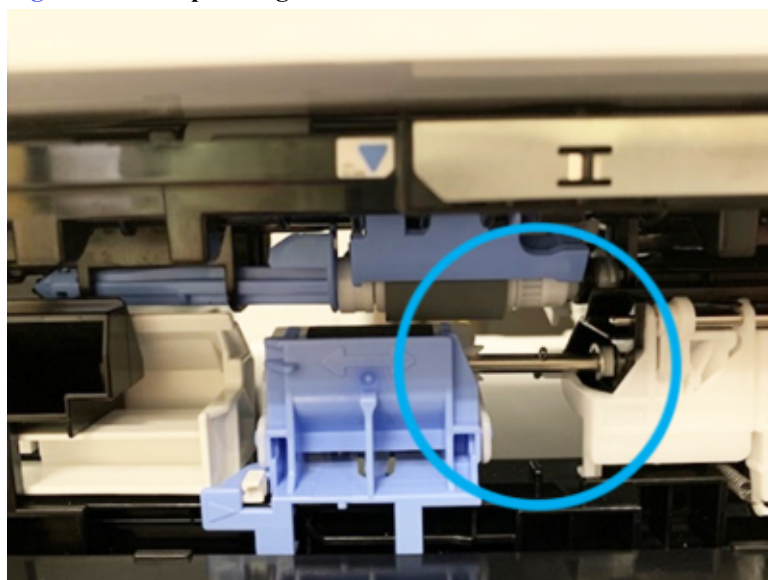


Figure 6-124 Separation roller not install and locked in correctly

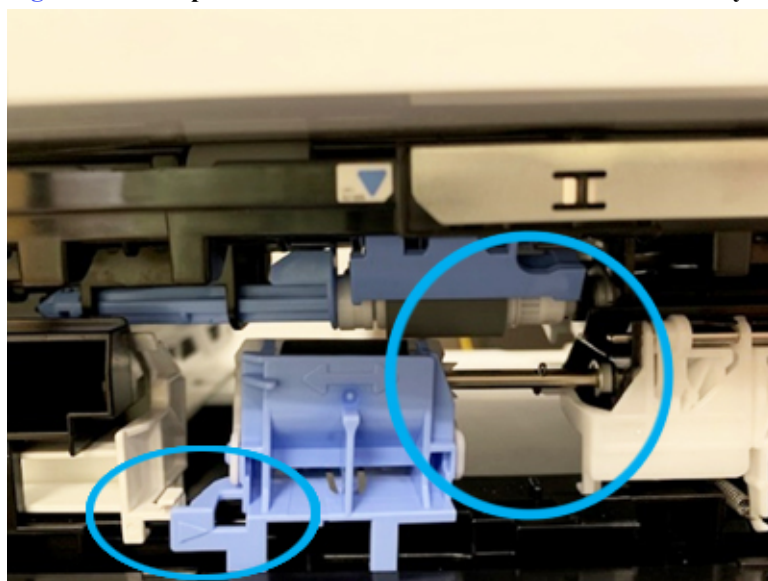

- b. If either roller is installed incorrectly, make sure to install it correctly as shown here.

Figure 6-125 Rollers installed correctly

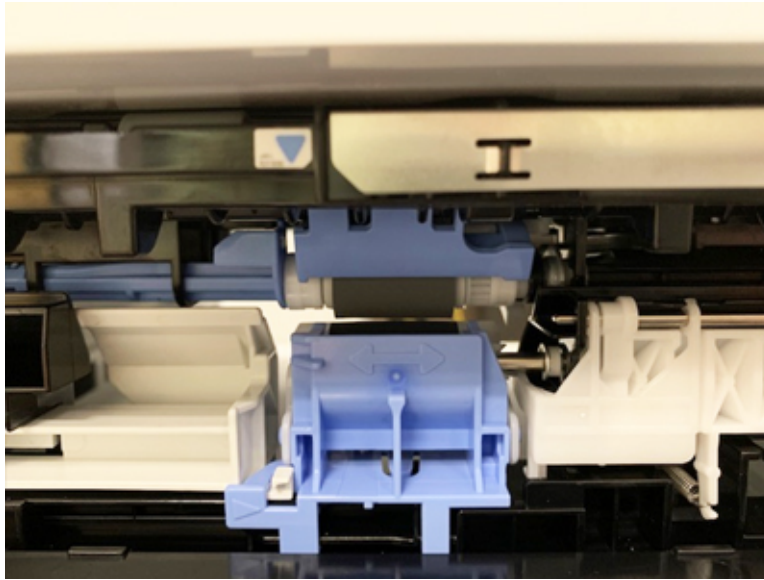

- c. If the rollers are dirty, clean the rollers.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

- d. If the error persists even after checking the rollers, replace the rollers.

Tray 2-x roller assembly part number: J8J70-67906

For instructions: *Removal and replacement: Tray 2-x roller kit* See the Repair Service Manual for this product.

- 10. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Touch **OK** to use another tray.
2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.




NOTE: For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

3. Print a configuration page to verify the size and type the trays are set to.

4. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-126 Tray 2 paper guides

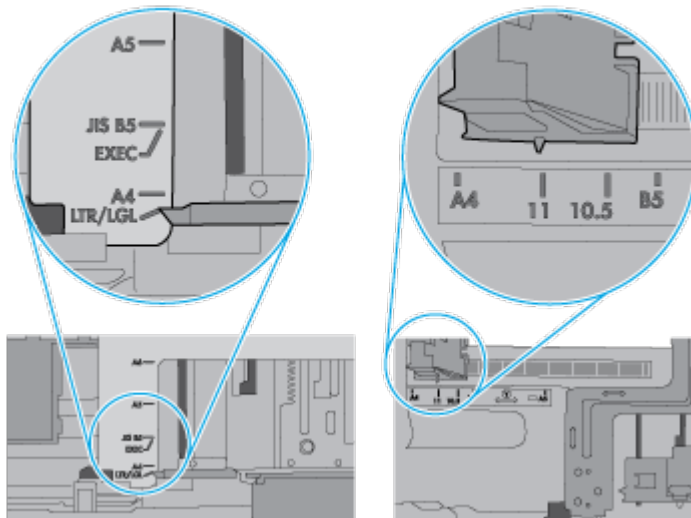

5. Ensure that the paper tray meets the tray capacity specifications or the stack of paper in the tray is not above the fill mark (line below the three triangles) as indicated in the image.

Figure 6-127 Paper height guides

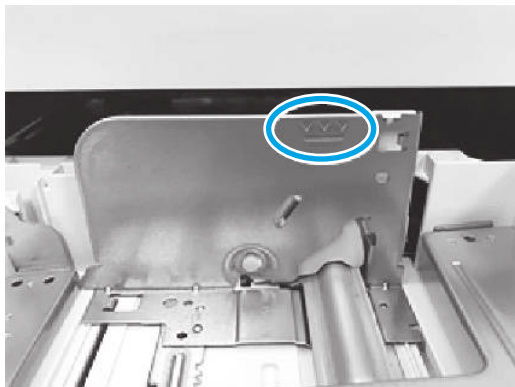


Figure 6-128 Overfilled tray

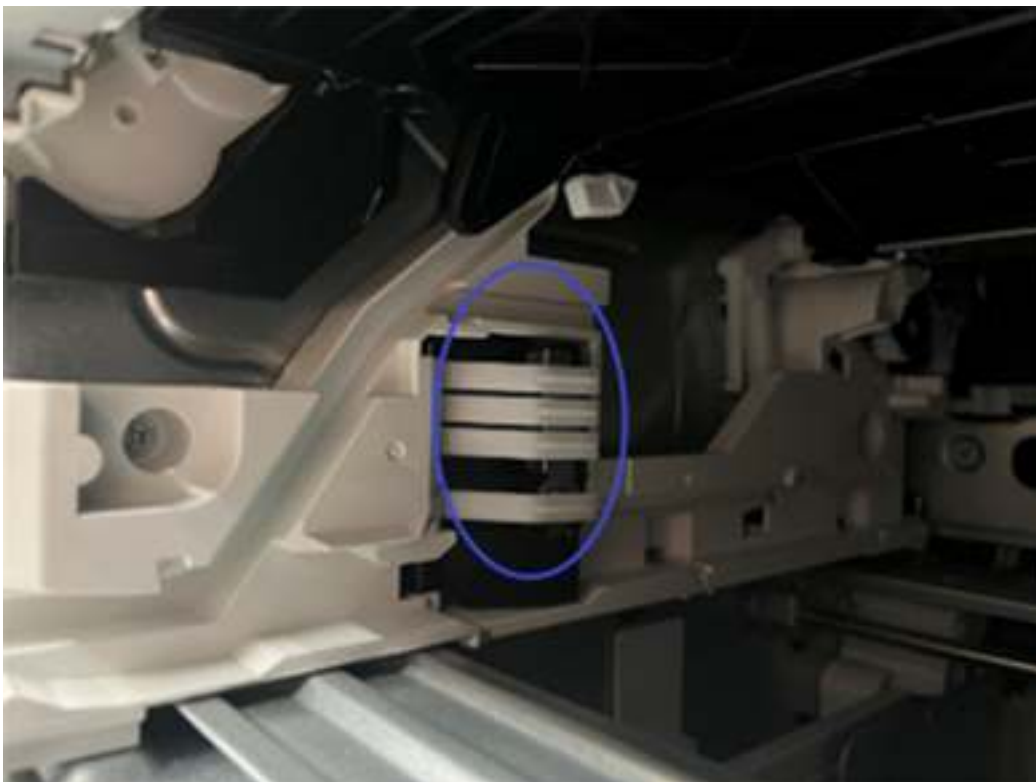


Figure 6-129 Stack of paper not overfilled in Tray 2



6. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
7. If the paper is jammed, ensure it is completely removed.
8. Verify that the toner cartridge and the transfer roller are seated correctly.
9. Remove tray 2, and check that the paper size detect assembly is not damaged or missing white flags.

Figure 6-130 Paper size detect assembly




If the paper size detect is damaged or missing the white sensor fingers, replace the assembly.

Size detect assembly part number: RM2-1255-000CN

10. While the tray is removed, inspect the size paper size fingers on the right side of the tray.

Figure 6-131 Paper tray fingers

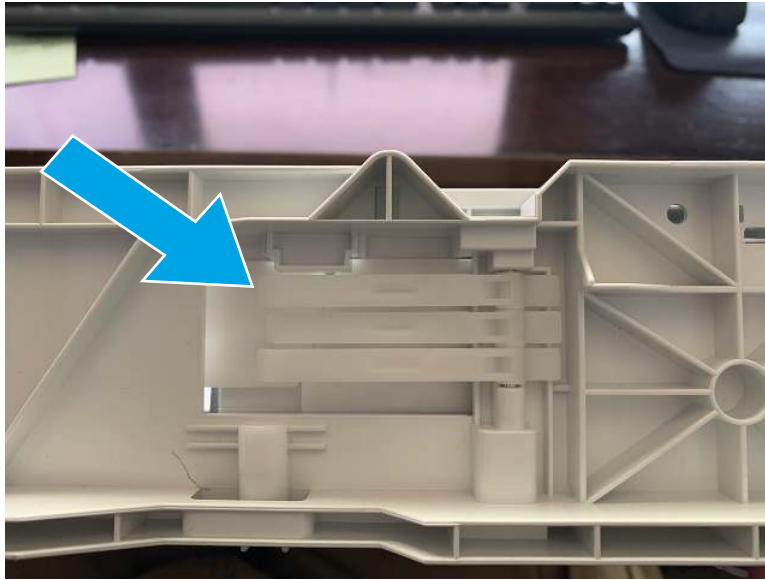

If they are damaged or missing, replace the tray.

Cassette assembly part number: RM2-6766-000CN

11. Ensure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear.
 - a. Check if the rollers are installed correctly.

Figure 6-132 Pick roller not locked in

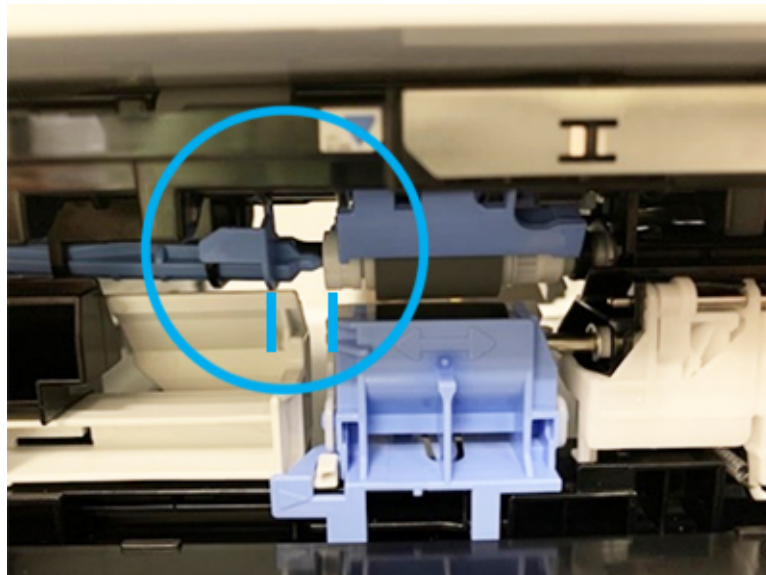


Figure 6-133 Separating roller not installed correct



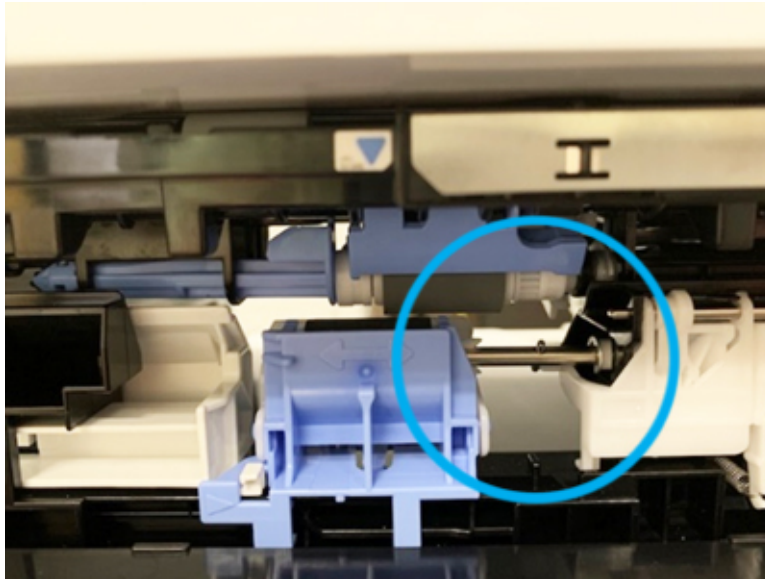


Figure 6-134 Separation roller not install and locked in correctly

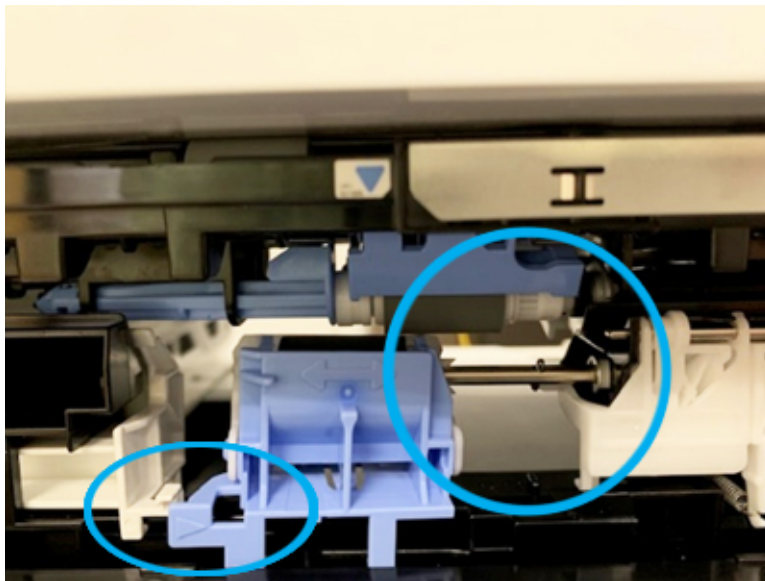

- b. If either roller is installed incorrectly, make sure to install it correctly as shown here.

Figure 6-135 Rollers installed correctly

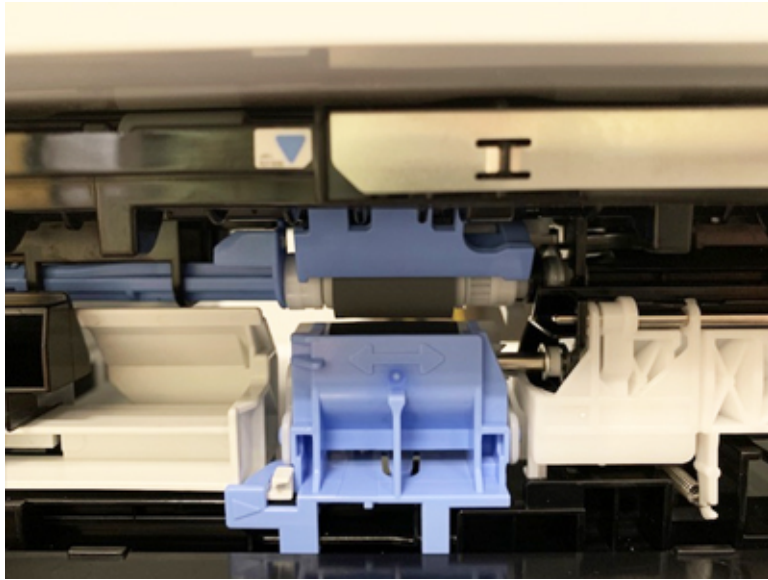

- c. If the rollers are dirty, clean the rollers.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

- d. If the error persists even after checking the rollers, replace the rollers.

Tray 2-x roller assembly part number: J8J70-67906

- 12. If the error persists, replace the registration assembly.

Part number: RM2-4218-000CN

Recommended action for onsite technicians

- 1. Touch **OK** to use another tray.
- 2. Ensure the type and quality of the paper being used meets the HP specifications for the printer.




NOTE: For supported sizes and types view [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#) c05495788.

- 3. Print a configuration page to verify the size and type the trays are set to.

4. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.

Figure 6-136 Tray 2 paper guides

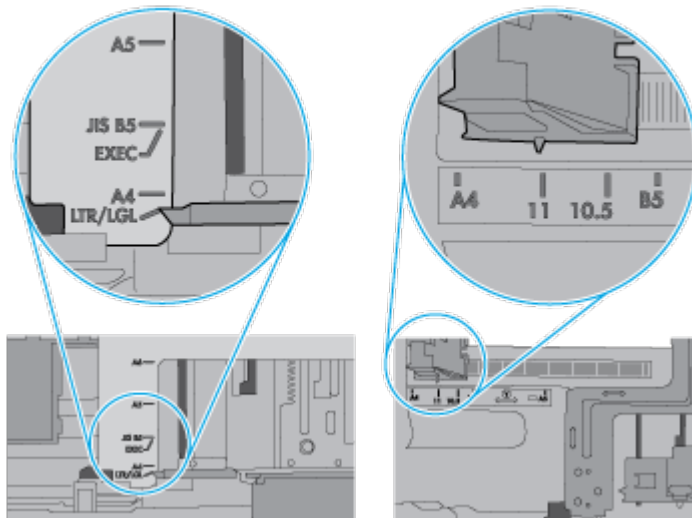

5. Ensure that the paper tray meets the tray capacity specifications or the stack of paper in the tray is not above the fill mark (line below the three triangles) as indicated in the image.

Figure 6-137 Paper height guides

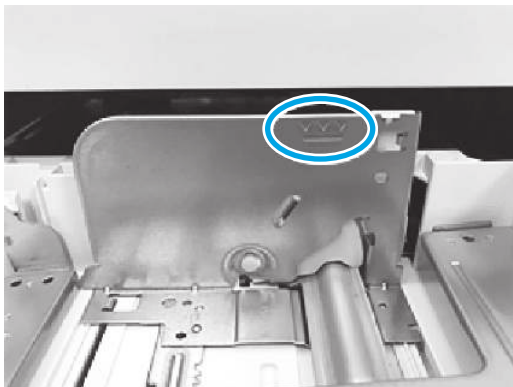


Figure 6-138 Overfilled tray

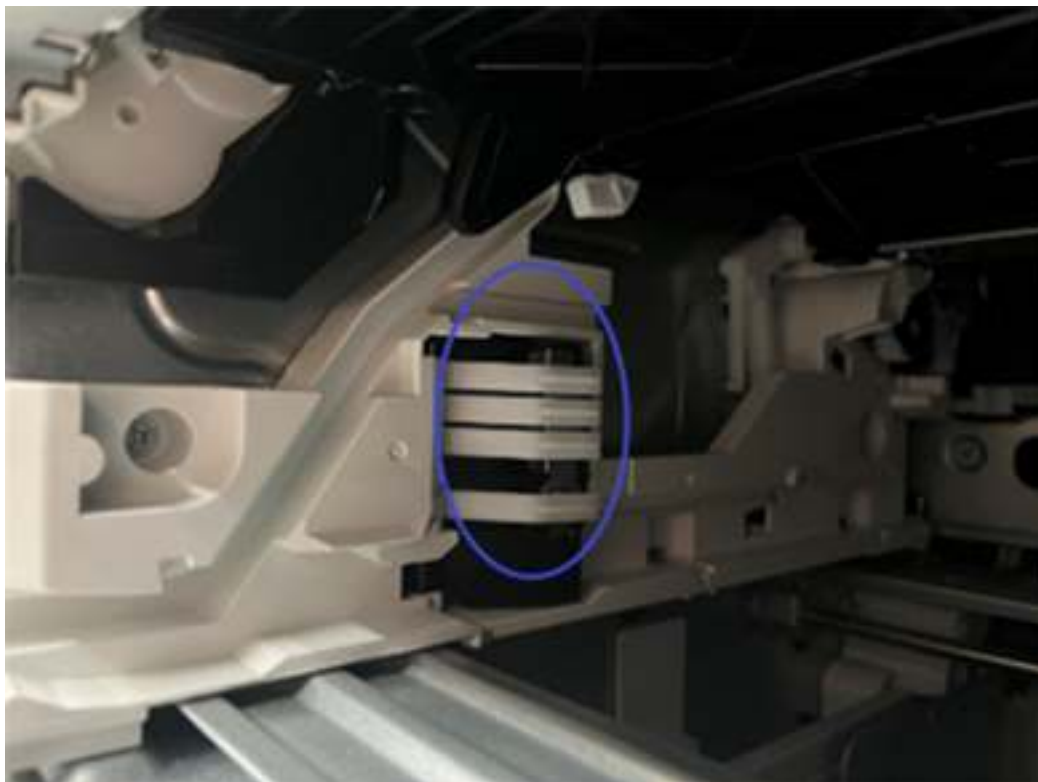


Figure 6-139 Stack of paper not overfilled in Tray 2



6. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
7. If the paper is jammed, ensure it is completely removed.
8. Verify that the toner cartridge and the transfer roller are seated correctly.
9. Remove tray 2, and check that the paper size detect assembly is not damaged or missing white flags.

Figure 6-140 Paper size detect assembly




If the paper size detect is damaged or missing the white sensor fingers, replace the assembly.

Size detect assembly part number: RM2-1255-000CN

10. While the tray is removed, inspect the size paper size fingers on the right side of the tray.

Figure 6-141 Paper tray fingers

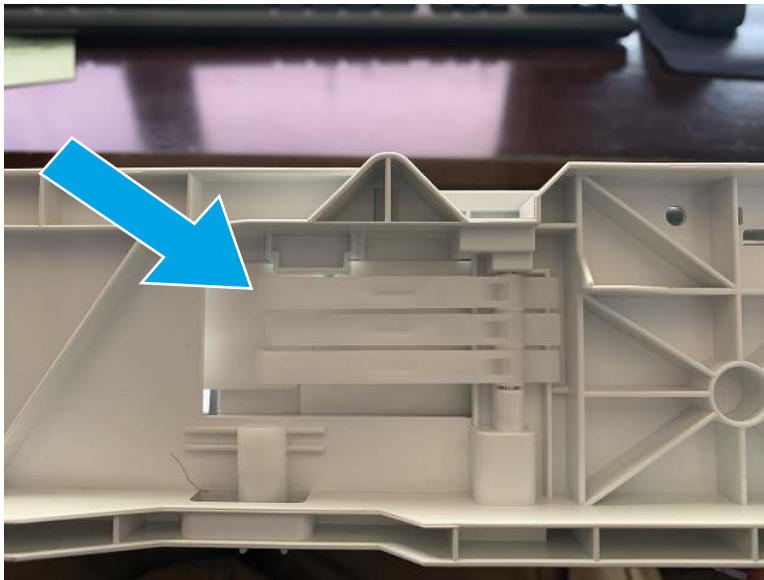

If they are damaged or missing, replace the tray.

Cassette assembly part number: RM2-6766-000CN

11. Ensure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear.
 - a. Check if the rollers are installed correctly.

Figure 6-142 Pick roller not locked in

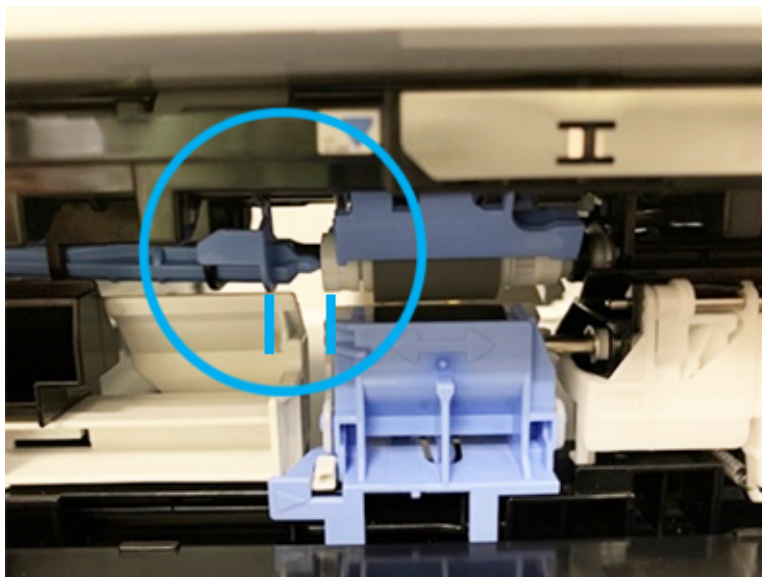


Figure 6-143 Separating roller not installed correct



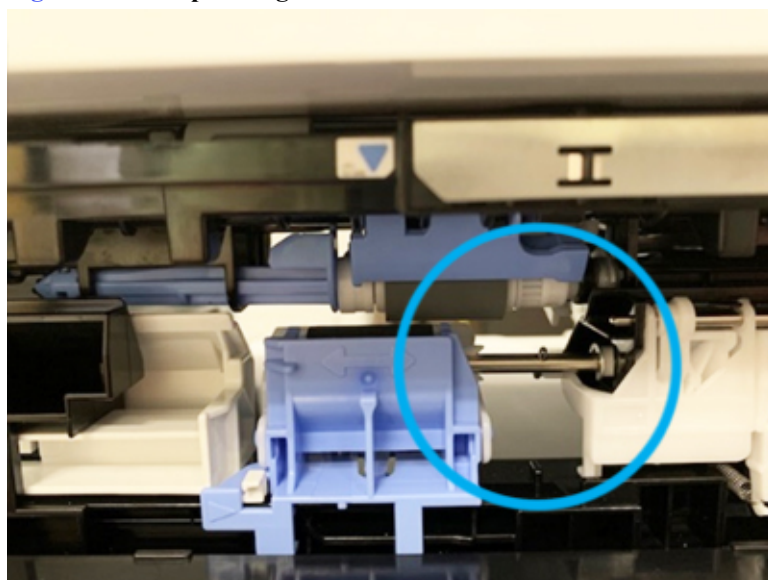


Figure 6-144 Separation roller not install and locked in correctly

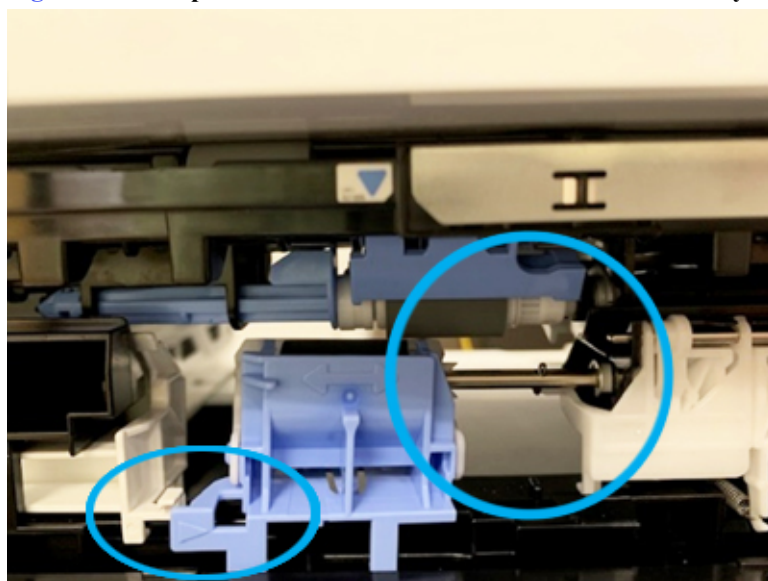

- b. If either roller is installed incorrectly, make sure to install it correctly as shown here.

Figure 6-145 Rollers installed correctly

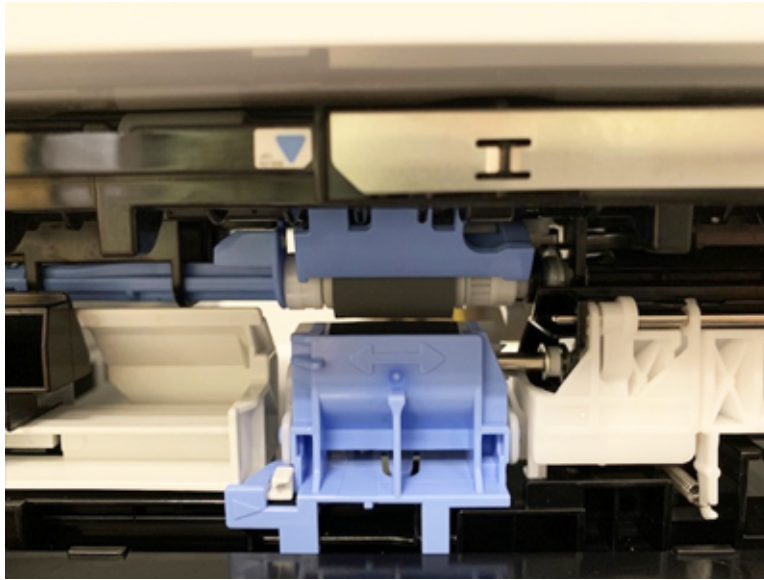

- c. If the rollers are dirty, clean the rollers.



NOTE: Clean the rollers with a dampened lint free cloth or paper.

- d. If the error persists even after checking the rollers, replace the rollers.

Tray 2-x roller assembly part number: J8J70-67906

For instructions: *Removal and replacement: Tray 2-x roller kit* See the Repair Service Manual for this product.

12. Test the registration/TOP sensor (PS4550) using the paper path sensor test.

- a. From the home screen on the printer control panel, touch “[Support Tools](#)”.
- b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Paper Path Sensor Test](#)
- c. Rotate the registration assembly and observe the sensor count as the assembly is rotated.
- d. If the sensor test still fails, replace the registration assembly.

Part number: RM2-4218-000CN

For instructions: *Removal and replacement: Registration assembly* See the Repair Service Manual for this product.

13. Test the fuser sensor (PS4650) using the paper path sensor test.

- a. From the home screen on the printer control panel, touch “[Support Tools](#)”.

b. Open the following menus:

- [Troubleshooting](#)
- [Diagnostic Tests](#)
- [Paper Path Sensor Test](#)

c. Remove the fuser assembly and place a piece of paper inside the fuser corresponding to the output sensor location and reinsert the fuser. If the fuser output sensor does not move from 0 to 1, replace the fuser.

110V part number: RM2-1256-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

41 . 03 . FZ Unknown Misprint Error

This is a general misprint error.

Either the paper is loaded off-center with the side guides in the tray or a paper width sensor failure occurred from an unknown tray. The error will be one of the following:

- 41.03.F0
- 41.03.F1
- 41.03.F2
- 41.03.F3
- 41.03.F4
- 41.03.F5
- 41.03.FD

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer and then turn on the printer.
2. If the error persists, check if the paper is loaded correctly in the tray.
3. Ensure the type and quality of the paper being used meets the HP specifications for the printer.



NOTE: For supported sizes and types, see [HP LaserJet M607-M609, E60055-E60075, E60155-E60175 - Supported paper sizes and types](#).

4. Make sure that the paper guides are adjusted to the correct size for the paper.



NOTE: Do not adjust the paper guides tightly against the paper stack. Adjust them to the indentations or markings in the tray.


5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Remove the paper from the tray, and then load the paper correctly in the tray.
3. Ensure that the tray width and length guides are adjusted to the correct size for the paper installed into the tray.

Figure 6-146 Tray 2 paper guides

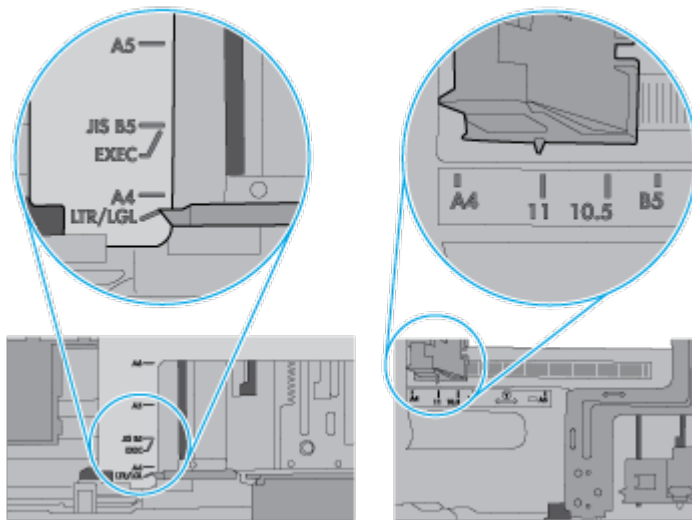

4. Ensure that the paper tray meets the tray capacity specifications or the stack of paper in the tray is not above the fill mark (line below the three triangles) as indicated in the image.

Figure 6-147 Paper height guides

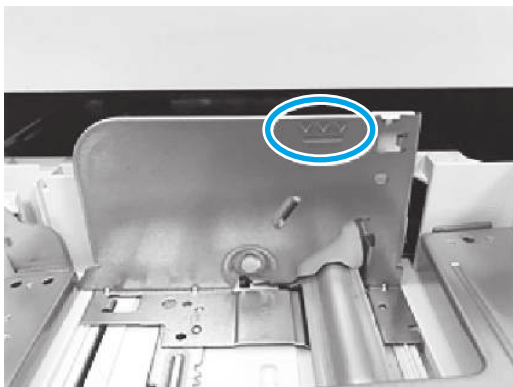


Figure 6-148 Overfilled tray




Figure 6-149 Stack of paper not overfilled in Tray 2



5. If the error persists, print a configuration page and note the paper size for the tray causing the issue.
 - a. From the Home screen on the printer control panel, select [Reports](#).
 - b. Select the [Configuration/Status pages](#), and then select [Configuration Page](#).
6. If the paper size is reported incorrectly, run the tray size sensor test.
 - a. From the Home screen on the printer control panel, select [Support Tools](#).
 - b. Select [Troubleshooting](#), and then select [Diagnostic Tests](#).
 - c. Select [Manual Sensor Test](#), and then from the [Options](#) menu, select [All sensors](#).
7. Remove the tray identified with an issue from the printer and set it aside to isolate the faulty tray switch or sensor.


- a. On the printer control panel, select the paper tray size sensor.

Figure 6-150 Manual Sensor Test on control panel

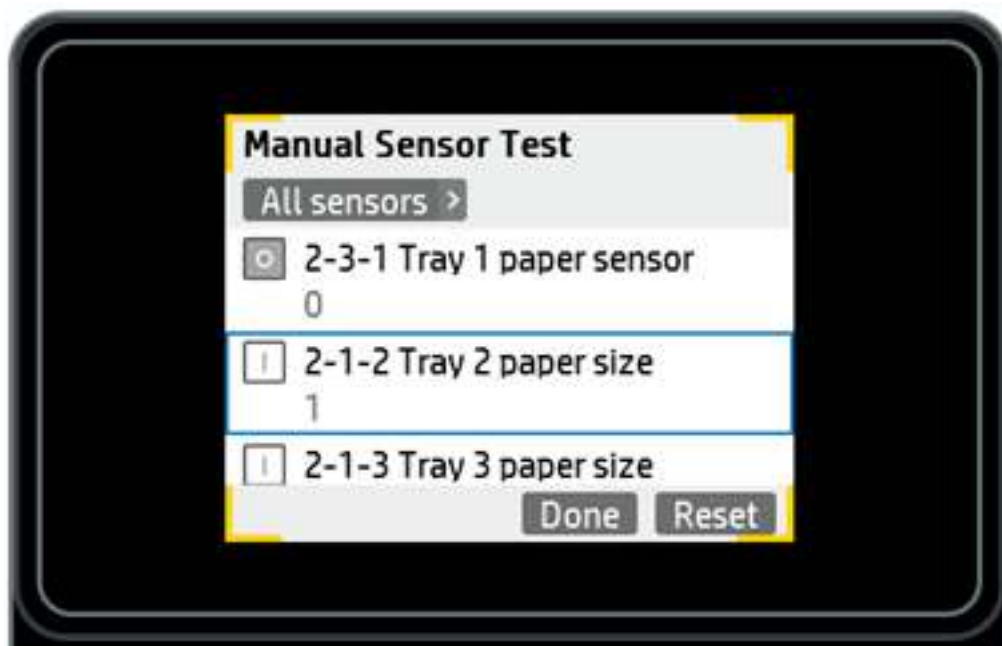

- b. Take note of the image sensor location within tray cavity on the control panel.


Figure 6-151 Image sensor location

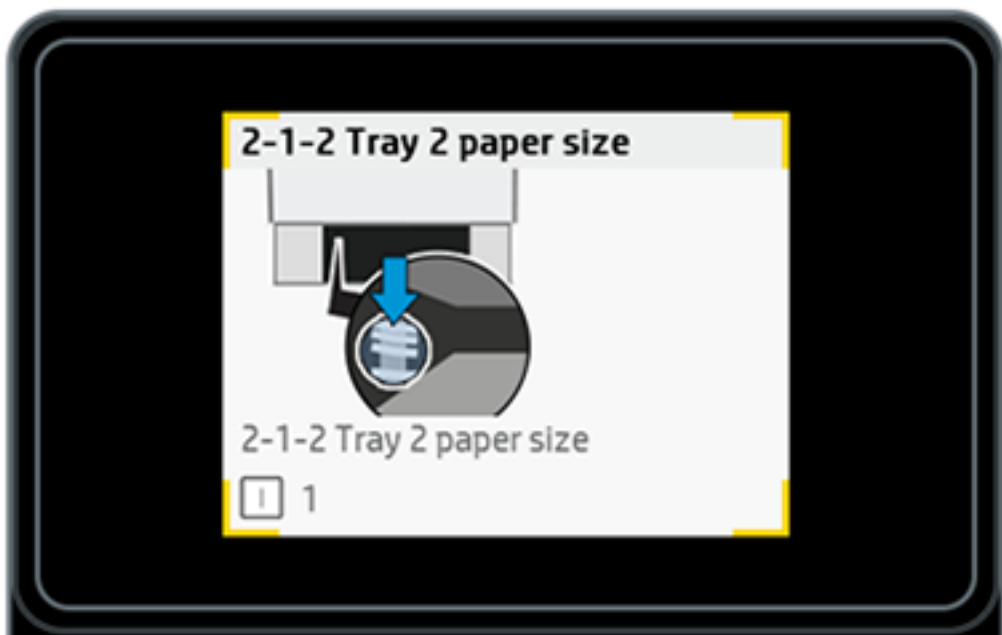

- c. Manually toggle each tray size switch in the tray cavity, and then verify the toggle counter under the sensor name is incremented for each toggle movement.
- If the toggle counter under the sensor name toggles from "0" to "1", the sensor is functioning correctly.

- If the toggle counter under the sensor name does not toggle, the sensor is not functioning correctly.

Figure 6-152 Paper size detect assembly

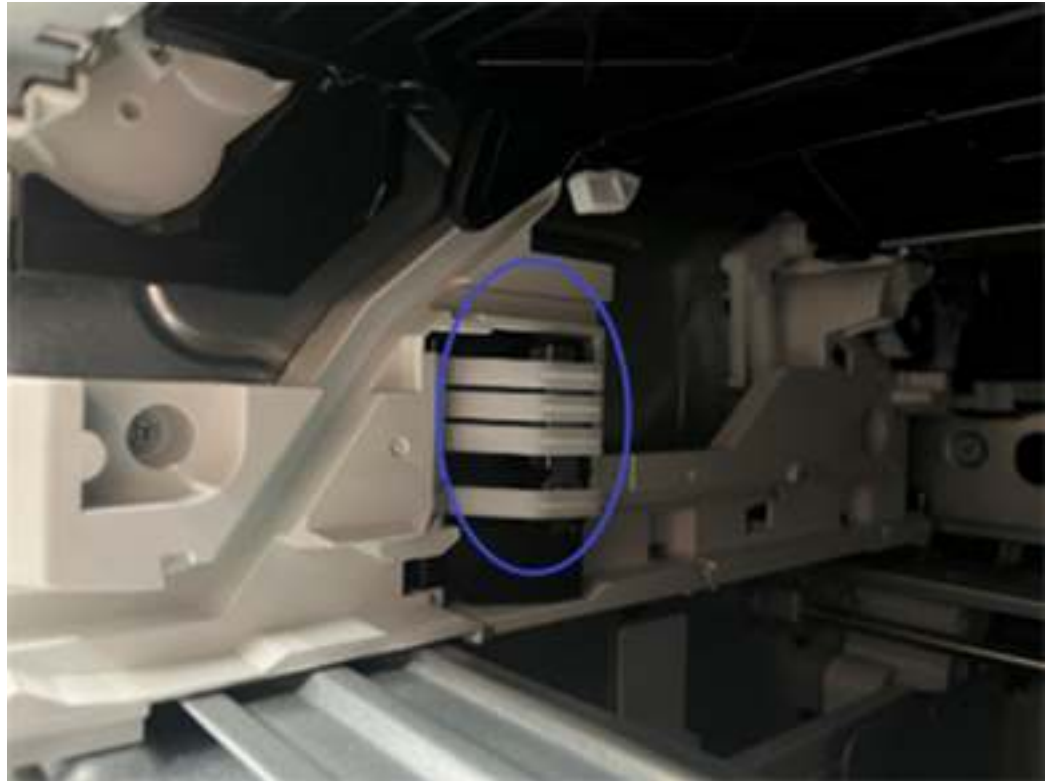

8. If the tray size sensor does not toggle or is not functioning correctly, replace the tray size sensor assembly for the failing tray.

Table 6-20 Tray size sensor assembly part numbers

Description	Part number
Size detect switch (SW5/SW5) assembly (Tray 2 and tray 3, and 4)	RM2-1255-000CN
2100-sheet feeder stand (HCI) size lever assembly - Includes switch (SW3401)	RM2-1162-000CN

9. If the tray size sensor is functioning correctly and the issue persists, check the left side of the paper cassette, switch activator fingers for damage.

Adjust the tray guides, and then verify the switch activator fingers change position for each tray guide setting modifications.

10. If the paper input tray switch activator fingers are damaged or fail to change position for each tray size change, replace the paper tray cassette.

Figure 6-153 Paper tray cassette

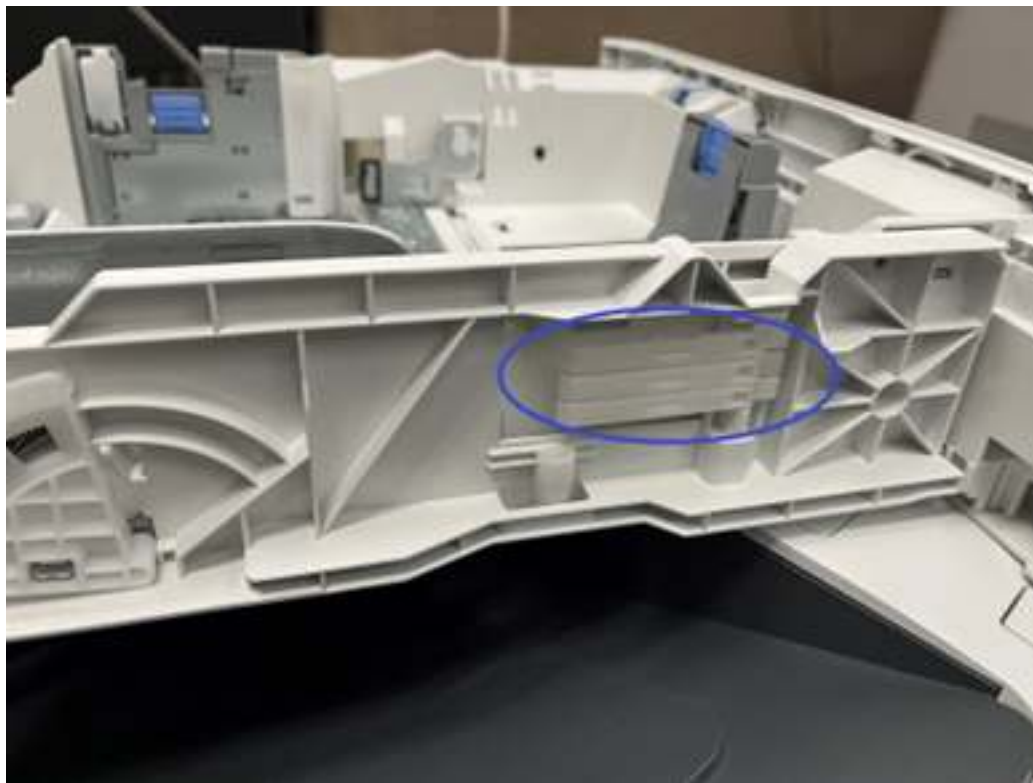


Table 6-21 Cassette assembly part numbers

Description	Part number
Tray 2 cassette assembly	RM2-6766-010CN
Tray 3, 4 , 5 assembly - cassette	RM2-0866-020CN


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Remove the paper from the tray, and then load the paper correctly in the tray.

3. Ensure that the tray width and length guides are adjusted to the correct size for the paper installed into the tray.

Figure 6-154 Tray 2 paper guides

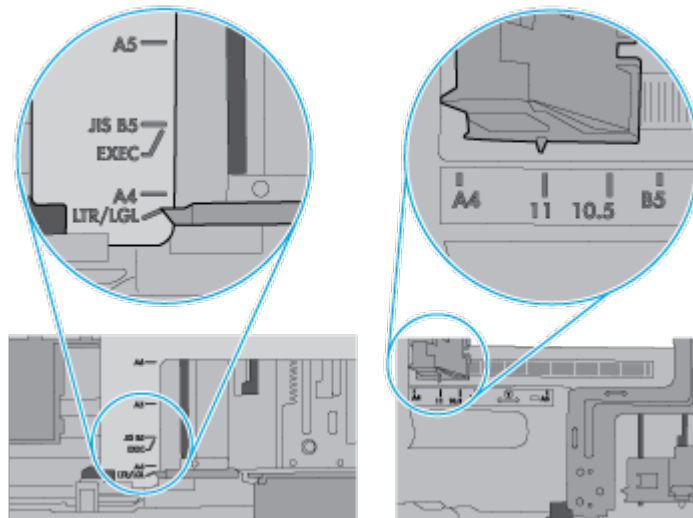

4. Ensure that the paper tray meets the tray capacity specifications or the stack of paper in the tray is not above the fill mark (line below the three triangles) as indicated in the image.

Figure 6-155 Paper height guides

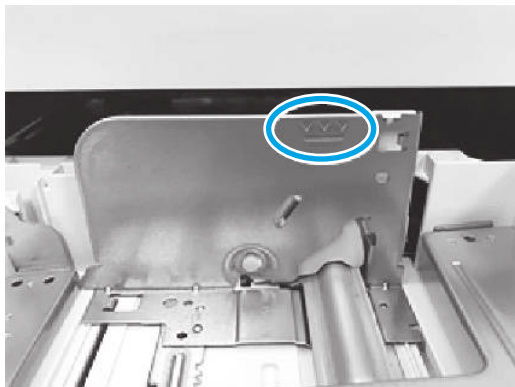


Figure 6-156 Overfilled tray

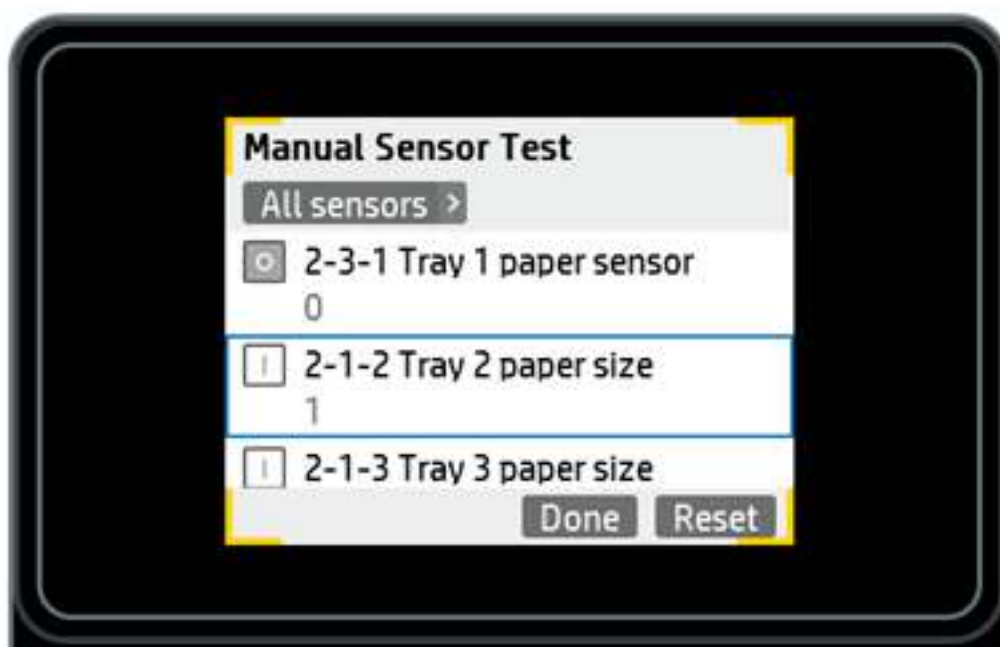


Figure 6-157 Stack of paper not overfilled in Tray 2




5. If the error persists, print a configuration page and note the paper size for the tray causing the issue.
 - a. From the Home screen on the printer control panel, select [Reports](#).
 - b. Select the [Configuration/Status pages](#), and then select [Configuration Page](#).
6. If the paper size is reported incorrectly, run the tray size sensor test.
 - a. From the Home screen on the printer control panel, select [Support Tools](#).
 - b. Select [Troubleshooting](#), and then select [Diagnostic Tests](#).
 - c. Select [Manual Sensor Test](#), and then from [Options](#) menu, select [All sensors](#).
7. Remove the tray identified with an issue from the printer and set it aside to isolate the faulty tray switch or sensor.
 - a. On the printer control panel, select the paper tray size sensor.

Figure 6-158 Manual Sensor Test on control panel




- b. Take note of the image sensor location within tray cavity on the control panel.

Figure 6-159 Image sensor location

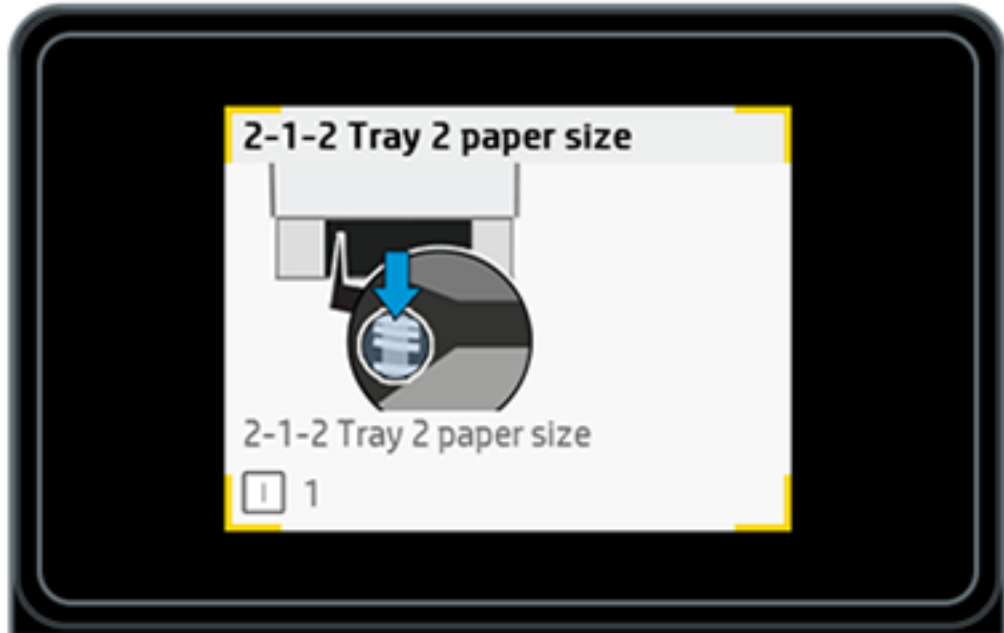

- c. Manually toggle each tray size switch in the tray cavity, and then verify the toggle counter under the sensor name is incremented for each toggle movement.
 - If the toggle counter under the sensor name toggles from "0" to "1", the sensor is functioning correctly.
 - If the toggle counter under the sensor name does not toggle, the sensor is not functioning correctly.

Figure 6-160 Paper size detect assembly

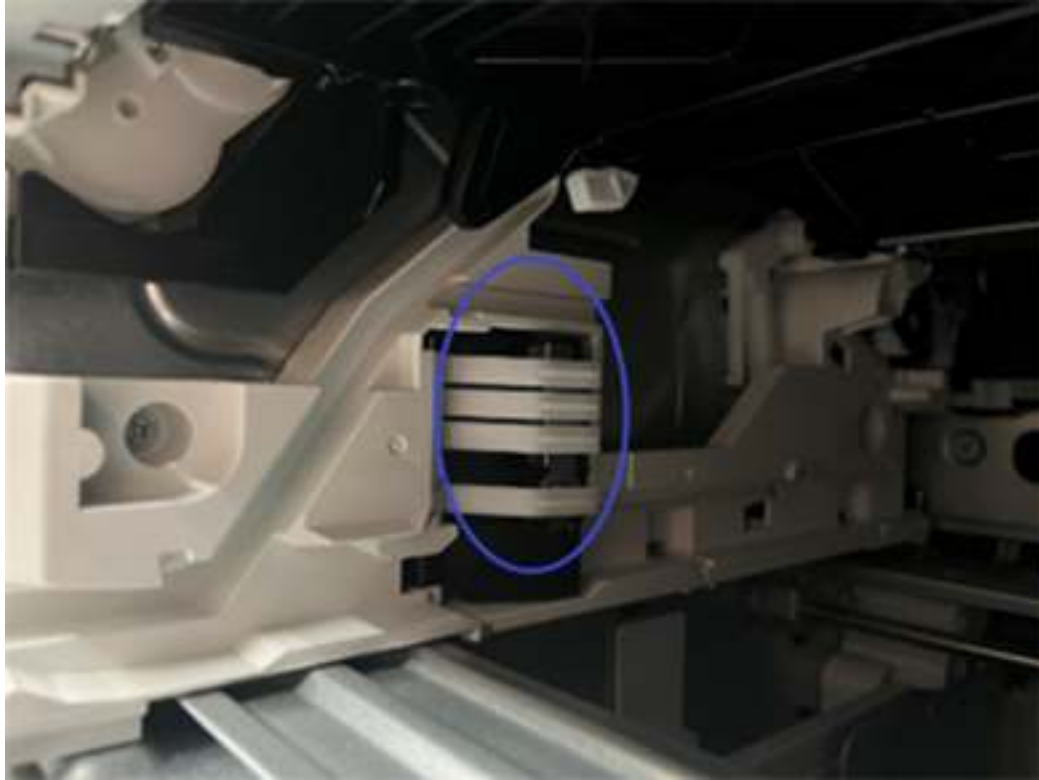

8. If the tray size sensor does not toggle or is not functioning correctly, replace the tray size sensor assembly for the failing tray.

Table 6-22 Tray size sensor assembly part numbers

Description	Part number
Size detect switch (SW5/SW5) assembly (Tray 2 and tray 3, and 4)	RM2-1255-000CN
2100-sheet feeder stand (HCI) size lever assembly - Includes switch (SW3401)	RM2-1162-000CN

9. If the tray size sensor is functioning correctly and the issue persists, check the left side of the paper cassette, switch activator fingers for damage.

Adjust the tray guides, and then verify the switch activator fingers change position for each tray guide setting modifications.

10. If the paper input tray switch activator fingers are damaged or fail to change position for each tray size change, replace the paper tray cassette.

Figure 6-161 Paper tray cassette

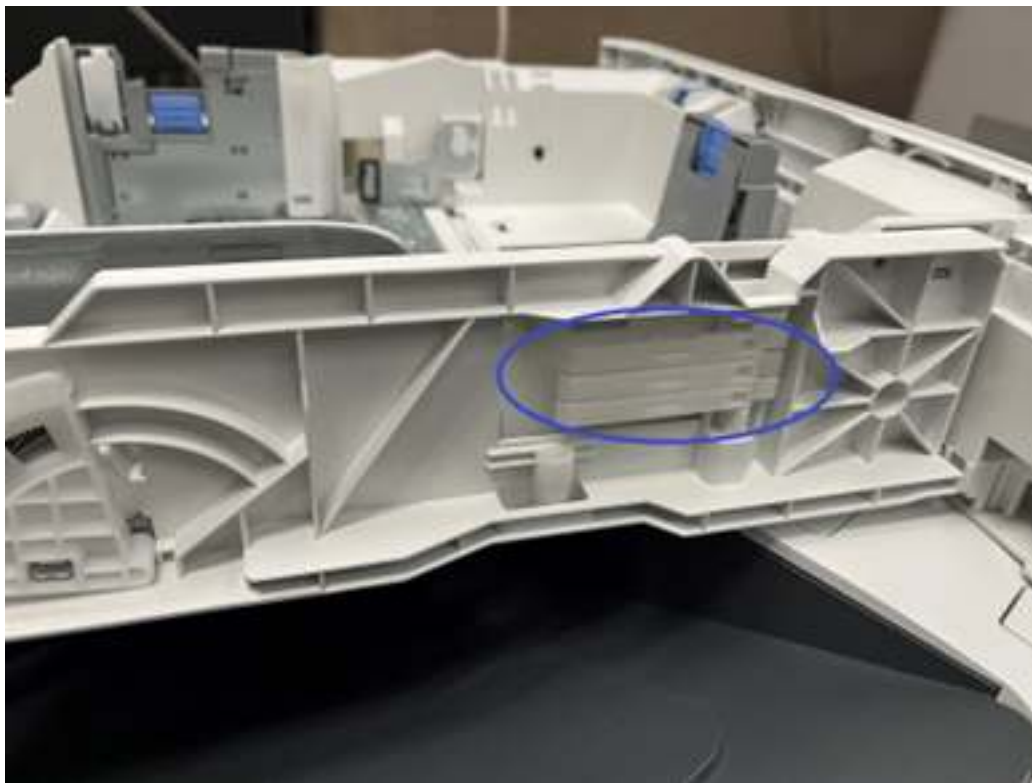


Table 6-23 Cassette assembly part numbers

Description	Part number
Tray 2 cassette assembly	RM2-6766-010CN
Tray 3, 4 , 5 assembly - cassette	RM2-0866-020CN

11. If the error persists, replace the DC Controller PCA.



NOTE: Make sure to order the correct part number for the printer model.

Table 6-24 DC Controller part numbers

Description	Part number
DC Controller PC board assembly	RM2-9494-000CN
For printer models: M607/M608/M609/E60055/E60065/E60075	
DC Controller	RM3-8461-000CN
For printer models: M610/M611/M612	
DC Controller PCA	RM3-7619-000CN
For printer models: E60155/ E60165/ E60175	

For removal and replacement instructions: *DC Controller PCA* See the Repair Service Manual for this product.

41.03.YZ Unexpected size in tray <X>

The printer detected a different paper size than expected.



NOTE: If using adhesive or self-sealing media, please see the instructions in *A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.* (ish_3199741-3199797-16).

Y = Type, Z = Tray

- Y = 0 Size mismatch. Detected paper is longer or shorter than expected.
- Y = A Size mismatch. Detected paper too long.
- Y = B Size mismatch. Detected paper too short.
- Y = C Size mismatch. Inter-page gap error.
- Y = D Size mismatch. Detected paper narrower than expected.
- Y = E Size mismatch. Detected paper wider than expected.
- Z = D Source is the duplexer.
- Z = E Source is the envelope feeder.
- Z = 1 Source is Tray 1.
- Z = 2 Source is Tray 2.
- Z = 3 Source is Tray 3.
- Z = 4 Source is Tray 4.
- Z = 5 Source is Tray 5.

Recommended action

1. Touch **OK** to use another tray.
2. Print a configuration page to verify the size and type the trays are set to.
3. Ensure that the tray width and length guides are set to the correct paper size being installed into the tray and that the tray is not over filled above the fill mark or over the tab on the tray.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. If the paper is jammed, ensure it is completely removed.
6. Verify that the toner cartridge and the transfer roller are seated correctly.
7. Use the manual sensor test to verify that the cassette paper switch is functioning correctly.
 - a. From the home screen on the printer control panel, touch **“Support Tools”**.

- b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - c. Select from the following tests:
 - [All Sensors](#) , [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#) (reset the selected sensor's state)
 - d. Test the failing tray paper size sensors.
 - e. If the tray size sensors test passes, check the back of the paper cassette for damage and ensure that when the tray guides are moved the sensors windows on the backside of the tray change. If the tray is damaged, replace the paper tray.

 Tray 2 part number: RM2-6766-000CN

 For instructions: *Removal and replacement: Tray 2 cassette* See the Repair Service Manual for this product.

 Tray 3, 4 or 5 550 optional paper feeder part number: RM2-0866-000CN
 - f. If the tray size sensors test fails, check the cable connections between the tray size sensor and the DC Controller.
 - g. If the cable connections are plugged in correctly and the cables are not damaged, replace the tray size sensor assembly for the failing tray.

 Tray 2 and tray 3,4 or 5 550 optional paper feeder part number: RM2-1255-000CN

 Tray 3 2,100 sheet feeder part number: RM2-1162-000CN
8. Test the registration/TOP sensor (PS4550) using the manual sensor test.
- a. From the home screen on the printer control panel, touch "[Support Tools](#)".
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - c. Select from the following tests:
 - [All Sensors](#) , [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#) (reset the selected sensor's state)
 - d. If the sensor test fails, check connector J15 on the DC controller then retest the sensor.

- e. If the sensor test still fails, replace the registration assembly.

Part number: RM2-4218-000CN

For instructions: *Removal and replacement: Registration assembly* See the Repair Service Manual for this product.

- 9. Test the fuser sensor (PS4650) using the manual sensor test.

- a. From the home screen on the printer control panel, touch “[Support Tools](#)”.

- b. Open the following menus:

- [Troubleshooting](#)
- [Diagnostic Tests](#)
- [Manual Sensor Test](#)

- c. Select from the following tests:

- [All Sensors](#) , [Engine Sensors](#)
- [Done](#) (return to the [Troubleshooting](#) menu)
- [Reset](#) (reset the selected sensor’s state)

- d. Test the fuser sensor to verify that the sensor is functioning correctly. If the sensor does not function, check connector J401 and J402 on the DC controller.

- e. If the sensor test still fails after checking the connectors, replace the fuser.

110V part number: RM2-1256-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

- 10. Enter the component test menu to run diagnostics on the printer.

- a. From the home screen on the printer control panel, touch “[Support Tools](#)”.

- b. Open the following menus:

- [Troubleshooting](#)
- [Diagnostic Tests](#)
- [Components Test](#)

- 11. Test the registration assembly motor and clutch. If they do not function correctly, replace the registration assembly.

Part number: RM2-4218-000CN

Registration assembly See the Repair Service Manual for this product.

41.04.YZ Printer Error

An unknown misprint error occurred on the printer.

Y = Type, Z = Tray

- Y = 0: Photo Paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light Paper 1, 2, or 3 mode
- Y = 4: Heavy Paper 1
- Y = 5: Heavy Paper 2
- Y = 6: Heavy Paper 3
- Y = 7: Glossy Paper 1
- Y = 8: Glossy Paper 2
- Y = 9: Glossy Paper 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = D: Source is the duplexer.
- Z = 0: Source is the envelope feeder.
- Z = 1: Source is Tray 1.
- Z = 2: Source is Tray 2.
- Z = 3: Source is Tray 3.
- Z = 4: Source is Tray 4.
- Z = 5: Source is Tray 5.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. If the error does not clear, turn off the printer, and then turn on the printer.
3. If the error persists, attempt to remove and reinstall the toner cartridge.



IMPORTANT: Ensure that the printer is using genuine HP supplies.

- a. Press the cartridge door release button to open the door.

- b. Pull out the cartridge drawer.
- c. Grasp the handle of the toner cartridge and pull it up to remove the toner cartridge from the printer.
- d. Check if genuine HP toner cartridges are installed.

A genuine HP toner cartridge has the word “HP” on it, or has the HP logo on it. For more information on identifying HP cartridges go to <http://www.hp.com/go/learnaboutsupplies>.

- e. Insert the toner cartridge in the cartridge drawer.
 - f. Close the toner cartridge drawer.
 - g. Close the cartridge door.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agent

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. If the error does not clear, turn off the printer, and then turn on the printer.
3. Swap out or re-seat the toner cartridge to test the toner cartridge.



IMPORTANT: Ensure that the printer is using genuine HP supplies.

- a. Press the cartridge door release button to open the door.
- b. Pull out the cartridge drawer.
- c. Grasp the handle of the toner cartridge and pull it up to remove the toner cartridge from the printer.
- d. Check if genuine HP toner cartridges are installed.

A genuine HP toner cartridge has the word “HP” on it, or has the HP logo on it. For more information on identifying HP cartridges go to <http://www.hp.com/go/learnaboutsupplies>.

- e. Insert the toner cartridge in the cartridge drawer.
 - f. Close the toner cartridge drawer.
 - g. Close the cartridge door.
4. If the error persists, replace the laser scanner assembly.

Table 6-25 Laser scanner assembly part number

Description	Part number
Laser scanner assembly	RM2-0906-000CN

For instructions: *Removal and replacement: Laser/scanner assembly* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. If the error does not clear, turn off the printer, and then turn on the printer.
3. Swap out or re-seat the toner cartridge to test the toner cartridge.



IMPORTANT: Ensure that the printer is using genuine HP supplies.

- a. Press the cartridge door release button to open the door.
- b. Pull out the cartridge drawer.
- c. Grasp the handle of the toner cartridge and pull it up to remove the toner cartridge from the printer.
- d. Check if genuine HP toner cartridges are installed.

A genuine HP toner cartridge has the word “HP” on it, or has the HP logo on it. For more information on identifying HP cartridges go to <http://www.hp.com/go/learnaboutsupplies>.

- e. Insert the toner cartridge in the cartridge drawer.
 - f. Close the toner cartridge drawer.
 - g. Close the cartridge door.
4. Inspect the toner cartridges high-voltage contacts are clean and not damaged.
 5. If the error persists check the wire harness from the laser scanner to the DC controller is seated correctly.
 6. Ensure that the cables are connected correctly before replacing any part.
 7. If the error persists, replace the laser/scanner assembly.

Table 6-26 Laser scanner assembly part number

Description	Part number
Laser scanner assembly	RM2-0906-000CN

For instructions: *Removal and replacement: Laser/scanner assembly* See the Repair Service Manual for this product.

8. If the error persists, replace the DC controller.

Table 6-27 DC Controller part numbers

Description	Part number
DC Controller PC board assembly	RM2-9494-000CN
For printer models: M607/M608/M609/E60055/E60065/E60075	
DC Controller	RM3-8461-000CN
For printer models: M610/M611/M612	

Table 6-27 DC Controller part numbers (continued)

Description	Part number
DC Controller PCA	RM3-7619-000CN
For printer models: E60155/ E60165/ E60175	

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

41.05.YZ Unexpected type in tray <X>

The printer can detect the type of paper in the paper path, and it adjusts the print mode accordingly.

The printer uses two types of paper sensors:

- **Reflection:** Detects the glossiness of the paper.
- **Transmission:** Detects the thickness of the paper.

Tray X is loaded with a paper type (transparencies, envelopes, etc.) that is different than what the tray is configured to use.

Y = Expected type, Z = Detected type

- Y = 0: Photo Paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light Paper 1, 2, or 3 mode
- Y = 4: Heavy Paper 1
- Y = 5: Heavy Paper 2
- Y = 6: Heavy Paper 3
- Y = 7: Glossy Paper 1
- Y = 8: Glossy Paper 2
- Y = 9: Glossy Paper 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = 0: Photo Paper (1, 2, or 3)
- Z = 1: Auto Sense (Normal)

- Z = 2: Normal (typed not from Auto Sense)
- Z = 3: Light Paper 1, 2, or 3 mode
- Z = 4: Heavy Paper 1
- Z = 5: Heavy Paper 2
- Z = 6: Heavy Paper 3
- Z = 7: Glossy Paper 1
- Z = 8: Glossy Paper 2
- Z = 9: Glossy Paper 3
- Z = A: Glossy film
- Z = B: OHT
- Z = C: Label
- Z = D: Envelope 1, 2, or 3 mode
- Z = E: Rough
- Z = F: Other mode

Recommended action

1. Load the tray with the size and type of paper indicated, or use another tray if available.
2. If this message displays and the tray is loaded with the correct paper type, check the print driver settings to ensure they match the tray type settings on the printer.
3. Check all application and printer settings to ensure that the **Type** setting is correctly.

42.WX.YZ error messages

42.* errors

Errors in the 42.* family indicate an internal system failure has occurred.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on. Retry the job.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on. Retry the job.
2. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

46.WX.YZ error messages

46.* error messages

Errors in the 46.* family occur when the printer is trying to perform an action that it is not able to complete.

- No network connectivity
- A problem with the file being printed, with the software application sending the job, or with the print driver

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Verify the printer is connected to the network, look at the network port connection on the back of the printer, and verify that the amber activity light flashes indicating network traffic, and the green link-status light is continuously lit indicating a network link. If the problem continues, try a different network cable or port on the hub and check network configuration settings such as the printer's IP address.
3. Send a different file from the same software application to see if the error is specific to the original file. Try sending a job from a different software application to see if the error is specific to the application. Verify the computer has the correct print driver installed.
4. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Verify the printer is connected to the network. If it is not, use a different network cable, and check the configuration settings.
3. Send a different file from the same software application to see if the error is specific to the original file. Try sending a job from a different software application to see if the error is specific to the application. Verify the computer has the correct print driver installed.
4. Upgrade the printer firmware.
5. If the error persists, go to WISE and search for the following document that contains links to flowcharts that you can use to troubleshoot the issue:

HP FutureSmart - 49 Error Troubleshooting (Persistent and Intermittent) (Document ID: c03122817)

Or, click the following link: [HP FutureSmart - 49 Error Troubleshooting \(Persistent and Intermittent\)](#)

47.WX.YZ error messages

47.* errors

Errors in the 47.* family indicate an internal error has occurred.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.00.xx

Back channel internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.

3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.01.xx

Image transformer internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the **Format Disk** item in the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.02.xx

Job parser internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.03.xx

Print job internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.04.xx

Print spooler 9100 internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the **Format Disk** item in the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.05.xx

Print spooler framework internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.06.xx

Print application internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

47.FC.yz Printer Calibration Failed To continue, touch “OK”

The device is unable to access or implement one of the image patterns files.

y = Calibration type, z = Event

- 47.FC.00 (event code) Color plane registration (CPR) Image not found at system initialization
- 47.FC.01 (event code) CPR Store Image failure
- 47.FC.02 (event code) CPR Image not found
- 47.FC.03 (event code) CPR Print engine execution failure
- 47.FC.10 (event code) Consecutive Dmax Dhalf Image not found at system initialization
- 47.FC.11 (event code) Consecutive Dmax Dhalf Store image failure
- 47.FC.12 (event code) Consecutive Dmax Dhalf Image not found
- 47.FC.13 (event code) Consecutive Dmax Dhalf Print engine execution failure
- 47.FC.20 (event code) Error Diffusion Image not found at system initialization
- 47.FC.21 (event code) Error Diffusion Store image failure
- 47.FC.22 (event code) Error Diffusion Image not found
- 47.FC.23 Error Diffusion Print engine execution failure
- 47.FC.30 0 (event code) Drum Speed Adjustment Image not found at system initialization
- 47.FC.31 (event code) Drum Speed Adjustment Store image failure
- 47.FC.32 (event code) Drum Speed Adjustment Image not found
- 47.FC.33 (event code) Drum Speed Adjustment Print engine execution failure
- 47.FC.40 (event code) Pulse Width Modulation Image not found at system initialization
- 47.FC.41 (event code) Pulse Width Modulation Store image failure
- 47.FC.42 (event code) Pulse Width Modulation Image not found
- 47.FC.43 (event code) Pulse Width Modulation Print engine execution failure

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the product off, and then on again.
2. If the error persists, reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the product off, and then on again.
2. If the error persists over multiple power cycles, then do the following.
 - In the [Support Tools](#) > [Troubleshooting](#) > [Diagnostics](#) menu, run the hard disk tests to validate the health of the device. Fix any issue found with the mass storage device.
3. If the error persists, reload the firmware.
4. If the error persists, perform a **Format Disk** procedure using the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

48.WX.YZ error messages

48.* errors

Errors in the 48.* family indicate an internal error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. In most cases, no action is necessary.
2. If the error persists, upgrade the printer firmware.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 48 error troubleshooting (whichever is appropriate) in document c03122817. Search for the following document on **WISE**: HP LaserJet FutureSmart Devices - 49 Error Troubleshooting (Persistent and Intermittent).

Or click the following link: [HP LaserJet FutureSmart Devices - 49 Error Troubleshooting \(Persistent and Intermittent\)](#)



NOTE: 48.wx.yz errors are similar to 49.wx.yz errors and use the same troubleshooting steps and procedures.

49.WX.YZ error messages

49.XX.YZ Error To continue turn off then on

A firmware error occurred.

Possible causes:

- Corrupted print jobs
- Software application issues
- Non-product specific print drivers
- Poor quality USB or network cables
- Bad network connections or incorrect configurations
- Invalid firmware operations
- Unsupported accessories

A 49 error might happen at any time for multiple reasons. Although some types of 49 errors can be caused by hardware failures, it is more common for 49 errors to be caused by printing a specific document or performing some task on the printer.

49 errors most often occur when a printer is asked to perform an action that the printer firmware is not capable of and might not have been designed to comply with, such as:

- Printing files with unsupported programming commands
- A unique combination of user environment and user interactions with the printer
- Interfacing with a third-party solution that was not designed to work with the printer
- Specific timing, network traffic, or concurrent processing of jobs

Recommended action for customers

Follow these troubleshooting steps in the order presented.



NOTE: LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
 - The error might be caused by a network connectivity problem, such as a bad USB or network interface cable, a bad USB port, or an invalid network configuration setting.
 - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
 - Upgrading the printer firmware might help resolve the error.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
 - The error might be caused by a network connectivity problem, such as a bad interface cable, a bad USB port, or an invalid network configuration setting.
 - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
 - Upgrading the printer firmware might help resolve the error.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 49 error troubleshooting (whichever is appropriate) in document c03122817. Search for the following document on **WISE**: HP LaserJet FutureSmart Devices - 49 Error Troubleshooting (Persistent and Intermittent).



NOTE: 48 errors are similar to 49 errors.

Or click the following link: [HP LaserJet FutureSmart Devices - 49 Error Troubleshooting \(Persistent and Intermittent\)](#)

49.38.0C

Firmware error.

This issue is caused by a formatter replacement that has not had the correct parameters set at the factory.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If any of the following messages display on the control panel: **49.38.0C**, **49.38.0D**, “**Disk Full**”, “**Data Corruption**”, or printer hangs with an “**Initializing message...**”, refer the following support document in WISE: ish_8742720-8736298-16

HP LaserJet Enterprise MFP M528, M577, M634, M635, M636, M637, M681, M682, Managed MFP E52645, E57540, E62655, E62665, E62675, E67550, E67560, E67650, E67660 - A 49.38.0C or 49.38.0D error displays on the printer control panel or in the Event Log (Service Action Advisory).

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If any of the following messages display on the control panel: **49.38.0C**, **49.38.0D**, “**Disk Full**”, “**Data Corruption**”, or printer hangs with an “**Initializing message...**”, refer the following support document in WISE: ish_8742720-8736298-16

HP LaserJet Enterprise MFP M528, M577, M634, M635, M636, M637, M681, M682, Managed MFP E52645, E57540, E62655, E62665, E62675, E67550, E67560, E67650, E67660 - A 49.38.0C or 49.38.0D error displays on the printer control panel or in the Event Log (Service Action Advisory).

49.38.07

Generic error.

This issue is caused by a formatter replacement that has not had the correct parameters set at the factory. This issue is tied to the factory installed Trusted Platform Module (TPM).

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print or view the printer Event log. Perform the appropriate tasks if 49.38.0C and/or 49.38.0D errors are present:
 - If 49.38.0C and/or 49.38.0D errors are present, refer the following support document in WISE: ish_8742720-8736298-16

HP LaserJet Enterprise MFP M528, M577, M634, M635, M636, M637, M681, M682, Managed MFP E52645, E57540, E62655, E62665, E62675, E67550, E67560, E67650, E67660 - A 49.38.0C or 49.38.0D error displays on the printer control panel or in the Event Log (Service Action Advisory).

- If 49.38.0C or 49.38.0D events are not in the Event log, see step 3.
3. Update the printer firmware to at a minimum of FutureSmart v5.3 version or newer.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print or view the printer Event log. Perform the appropriate tasks if 49.38.0C and/or 49.38.0D errors are present:

- If 49.38.0C and/or 49.38.0D errors are present, refer the following support document in WISE:
ish_8742720-8736298-16

HP LaserJet Enterprise MFP M528, M577, M634, M635, M636, M637, M681, M682, Managed MFP E52645, E57540, E62655, E62665, E62675, E67550, E67560, E67650, E67660 - A 49.38.0C or 49.38.0D error displays on the printer control panel or in the Event Log (Service Action Advisory).

- If 49.38.0C or 49.38.0D events are not in the Event log, see step 3.
3. Update the printer firmware to FutureSmart v5.3 version or newer.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

50.WX.YZ error messages

50.* errors

Errors in the 50.* family indicate a problem with the fuser.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and remove the fuser. Check the fuser for damage or obstructions. Reinstall or replace the fuser as needed.

 **CAUTION:** The fuser might be hot.

2. Check the connectors between the fuser and the DC controller and from the fuser to the printer.
3. Replace the fuser. If it has already been replaced, replace the fuser power supply.

50.1x.yz

Low fuser temperature failure

x = fuser mode, y = previous printer sleep state, and z = next printer sleep state.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.

 **NOTE:** Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.

Check the size and type on the control panel Trays menu or use the EWS Trays menu

4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.


6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians


1. Turn the printer off.
2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

⚠ CAUTION: The fuser might be hot.

- a. Open the rear door.

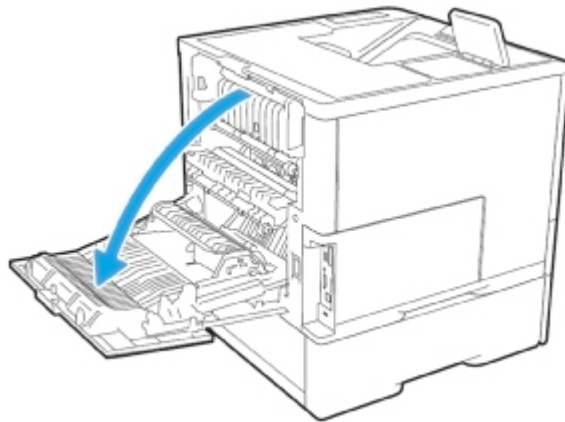


- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

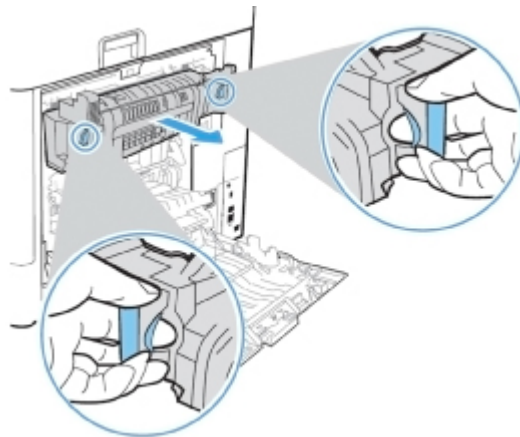


- c. Ensure that there is no residual paper in the fuser.

- d. Reseat the fuser.

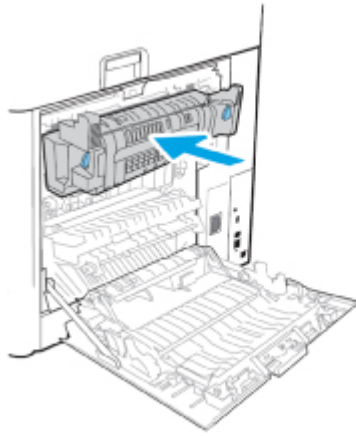

- e. Close the front door.
3. If the error persists, check the fuser connections.
- a. Remove the fuser.
 - b. Check the connection on the fuser

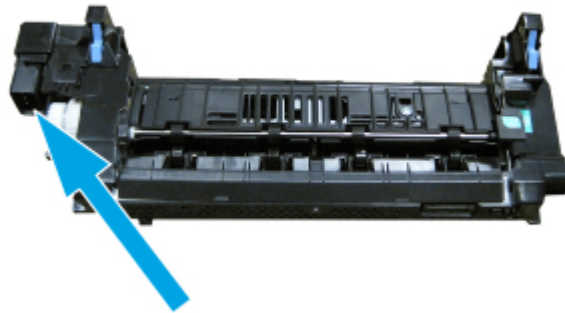

- c. If the fuser connector is damaged, replace the fuser.


110V part number: RM2-1256-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

- d. Check the connection to the fuser in the printer.

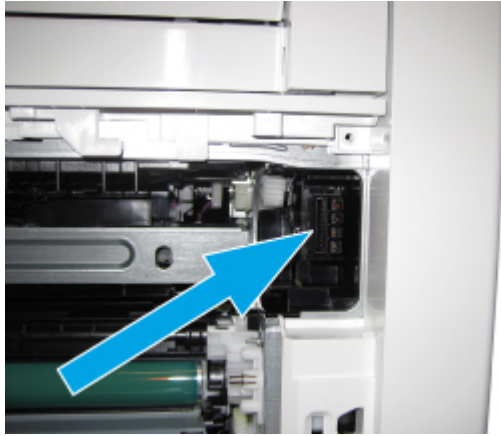

- e. If the connector is damaged, Elevate the issue using the Standard Support Process.
 - f. Check connections J401 and J402 on the DC controller PCA.
4. If the fuser has not been replaced, replace the fuser.
110V part number: RM2-1256-000CN
For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.
220V part number: RM2-1257-000CN
For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.
 5. If the error persists, replace the low voltage power supply (LVPS).
110V LVPS part number: RM2-6797-000CN
For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.
220V LVPS part number: RM2-6798-000CN
For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

50.2X.YZ

Fuser warm-up error

50.2F.00 (for search reference)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.


3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians


1. Turn the printer off.
2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

⚠ CAUTION: The fuser might be hot.

- a. Open the rear door.

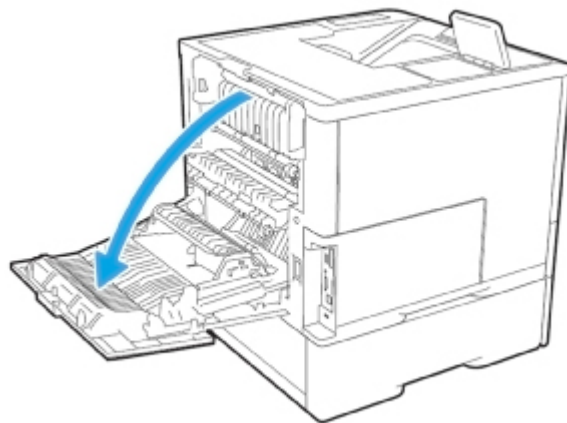


- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

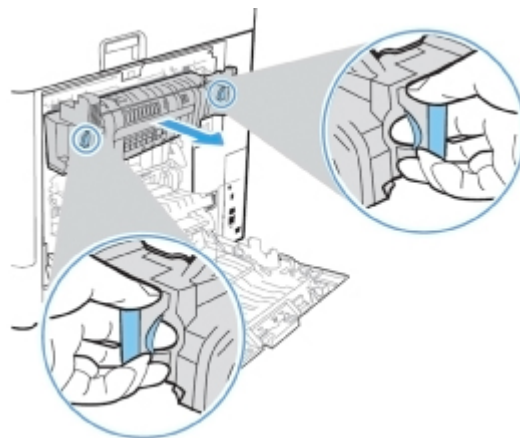


- c. Ensure that there is no residual paper in the fuser.

- d. Reseat the fuser.

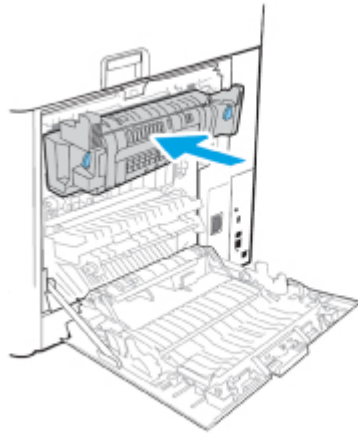

- e. Close the front door.
3. If the error persists, check the fuser connections.
- a. Remove the fuser.
 - b. Check the connection on the fuser

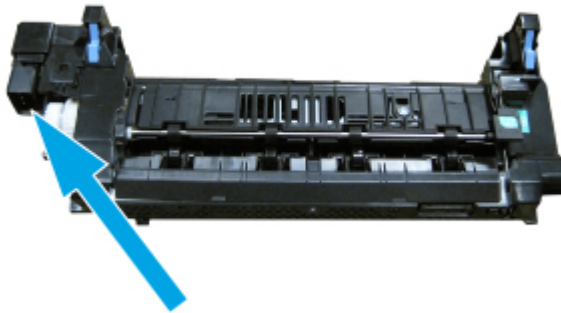

- c. If the fuser connector is damaged, replace the fuser.


110V part number: RM2-1256-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

- d. Check the connection to the fuser in the printer.

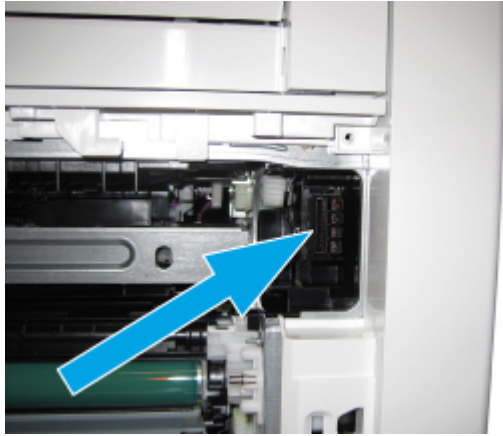

- e. If the connector is damaged, Elevate the issue using the Standard Support Process.
 - f. Check connections J401 and J402 on the DC controller PCA.
4. If the fuser has not been replaced, replace the fuser.
- 110V part number: RM2-1256-000CN
For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.
- 220V part number: RM2-1257-000CN
For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.
5. If the error persists, replace the low voltage power supply (LVPS).
- 110V LVPS part number: RM2-6797-000CN
For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.
- 220V LVPS part number: RM2-6798-000CN
For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

50.3X.YZ

High fuser temperature

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.


3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians


1. Turn the printer off.
2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

⚠ CAUTION: The fuser might be hot.

- a. Open the rear door.

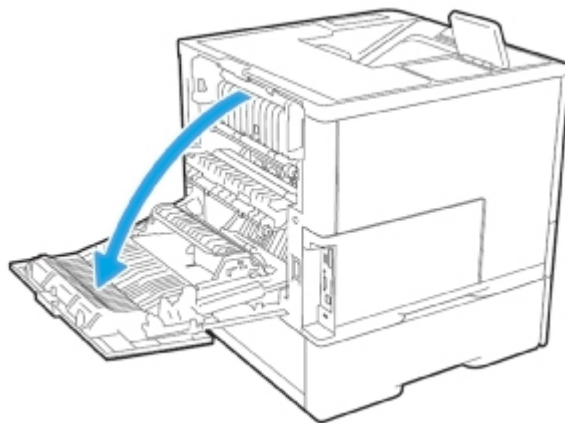


- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

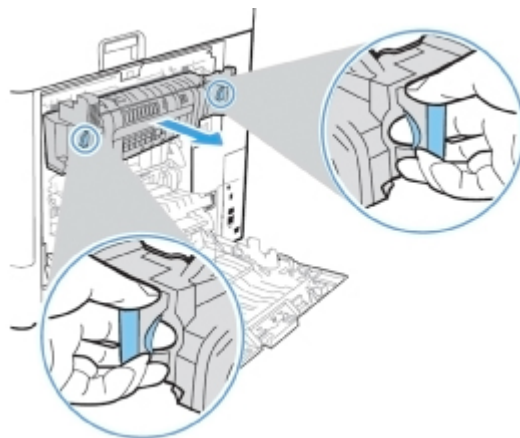


- c. Ensure that there is no residual paper in the fuser.

- d. Reseat the fuser.

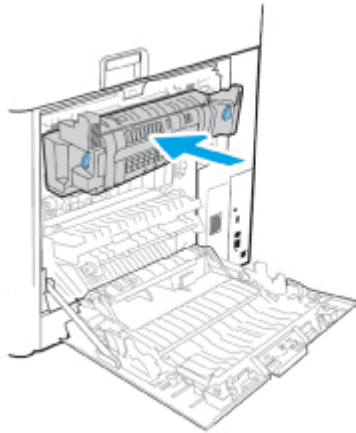

- e. Close the front door.
3. If the error persists, check the fuser connections.
- a. Remove the fuser.
 - b. Check the connection on the fuser

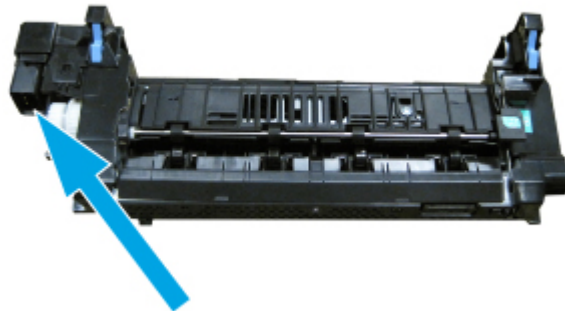

- c. If the fuser connector is damaged, replace the fuser.


110V part number: RM2-1256-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

- d. Check the connection to the fuser in the printer.

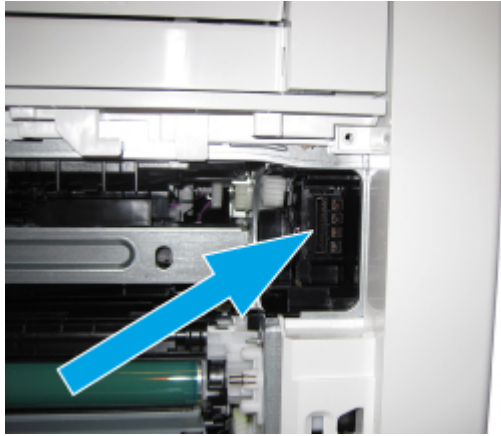

- e. If the connector is damaged, Elevate the issue using the Standard Support Process.
 - f. Check connections J401 and J402 on the DC controller PCA.
4. Check the paper type setting in the printer control panel menus and in the print driver. Ensure that the settings match and are correct for the type of paper being used.
 5. If the error persists, replace the low voltage power supply (LVPS).

110V LVPS part number: RM2-6797-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

220V LVPS part number: RM2-6798-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

50.4X.YZ

Drive circuit fault

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.

Check the size and type on the control panel Trays menu or use the EWS Trays menu

4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.


5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians


1. Turn the printer off.
2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

⚠ CAUTION: The fuser might be hot.

- a. Open the rear door.

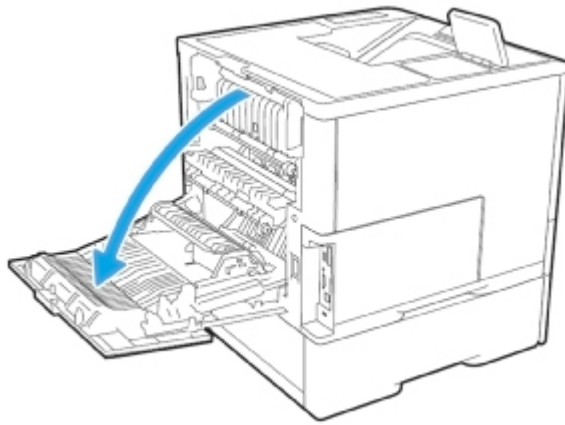


- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

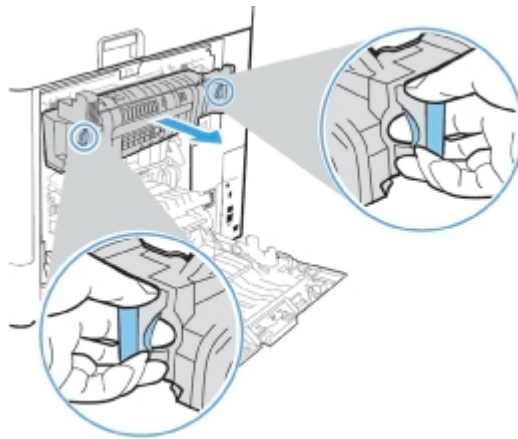

- c. Ensure that there is no residual paper in the fuser.

- d. Reseat the fuser.

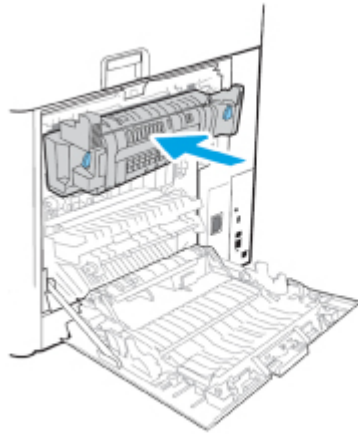

- e. Close the front door.

3. Check the printer power source. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.



NOTE: If the printer does not meet the power requirement of 43 to 67Hz frequency, the fuser temperature control does not work correctly and this will cause the error.

4. Check connections J401 and J402 on the DC controller PCA.
5. If the fuser has not been replaced, replace the fuser.

110V part number: RM2-1256-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

6. If the error persists, replace the low voltage power supply (LVPS).

110V LVPS part number: RM2-6797-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

220V LVPS part number: RM2-6798-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

50. 6X.YZ

Open fuser circuit (heating element failure)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.

 **NOTE:** Unplug the printer from any power-strip or uninterrupt power supply, and plug it directly into a wall socket.


3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians


1. Turn the printer off.
2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

 **CAUTION:** The fuser might be hot.

- a. Open the rear door.

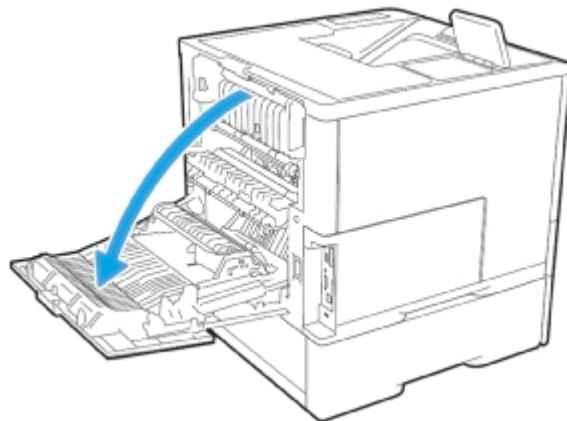

- b. Check the connection on the fuser

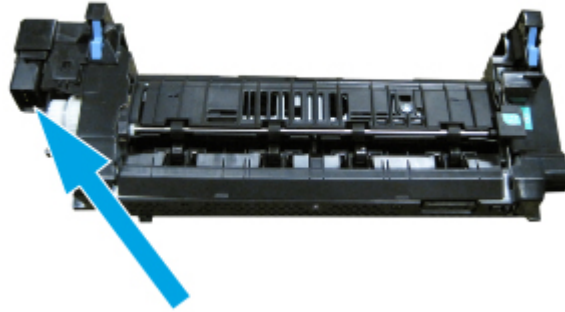

- c. If the fuser connector is damaged, replace the fuser.


110V part number: RM2-1256-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

- d. Check the connection to the fuser in the printer.

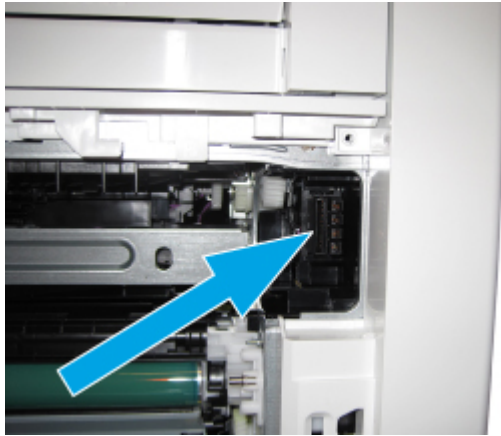

- e. If the connector is damaged, Elevate the issue using the Standard Support Process.

- f. Check connections J401 and J402 on the DC controller PCA.

- 4. If the fuser has not been replaced, replace the fuser.

110V part number: RM2-1256-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

- 5. If the error persists, replace the low voltage power supply (LVPS).

110V LVPS part number: RM2-6797-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

220V LVPS part number: RM2-6798-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

50.7F.00

Fuser pressure-release mechanism failure

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.




CAUTION: The fuser might be hot.

2. Check the condition and position of the fuser pressure relief sensor. If the sensor is damaged or missing, replace the fuser sensor.

Fuser output sensor (SR5) part number: WG8-5935-000CN

Figure 6-162 An undamaged fuser pressure relief sensor

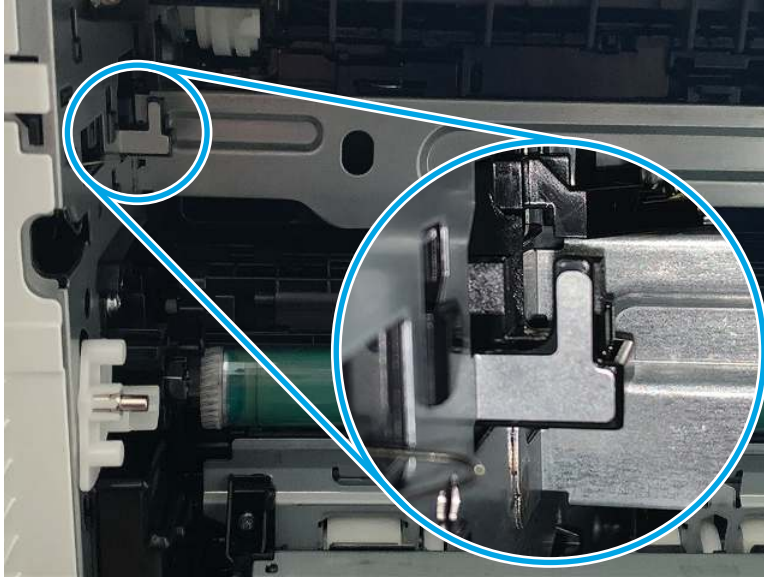

3. Inspect the fuser flag for damage. If the flag is damaged or missing, replace the fuser.

110V Fuser part number: RM2-1256-010CN

220V Fuser part number: RM2-1257-010CN

Figure 6-163 An undamaged fuser alienation flag on the left side of the fuser



4. If the error persists, replace the fuser drive motor assembly.

Fuser drive motor (M1) assembly part number: RM2-6763-000CN

Recommended action for onsite technicians


1. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

⚠ CAUTION: The fuser might be hot.

2. Check the condition and position of the fuser pressure relief sensor. If the sensor is damaged or missing, replace the fuser sensor.

Fuser output sensor (SR5) part number: WG8-5935-000CN

Figure 6-164 An undamaged fuser pressure relief sensor

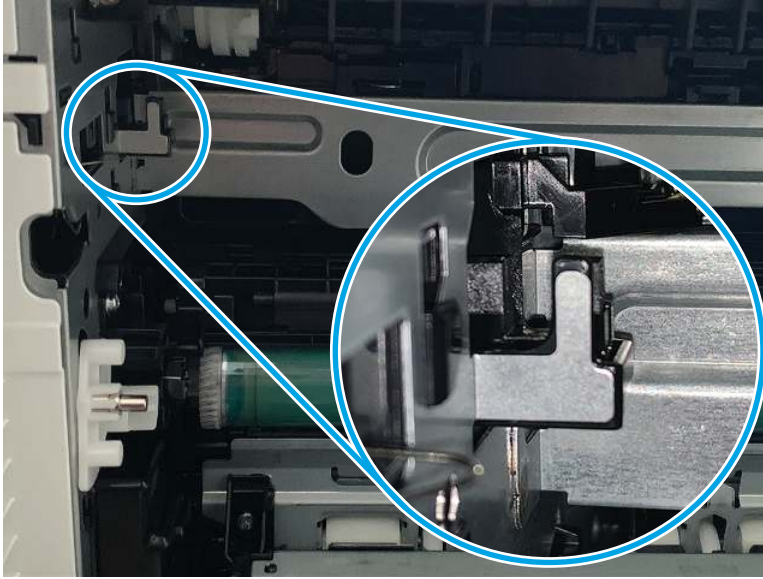

3. Inspect the fuser flag for damage. If the flag is damaged or missing, replace the fuser.

110V Fuser part number: RM2-1256-010CN

220V Fuser part number: RM2-1257-010CN

For instructions: *Removal and replacement: Fuser assembly* See the Repair Service Manual for this product.

Figure 6-165 An undamaged fuser alienation flag on the left side of the fuser




4. Run a **Fuser pressure relief motor** test from the printer control panel:
 - a. From the Home screen on the printer control panel, touch **Support Tools**.
 - b. Open **Troubleshooting > Diagnostic Tests > Components Test**.
 - c. Select the **Fuser pressure relief motor** option.
 - d. Select the **Repeat** check box.
 - e. Touch the **Start** button.
 - f. Listen for a clicking noise, which confirms that the motor is functioning.
 - g. If the motor test fails, replace the fuser drive motor assembly.

Fuser drive motor (M1) assembly part number: RM2-6763-000CN

For instructions: *Removal and replacement: Fuser drive assembly* See the Repair Service Manual for this product.

5. If this issue occurs after the replacement of a fuser drive assembly, check the spring on the new assembly and ensure it is in place. Without the spring, it will cause a 50.7F error.

Figure 6-166 Spring in correct location

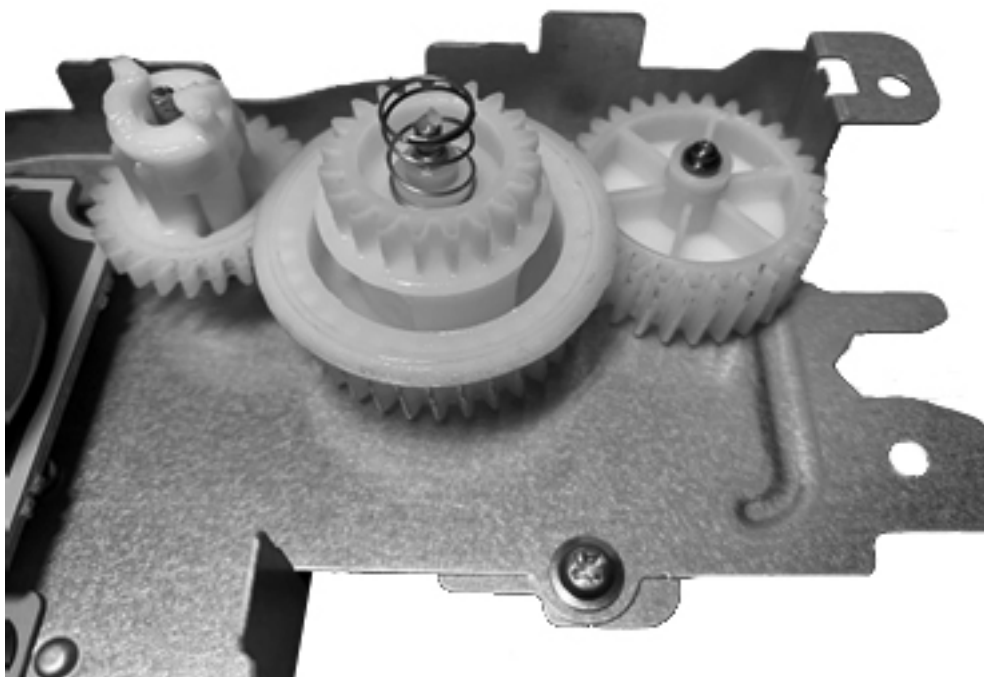

50.8X.YZ

Low fuser temperature 2

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.

 **NOTE:** Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.

Check the size and type on the control panel Trays menu or use the EWS Trays menu

4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.


6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians


1. Turn the printer off.
2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

⚠ CAUTION: The fuser might be hot.

- a. Open the rear door.

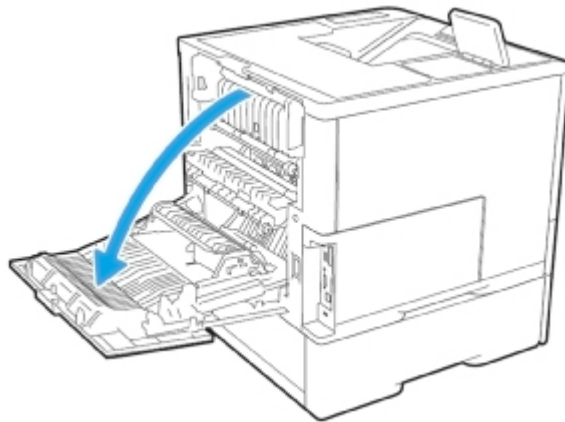


- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

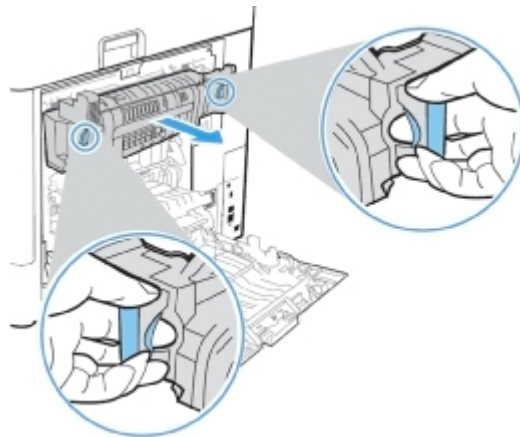

- c. Ensure that there is no residual paper in the fuser.

- d. Reseat the fuser.

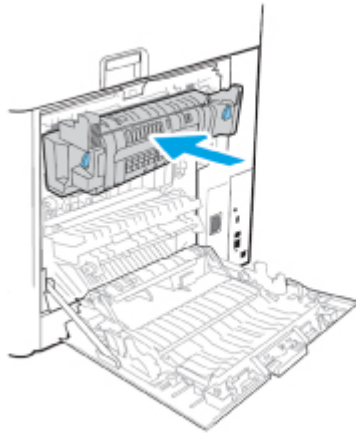

- e. Close the front door.

3. Check the printer power source. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.



NOTE: If the printer does not meet the power requirement of 43 to 67Hz frequency, the fuser temperature control does not work correctly and this will cause the error.

4. Check connections J401 and J402 on the DC controller PCA.

5. If the fuser has not been replaced, replace the fuser.

110V part number: RM2-1256-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

6. If the error persists, replace the low voltage power supply (LVPS).

110V LVPS part number: RM2-6797-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

220V LVPS part number: RM2-6798-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

50.9X.YZ

High fuser temperature 2

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterruptured power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.

Check the size and type on the control panel Trays menu or use the EWS Trays menu

4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.


Recommended action for call-center agents and onsite technicians

1. Turn the printer off.
2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.




CAUTION: The fuser might be hot.


- a. Open the rear door.

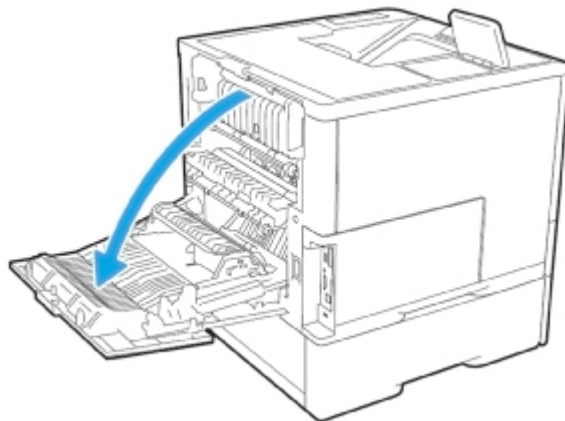

- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

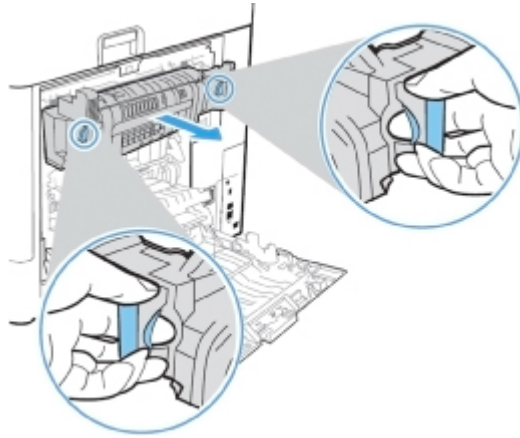

- c. Ensure that there is no residual paper in the fuser.
- d. Reseat the fuser.

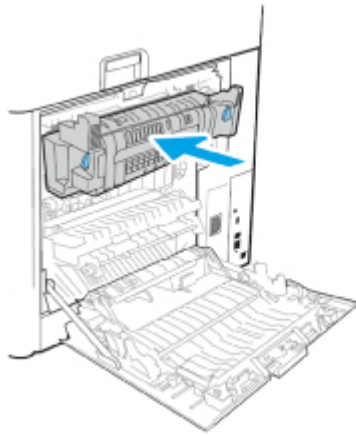

- e. Close the front door.
3. Check the printer power source. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.



NOTE: If the printer does not meet the power requirement of 43 to 67Hz frequency, the fuser temperature control does not work correctly and this will cause the error.

4. Check connections J401 and J402 on the DC controller PCA.
5. If the fuser has not been replaced, replace the fuser.

110V part number: RM2-1256-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

6. If the error persists, replace the low voltage power supply (LVPS).

110V LVPS part number: RM2-6797-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

220V LVPS part number: RM2-6798-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

50 .AX.YZ

Low fuser temperature 3

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.
Check the size and type on the control panel Trays menu or use the EWS Trays menu
4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.


Recommended action for call-center agents and onsite technicians

1. Turn the printer off.
2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.




CAUTION: The fuser might be hot.


- a. Open the rear door.

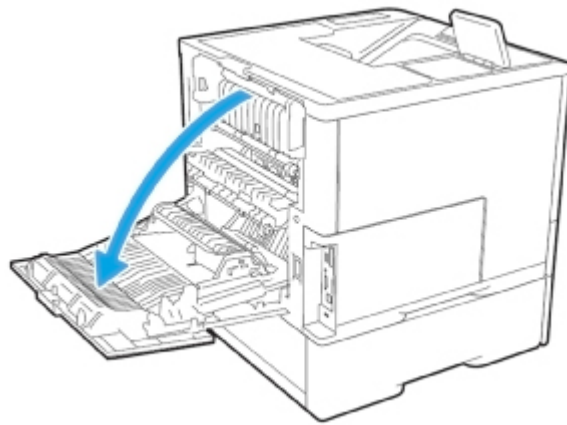

- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

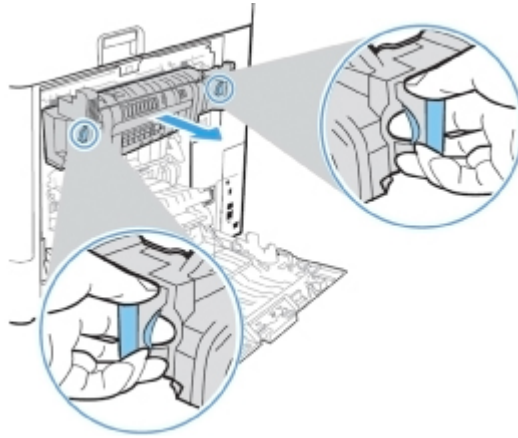

- c. Ensure that there is no residual paper in the fuser.
- d. Reseat the fuser.

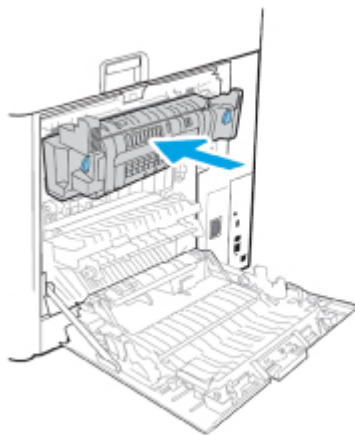

- e. Close the front door.

3. Check the printer power source. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.



NOTE: If the printer does not meet the power requirement of 43 to 67Hz frequency, the fuser temperature control does not work correctly and this will cause the error.

4. Check connections J401 and J402 on the DC controller PCA.

5. If the fuser has not been replaced, replace the fuser.

110V part number: RM2-1256-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

6. If the error persists, replace the low voltage power supply (LVPS).

110V LVPS part number: RM2-6797-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

220V LVPS part number: RM2-6798-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

50 .BX .YZ

High fuser temperature 3

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the printer is plugged directly into a wall outlet and that the outlet voltages matches the specification for the printer.



NOTE: Unplug the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correct for the paper being used.

Check the size and type on the control panel Trays menu or use the EWS Trays menu

4. Make sure the paper type is set correctly on the printer and that the printer driver matches the type of paper being printed on.
5. Retest the printer.
6. If the error persists, please contact customer support at: www.hp.com/go/contactHP.


Recommended action for call-center agents and onsite technicians

1. Turn the printer off.


2. Remove and reinstall the fuser. Ensure that the fuser is seated correctly.

⚠ CAUTION: The fuser might be hot.


- a. Open the rear door.

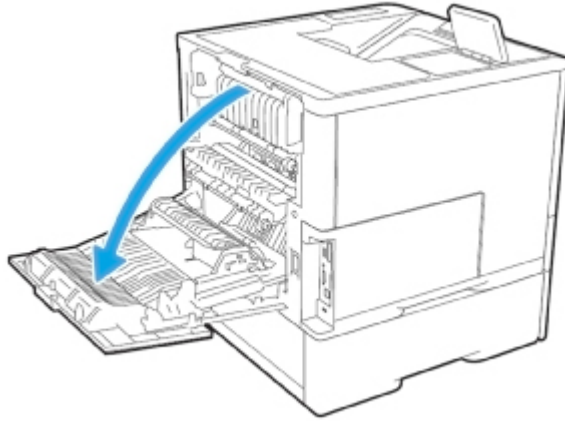

- b. Grasp the blue handles on both sides of the fuser and pull straight out to remove it.

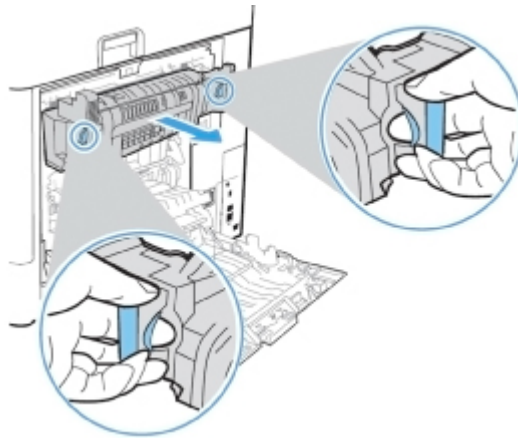

- c. Ensure that there is no residual paper in the fuser.
- d. Reseat the fuser.

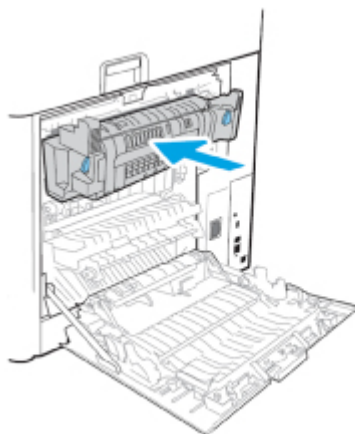

- e. Close the front door.
- 3. Check the printer power source. Ensure that the power source meets the printer requirements. Ensure that the printer is the only device using the circuit.



NOTE: If the printer does not meet the power requirement of 43 to 67Hz frequency, the fuser temperature control does not work correctly and this will cause the error.

- 4. Check connections J401 and J402 on the DC controller PCA.
- 5. If the fuser has not been replaced, replace the fuser.

110V part number: RM2-1256-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

- 6. If the error persists, replace the low voltage power supply (LVPS).

110V LVPS part number: RM2-6797-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

220V LVPS part number: RM2-6798-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

51.WX.YZ, 52.WX.YZ error messages

51.* errors

Errors in the 51.* family are related to the laser scanner.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Ensure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Check all connections on the laser/scanner and from the laser/scanner to the DC controller, and reseal them if necessary.
3. If the error persists, replace the laser scanner.

51.00.yz

An error with the laser/scanner assembly has occurred in the printer.

- **51.00.10** Beam detect error
- **51.00.19** Laser malfunction

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Open and close the front and rear doors to see if the printer returns to a [Ready](#).
2. Turn the printer off, and then on.
3. Reconnect connector (J8301) on the laser/scanner assembly and connector (J606) on the DC controller PCA.

4. If the error persists, replace the laser/scanner assembly.

Part number: RM2-0906-000CN

For instructions: *Removal and replacement: Laser/scanner assembly* See the Repair Service Manual for this product.

52.00.00/52.00.20 Scanner Startup/Rotation error

A printer laser/scanner error occurred.

- **52.00.00** laser/scanner startup error.
- **52.00.20** laser/scanner rotation error.

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Open and close the front and rear doors to see if the printer returns to a [Ready](#).
2. Turn the printer off, and then on.
3. Reconnect connector (J6104) on the laser/scanner assembly and connector (J205) on the DC controller PCA.
4. If the error persists, replace the laser/scanner assembly.

Part number: RM2-0906-000CN

For instructions: *Removal and replacement: Laser/scanner assembly* See the Repair Service Manual for this product.

53.WX.YZ error messages

53.A0.y0

Tray "Y" side guide misalignment resolved.

The engine detected that the tray guide misalignment has been resolved.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A0.10:** Tray 1 Side guide misalignment resolved.
- **53.A0.20:** Tray 2 side guide misalignment resolved.
- **53.A0.30:** Tray 3 side guide misalignment resolved.
- **53.A0.40:** Tray 4 side guide misalignment resolved.
- **53.A0.50:** Tray 5 side guide misalignment resolved.
- **53.A0.60:** Tray 6 side guide misalignment resolved.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.A0.y1

Tray "Y" Side guide misalignment proactive warning.

The engine detected a tray "Y" side guide misalignment.

This is a proactive warning intended to avoid a jam event.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A0.11:** Tray 1 side guide misalignment warning.
- **53.A0.21:** Tray 2 side guide misalignment warning.
- **53.A0.31:** Tray 3 side guide misalignment warning.
- **53.A0.41:** Tray 4 side guide misalignment warning.
- **53.A0.51:** Tray 5 side guide misalignment warning.
- **53.A0.61:** Tray 6 side guide misalignment warning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper size in the tray matches the tray size in the [Trays](#) menu.

2. If the trays are **not** locked, ensure the tray guides are correctly aligned to the size of paper being installed.
3. If the trays are locked, contact your managed print provider if you need to change the paper size from the one selected.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ask the customer to check the paper size loaded in the tray to see if it matches the size listed in the [Trays](#) menu or on the Configuration Page.
2. If the trays are **not** locked, educate the customer on the correct way to align the side guides when refilling paper in the tray.
3. Instruct the customer to contact the managed print provider if the paper size needs to be changed from the one selected.

53.A1.y0 Enter error message

Tray "Y" paper delivery direction misalignment resolved.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A1.10:** Tray 1 Side guide misalignment resolved.
- **53.A1.20:** Tray 2 side guide misalignment resolved.
- **53.A1.30:** Tray 3 side guide misalignment resolved.
- **53.A1.40:** Tray 4 side guide misalignment resolved.
- **53.A1.50:** Tray 5 side guide misalignment resolved.
- **53.A1.60:** Tray 6 side guide misalignment resolved.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.A1.y1

Tray "Y" paper delivery direction misalignment warning.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A1.11:** Tray 1 paper delivery direction misalignment warning.
- **53.A1.21:** Tray 2 paper delivery direction misalignment warning.
- **53.A1.31:** Tray 3 paper delivery direction misalignment warning.
- **53.A1.41:** Tray 4 paper delivery direction misalignment warning.

- **53.A1.51:** Tray 5 paper delivery direction misalignment warning.
- **53.A1.61:** Tray 6 paper delivery direction misalignment warning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper size in the tray matches the tray size in the [Trays](#) menu.
2. If the trays are **not** locked, ensure the tray guides are correctly aligned to the size of paper being installed.
3. If the trays are locked, contact your managed print provider if you need to change the paper size from the one selected.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper tray guides are set to the correct paper size that is being loaded into the paper tray.



NOTE: Check the event log for the following messages to determine which tray guides need to be adjusted.

- **53.A1.11:** Tray 1 paper delivery direction misalignment warning.
 - **53.A1.21:** Tray 2 paper delivery direction misalignment warning.
 - **53.A1.31:** Tray 3 paper delivery direction misalignment warning.
 - **53.A1.41:** Tray 4 paper delivery direction misalignment warning.
 - **53.A1.51:** Tray 5 paper delivery direction misalignment warning.
 - **53.A1.61:** Tray 6 paper delivery direction misalignment warning.
2. Ensure that the rear paper guide is set to the correct paper length.
 3. Ask the customer to check the paper size loaded in the tray to see if it matches the size listed in the [Trays](#) menu or on the Configuration Page.
 4. If the trays are **not** locked, educate the customer on the correct way to align the guides when refilling paper in the tray.
 5. Inspect the quality and condition of the customer paper to identify conditions that may lead to paper skewing.
 6. Inspect the condition of the feed and separation rollers of the listed tray, and ensure they are not worn, or damaged. Replace the rollers as needed.

53.A2.y0

Tray "Y" overload resolved.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A2.10:** Tray 1 overload resolved.

- **53.A2.20:** Tray 2 overload resolved.
- **53.A2.30:** Tray 3 overload resolved.
- **53.A2.40:** Tray 4 overload resolved.
- **53.A2.50:** Tray 5 overload resolved.
- **53.A2.60:** Tray 6 overload resolved.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.A2.y1

Tray "Y" overload warning.



NOTE: This is an event log only message, it will not show on the control panel.

"Y" = Tray number.

- **53.A2.11:** Tray 1 overload warning.
- **53.A2.21:** Tray 2 overload warning.
- **53.A2.31:** Tray 3 overload warning.
- **53.A2.41:** Tray 4 overload warning.
- **53.A2.51:** Tray 5 overload warning.
- **53.A2.61:** Tray 6 overload warning.

Recommended action

Follow these troubleshooting steps in the order presented.

- Remove paper from the specified tray until it is below the paper fill level mark.

53.B0.0z

Tray "Z" feed roller nearing end of life.

Prepare to replace tray pick rollers



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B0.01:** Tray 1 feed roller nearing end of life.
- **53.B0.02:** Tray 2 feed roller nearing end of life.
- **53.B0.03:** Tray 3 feed roller nearing end of life.
- **53.B0.04:** Tray 4 feed roller nearing end of life.

- **53.B0.05:** Tray 5 feed roller nearing end of life.
- **53.B0.06:** Tray 6 feed roller nearing end of life.

Recommended action

Follow these troubleshooting steps in the order presented.

- The paper tray rollers will need to be replaced soon. Be prepared to replace the tray rollers for the specified tray.



NOTE: Check the event log for the following messages to determine which tray rollers need to be changed.

- **53.B0.01:** Tray 1 feed roller nearing end of life.
- **53.B0.02:** Tray 2 feed roller nearing end of life.
- **53.B0.03:** Tray 3 feed roller nearing end of life.
- **53.B0.04:** Tray 4 feed roller nearing end of life.
- **53.B0.05:** Tray 5 feed roller nearing end of life.
- **53.B0.06:** Tray 6 feed roller nearing end of life.

53.B1.0z

Tray "Z" feed roller at end of life.



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B1.01:** Tray 1 feed roller at end of life.
- **53.B1.02:** Tray 2 feed roller at end of life.
- **53.B1.03:** Tray 3 feed roller at end of life.
- **53.B1.04:** Tray 4 feed roller at end of life.
- **53.B1.05:** Tray 5 feed roller at end of life.
- **53.B1.06:** Tray 6 feed roller at end of life.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

- Replace the feed and separation rollers for the specified tray.

53.B2.0z

Tray "Z" feed roller brand new.



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B2.01:** Tray 1 feed roller brand new.
- **53.B2.02:** Tray 2 feed roller brand new.
- **53.B2.03:** Tray 3 feed roller brand new.
- **53.B2.04:** Tray 4 feed roller brand new.
- **53.B2.05:** Tray 5 feed roller brand new.
- **53.B2.06:** Tray 6 feed roller brand new.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.B3.0z

Tray "Z" pick roller brand new (engine detected).

The engine detected that new tray feed rollers have been installed.



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B3.01:** Tray 1 feed roller brand new (engine detected).
- **53.B3.02:** Tray 2 feed roller brand new (engine detected).
- **53.B3.03:** Tray 3 feed roller brand new (engine detected).
- **53.B3.04:** Tray 4 feed roller brand new (engine detected).
- **53.B3.05:** Tray 5 feed roller brand new (engine detected).
- **53.B3.06:** Tray 6 feed roller brand new (engine detected).

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.C1.0z Tray "Z" size mismatch.

The specified tray contains a size that does not match the configured size.

Complete screen message:

The specified tray contains a size that does not match the configured size.

The tray is configured to support the only size indicated

Confirm guides are in correct position.

This issue occurs when the managed print provider has locked the paper tray to either letter or A4 and the tray has a different size paper loaded.



NOTE: This can occur if the tray was swapped out or the physical trays locks in the tray were removed and the guides changed.

- **53.C1.02:** Tray 2 size mismatch.
- **53.C1.03:** Tray 3 size mismatch.
- **53.C1.04:** Tray 4 size mismatch.
- **53.C1.05:** Tray 5 size mismatch.
- **53.C1.06:** Tray 6 size mismatch.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper size in the tray matches the tray size in the [Trays](#) menu.
2. Contact your managed print provider if you need to change the paper size from the one selected.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ask the customer to check the media size loaded in the tray to see if it matches the size listed in the [Trays](#) menu or on the Configuration Page.
2. Instruct the customer to contact the managed print provider if the paper size needs to be changed from the one selected.

54.WX.YZ error messages

54.* errors

Errors in the 54.* family are related to the image-formation system.

- For HP LaserJet printers, they can indicate a problem with the toner cartridges or the transfer unit (color printers only), or they can indicate a problem with a sensor, such as with the laser/scanner.
- For HP PageWide printers, they can indicate a problem with the calibration process.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Check the supplies status page using the [Supplies](#) menu on the control panel to verify that toner cartridges, toner collection unit (TCU), or the transfer belt kit are not past their useful life. Replace the supplies and maintenance parts as necessary.

To print a Supplies Status Page:

- a. From the Home screen on the printer control panel, select [Administration](#).
- b. Open the following menus:
 - i. [Reports](#)
 - ii. [Configuration/Status Pages](#)
- c. Scroll to and select [Supplies Status Page](#).
- d. Select [Print](#) to print the page.

To order parts, go to <https://www.hp.com/buy/parts>.

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check the supplies status page to verify that the toner cartridges, TCU, or the transfer belt kit are not past their useful life. Replace the supplies and maintenance parts as necessary.

3. For color printers, inspect the transfer belt for damage. Replace the transfer belt if necessary or instruct the customer to replace it.
4. For color printers, if the error persists, replace the registration assembly.
5. Check the connections between the laser/scanner and the DC controller, and from the laser/scanner to the printer. Reseat them if necessary. If the error persists, replace the laser scanner.

54.00.01 / 54.00.03

Environment sensor abnormality warning

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Replace the environment sensor.

Part number: RM2-9037-000CN



NOTE: Before replacing any parts, ensure that the connection (J16) on the DC controller is correctly seated.

55.WX.YZ, 56.WX.YZ error messages

55.* errors

Errors in the 55.* family often indicate a problem with the DC controller.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Reset the printer:
 - a. Turn the printer off using the power switch, and then wait at least 30 seconds.
 - b. Turn the printer on and wait for it to initialize.
2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, replace the DC controller.

55.00.01, 55.00.03 or 55.00.04 DC Controller Error

The communication link between the formatter and DC controller was lost.

- **55.00.01** DC controller memory error.
- **55.00.03** DC controller no engine response.
- **55.00.04** DC controller communications time out

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, replace the DC controller.



NOTE: Make sure to order the correct part number for the printer model.

Table 6-28 DC Controller part numbers

Description	Part number
DC Controller PC board assembly For printer models: M607/M608/M609/E60055/E60065/E60075	RM2-9494-000CN
DC Controller For printer models: M610/M611/M612	RM3-8461-000CN
DC Controller PCA For printer models: E60155/ E60165/ E60175	RM3-7619-000CN

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Turn the printer off, and then on.
2. Verify that all connectors on the DC controller are seated correctly.
3. If the error persists, disconnect and reconnect the flat flexible cables (FFC) between the formatter and DC controller.

Formatter connector: Remove one zero insertion force (ZIF) FFC (callout 1) and seven connectors (callout 2) from formatter PCA as indicated in the image below.




NOTE: One connector at the upper left corner of the formatter PCA is hidden behind the sheet metal and is not indicated by callout 2.

Figure 6-167 Formatter connector: ZIF FFC and connectors

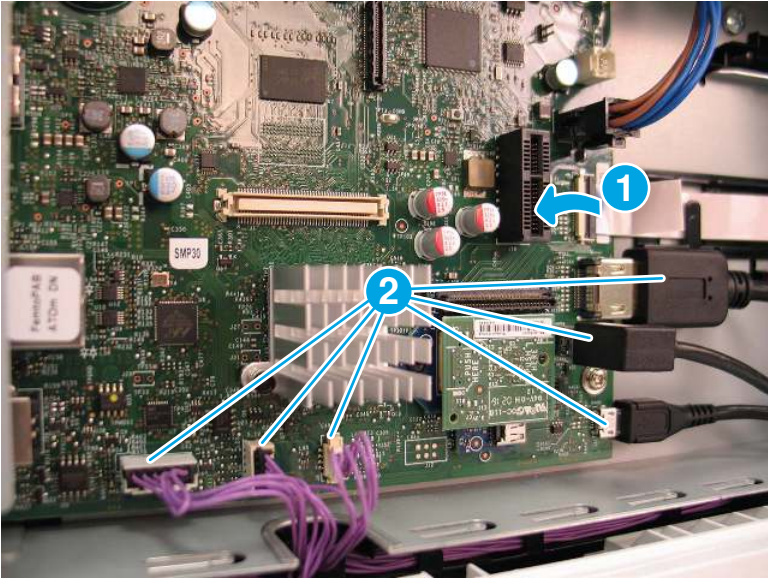

DC controller connector: Disconnect and remove the zero insertion force (ZIF) FFC cable (callout 1).

Figure 6-168 DC Controller connector: ZIF FFC cable

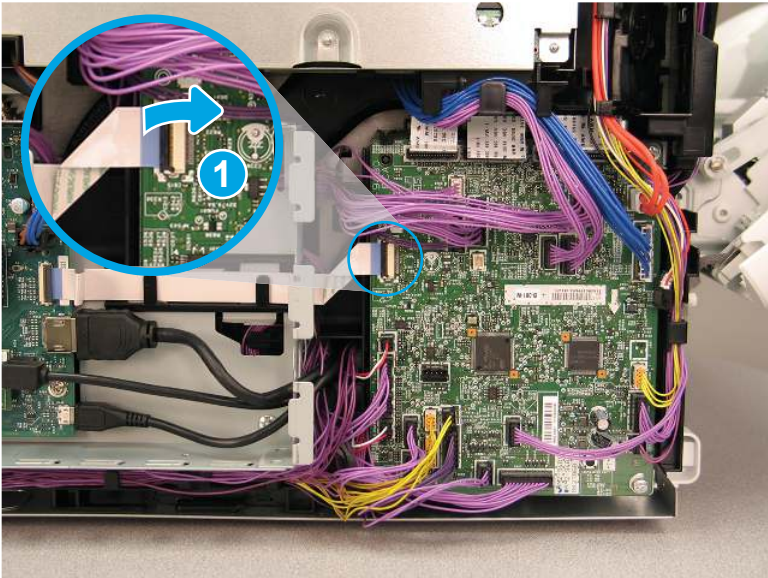

- 4. If the error persists, replace the DC controller.

 **NOTE:** Make sure to order the correct part number for the printer model.

Table 6-29 DC Controller part numbers

Description	Part number
DC Controller PC board assembly	RM2-9494-000CN
For printer models: M607/M608/M609/E60055/E60065/ E60075	

Table 6-29 DC Controller part numbers (continued)

Description	Part number
DC Controller	RM3-8461-000CN
For printer models: M610/M611/M612	
DC Controller PCA	RM3-7619-000CN
For printer models: E60155/ E60165/ E60175	

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

55.00.05 Engine Firmware RFU Error

The firmware upgrade failed.

Recommended action

1. Turn the printer off, and then on.
2. If issue remains re-send the upgrade.

55.01.06, 55.02.06 DC controller error To continue turn off then on

NVRAM memory warning

- 55.01.06 (event code)
NVRAM memory data error warning.
- 55.02.06 (event code)
NVRAM memory access error warning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, remove and reinstall the formatter board.
3. If the error persists, replace the DC controller.



NOTE: Make sure to order the correct part number for the printer model.

Table 6-30 DC Controller part numbers

Description	Part number
DC Controller PC board assembly For printer models: M607/M608/M609/E60055/E60065/ E60075	RM2-9494-000CN
DC Controller For printer models: M610/M611/M612	RM3-8461-000CN
DC Controller PCA For printer models: E60155/ E60165/ E60175	RM3-7619-000CN

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, remove the formatter, reseal the DIMMs, EIO cards, and reinstall the formatter.
3. If the error persists, disconnect and reconnect all the cables on the DC controller.
4. If the error persists, replace the DC controller.

Table 6-31 DC Controller part numbers

Description	Part number
DC Controller PC board assembly For printer models: M607/M608/M609/E60055/E60065/ E60075	RM2-9494-000CN
DC Controller For printer models: M610/M611/M612	RM3-8461-000CN
DC Controller PCA For printer models: E60155/ E60165/ E60175	RM3-7619-000CN

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

56.* errors

Errors in the 56.* family indicate a communication problem with an optional paper tray or other external accessory.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. If any third-party hardware is installed, remove it and try printing again.
3. If an optional paper tray is installed, remove it. Check the connectors on the tray for damage. If the connector is damaged, replace the tray.
4. Reinstall the tray, and make sure it is correctly seated.

56.00.YZ

The printer experienced a communication error with the optional paper trays.

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call agents and service technicians

1. Turn the printer off, then on.
2. If the error persists, re-seat the optional paper trays.
3. Check the input connectors for damage. If a connector is damaged, replace the connector.

1X550 SF Option top cable assembly part number: RM2-8868-000CN

1X550 SF Option bottom cable assembly part number: RM2-8869-000CN

2100 SF Draw upper cable assembly part number: RM2-9286-000CN

56.00.01 Illegal Input Printer Error

The printer experienced an illegal input.

Recommended action

1. Turn the printer off, then on.
2. Remove any third-party hardware and test again.

57.WX.YZ error messages

57.* errors

Errors in the 57.* family indicate a problem with a fan.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the printer troubleshooting manual to identify the locations of each fan. Turn the printer off and then on, and listen for noise coming from the area of each fan. Replace any fan that is not making noise.
2. Update the firmware to the latest version. If the latest version firmware is already installed, reinstall it now.

For more information, see:

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Remove enough parts to access the DC controller or the power supply PCA. Check the connections from each fan to the DC controller or power supply PCA. Reseat them if necessary.
4. With the DC controller or power supply PCA exposed, turn the printer on. Immediately measure the voltage between the connectors for each fan and the DC controller. If the voltage changes from 0V to approximately 24V during the power-on cycle, replace the affected fan. If the voltage remains at 0V, replace the DC controller.

57.00.01 Fan failure

Cartridge upper (FM3) failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Verify the error condition with the customer.
3. If the error persists, replace the cartridge upper fan, FM3.
 - a. Remove and reconnect J6404 on the cartridge upper fan.
 - b. Remove and reconnect J16 on the DC controller PCA.
 - c. Replace the cartridge upper fan: FM3.

Table 6-32 FM3 part number

Description	Part number
Fan assembly kit - Includes (FM3/FM4) fans	RK2-8946-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Check the cartridge upper fan, FM3.
 - a. Remove and reconnect J6404 on the cartridge upper fan.
 - b. Remove and reconnect J16 on the DC controller PCA.
 - c. If the error persists, replace the cartridge upper fan, FM3.



NOTE: The part numbers for the Cartridge Upper Fan (FM3) and Cartridge Lower Fan (FM4) are the same. These parts can be swapped to determine the fan functionality.

Table 6-33 FM3 part number

Description	Part number
Fan assembly kit - Includes (FM3/FM4) fans	RK2-8946-000CN

3. If the error persists after the fan replacement, replace the DC controller.



NOTE: Make sure to order the correct part number for the printer model.

Table 6-34 DC Controller part numbers

Description	Part number
DC Controller PC board assembly	RM2-9494-000CN
For printer models: M607/M608/M609/E60055/E60065/E60075	
DC Controller	RM3-8461-000CN
For printer models: M610/M611/M612	

Table 6-34 DC Controller part numbers (continued)

Description	Part number
DC Controller PCA	RM3-7619-000CN
For printer models: E60155/ E60165/ E60175	

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

57.00.02 Fan failure

Cartridge lower fan (FM4) error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Verify the error condition with the customer.
3. If the error persists, replace the cartridge lower fan, FM4.
 - a. Remove and reconnect J6405 on the cartridge lower fan.
 - b. Remove and reconnect J16 on the DC controller PCA.
 - c. Replace the cartridge lower fan: FM4.

Table 6-35 FM4 part number

Description	Part number
Fan assembly kit - Includes (FM3/FM4) fans	RK2-8946-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Check the cartridge upper fan, FM4.
 - a. Remove and reconnect J6405 on the cartridge upper fan.
 - b. Remove and reconnect J16 on the DC controller PCA.

- c. If the error persists, replace the cartridge upper fan, FM4.



NOTE: The part numbers for the Cartridge Upper Fan (FM3) and Cartridge Lower Fan (FM4) are the same. These parts can be swapped to determine the fan functionality.

Table 6-36 FM4 part number

Description	Part number
Fan assembly kit - Includes (FM3/FM4) fans	RK2-8946-000CN

3. If the error persists after the fan replacement, replace the DC controller.



NOTE: Make sure to order the correct part number for the printer model.

Table 6-37 DC Controller part numbers

Description	Part number
DC Controller PC board assembly	RM2-9494-000CN
For printer models: M607/M608/M609/E60055/E60065/E60075	
DC Controller	RM3-8461-000CN
For printer models: M610/M611/M612	
DC Controller PCA	RM3-7619-000CN
For printer models: E60155/ E60165/ E60175	

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

57.00.03 Fan failure

Duplex fan FM2 failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Verify the error condition with the customer. The printer will not be able to print.

3. Dispatch a technician with the correct part number for Fan, FM2.

Table 6-38 FM2 part number

Description	Part number
Fan (FM2)	RK2-8948-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Verify the error condition with the customer.
3. Prior to replacing the fan, tighten the screw on the upper paper feed guide assembly as indicated in the image below.

Figure 6-169 View from Rear door


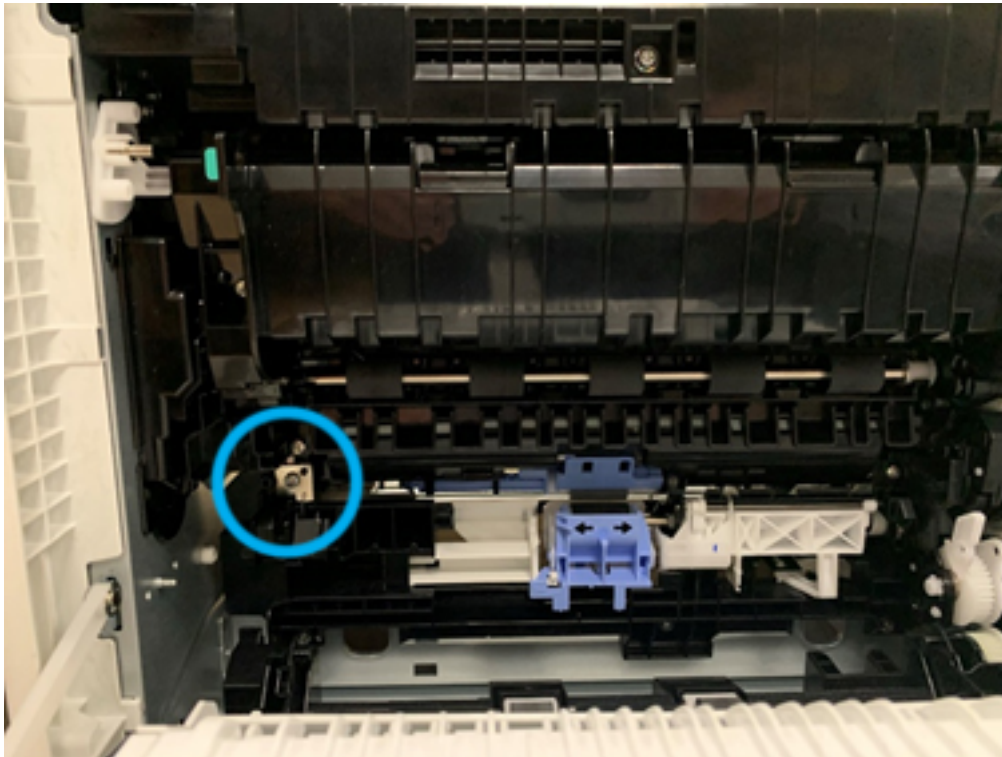


Figure 6-170 Tighten screw

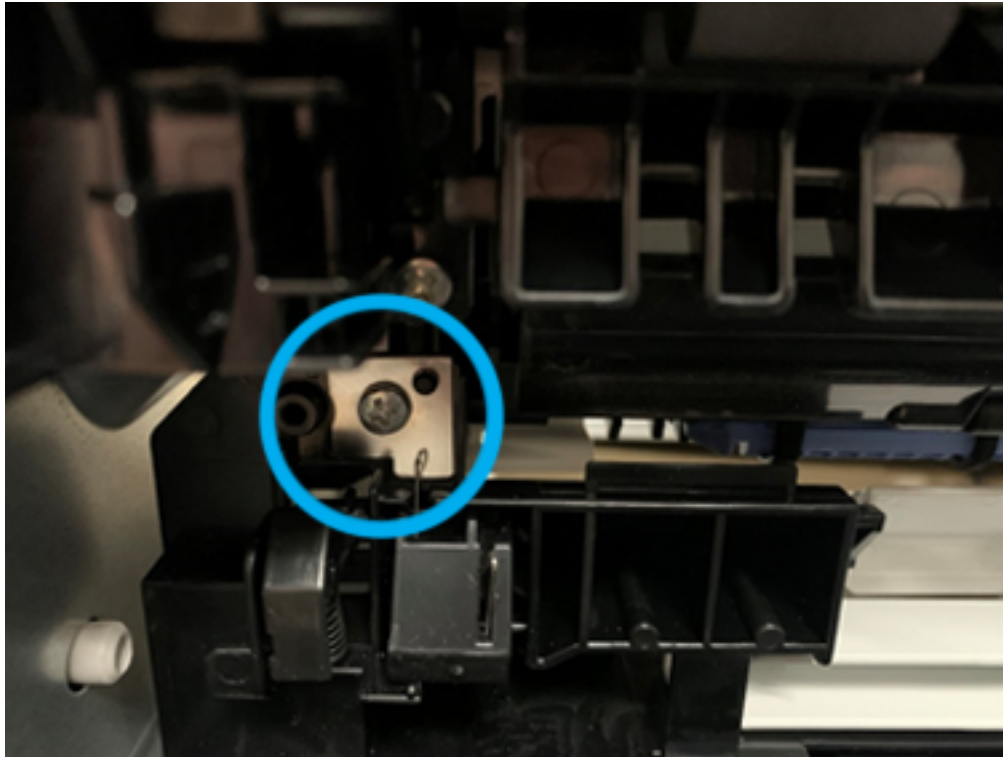

4. If the error persists after tightening the screw, replace Fan 2 (FM2).

Table 6-39 FM2 part number

Description	Part number
Fan (FM2)	RK2-8948-000CN

5. If the error persists after the fan replacement, replace the DC Controller for the specific product.



NOTE: Make sure to order the correct part number for the printer model.

Table 6-40 DC Controller part numbers

Description	Part number
DC Controller PC board assembly	RM2-9494-000CN
For printer models: M607/M608/M609/E60055/E60065/E60075	
DC Controller	RM3-8461-000CN
For printer models: M610/M611/M612	
DC Controller PCA	RM3-7619-000CN
For printer models: E60155/ E60165/ E60175	

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

57.00.04 Fan failure

Scanner fan FM1 failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Verify the error condition with the customer.
3. If the error persists, replace the scanner fan, FM1.
 - a. Remove and reconnect J6402 on the scanner fan.
 - b. Remove and reconnect J211 on the DC controller PCA.
 - c. Replace the scanner fan: FM1.

Table 6-41 FM1 part number

Description	Part number
Fan assembly kit	RK2-8946-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Check the scanner fan FM1.
 - a. Remove and reconnect J6402 on the scanner fan.
 - b. Remove and reconnect J211 on the DC controller PCA.
 - c. If the error persists, replace the scanner fan, FM1.

Table 6-42 FM1 part number

Description	Part number
Fan assembly kit	RK2-8946-000CN

3. If the error persists after the fan replacement, replace the DC controller for the product.



NOTE: Make sure to order the correct part number for the printer model.

Table 6-43 DC Controller part numbers

Description	Part number
DC Controller PC board assembly For printer models: M607/M608/M609/E60055/E60065/ E60075	RM2-9494-000CN
DC Controller For printer models: M610/M611/M612	RM3-8461-000CN
DC Controller PCA For printer models: E60155/ E60165/ E60175	RM3-7619-000CN

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

58.WX.YZ error messages

58.* errors

Errors in the 58.* family indicate an electrical problem inside the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. Check all connections on the DC Controller and the power supply. Trace the connections from the DC Controller and power supply to the sensors and other components and reseal them if necessary.

58.00.02 Error

Environmental sensor failure.

Recommended action for customers

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues. Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues. Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. If the error persists, replace the environmental sensor.

Part number: RM2-9037-000CN



NOTE: Before replacing any parts, ensure that the connections of the environment sensor (J4200) and connector (J16) on the DC controller PCA.

58.00.03 Error

DC controller failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Verify the error condition with the customer.
3. If the error persists, replace the DC controller PCA.



NOTE: Make sure to order the correct part number for the printer model.

Table 6-44 DC Controller part numbers

Description	Part number
DC Controller PC board assembly	RM2-9494-000CN
For printer models: M607/M608/M609/E60055/E60065/E60075	
DC Controller	RM3-8461-000CN
For printer models: M610/M611/M612	
DC Controller PCA	RM3-7619-000CN
For printer models: E60155/ E60165/ E60175	

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure all the connections on the DC controller PCA are connected and securely seated.

3. If the error persists, replace the DC controller PCA.



NOTE: Make sure to order the correct part number for the printer model.

Table 6-45 DC Controller part numbers

Description	Part number
DC Controller PC board assembly For printer models: M607/M608/M609/E60055/E60065/ E60075	RM2-9494-000CN
DC Controller For printer models: M610/M611/M612	RM3-8461-000CN
DC Controller PCA For printer models: E60155/ E60165/ E60175	RM3-7619-000CN

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

58.00.04 Error

Low-voltage power supply unit malfunction.

Recommended action for customers

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues. Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues. Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. Ensure the printer is plugged into a dedicated power outlet.
3. If the error persists, replace the low-voltage power supply (LVPS).



NOTE: Before replacing any parts, ensure that connector J601 and J602 on the DC controller PCA are connected and securely seated.

110V LVPS part number: RM2-6797-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

220V LVPS part number: RM2-6798-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

58.01.04 Error

24V power supply error during operation.

During a regular printing operation the 24V power supply experienced an error.

Recommended action for customers

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues. Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues. Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. Ensure the printer is plugged into a dedicated power outlet.
3. If the error persists, replace the low-voltage power supply (LVPS).



NOTE: Before replacing any parts, ensure that all of the connections on the DC controller PCA are connected and securely seated.

110V LVPS part number: RM2-6797-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

220V LVPS part number: RM2-6798-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

58.02.04 Error

24V power supply error during printer power on or wake up.

During the printer power on, or when waking from a sleep mode, the printer experienced an error with the 24V power supply.

Recommended action for customers

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues. Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues. Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. Ensure the printer is plugged into a dedicated power outlet.
3. If the error persists, replace the low-voltage power supply (LVPS).



NOTE: Before replacing any parts, ensure that all of the connections on the DC controller PCA are connected and securely seated.

110V LVPS part number: RM2-6797-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

220V LVPS part number: RM2-6798-000CN

For instructions: *Removal and replacement: Low voltage power supply* See the Repair Service Manual for this product.

59.WX.YZ error messages

59.* errors

Errors in the 59.* family indicate a problem with one of the motors or with the lifter drive assembly for one of the trays.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check all connections on the main control board of the printer, (DC controller, Engine control board ECB), the driver PCA, each motor, and to the paper feeder drive PCA (for an optional paper feeder). Reseat them if necessary.

59.00.00 Motor error

Tray lift motor M3 failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then turn on the printer.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Verify the error condition with the customer.
3. Replace the lifter drive assembly.

 **IMPORTANT:** Ensure to add notes for the onsite technician to check the connector J206 on the DC controller before replacing any parts.

Table 6-46 Lifter drive assembly

Description	Part number
Lifter drive assembly - Includes motor (M3)	RM2-6744-000CN

For instructions: *Removal and replacement: Lifter drive assembly* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the lifter drive assembly.


Table 6-47 Lifter drive assembly

Description	Part number
Lifter drive assembly - Includes motor (M3)	RM2-6744-000CN

For instructions: *Removal and replacement: Lifter drive assembly* See the Repair Service Manual for this product.

3. If the error persists, reseal the connector J206 on the DC controller prior to replacing any part.

Figure 6-171 DC controller PCA connections

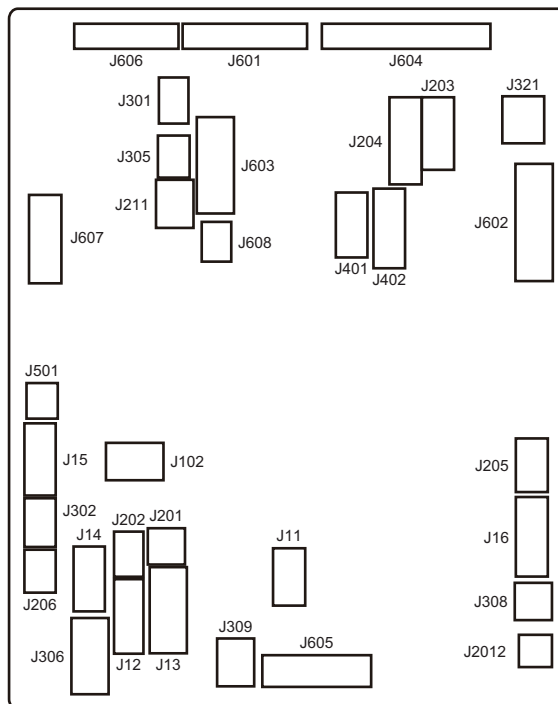

4. If the error persists after re-seating J206 on the DC controller, replace the DC controller.



NOTE: Make sure to order the correct part number for the printer model.

Table 6-48 DC Controller part numbers

Description	Part number
DC Controller PC board assembly For printer models: M607/M608/M609/E60055/E60065/E60075	RM2-9494-000CN
DC Controller For printer models: M610/M611/M612	RM3-8461-000CN
DC Controller PCA For printer models: E60155/ E60165/ E60175	RM3-7619-000CN

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

59.00.30 or 59.00.40: Fuser error

Fuser motor (M1) start up error or fuser motor (M1) rotational error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer to clear the error.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. Verify the error condition with the customer.
3. Locate the fuser and remove it.

Depending on the location of the fuser, open the rear door or the right door to remove the fuser.

 **CAUTION:** The fuser might be hot. Ensure to wait for the fuser to cool before removing it.

4. Rotate the fuser gear to ensure it moves freely. If it does not move freely, replace the fuser.

Table 6-49 Fuser assembly part numbers


Description	Part number
110V Fuser assembly	RM2-1256-020CN
220V Fuser assembly	RM2-1257-020CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

5. If the fuser gear moves freely, perform a diagnostic test to check the fuser motor.

- a. From the Home screen on the printer control panel, select [Support Tools](#).
- b. Open the following menus:
 - i. [Troubleshooting](#)
 - ii. [Diagnostic Tests](#)
 - iii. [Component Test](#)
- c. Select [Fuser motor](#), and then select [Start](#).

Figure 6-172 Fuser motor test

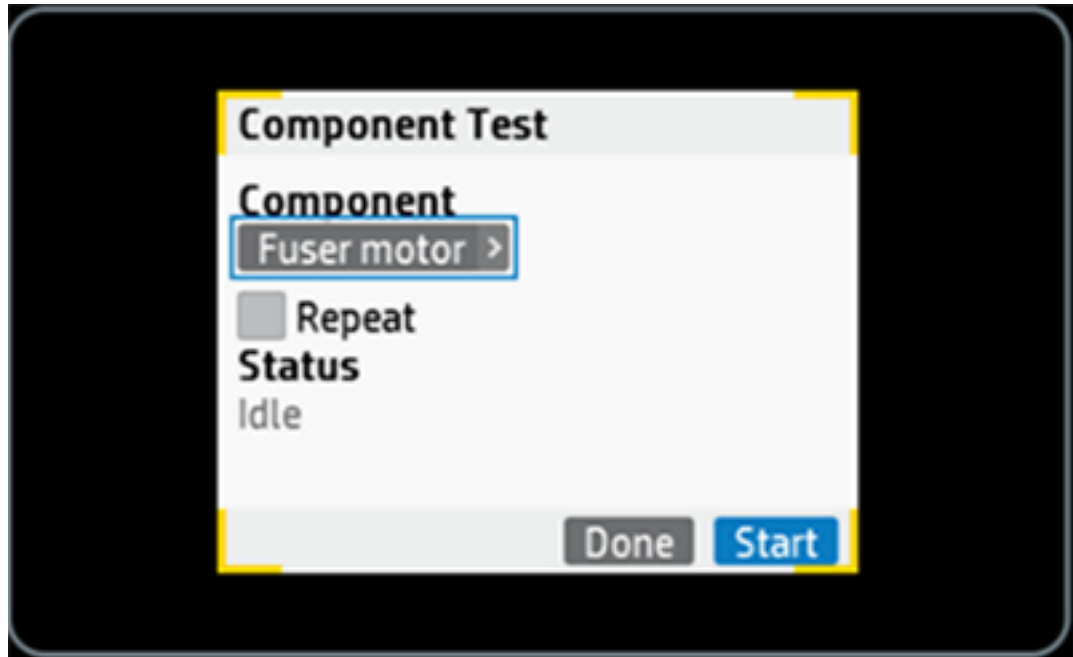

6. If the fuser motor test fails, replace the fuser drive assembly.

Table 6-50 Fuser drive motor part number

Description	Part number
Fuser drive motor (M1) assembly	RM2-6763-000CN

For instructions: *Fuser drive* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. Locate the fuser and remove it.

Depending on the location of the fuser, open the rear door or the right door to remove the fuser.

⚠ CAUTION: The fuser might be hot. Ensure to wait for the fuser to cool before removing it.

3. Rotate the fuser gear to ensure it moves freely. If it does not move freely, replace the fuser.


Table 6-51 Fuser assembly part numbers

Description	Part number
110V Fuser assembly	RM2-1256-020CN
220V Fuser assembly	RM2-1257-020CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.


4. If the fuser gear moves freely, perform a diagnostic test to check the fuser motor.
 - a. From the Home screen on the printer control panel, select [Support Tools](#).
 - b. Open the following menus:
 - i. [Troubleshooting](#)
 - ii. [Diagnostic Tests](#)
 - iii. [Component Test](#)
 - c. Select [Fuser motor](#), and then select [Start](#).

Figure 6-173 Fuser motor test

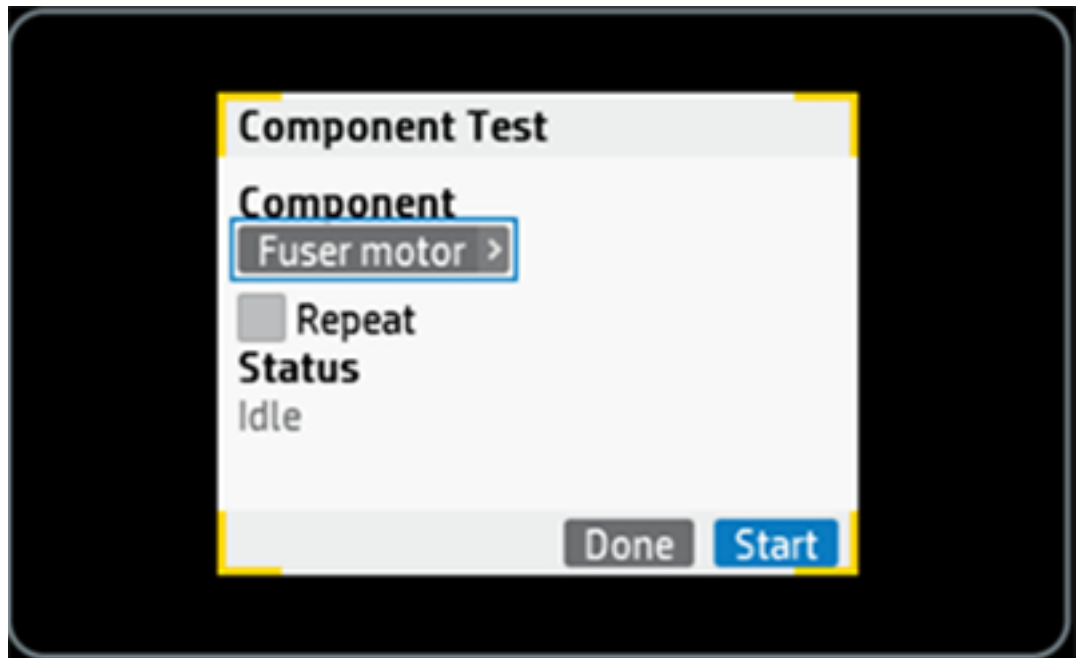

5. If the fuser motor does not function correctly, ensure connector J204 on the DC controller PCA is securely and correctly seated.

Figure 6-174 DC controller PCA connections

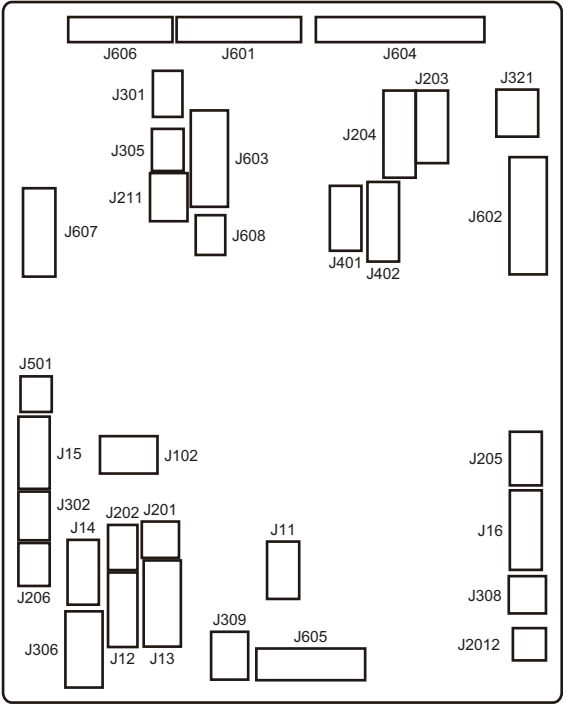

6. If the error persists after re-seating J204 on the DC controller, retest the fuser motor.
7. If the fuser motor test fails, replace the fuser drive assembly.

Table 6-52 Fuser drive motor part number

Description	Part number
Fuser drive motor (M1) assembly	RM2-6763-000CN

For instructions: *Fuser drive* See the Repair Service Manual for this product.

8. If the error persists after the motor has been replaced, replace the DC controller.

 **NOTE:** Make sure to order the correct part number for the printer model.

Table 6-53 DC Controller part numbers

Description	Part number
DC Controller PC board assembly	RM2-9494-000CN
For printer models: M607/M608/M609/E60055/E60065/E60075	
DC Controller	RM3-8461-000CN
For printer models: M610/M611/M612	

Table 6-53 DC Controller part numbers (continued)

Description	Part number
DC Controller PCA	RM3-7619-000CN
For printer models: E60155/ E60165/ E60175	

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

59.00.50 or 59.00.60

The printer experienced a drum motor (M2) error.

- **59.00.50** Drum motor startup abnormality.
- **59.00.60** Drum motor rotation abnormality.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn off the printer.
2. Remove the toner cartridge and turn on the printer.
 - a. Press the cartridge door release button to open the door.
 - b. Pull out the cartridge drawer.
 - c. Grasp the handle or indentation of the used toner cartridge and pull up to remove it.
3. If the error does not occur with the toner cartridge removed, install a different or new HP genuine toner cartridge.
 - a. Remove the new toner cartridge from its protective bag.
 - b. Hold both ends of the toner cartridge and rock it side-to-side 5-6 times.
 - c. Remove the cartridge shipping cover.
 - d. Place the toner cartridge in the cartridge drawer.
 - e. Close the toner cartridge drawer.
 - f. Close the cartridge door.
4. If the issue persists with the toner cartridge removed, contact customer support at:<http://www.hp.com/go/contactHP>.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer.
2. Remove the toner cartridge and turn on the printer.

3. If the issue persists with the toner cartridge removed, replace the drum motor, M2.

Table 6-54 Drum motor (M2) assembly part number

Description	Part number
Drum motor (M2) assembly	RM2-9316-000CN

For instructions: *Removal and replacement: Drum motor* See the Repair Service Manual for this product.

4. If the error does not occur with the toner cartridge removed, replace the toner cartridge.



NOTE: Check the part number on the installed toner cartridge to ensure the correct capacity cartridge is ordered.

Table 6-55 Toner cartridge part numbers


Description	Part number
Cartridge - SVC 37A Black Toner	CF237-67906
Cartridge - SVC 37X Black Toner Extra	CF237-67907
HP CF237G US federal government black toner cartridge	CF237-67903

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.


1. Turn off the printer.
2. Remove the toner cartridge, and then turn on the printer.
3. If the issue persists with the toner cartridge removed, perform the drum motor (M2) diagnostic test.
 - a. From the Home screen on the printer control panel, select [Support Tools](#).
 - b. Open the following menus:
 - i. [Troubleshooting](#)
 - ii. [Diagnostic Tests](#)
 - iii. [Component Test](#)
 - c. Select [Drum motor](#), and then select [Start](#) to start the component test.

Figure 6-175 Drum motor

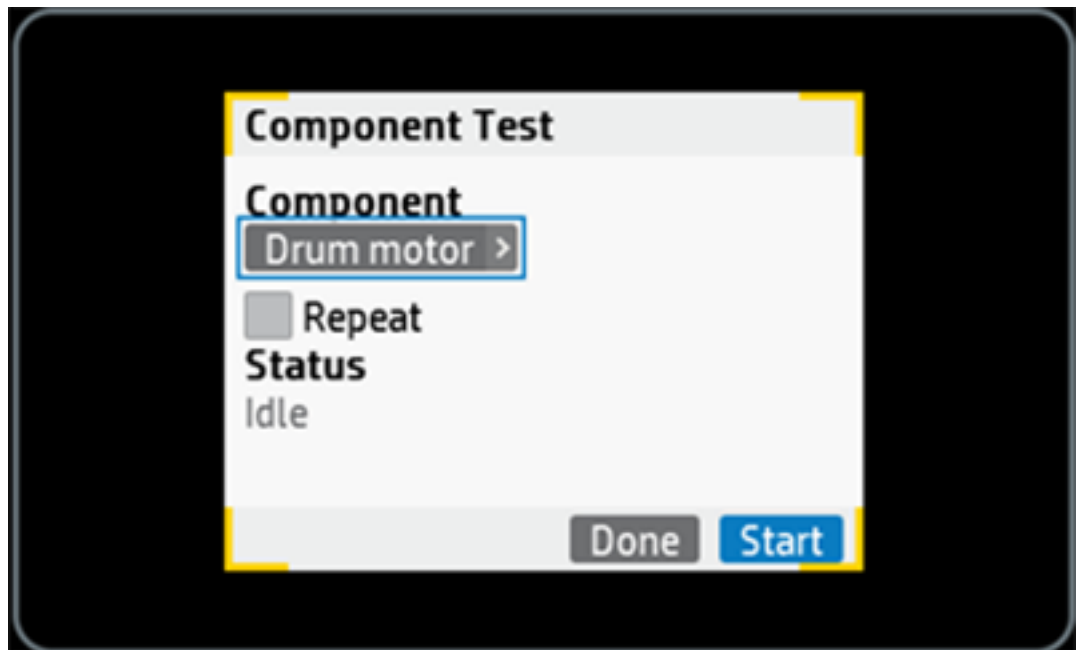

4. If the motor does not function correctly or fails, do the following tasks in the order presented before replacing any part:
 - a. Disconnect and reconnect connector J203 on the DC controller PCA.

Figure 6-176 DC controller PCA connections

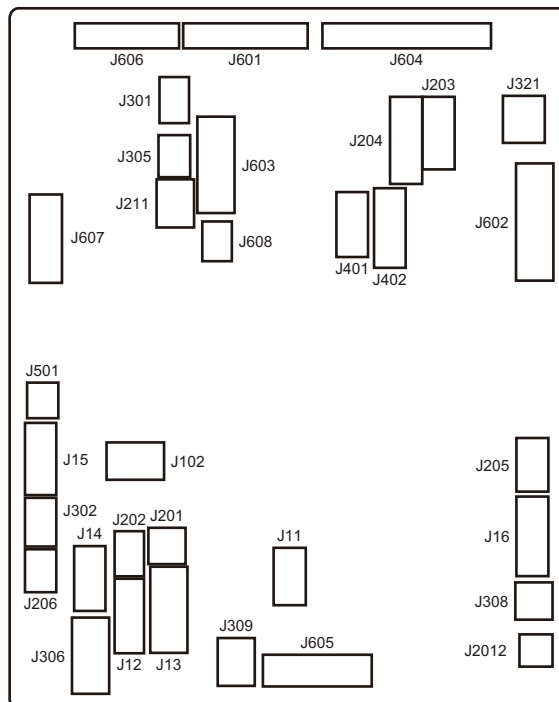

- b. Use the power button to turn off the printer.
 - c. Run the drum motor test again and check if the issue persists.

- d. If the issue persists and the drum motor continues to fail, replace the drum motor (M2) assembly.

Table 6-56 Drum motor (M2) assembly part number

Description	Part number
Drum motor (M2) assembly	RM2-9316-000CN

For instructions: *Drum motor* See the Repair Service Manual for this product.

5. If the drum motor test is successful without the toner cartridge installed, replace the toner cartridge.



NOTE: Check the part number on the installed toner cartridge to ensure the correct capacity cartridge is ordered.

Table 6-57 Toner cartridge part numbers

Description	Part number
Cartridge - SVC 37A Black Toner	CF237-67906
Cartridge - SVC 37X Black Toner Extra	CF237-67907
HP CF237G US federal government black toner cartridge	CF237-67903

6. If the error persists after the drum motor has been replaced, replace the DC controller.



NOTE: Make sure to order the correct part number for the printer model.

Table 6-58 DC Controller part numbers

Description	Part number
DC Controller PC board assembly	RM2-9494-000CN
For printer models: M607/M608/M609/E60055/E60065/E60075	
DC Controller	RM3-8461-000CN
For printer models: M610/M611/M612	
DC Controller PCA	RM3-7619-000CN
For printer models: E60155/ E60165/ E60175	

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

59.00.90

The developer-disengagement motor experienced a rotational error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Turn the printer off.
2. Remove the toner cartridge and turn the printer on.

If the message "install toner cartridge appears without the 59 error, reinstall the toner cartridge.
3. If the error returns with the toner cartridge installed, try a new cartridge if available. If not replace the toner cartridge.



NOTE: Check the part number on the installed toner cartridge to ensure the correct capacity cartridge is ordered.

4. If the error persists with a new toner cartridge, replace the Developing Drive Assembly.

Developer drive assembly part number: RM2-6756-000CN

M607, M608, M608nk, M609, M610, M611, M612, E60055-E60075, E60155-E60175

For instructions: *Remove and replace: Developer drive assembly* See the Repair Service Manual for this product.

M631, M632, M633, M634, M635, M636, M637, E62555-E62575, E62655-E62675

For instructions: *Remove and replace: Developer drive assembly* See the Repair Service Manual for this product.

Recommended action for onsite technicians

1. Turn the printer off.
2. Remove the toner cartridge and turn the printer on.

If the message "install toner cartridge appears without the 59 error, reinstall the toner cartridge.
3. If the error returns with the toner cartridge installed, try a new cartridge if available. If not replace the toner cartridge.



NOTE: Check the part number on the installed toner cartridge to ensure the correct capacity cartridge is ordered.

4. If the error persists, check connection J301 on the DC Controller.
5. Check the connection on the Developing Drive Assembly.
6. If the error persists with a new toner cartridge, replace the Developing Drive Assembly.

Developer drive assembly part number: RM2-6756-000CN

M607, M608, M608nk, M609, M610, M611, M612, E60055-E60075, E60155-E60175

For instructions: *Remove and replace: Developer drive assembly* See the Repair Service Manual for this product.

M631, M632, M633, M634, M635, M636, M637, E62555-E62575, E62655-E62675

For instructions: *Remove and replace: Developer drive assembly* See the Repair Service Manual for this product.

59.00.C0

The developer-disengagement motor experienced a rotational error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

1. Turn the printer off.
2. Remove the toner cartridge and turn the printer on.
If the message "install toner cartridge appears without the 59 error, reinstall the toner cartridge.
3. If the error returns with the tone cartridge installed, try a new cartridge if available. If not replace the toner cartridge.



NOTE: Check the part number on the installed toner cartridge to ensure the correct capacity cartridge is ordered.

4. If the error persists with a new toner cartridge, replace the Developing Drive Assembly.

Developer drive assembly part number: RM2-6756-000CN

M607, M608, M608nk, M609, M610, M611, M612, E60055-E60075, E60155-E60175

For instructions: *Remove and replace: Developer drive assembly* See the Repair Service Manual for this product.

M631, M632, M633, M634, M635, M636, M637, E62555-E62575, E62655-E62675

For instructions: *Remove and replace: Developer drive assembly* See the Repair Service Manual for this product.

Recommended action for onsite technicians

1. Turn the printer off.
2. Remove the toner cartridge and turn the printer on.
If the message "install toner cartridge appears without the 59 error, reinstall the toner cartridge.
3. If the error returns with the tone cartridge installed, try a new cartridge if available. If not replace the toner cartridge.



NOTE: Check the part number on the installed toner cartridge to ensure the correct capacity cartridge is ordered.

4. Check connection J301 on the DC Controller.
5. Check the connection on the Developing Drive Assembly.
6. If the error persists, replace the Developing Drive Assembly (PS4850).

Developer drive assembly part number: RM2-6756-000CN

M607, M608, M608nk, M609, M610, M611, M612, E60055-E60075, E60155-E60175

For instructions: *Remove and replace: Developer drive assembly* See the Repair Service Manual for this product.

M631, M632, M633, M634, M635, M636, M637, E62555-E62575, E62655-E62675

For instructions: *Remove and replace: Developer drive assembly* See the Repair Service Manual for this product.

60.00.0Y error messages

60.* errors

Errors in the 60.* family are related to one of the optional trays.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.



NOTE: You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.
2. Close the tray to check if the error persists.
3. Reload the paper and test the printer.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the [Tray/Bin Manual Sensor](#) test to verify that the sensors for each tray are functioning correctly.
2. Check all connectors on the paper feeder PCA.
3. Replace the optional paper feeder.

60.01.02

Tray 2 lifting error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.



NOTE: You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.

2. Close the tray to check if the error persists.
3. Reload the paper and test the printer.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent

Follow these troubleshooting steps in the order presented.

 **NOTE:** You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.
2. Close the tray to check if the error persists.
3. If the issue persists, reload the paper in the tray and adjust the paper guides to the correct size for the paper.

 **NOTE:** Do not adjust the paper guides tightly against the paper stack. Adjust them to the indentations or markings in the tray.

4. If the error persists, replace the cassette assembly.

Table 6-59 Cassette assembly part number

Description	Part number
550-sheet paper feeder cassette	RM2-0866-020CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

 **NOTE:** You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.
2. Close the tray to check if the error persists.
3. If the issue persists, reload the paper in the tray and adjust the paper guides to the correct paper size.

 **NOTE:** Do not adjust the paper guides tightly against the paper stack. Adjust them to the indentations or markings in the tray.


4. If the error persists, replace the cassette assembly.

Table 6-60 Cassette assembly part number

Description	Part number
550-sheet paper feeder cassette	RM2-0866-020CN

5. If the error persists, disconnect and reconnect J206 on the DC Controller PCA prior to replacing any part.

Figure 6-177 DC controller PCA connections

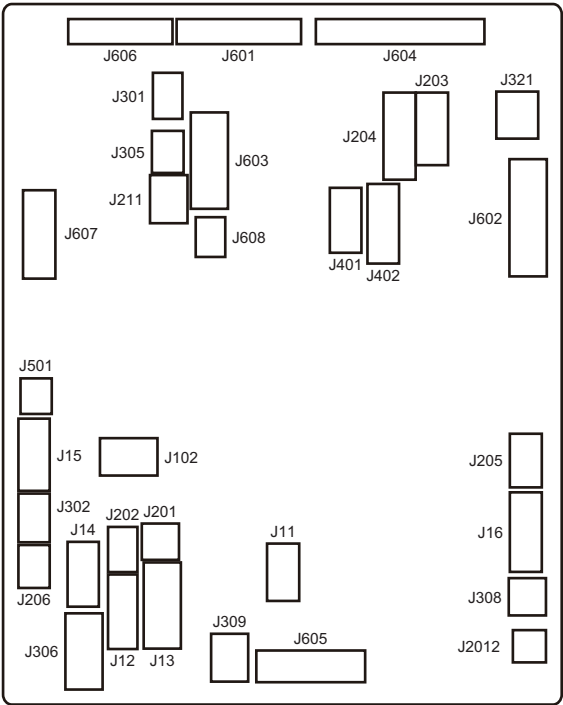

6. If the error persists, replace the lifter drive assembly.

Table 6-61 Lifter drive assembly

Description	Part number
Lifter drive assembly - Includes motor (M3)	RM2-6744-000CN

For instructions: *Removal and replacement: Lifter drive assembly* See the Repair Service Manual for this product.

7. If the error persists, replace the DC Controller PCA.

 **NOTE:** Make sure to order the correct part number for the printer model.

Table 6-62 DC Controller part numbers

Description	Part number
DC Controller PC board assembly	RM2-9494-000CN
For printer models: M607/M608/M609/E60055/E60065/E60075	
DC Controller	RM3-8461-000CN
For printer models: M610/M611/M612	
DC Controller PCA	RM3-7619-000CN
For printer models: E60155/ E60165/ E60175	

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

60.01.03

Tray 3 lifting error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.



NOTE: You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.
2. Close the tray to check if the error persists.
3. Reload the paper and test the printer.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Re-seat connector on the Feeder Controller/HCI Controller PCA assembly from the lifter drive assembly.
2. If the error persists, replace the Lifter drive Assembly based on the input tray.

Table 6-63 Parts

Part Name	Part Number	Instructions link
1x550 Input tray lifter drive assembly M3601	RM2-0874-000CN	For instructions: <i>Removal and replacement: 1x550 sheet feeder lifter drive assembly</i> See the Repair Service Manual for this product.
1x550 Envelope feeder lifter drive assembly M3601	RM2-0874-000CN	For instructions: <i>Removal and replacement: 1x550 sheet feeder lifter drive assembly</i> See the Repair Service Manual for this product.
2100 Sheet Feeder Lifter Drive Assembly (M3401)	RM2-1162-000CN	

3. If the error persists, replace the Feeder Controller PCA Assembly.

Table 6-64 Parts

Part Name	Part Number	Instructions link
1x550 Input Tray Feeder Controller PCA Assembly	RM2-8867-000CN	For instructions: <i>Remove and replace: 1x550 Controller PCA</i> See the Repair Service Manual for this product.

Table 6-64 Parts (continued)

Part Name	Part Number	Instructions link
1x550 Envelope Feeder Controller PCA Assembly	RM2-8885-000CN	For instructions: <i>Remove and replace: 1x550 Controller PCA</i> See the Repair Service Manual for this product.
2100 Sheet Feeder HCI Controller PCA Assembly	RM2-8917-000CN	For instructions: <i>Removal and replacement: 2100 HCI Controller</i> See the Repair Service Manual for this product.

60.01.04

Tray 4 lifting error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.



NOTE: You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.
2. Close the tray to check if the error persists.
3. Reload the paper and test the printer.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Re-seat connector on the Feeder Controller/HCI Controller PCA assembly from the lifter drive assembly.
2. If the error persists, replace the Lifter drive Assembly based on the input tray.

Table 6-65 Parts

Part Name	Part Number	Instructions link
1x550 Input tray lifter drive assembly M3601	RM2-0874-000CN	For instructions: <i>Removal and replacement: 1x550 sheet feeder lifter drive assembly</i> See the Repair Service Manual for this product.
1x550 Envelope feeder lifter drive assembly M3601	RM2-0874-000CN	For instructions: <i>Removal and replacement: 1x550 sheet feeder lifter drive assembly</i> See the Repair Service Manual for this product.
2100 Sheet Feeder Lifter Drive Assembly (M3401)	RM2-1162-000CN	

3. If the error persists, replace the Feeder Controller PCA Assembly.

Table 6-66 Parts

Part Name	Part Number	Instructions link
1x550 Input Tray Feeder Controller PCA Assembly	RM2-8867-000CN	For instructions: <i>Remove and replace: 1x550 Controller PCA</i> See the Repair Service Manual for this product.
1x550 Envelope Feeder Controller PCA Assembly	RM2-8885-000CN	For instructions: <i>Remove and replace: 1x550 Controller PCA</i> See the Repair Service Manual for this product.
2100 Sheet Feeder HCI Controller PCA Assembly	RM2-8917-000CN	For instructions: <i>Removal and replacement: 2100 HCI Controller</i> See the Repair Service Manual for this product.

60.01.05

Tray 5 lifting error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.



NOTE: You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.
2. Close the tray to check if the error persists.
3. Reload the paper and test the printer.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Re-seat connector on the Feeder Controller/HCI Controller PCA assembly from the lifter drive assembly.
2. If the error persists, replace the Lifter drive Assembly based on the input tray.

Table 6-67 Parts

Part Name	Part Number	Instructions link
1x550 Input tray lifter drive assembly M3601	RM2-0874-000CN	For instructions: <i>Removal and replacement: 1x550 sheet feeder lifter drive assembly</i> See the Repair Service Manual for this product.

Table 6-67 Parts (continued)

Part Name	Part Number	Instructions link
1x550 Envelope feeder lifter drive assembly M3601	RM2-0874-000CN	For instructions: <i>Removal and replacement: 1x550 sheet feeder lifter drive assembly</i> See the Repair Service Manual for this product.
2100 Sheet Feeder Lifter Drive Assembly (M3401)	RM2-1162-000CN	

3. If the error persists, replace the Feeder Controller PCA Assembly.

Table 6-68 Parts

Part Name	Part Number	Instructions link
1x550 Input Tray Feeder Controller PCA Assembly	RM2-8867-000CN	For instructions: <i>Remove and replace: 1x550 Controller PCA</i> See the Repair Service Manual for this product.
1x550 Envelope Feeder Controller PCA Assembly	RM2-8885-000CN	For instructions: <i>Remove and replace: 1x550 Controller PCA</i> See the Repair Service Manual for this product.
2100 Sheet Feeder HCI Controller PCA Assembly	RM2-8917-000CN	For instructions: <i>Removal and replacement: 2100 HCI Controller</i> See the Repair Service Manual for this product.

60.01.06

Tray 6 lifting error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.



NOTE: You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
- 60.00.03 or 60.01.03 = Tray 3

1. Open the failing tray and remove all paper from the tray.
2. Close the tray to check if the error persists.
3. Reload the paper and test the printer.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Re-seat connector on the Feeder Controller/HCI Controller PCA assembly from the lifter drive assembly.

2. If the error persists, replace the Lifter drive Assembly based on the input tray.

Table 6-69 Parts

Part Name	Part Number	Instructions link
1x550 Input tray lifter drive assembly M3601	RM2-0874-000CN	For instructions: <i>Removal and replacement: 1x550 sheet feeder lifter drive assembly</i> See the Repair Service Manual for this product.
1x550 Envelope feeder lifter drive assembly M3601	RM2-0874-000CN	For instructions: <i>Removal and replacement: 1x550 sheet feeder lifter drive assembly</i> See the Repair Service Manual for this product.
2100 Sheet Feeder Lifter Drive Assembly (M3401)	RM2-1162-000CN	

3. If the error persists, replace the Feeder Controller PCA Assembly.

Table 6-70 Parts

Part Name	Part Number	Instructions link
1x550 Input Tray Feeder Controller PCA Assembly	RM2-8867-000CN	For instructions: <i>Remove and replace: 1x550 Controller PCA</i> See the Repair Service Manual for this product.
1x550 Envelope Feeder Controller PCA Assembly	RM2-8885-000CN	For instructions: <i>Remove and replace: 1x550 Controller PCA</i> See the Repair Service Manual for this product.
2100 Sheet Feeder HCI Controller PCA Assembly	RM2-8917-000CN	For instructions: <i>Removal and replacement: 2100 HCI Controller</i> See the Repair Service Manual for this product.

62.WX.YZ error messages

62.* errors

Errors in the 62.* family indicate a problem with the print engine.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check all connectors on the formatter. Reseat them if necessary.
3. Upgrade the printer firmware.
4. If the error persists print the event log from the control panel, or access it from the HP Embedded Web Server (EWS), then elevate the case using the Standard Support Process.



NOTE: To access the EWS, open a Web browser, and in the address line, enter the printer IP address.

62.00.00 No system To continue turn off then on

The printer experienced an internal system failure.

Recommended action

1. Turn the printer off, then on.
2. If the error persists, reload the firmware. If the error still persists, perform a firmware upgrade.
3. If the firmware upgrade does not resolve the problem, replace the hard disk.

Part number (new): B5L29A

For instructions: *Hard disk drive* See the Repair Service Manual for this product.

Part number (service): B5L29-67903

For instructions: *Hard disk drive* See the Repair Service Manual for this product.

65.X0.AZ error messages

65.X0.A1 Output accessory disconnected

An external paper handling accessory connection has been interrupted.

Recommended action

1. Turn the printer off.
2. Make sure that all packing materials have been removed from the paper handling accessory.
3. Check the paper path for obstructions, or jammed paper.
4. Check the accessory cable connection.
5. Turn the printer on. If the error persists, replace the accessory.

66.WX.YZ error messages

66.* errors

Errors in the 66.* family are related to output accessories.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Verify the output accessory is correctly connected to the printer.
3. If the error persists, replace the output accessory.

66.60.32 Device failure

The multi-bin mail box experienced a main tray issue.

Recommended action for customers

1. Check the output device for any paper jams or obstructions. Clear paper jams and debris as needed.
2. Turn the printer off, and then on.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Check the output device for any paper jams or obstructions. Clear paper jams and debris as needed.
2. Turn the printer off, and then on.
3. If the error persists, replace the lower paper feed assembly.

Part number: RM2-1043-000CN

For instructions: *Removal and replacement: Lower feed assembly* See the Repair Service Manual for this product.

66.70.YZ Device failure

An external paper handling accessory error has occurred.

- **66.70.41** Internal memory overflow for nvram operation
- **66.70.50** System error (FW error)
- **66.70.70** Communication error (Page_Info received during FLUSH sequence)
- **66.70.72** Delivery notice error
- **66.70.74** Checking paper path start in PDLV

- **66.70.75** Flush request in flush
- **66.70.76** Non Flush_Complete

Recommended action for customers

1. Check the output device for any paper jams or obstructions. Clear paper jams and debris as needed.
2. Turn the printer off, and then on.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Check the output device for any paper jams or obstructions. Clear paper jams and debris as needed.
2. Turn the printer off, and then on.
3. If the error persists, replace the mailbox controller PCA assembly.

Part number: RM2-8717-000CN

For instructions: *Removal and replacement: SSMBM Controller PCA* See the Repair Service Manual for this product.

66.80.01 and 66.80.02 Device failure

An external paper handling accessory error has occurred.

- **66.80.01** Y-align malfunction
- **66.80.02** Jogger malfunction

Recommended action for customers

1. Check the output device for any paper jams or obstructions. Clear paper jams and debris as needed.
2. Turn the printer off, and then on.
3. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Check the output device for any paper jams or obstructions. Clear paper jams and debris as needed.
2. Turn the printer off, and then on.
3. If the error persists, replace the jog assembly.

Part number: RM2-1066-000CN

For instructions: *Removal and replacement: Jog assembly* See the Repair Service Manual for this product.

66.80.03 and 66.80.35 Device failure

An external paper handling accessory error has occurred.

- **66.80.03** Stapler malfunction

- **66.80.35** Self priming malfunction

Recommended action for customers

1. Check the output device for any paper jams or obstructions. Clear paper jams and debris as needed.
2. Remove the staple cartridge and check for jammed staples. Clear all jammed staples.
3. Turn the printer off, and then on.
4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Check the output device for any paper jams or obstructions. Clear paper jams and debris as needed.
2. Remove the staple cartridge and check for jammed staples. Clear all jammed staples.
3. Turn the printer off, and then on.
4. If the error persists, replace the stapler.

Part number: RK2-8148-000CN

For instructions: *Removal and replacement: Staple assembly* See the Repair Service Manual for this product.

66.80.17 Device failure

An external paper handling accessory error has occurred.

- **66.80.17** Fan malfunction

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, replace the fan.

Part number: RK2-8153-000CN

For instructions: *Removal and replacement: SSMBM Fan* See the Repair Service Manual for this product.

66.80.21, 66.80.22, 66.80.23, and 66.80.33 Device failure

An external paper handling accessory error has occurred.

- **66.80.21** Lift up malfunction
- **66.80.22** Lift down malfunction
- **66.80.23** Lift sensor malfunction

- **66.80.33** Alienation malfunction

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, replace the upper paper feed assembly..

Part number: RM2-1051-000CN

For instructions: *Removal and replacement: SSMBM Upper feed assembly* See the Repair Service Manual for this product.

66.80.77 and 66.80.0A Device failure

An external paper handling accessory error has occurred.

- **66.80.77** Internal communication failure
- **66.80.0A** STOP_CONTROL timeout error

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. If the error persists, replace the mailbox controller PCA assembly.

Part number: RM2-8717-000CN

For instructions: *Removal and replacement: SSMBM Controller PCA* See the Repair Service Manual for this product.

70.WX.YZ error messages

70.* errors

Messages in the 70.* family indicate a problem with the DC controller or Formatter (ECB) depending on your printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Replace the DC controller or the Formatter as needed.

70.00.00 Error To continue turn off then on

DC controller failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agent

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the DC controller.

 **NOTE:** Make sure to order the correct part number for the printer model.

Table 6-71 DC Controller part numbers

Description	Part number
DC Controller PC board assembly	RM2-9494-000CN
For printer models: M607/M608/M609/E60055/E60065/E60075	

Table 6-71 DC Controller part numbers (continued)

Description	Part number
DC Controller	RM3-8461-000CN
For printer models: M610/M611/M612	
DC Controller PCA	RM3-7619-000CN
For printer models: E60155/ E60165/ E60175	

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the DC controller.



NOTE: Make sure to order the correct part number for the printer model.

Table 6-72 DC Controller part numbers

Description	Part number
DC Controller PC board assembly	RM2-9494-000CN
For printer models: M607/M608/M609/E60055/E60065/ E60075	
DC Controller	RM3-8461-000CN
For printer models: M610/M611/M612	
DC Controller PCA	RM3-7619-000CN
For printer models: E60155/ E60165/ E60175	

For instructions: *DC Controller PCA* See the Repair Service Manual for this product.

80.WX.YZ, 81.WX.YZ, 82.WX.YZ error messages

80 . 0x . yz Embedded Jetdirect Error

An Embedded HP JetDirect print server critical error has occurred.

- 80 . 01 . 80 (event log) No heartbeat
- 80 . 01 . 81 (event log) Reclaim time-out
- 80 . 01 . 82 (event log) Invalid data length
- 80 . 01 . 8B (event log) Invalid max outstanding packet header field
- 80 . 01 . 8C (event log) Invalid channel mapping response
- 80 . 03 . 01 (event log) No PGP buffers
- 80 . 03 . 02 (event log) Channel table full
- 80 . 03 . 03 (event log) Producer index not reset
- 80 . 03 . 04 (event log) Consumer index not reset
- 80 . 03 . 05 (event log) Queue position size too small
- 80 . 03 . 06 (event log) Transport overflow
- 80 . 03 . 07 (event log) No overflow packets
- 80 . 03 . 08 (event log) Invalid identify response
- 80 . 03 . 09 (event log) Invalid channel map return status
- 80 . 03 . 10 (event log) Invalid reclaim return status
- 80 . 03 . 12 (event log) Datagram invalid buffer
- 80 . 03 . 13 (event log) Max stream channels
- 80 . 03 . 14 (event log) Max datagram channels
- 80 . 03 . 15 (event log) Card reset failed
- 80 . 03 . 16 (event log) Self-test failure
- 80 . 03 . 17 (event log) Unknown PGP packet
- 80 . 03 . 18 (event log) Duplicate I/O channel

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer.
2. Disconnect the network (Ethernet) cable.

3. Press the power button to turn on the printer.
4. Turn off the printer, and then reconnect the Ethernet cable to the Ethernet port on the printer and on the router.
5. Turn on the printer.
6. If the error is present only with network cable connected, try using another Ethernet cable or check the network settings.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer.
2. Disconnect the network (Ethernet) cable.
3. Press the power button to turn on the printer.
4. If the error is present only with network cable connected, try using another cable or check the network settings.
5. If the error persists, replace the formatter.

Table 6-73 Formatter part numbers

Description	Part number
Formatter (main logic) PC board assembly	K0Q14-60001
For printer models: M608x/M609x	
Formatter (main logic) PC board assembly	K0Q14-60002
For printer models: M607n/dn, M608n/dn, M609n/dn, M610/M611/M612/E60055/E60065/E60075	
Formatter	7PS81-67901
For printer models: M611x/M612x (India/China)	
Formatter	7PS81-67902
For printer models: M611x/M612x	
Formatter	7PS81-67905
For printer models: M610n/dn, M611n/dn, M612n/dn (India/China)	
Formatter	7PS81-67906
For printer models: M610n/dn, M611n/dn, M612n/dn	
Formatter (main logic) PC board assembly	3GY09-67902
For printer models: E60155/ E60165/ E60175	
Kit- Formatter	3GY09-67903
For printer models: E60155/ E60165/ E60175 (India/China)	

For instructions to remove and replace the formatter: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer.
2. Disconnect the network (Ethernet) cable.
3. Press the power button to turn on the printer.
4. If the error is present only with network cable connected, try using another cable or check the network settings.
5. If the error persists, replace the formatter.



IMPORTANT: Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

Table 6-74 Formatter part numbers

Description	Part number
Formatter (main logic) PC board assembly	K0Q14-60001
For printer models: M608x/M609x	
Formatter (main logic) PC board assembly	K0Q14-60002
For printer models: M607n/dn, M608n/dn, M609n/dn, M610/M611/M612/E60055/E60065/E60075	
Formatter	7PS81-67901
For printer models: M611x/M612x (India/China)	
Formatter	7PS81-67902
For printer models: M611x/M612x	
Formatter	7PS81-67905
For printer models: M610n/dn, M611n/dn, M612n/dn (India/China)	
Formatter	7PS81-67906
For printer models: M610n/dn, M611n/dn, M612n/dn	
Formatter (main logic) PC board assembly	3GY09-67902
For printer models: E60155/ E60165/ E60175	
Kit- Formatter	3GY09-67903
For printer models: E60155/ E60165/ E60175 (India/China)	

For instructions to remove and replace the formatter: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

81 .WX .YZ EIO Error To continue turn off then on

An external I/O card has failed on the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer.
2. Disconnect the network (Ethernet) cable.
3. Press the power button to turn on the printer.
4. Turn off the printer, and then reconnect the Ethernet cable to the Ethernet port on the printer and on the router.
5. Turn on the printer.
6. If the error is present only with network cable connected, try using another Ethernet cable or check the network settings.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer.
2. Disconnect the network (Ethernet) cable.
3. Press the power button to turn on the printer.
4. Turn off the printer, and then reconnect the Ethernet cable to the Ethernet port on the printer and on the router.
5. Turn on the printer.
6. If the error is present only with network cable connected, try using another cable or check the network settings.
7. If the error persists, replace the formatter.

Table 6-75 Formatter part numbers

Description	Part number
Formatter (main logic) PC board assembly	K0Q14-60001
For printer models: M608x/M609x	
Formatter (main logic) PC board assembly	K0Q14-60002
For printer models: M607n/dn, M608n/dn, M609n/dn, M610/M611/M612/E60055/E60065/E60075	
Formatter	7PS81-67901
For printer models: M611x/M612x (India/China)	

Table 6-75 Formatter part numbers (continued)

Description	Part number
Formatter	7PS81-67902
For printer models: M611x/M612x	
Formatter	7PS81-67905
For printer models: M610n/dn, M611n/dn, M612n/dn (India/China)	
Formatter	7PS81-67906
For printer models: M610n/dn, M611n/dn, M612n/dn	
Formatter (main logic) PC board assembly	3GY09-67902
For printer models: E60155/ E60165/ E60175	
Kit- Formatter	3GY09-67903
For printer models: E60155/ E60165/ E60175 (India/China)	

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn off the printer.
2. Disconnect the network (Ethernet) cable.
3. Press the power button to turn on the printer.
4. Turn off the printer, reconnect the Ethernet cable, and then turn on the printer.
5. If the error is present only with network cable connected, try using another Ethernet cable or check the network settings.
6. If the error persists, replace the formatter.



IMPORTANT: Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

Table 6-76 Formatter part numbers

Description	Part number
Formatter (main logic) PC board assembly	K0Q14-60001
For printer models: M608x/M609x	
Formatter (main logic) PC board assembly	K0Q14-60002
For printer models: M607n/dn, M608n/dn, M609n/dn, M610/M611/M612/E60055/E60065/E60075	
Formatter	7PS81-67901
For printer models: M611x/M612x (India/China)	

Table 6-76 Formatter part numbers (continued)

Description	Part number
Formatter	7PS81-67902
For printer models: M611x/M612x	
Formatter	7PS81-67905
For printer models: M610n/dn, M611n/dn, M612n/dn (India/China)	
Formatter	7PS81-67906
For printer models: M610n/dn, M611n/dn, M612n/dn	
Formatter (main logic) PC board assembly	3GY09-67902
For printer models: E60155/ E60165/ E60175	
Kit- Formatter	3GY09-67903
For printer models: E60155/ E60165/ E60175 (India/China)	

For instructions to remove and replace the formatter: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

81.09.00 Error

Internal Jetdirect Inside Networking event.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technician

Follow these troubleshooting steps in the order presented.

1. Verify that the issue occurs with the latest version of firmware.
 - a. Obtain the latest public firmware version for the device from hp.com.
 - b. Update the device firmware.
 - c. The device will reboot during the firmware update process.
 - d. If available (from HP Advance Technical Support), obtain the latest interim version of firmware to perform the same update test.
 - e. If the issue persists, continue with the next troubleshooting step.
2. Verify that the issue occurs when the device has the latest firmware and is not connected to the network.
 - a. Disconnect the network cable from the network I/O port on the device.

- b. Turn the printer off, and then on.
 - c. If the error persists, continue with the next troubleshooting step.
 - 3. Verify that the issue occurs when disconnected from the network and with default configuration.
 - a. Run a partial clean.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*
 - b. If the error persists, continue with the next troubleshooting step.
 - 4. **Call center agents:** Dispatch an onsite technician to re-establish the trusted platform module state in the printer.

 **IMPORTANT:** Never replace the TPM on a unit that shipped with one. The TPM that can be ordered is only available for adding a level of security on a device that never had a TPM paired from the factory. A new TPM cannot be installed for security reasons.

82 . 0x . YZ Internal disk device failure

The internal disk failed on the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

- 1. Touch **OK** to clear the error.
- 2. Check if the error persists.
- 3. If the error persists, turn off the printer, and then disconnect the power cable.
- 4. Remove the Hard disk drive (HDD), and then reinstall the HDD.

 **NOTE:** Do not replace the Hard disk drive.

For instructions,
go to *Removal and replacement: Hard disk drive*

- 5. If the error persists, verify the HDD installed is compatible.
- 6. Connect the power cable, and then turn on the printer.
- 7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

- 1. Touch **OK** to clear the error.

2. If the error persists, turn off the printer, and then remove and reinstall the Hard disk drive (HDD).

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

3. If the error persists, verify the HDD installed is compatible.
4. Download the printer firmware, and then extract the firmware file to a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

5. Check if the printer boots to an error state, and then see the following information before performing a **Format Disk**.



NOTE: After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

6. Use the Preboot menu to perform a Format Disk.

If an administrator password is assigned, a prompt will display to enter the password. Ensure to enter the correct password.

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
- d. Press the **OK** button again.
- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".

7. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

8. Update the printer firmware from the Preboot menu using the USB flash drive.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

9. If the error persists, replace the Hard disk drive.



WARNING! Do not replace the printer formatter, it will not resolve this issue.

Table 6-77 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.



NOTE: As a workaround, it is possible to return the printer to a functional state by enabling the eMMC as the primary boot device until the HDD can be replaced.

To enable the eMMC as the primary boot device perform the following steps:

1. Access the Preboot menu and then select [Administrator](#).
 - a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the [Cancel](#) button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - b. Use the arrow buttons to select the [Administrator](#) item, and then press the [OK](#) button.
2. Select **Manage Disk**, and then select **Boot Device**.
3. Select **Use Secondary**, and then select [OK](#).
4. Use the power button to turn off the printer, and then disconnect the power cable.
5. Disconnect the HDD from the formatter.
6. Use the power button to turn on the printer.

The printer should boot using the eMMC.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch [OK](#) to clear the error.
2. If the error persists, turn off the printer, and then remove and reinstall the Hard disk drive (HDD).

For instructions, watch the following video: [How to replace the Hard disk drive](#).

3. If the error persists, verify the HDD installed is compatible.
4. Download the printer firmware, and then extract the firmware file to a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

5. Check if the printer boots to an error state, and then see the following information before performing a **Format Disk**.



NOTE: After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed). Any installed workflow solutions be present will be deleted after a Format Disk, and will require reloading and setup by the customer.

6. Use the Preboot menu to perform a Format Disk.

If an administrator password is assigned, a prompt will display to enter the password. Ensure to enter the correct password.

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
- d. Press the **OK** button again.
- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".

7. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

8. Update the printer firmware from the Preboot menu using the USB flash drive.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

9. If the error persists, replace the Hard disk drive.



WARNING! Do not replace the printer formatter, it will not resolve this issue.

Table 6-78 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.



NOTE: As a workaround, it is possible to return the printer to a functional state by enabling the eMMC as the primary boot device until the HDD can be replaced.

To enable the eMMC as the primary boot device perform the following steps:

- a. Access the Preboot menu and then select **Administrator**.
 - i. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - ii. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
- b. Select **Manage Disk**, and then select **Boot Device**.
- c. Select **Use Secondary**, and then select **OK**.
- d. Use the power button to turn off the printer, and then disconnect the power cable.
- e. Disconnect the HDD from the formatter.
- f. Use the power button to turn on the printer.

The printer should boot using the eMMC.

10. If the issue persists, elevate the issue using your country/region support process.

82.73.46, 82.73.47

A hard disk or compact flash disk cleaning failed. This error is usually caused by a failure of the disk hardware.

Recommended action

1. Turn the printer off, and then on.
2. Use the **Format Disk** item in the **Preboot** menu.
3. Reload the firmware.

90.WX.YZ error messages

90.* errors

Errors in the 90.* family are related to the control panel.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, dispatch an onsite technician.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off by holding down the power button for at least 10 seconds.
2. Check the connectors on the control panel. Reseat them if necessary.
3. Turn the printer on. If the status LED on the formatter is yellow instead of green, the control panel might be defective. Replace the control panel.

90.15.00

The video interface has been detected.

Communication with the control panel has been detected.

This message is a normal part of booting up and establishing communication with the control panel.

Recommended action

- No action necessary.

90.15.01

The video interface has **NOT** been detected.

Communication with the control panel has not been established in the expected time frame. The control panel likely will not display correctly.

Recommended action

1. Turn the printer off, and then on.
2. Turn the printer off by holding down the power button for at least 10 seconds.
3. Ensure that the control panel connectors on control panel are correctly seated.
4. Turn the printer on. If formatter status LED is yellow, the control panel may be defective.
5. Replace the control panel.

Control panel (n/dn moodels only) part number: 5851-7253

For instructions: *Removal and replacement: Control panel 2.7 inch* See the Repair Service Manual for this product.

Control panel (x moodels only) part number: 5851-7252

For instructions: *Removal and replacement: Control panel 4.3 inch* See the Repair Service Manual for this product.

98.0X.0Y error messages

98.00.0c

Data corruption has occurred and fails to mount partition.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, update the printer firmware to the latest version.
 - a. Go to [Software and Driver Downloads](https://support.hp.com/us-en/drivers) (<https://support.hp.com/us-en/drivers>), and then click the *Printer* icon.
 - b. Enter your printer model, and then click **Submit**.
 - c. Expand the **Firmware** section, and then click **Download** to download the latest firmware version.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. Check if the **98.00.0c** event is intermittent or persistent and perform the appropriate task.
 - For **intermittent 98.00.0c** event error, do the following:
 - a. Print or view the printer Event log.
 - b. Check if a 49.38.0C or 49.38.0D error is present in the Event log.
 - c. If 49.38.0C and/or 49.38.0D errors are present, refer the following support document in WISE: ish_8742720-8736298-16

HP LaserJet Enterprise MFP M528, M577, M634, M635, M636, M637, M681, M682, Managed MFP E52645, E57540, E62655, E62665, E62675, E67550, E67560, E67650, E67660 - A 49.38.0C or 49.38.0D error displays on the printer control panel or in the Event Log (Service Action Advisory).

- d. If 49.38.0C or 49.38.0D errors are NOT present, download the printer firmware using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

- For **persistent 98.00.0c** event error, do the following:
 - Download the printer firmware using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. Check if the printer boots to an error state, and then see the following information about performing a **Format Disk**.



NOTE: After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

4. Use the Preboot menu to perform a Format Disk.
 - a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
 - c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
 - d. Press the **OK** button again.
 - e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".
5. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.
6. Update the printer firmware from the Preboot menu using a USB flash drive.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

7. If the error persists, replace the Hard disk drive.



WARNING! Do not replace the printer formatter, it will not resolve this issue.

Table 6-79 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. Check if the **98.00.0c** event is intermittent or persistent and perform the appropriate task.
 - For **intermittent 98.00.0c** event error, do the following:
 - a. Print or view the printer Event log.
 - b. Check if a 49.38.0C or 49.38.0D errors are present
 - c. If 49.38.0C and/or 49.38.0D errors are present, refer the following support document in WISE:
ish_8742720-8736298-16

HP LaserJet Enterprise MFP M528, M577, M634, M635, M636, M637, M681, M682, Managed MFP E52645, E57540, E62655, E62665, E62675, E67550, E67560, E67650, E67660 - A 49.38.0C or 49.38.0D error displays on the printer control panel or in the Event Log (Service Action Advisory).
 - d. If 49.38.0C or 49.38.0D errors are NOT present, download the printer firmware using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

- For **persistent 98.00.0c** event error, do the following:
 - Download the printer firmware using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).
3. Check if the printer boots to an error state, and then see the following information before performing a **Format Disk**.



NOTE: After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

4. Use the Preboot menu to perform a Format Disk.
 - a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the [Cancel](#) button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - b. Use the arrow buttons to select the [Administrator](#) item, and then press the [OK](#) button.
 - c. Use the arrow buttons to select the [Format Disk](#) item, and then press the [OK](#) button.
 - d. Press the [OK](#) button again.

- e. Select **Accept** to confirm the onscreen message, “Will require new firmware install”.
5. Use the power button to turn off, and then to turn on the printer.
The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.
6. Update the printer firmware from the Preboot menu using a USB flash drive.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

7. If the error persists, replace the Hard disk drive.



WARNING! Do not replace the printer formatter, it will not resolve this issue.

Table 6-80 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

8. If the issue persists, elevate the issue using your country/region support process.

98.00.00, 98.00.01, or 98.01.00 Corrupt data in firmware volume

Data corruption has occurred in the firmware volume.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

3. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

98.00.02 Corrupt data in the solutions volume

Data corruption has occurred in the solutions volume.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. Check if the **98.00.0c** event is intermittent or persistent, and then perform the appropriate task.
 - For **intermittent 98.00.0c** event error, do the following:
 - a. Print or view the printer Event log.
 - b. Check if a 49.38.0C or 49.38.0D error is present in the Event log.
 - c. If 49.38.0C and/or 49.38.0D errors are present, refer the following support document in WISE: ish_8742720-8736298-16
HP LaserJet Enterprise MFP M528, M577, M634, M635, M636, M637, M681, M682, Managed MFP E52645, E57540, E62655, E62665, E62675, E67550, E67560, E67650, E67660 - A 49.38.0C or 49.38.0D error displays on the printer control panel or in the Event Log (Service Action Advisory).
 - d. If 49.38.0C or 49.38.0D errors are NOT present, download the printer firmware using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

- For **persistent 98.00.0c** event error, do the following:

- Download and update the printer firmware using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. Check if the printer boots to an error state, and then review the following information about performing a **Format Disk**.



NOTE: After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

4. Use the Preboot menu to perform a Format Disk.
 - a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.

If a password is assigned to the administrator, a prompt displays to enter the password.
 - c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
 - d. Press the **OK** button again.
 - e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".

5. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

6. Update the printer firmware from the Preboot menu using a USB flash drive.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

7. If the error persists, replace the Hard disk drive.



WARNING! Do not replace the printer formatter to resolve this issue.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-81 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011

Table 6-81 Hard disk drive (HDD) part number (continued)

Description	Part number
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. Check if the **98.00.0c** event is intermittent or persistent and perform the appropriate task.
 - For **intermittent 98.00.0c** event error, do the following:
 - a. Print or view the printer Event log.
 - b. Check if a 49.38.0C or 49.38.0D error is present in the Event log.
 - c. If 49.38.0C and/or 49.38.0D errors are present, refer the following support document in WISE:
ish_8742720-8736298-16

HP LaserJet Enterprise MFP M528, M577, M634, M635, M636, M637, M681, M682, Managed MFP E52645, E57540, E62655, E62665, E62675, E67550, E67560, E67650, E67660 - A 49.38.0C or 49.38.0D error displays on the printer control panel or in the Event Log (Service Action Advisory).
 - d. If 49.38.0C or 49.38.0D errors are NOT present, download the printer firmware using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).
 - For **persistent 98.00.0c** event error, do the following:
 - Download the printer firmware using a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).
3. Check if the printer boots to an error state, and then see the following information about performing a **Format Disk**.



NOTE: After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

4. Use the Preboot menu to perform a Format Disk.

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the [Cancel](#) button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - b. Use the arrow buttons to select the [Administrator](#) item, and then press the [OK](#) button.
If a password is assigned to the administrator, a prompt displays to enter the password.
 - c. Use the arrow buttons to select the [Format Disk](#) item, and then press the [OK](#) button.
 - d. Press the [OK](#) button again.
 - e. Select [Accept](#) to confirm the onscreen message, “Will require new firmware install”.
5. Use the power button to turn off, and then to turn on the printer.
The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.
 6. Update the printer firmware from the Preboot menu using a USB flash drive.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

7. If the error persists, replace the Hard disk drive.



WARNING! Do Not replace the printer formatter to resolve this issue.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-82 Hard disk drive (HDD) part number

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

8. If the issue persists, elevate the issue using your country/region support process.

98.00.03 Corrupt data in the configuration volume

Data corruption has occurred in the configuration volume.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Download the firmware again, and then attempt the upgrade again.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

4. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

98.00.04 Corrupt data in the job data volume

Data corruption has occurred in the job data volume.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Rerun the file erase function.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

98.03.11

Partition manager error

Machine Data partition lost all data.

Recommended action

1. Turn the printer off, and then on.

2. Ensure the firmware is the latest version.
3. Reinstall the firmware.

99.WX.YZ error messages

99.* errors

Errors in the 99.* family are related to the firmware upgrade process.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure the connection to the network is good, and then try the firmware upgrade again.
2. If the error persists, try using the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Make sure the connection to the network is good, and then try the upgrade again.
2. Try using the USB upgrade method.
3. If the error persists, run the [Format Disk](#) process from the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#)*.

4. If the issue persists, replace the hard disk drive (HDD).



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-83 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

99.00.01 Upgrade not performed file is corrupt

A remote firmware upgrade (RFU) was not performed.

This is a CRC error in the firmware image (bad image).

Recommended action

Follow these troubleshooting steps in the order presented.

- Download the firmware upgrade file, and then attempt the upgrade again.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99.00.02 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header number and size. It indicates a problem with the network environment, not the product.

Recommended action

Follow these troubleshooting steps in the order presented.

The most common cause is an issue with the network environment.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99.00.03 Upgrade not performed error writing to disk

A remote firmware upgrade (RFU) was not performed.

This is a disk error. It might indicate a problem or a hard disk drive failure. It might be necessary to check the connection to the hard disk drive or replace the hard disk drive.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, update the printer firmware to the latest version.
 - a. Go to [Software and Driver Downloads](https://support.hp.com/us-en/drivers) (<https://support.hp.com/us-en/drivers>), and then click the *Printer* icon.
 - b. Enter your printer model, and then click **Submit**.
 - c. Expand the **Firmware** section, and then click **Download** to download the latest firmware version.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, download and update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the issue persists, use the Preboot menu to perform a Format Disk.



IMPORTANT: **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.

If a password is assigned to the administrator, a prompt displays to enter the password.
- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
- d. Press the **OK** button again.
- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".
- f. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.
- g. Update the printer firmware from the Preboot menu.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, replace the Hard disk drive.



WARNING! Do not replace the printer formatter to resolve this issue.

Table 6-84 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, download and update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the issue persists, use the Preboot menu to perform a Format Disk.



IMPORTANT: **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the [Cancel](#) button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the [Administrator](#) item, and then press the [OK](#) button.

If a password is assigned to the administrator, a prompt displays to enter the password.
- c. Use the arrow buttons to select the [Format Disk](#) item, and then press the [OK](#) button.
- d. Press the [OK](#) button again.
- e. Select [Accept](#) to confirm the onscreen message, "Will require new firmware install".
- f. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.
- g. Update the printer firmware from the Preboot menu.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, use the Preboot menu to perform a hard disk drive diagnostic test.
 - a. Access the Preboot menu and then select **Administrator**.
 - i. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - ii. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
 - b. Select **Diagnostics**.
 - c. Except for option **6 Disk**, select each diagnostic option, and then select **Do not Run** item to exclude the Disk diagnostic when executing multiple diagnostics.
 - d. Select option **6 Disk**, and then select **d Smart** drive to help anticipate disk failures (SMART status).
 - e. Select **OK**.
 - f. Scroll down and select the **Run Selected** item to start the test.
5. If any errors are encountered or if the error persists, replace the hard disk drive.

 **WARNING!** Do not replace the printer formatter to resolve this issue.

Table 6-85 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

6. If the issue persists, elevate the issue using your country/region support process.

99.00.04 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header.

The most common cause is an issue with the network environment.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99.00.05 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading image data.

The most common cause is an issue with the network environment.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99.00.06 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

This is an unexpected read error when reading the header number and size.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, update the printer firmware to the latest version.
 - a. Go to [Software and Driver Downloads](https://support.hp.com/us-en/drivers) (<https://support.hp.com/us-en/drivers>), and then click the *Printer* icon.
 - b. Enter your printer model, and then click **Submit**.
 - c. Expand the **Firmware** section, and then click **Download** to download the latest firmware version.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, download and update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the issue persists, use the Preboot menu to perform a Format Disk.

 **IMPORTANT:** **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.

If a password is assigned to the administrator, a prompt displays to enter the password.
- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
- d. Press the **OK** button again.
- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".
- f. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.
- g. Update the printer firmware from the Preboot menu.

 **NOTE:** The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, replace the Hard disk drive.

 **WARNING!** Do not replace the printer formatter to resolve this issue.

Table 6-86 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, download and update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the issue persists, use the Preboot menu to perform a Format Disk.



IMPORTANT: **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the [Cancel](#) button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the [Administrator](#) item, and then press the [OK](#) button.

If a password is assigned to the administrator, a prompt displays to enter the password.
- c. Use the arrow buttons to select the [Format Disk](#) item, and then press the [OK](#) button.
- d. Press the [OK](#) button again.
- e. Select [Accept](#) to confirm the onscreen message, "Will require new firmware install".
- f. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.
- g. Update the printer firmware from the Preboot menu.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, use the Preboot menu to perform a hard disk drive diagnostic test.
 - a. Access the Preboot menu and then select **Administrator**.
 - i. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - ii. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
 - b. Select **Diagnostics**.
 - c. Except for option **6 Disk**, select each diagnostic option, and then select **Do not Run** item to exclude the Disk diagnostic when executing multiple diagnostics.
 - d. Select option **6 Disk**, and then select **d Smart** drive to help anticipate disk failures (SMART status).
 - e. Select **OK**.
 - f. Scroll down and select the **Run Selected** item to start the test.
5. If any errors are encountered or if the error persists, replace the hard disk drive.

 **WARNING!** Do not replace the printer formatter to resolve this issue.

Table 6-87 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

6. If the issue persists, elevate the issue using your country/region support process.

99.00.07 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

This is an unexpected read error when reading the rest of the header.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, update the printer firmware to the latest version.

- a. Go to [Software and Driver Downloads](https://support.hp.com/us-en/drivers) (<https://support.hp.com/us-en/drivers>), and then click the *Printer* icon.
- b. Enter your printer model, and then click **Submit**.
- c. Expand the **Firmware** section, and then click **Download** to download the latest firmware version.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, download and update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the issue persists, use the Preboot menu to perform a Format Disk.



IMPORTANT: **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the [Cancel](#) button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the [Administrator](#) item, and then press the [OK](#) button.
If a password is assigned to the administrator, a prompt displays to enter the password.
- c. Use the arrow buttons to select the [Format Disk](#) item, and then press the [OK](#) button.
- d. Press the [OK](#) button again.
- e. Select [Accept](#) to confirm the onscreen message, "Will require new firmware install".
- f. Use the power button to turn off, and then to turn on the printer.
The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.
- g. Update the printer firmware from the Preboot menu.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, replace the Hard disk drive.

 **WARNING!** Do not replace the printer formatter to resolve this issue.

Table 6-88 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, download and update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the issue persists, use the Preboot menu to perform a Format Disk.

 **IMPORTANT:** **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.

If a password is assigned to the administrator, a prompt displays to enter the password.
- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
- d. Press the **OK** button again.
- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".

- f. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

- g. Update the printer firmware from the Preboot menu.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, use the Preboot menu to perform a hard disk drive diagnostic test.
- a. Access the Preboot menu and then select **Administrator**.
- i. Depending on the printer control panel, follow the appropriate step:
- **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- ii. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
- b. Select **Diagnostics**.
- c. Except for option **6 Disk**, select each diagnostic option, and then select **Do not Run** item to exclude the Disk diagnostic when executing multiple diagnostics.
- d. Select option **6 Disk**, and then select **d Smart** drive to help anticipate disk failures (SMART status).
- e. Select **OK**.
- f. Scroll down and select the **Run Selected** item to start the test.
5. If any errors are encountered or if the error persists, replace the hard disk drive.



WARNING! Do not replace the printer formatter to resolve this issue.

Table 6-89 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

6. If the issue persists, elevate the issue using your country/region support process.

99.00.08 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

This is an unexpected read error when reading image data.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, update the printer firmware to the latest version.
 - a. Go to [Software and Driver Downloads](https://support.hp.com/us-en/drivers) (<https://support.hp.com/us-en/drivers>), and then click the *Printer* icon.
 - b. Enter your printer model, and then click **Submit**.
 - c. Expand the **Firmware** section, and then click **Download** to download the latest firmware version.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, download and update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the issue persists, use the Preboot menu to perform a Format Disk.

 **IMPORTANT:** **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.

If a password is assigned to the administrator, a prompt displays to enter the password.
- c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
- d. Press the **OK** button again.
- e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".

- f. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

- g. Update the printer firmware from the Preboot menu.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, replace the Hard disk drive.



WARNING! Do not replace the printer formatter to resolve this issue.

Table 6-90 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the issue persists, download and update the printer firmware.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

3. If the issue persists, use the Preboot menu to perform a Format Disk.



IMPORTANT: **Format Disk** removes all data. After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed to return the printer to a bootable state.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.

If a password is assigned to the administrator, a prompt displays to enter the password.

- c. Use the arrow buttons to select the [Format Disk](#) item, and then press the [OK](#) button.
- d. Press the [OK](#) button again.
- e. Select [Accept](#) to confirm the onscreen message, “Will require new firmware install”.
- f. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

- g. Update the printer firmware from the Preboot menu.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

4. If the error persists, use the Preboot menu to perform a hard disk drive diagnostic test.
 - a. Access the Preboot menu and then select [Administrator](#).
 - i. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the [Cancel](#) button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - ii. Use the arrow buttons to select the [Administrator](#) item, and then press the [OK](#) button.
 - b. Select **Diagnostics**.
 - c. Except for option **6 Disk**, select each diagnostic option, and then select **Do not Run** item to exclude the Disk diagnostic when executing multiple diagnostics.
 - d. Select option **6 Disk**, and then select **d Smart** drive to help anticipate disk failures (SMART status).
 - e. Select [OK](#).
 - f. Scroll down and select the **Run Selected** item to start the test.
5. If any errors are encountered or if the error persists, replace the hard disk drive.



WARNING! Do not replace the printer formatter to resolve this issue.

Table 6-91 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

6. If the issue persists, elevate the issue using your country/region support process.

99.00.09 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled.

Recommended action

Follow these troubleshooting steps in the order presented.

- Resend the remote firmware upgrade (RFU).

99.00.10 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the header number and size.

Recommended action

Follow these troubleshooting steps in the order presented.

- Resend the remote firmware upgrade (RFU).

99.00.11 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the rest of the header, after reading the header number and size.

Recommended action

Follow these troubleshooting steps in the order presented.

- Resend the remote firmware upgrade (RFU).

99.00.12 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 1, but the header size does not match version 1 size.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the remote firmware upgrade (RFU) file again.
Make sure that you download the file for the correct printer model.
For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
2. Resend the RFU.

99.00.13 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 2, but the header size does not match version 2 size.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the remote firmware upgrade (RFU) file again.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Resend the RFU.

99.00.14 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The file is invalid.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the remote firmware upgrade (RFU) file again.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Resend the RFU.

99.00.2X

There is a compatibility issue with the firmware. The specific message varies depending on the cause, but the solution for each message is the same.

- **99.00.20** (event log) The bundle is not for this printer.
- **99.00.21** (event log) The bundle is not signed with the correct signature, or the signature is invalid.
- **99.00.22** (event log) The bundle header version is not supported by this firmware.
- **99.00.23** (event log) The package header version is not supported by this firmware.
- **99.00.24** (event log) The format of the bundle is invalid.
- **99.00.25** (event log) The format of the package is invalid.
- **99.00.26** (event log) A CRC32 check did not pass.
- **99.00.27** (event log) An I/O error occurred while downloading the bundle.

Recommended action for customers

- Download the correct firmware file from www.hp.com, and then re-send the firmware upgrade.

Recommended action for call agents and service technicians

99.00.27 only:

1. Turn the printer off, and then on.

2. Re-send the firmware upgrade.
3. If the error persists, try installing the upgrade by another method (USB or Embedded Web Server).

99.01.xx

A firmware install error has occurred.

The specific message varies depending on the cause, but the solution for each message is the same.

- 99.01.00
- 99.01.10
- 99.01.20
- 99.01.21

Recommended action

Follow these troubleshooting steps in the order presented.

- Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
Firmware update steps,

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99.02.01

Firmware installation was successful.

Recommended action

See recommended action.

- No action necessary.

99.02.09

Firmware upgrade cancelled by user.

Recommended action

See recommended action.

- No action necessary.

99.09.60 Unsupported disk

This is a [Preboot](#) menu error.

The hard disk currently installed is not recognized or supported by the printer.

Recommended action

- Install the correct hard disk for this printer.

Do NOT replace the formatter board, it will not resolve this.

99.09.61 Unsupported disk

The HDD or SSD installed is not support in this printer.

The hard disk drive (HDD) or solid state drive (SSD) is not encrypted and the printer is configured for an encrypted HDD/SSD.

Recommended action

Follow these troubleshooting steps in the order presented.



NOTE: Do NOT replace the formatter board, it will not resolve this error.

- Access the [Preboot](#) menu, and then select [Lock Disk](#) to lock the disk.
 - a. Access the [Preboot](#) menu
 - b. Turn the product on.
 - c. Touch the HP logo that displays in the center of the touchscreen until the [Preboot](#) menu item opens.
 - d. Use the arrow buttons on the touchscreen to navigate the [Preboot](#) menu.
 - e. Touch the [OK](#) button to select a menu item.

99.09.62 Unknown disk

This error indicates that there is an encryption mismatch between the HDD or SSD and the formatter.

This typically happens because an HDD or SSD was swapped into a device from another device.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.



NOTE: Do NOT replace the formatter board, it will not resolve this error.

1. Use the [Preboot](#) menu to unlock the disk.
 - a. Access the [Preboot](#) menu
 - b. Turn the product on.
 - c. Touch the HP logo that displays in the center of the touchscreen until the [Preboot](#) menu item opens.
 - d. Use the arrow buttons on the touchscreen to navigate the [Preboot](#) menu.
 - e. Touch the [OK](#) button to select a menu item.

2. If a disk is to be reused in a different product, execute the [Erase and Unlock](#) procedure from the [Preboot](#) menu, and then reload the firmware.
 - From the [Preboot](#) menu, open the following menus:
 - [Administration](#) (select 3)
 - [Manage Disks](#) (select 6)
 - [Boot Device](#) (select 6)
 - [Erase / Unlock](#) (select 2)
3. If the issue persists, replace the HDD/SSD as needed.



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-92 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Solid state drive (SSD)	0950-5111
Federal Information Processing Standards Drive, FIPS	6HN31-67001
See NOTE above.	See NOTE above.

99.09.63 Incorrect disk

Expected encrypted hard disk drive is not present.

This is expected behavior when installing a new hard disk drive in a device where the previous hard disk drive was encrypted.

Recommended action

- Follow the procedure to load firmware on a new hard disk drive, and then lock the disk to this printer.

Do NOT replace the formatter board, it will not resolve this.

For instructions on accessing the Preboot menu, see this document: [HP LaserJet Enterprise M604, M605, M606 and HP Color LaserJet Enterprise M552, M553 - Pre-boot menu options](#).

99.09.64 Disk Nonfunctional

A fatal hard disk drive failure has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. Check if the error persists.
3. If the error persists, turn off the printer, and then disconnect the power cable.

4. Remove the Hard disk drive (HDD), and then reinstall the HDD.

 **NOTE:** Do not replace the Hard disk drive.

For instructions on how to remove and reinstall the hard drive, watch the following video: [How to replace the Hard disk drive](#).

5. If the error persists, the hard disk drive needs to be replaced. Contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the error persists, turn off the printer, and then remove and reinstall the Hard disk drive (HDD).

For instructions, watch the following video: [How to replace the Hard disk drive](#).

3. If the issue persists, make sure to review the following information about performing a **Format Disk**.

 **WARNING!** Selecting Format Disk removes **all** data.

 **IMPORTANT:** After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

4. Use the Preboot menu to perform a Format Disk.
 - a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - b. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
 - c. Use the arrow buttons to select the **Format Disk** item, and then press the **OK** button.
 - d. Press the **OK** button again.
 - e. Select **Accept** to confirm the onscreen message, "Will require new firmware install".
5. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

6. Update the printer firmware using the Preboot menu when a **99.09.67** error displays on the printer control panel.

 **NOTE:** The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

7. If the error persists, replace the Hard disk drive.

 **WARNING!** Do not replace the printer formatter, it will not resolve this issue.

Table 6-93 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. If the error persists, turn off the printer, and then remove and reinstall the Hard disk drive (HDD).

For instructions, watch the following video: [How to replace the Hard disk drive](#).

3. If the issue persists, make sure to review the following information about performing a **Format Disk**.

 **WARNING!** Selecting Format Disk removes **all** data.

 **IMPORTANT:** After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed).

4. Use the Preboot menu to perform a Format Disk.
 - a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the [Cancel](#) button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - b. Use the arrow buttons to select the [Administrator](#) item, and then press the [OK](#) button.

If a password is assigned to the administrator, a prompt displays to enter the password.
 - c. Use the arrow buttons to select the [Format Disk](#) item, and then press the [OK](#) button.
 - d. Press the [OK](#) button again.
 - e. Select [Accept](#) to confirm the onscreen message, "Will require new firmware install".
 - f. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

- g. Update the printer firmware using the Preboot menu when a **99.09.67** error displays on the printer control panel.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#) (ish_4158468-4158516-16).

5. If the error persists, use the Preboot menu to perform a hard disk drive diagnostic test.
- a. Access the Preboot menu and then select **Administrator**.
- i. Depending on the printer control panel, follow the appropriate step:
- **Non-touchscreen control panel:** Press the **Cancel** button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- ii. Use the arrow buttons to select the **Administrator** item, and then press the **OK** button.
- b. Select **Diagnostics**.
- c. Except for option **6 Disk**, select each diagnostic option, and then select **Do not Run** item to exclude the Disk diagnostic when executing multiple diagnostics.
- d. Select option **6 Disk**, and then select **d Smart** drive to help anticipate disk failures (SMART status).
- e. Select **OK**.
- f. Scroll down and select the **Run Selected** item to start the test.
6. If any errors are encountered or if the error persists, replace the hard disk drive.



WARNING! Do not replace the printer formatter to resolve this issue.

Table 6-94 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

99.09.65 Disk data error

Disk data corruption has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.



NOTE: Do NOT replace the formatter board, it will not resolve this error.

- Use the [Format Disk](#) procedure from the [Preboot](#) menu, and then resend the remote firmware upgrade (RFU).

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives.*

99.09.66 No boot device.

A hard disk drive or eMMC is not installed in the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then to turn on the printer.
2. Check if the error persists.
3. Check if a Hard disk drive (HDD) or Embedded multi-media card (eMMC) is installed.
 - a. Print or view a Configuration page.
 - b. Review the section **Installed Personalities and Options** to check the "Internal Disk" and "Hard Disk Encryption Status" information.
 - Internal Disk: Hard Disk: **Enabled**.
 - Hard Disk Encryption Status, "**Disk cannot be encrypted**" denotes an eMMC storage device".
4. Verify the HDD or eMMC installed is compatible with your printer.
5. If the error persists, turn off the printer, and then disconnect the power cable.
6. Remove and reinstall the storage device (HDD or eMMC).



NOTE: Do not replace the HDD or eMMC.

For instructions on how to remove and reinstall the hard drive, watch the following video: [How to replace the Hard disk drive](#).

For instructions: *Removal and replacement: Embedded multi-media card (eMMC) kit* .

7. If the error persists, the storage device needs to be replaced. Contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Determine the customer's intended boot device is a Hard disk drive (HDD) or Embedded multi-media card (eMMC).
 - a. Print or view a Configuration page.
 - b. Review the section **Installed Personalities and Options** to check the "Internal Disk" and "Hard Disk Encryption Status" information.
 - Internal Disk: Hard Disk: **Enabled**.

- Hard Disk Encryption Status, “**Disk cannot be encrypted**” denotes an eMMC storage device”.
2. Verify the HDD or eMMC installed is compatible.
 3. If the error persists, turn off the printer, and then remove and reinstall the storage device (HDD or eMMC).

Do not replace the hard drive.

For instructions, watch the following video: [How to replace the Hard disk drive](#).

4. If the error persists, replace the hard disk drive or eMMC.

 **NOTE:** Device is unusable until a new boot device is installed.

 **WARNING!** Do not replace the printer formatter, it will not resolve this issue.

Table 6-95 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903
Module 16B embedded MultiMedia Card (eMMC) kit	5851-6436

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

For instructions: *Removal and replacement: Embedded multi-media card (eMMC) kit* See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Determine the customer's intended boot device is a Hard disk drive (HDD) or Embedded multi-media card (eMMC).
 - a. Print or view a Configuration page.
 - b. Review the section **Installed Personalities and Options** to check the "Internal Disk" and "Hard Disk Encryption Status" information.

- Internal Disk: Hard Disk: **Enabled**.
- Hard Disk Encryption Status, “**Disk cannot be encrypted**” denotes an eMMC storage device”.

2. If the error persists, turn off the printer, and then remove and reinstall the storage device (HDD or eMMC).

Do not replace the hard drive.

For instructions, watch the following video: [How to replace the Hard disk drive](#).

3. If the error persists, replace the hard disk drive or eMMC.

 **NOTE:** Device is unusable until a new boot device is installed.

 **WARNING!** Do not replace the printer formatter, it will not resolve this issue.

Table 6-96 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903
Module 16B embedded MultiMedia Card (eMMC) kit	5851-6436

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

For instructions: *Removal and replacement: Embedded multi-media card (eMMC) kit* See the Repair Service Manual for this product.

4. If the issue persists, elevate the issue using your country/region support process.

99.09.67 Disk is not bootable please download firmware

There is no firmware installed on the hard disk drive or eMMC. This is usually the result of installing a new hard disk drive or performing a [Clean Disk](#) procedure from the [Preboot](#) menu.



NOTE: When installing a new hard drive or eMMC, the disk should be formatted through the Preboot menu, BEFORE loading firmware.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Use the power button to turn off the printer, and then disconnect the power cable.
2. Remove and reinstall the HDD.



NOTE: If you are installing a new hard disk drive (HDD), follow the instructions provided for installing the part.

For instructions on how to remove and reinstall the hard drive, you can view the following video or instructions using a web browser:

Watch the video: [How to replace the Hard disk drive](#).

or

Go to the following support document: *Removal and replacement: Hard disk drive*

3. Verify the HDD installed is compatible with your printer.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Download the printer firmware, and then extract the firmware file to a USB flash drive.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

2. Use the Preboot menu to perform a Format Disk.



NOTE: After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed). Any installed workflow solutions be present will be deleted after a Format Disk, and will require reloading and setup by the customer.

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the [Cancel](#) button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the [Administrator](#) item, and then press the [OK](#) button.
- c. Use the arrow buttons to select the [Format Disk](#) item, and then press the [OK](#) button.
- d. Press the [OK](#) button again.
- e. Select [Accept](#) to confirm the onscreen message, "Will require new firmware install".

3. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

4. Update the printer firmware from the Preboot menu using the USB flash drive.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

5. If the error persists, replace the Hard disk drive.



WARNING! Do not replace the printer formatter, it will not resolve this issue.

Table 6-97 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.



NOTE: As a workaround, it is possible to return the printer to a functional state by enabling the eMMC as the primary boot device until the HDD can be replaced.

To enable the eMMC as the primary boot device perform the following steps:

- a. Access the Preboot menu, and then select [Administrator](#).

- i. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the [Cancel](#) button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- ii. Use the arrow buttons to select the [Administrator](#) item, and then press the [OK](#) button.



NOTE: If an administrator password is assigned, a prompt will display on the control panel to enter the password. Enter the correct password to proceed.

- b. Select **Manage Disk**, and then select **Boot Device**.
- c. Select **Use Secondary**, and then select [OK](#).
- d. Use the power button to turn off the printer, and then disconnect the power cable.
- e. Disconnect the HDD from the formatter.
- f. Use the power button to turn on the printer.

The printer should boot using the eMMC.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Download the printer firmware, and then extract the firmware file to a USB flash drive.
For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).
2. Use the Preboot menu to perform a Format Disk.



NOTE: After performing a "Format Disk", the printer is not bootable. Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted. After this action, a **99.09.67** error displays on the control panel. A firmware download must be performed.

HP recommends backing-up printer configuration data before executing a Format Disk to retain customer-defined settings (if needed). Any installed workflow solutions be present will be deleted after a Format Disk, and will require reloading and setup by the customer.

- a. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the [Cancel](#) button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
- b. Use the arrow buttons to select the [Administrator](#) item, and then press the [OK](#) button.
- c. Use the arrow buttons to select the [Format Disk](#) item, and then press the [OK](#) button.
- d. Press the [OK](#) button again.
- e. Select [Accept](#) to confirm the onscreen message, "Will require new firmware install".

3. Use the power button to turn off, and then to turn on the printer.

The printer will return to a Preboot menu displaying a **99.09.67** error on the control panel.

4. Update the printer firmware from the Preboot menu using the USB flash drive.



NOTE: The printer is unusable until the firmware is installed.

For instructions, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

5. If the error persists, replace the Hard disk drive.



WARNING! Do not replace the printer formatter, it will not resolve this issue.

Table 6-98 Hard disk drive (HDD) part number

Description	Part number
500GB Hard disk drive (With Federal Information Processing Standards (FIPS) security)	5851-6712
500GB Secure Hard Disk Drive (HDD) assembly	B5L29-67903

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.



NOTE: As a workaround, it is possible to return the printer to a functional state by enabling the eMMC as the primary boot device until the HDD can be replaced.

To enable the eMMC as the primary boot device perform the following steps:

- a. Access the Preboot menu and then select [Administrator](#).
 - i. Depending on the printer control panel, follow the appropriate step:
 - **Non-touchscreen control panel:** Press the [Cancel](#) button when you see the 1/8 under the logo.
 - **Touchscreen control panel:** Touch the middle of the control-panel display when you see the 1/8 under the logo.
 - ii. Use the arrow buttons to select the [Administrator](#) item, and then press the [OK](#) button.
- b. Select **Manage Disk**, and then select **Boot Device**.
- c. Select **Use Secondary**, and then select [OK](#).
- d. Use the power button to turn off the printer, and then disconnect the power cable.
- e. Disconnect the HDD from the formatter.
- f. Use the power button to turn on the printer.

The printer should boot using the eMMC.

6. If the issue persists, elevate the issue using your country/region support process.

99.39.64 eMMC Nonfunctional

The eMMC is not functioning.

Recommended action

- Replace the eMMC.

eMMC Kit part number: 5851-6436

For instructions: *Removal and replacement: Embedded multi-media card (eMMC) kit* See the Repair Service Manual for this product.



NOTE: The device is unusable until a new eMMC is installed.

Do NOT replace the formatter board, it will not resolve this.

99.39.67 eMMC Not Bootable

Data on the eMMC cannot be secured or encrypted.

When the hard disk drive is installed all data on the eMMC is automatically migrated to the hard disk drive and erased from the eMMC. As long as the hard disk drive is installed the eMMC is non-functional.

The customer passed the data migration and put the eMMC back in.

Recommended action

1. Download firmware to the eMMC.
2. If the download fails to eMMC, replace the eMMC.

eMMC Kit part number: 5851-6436

For instructions: *Removal and replacement: Embedded multi-media card (eMMC) kit* See the Repair Service Manual for this product.

Do NOT replace the formatter board, it will not resolve this.



NOTE: The device is unusable until a new eMMC is installed.

7 Alphabetical control panel messages

Use the following alphabetical message to see further information on the message.

Alphabetical error messages

Accept bad signature

The product is performing a remote firmware upgrade and the code signature is invalid.

Recommended action

Follow these troubleshooting steps in the order presented.

- Download the correct firmware upgrade file for the product, and then reinstall the upgrade.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

Authentication required

A user name and password are required.

Recommended action

- Type the user name and password, or contact the network administrator.

Bad optional tray connection

The optional tray is not connected, not connected correctly, or a connection is not working correctly.

Recommended action

1. Turn the printer off.
2. Remove and then reinstall the optional tray.
3. If more than one extra 550 Sheet feeder is available swap trays and test again.
4. Remove the tray and inspect the connectors on the tray and printer for damage. If either of them are broken, have bent pins, or otherwise appear damaged, replace them.
5. Carefully reposition printer base onto the optional tray. HP recommends that two people lift the printer.
6. If the problem continues, replace the connector for the tray.

Canceling...<jobname>

The printer is canceling the current job <jobname>.

Recommended action

See recommended action.

- No action necessary.

Cartridge low

If this message appears even though the toner cartridge is new, perform the following.

Recommended action

1. Remove, and then reinstall the toner cartridge.

2. Make sure a genuine HP supply is used.
3. If the error persists, replace the toner cartridge.

Cartridge Memory Abnormal

This message appears even though the toner cartridge is new.

Recommended action

1. Remove, and then reinstall the toner cartridge.
2. If the error persists, replace the toner cartridge.

Cartridge out

This message appears even though the toner cartridge is new.

Recommended action

1. Remove, and then reinstall the toner cartridge.
2. Make sure a genuine HP supply is used.
3. If the error persists, replace the toner cartridge.

Checking engine

The printer is conducting an internal test.

Recommended action

See recommended action.

- No action necessary.

Checking paper path

The printer is checking for possible paper jams.

Recommended action

See recommended action.

- No action necessary.

Chosen personality not available To continue touch “OK”

A print job requested a printer language (personality) that is not available for this printer. The job will not print and will be cleared from memory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Print the job by using a print driver for a different printer language, or add the requested language to the printer (if possible). To see a list of available personalities, print a configuration page.

- a. From the Home screen on the printer control panel, go to the following menus: **Reports > Configuration/Status Pages**
- b. Select [Configuration Page](#), then select the [Print](#) button to print the pages.

Cleaning disk <X> complete Do not power off

A storage device is being sanitized or cleaned.

Recommended action

- Do not turn off the printer. The printer's functions are unavailable. The printer will automatically restart when finished.

Cleaning

The printer is performing an automatic cleaning cycle. Printing will continue after the cleaning is complete.

Recommended action

See recommended action.

- No action necessary.

Clearing activity log

This message is displayed while the activity log is cleared. The printer exits the menus when the log has been cleared.

Recommended action

- No action necessary.

Clearing event log

This message is displayed while the event log is cleared. The printer exits the menus when the event log has been cleared.

Recommended action

See recommended action.

- No action necessary.

Clearing paper path

The printer is attempting to eject jammed paper.

Recommended action

Follow these troubleshooting steps in the order presented.

- Check the progress at the bottom of the display.

Close front door

The front door is open.

This message appears even though the top front door is closed.

Recommended action for customers


1. Close the front door to allow the printer to attempt to clear the jam.
2. Open then close the front door to ensure it is fully closed.

Recommended action for call-center agents and onsite technicians

1. Close the front door to allow the printer to attempt to clear the jam.
2. Check the projection part on the front door that defeats the front door interlocks. If broken replace the front door assembly.

Part number: RM2-4277-000CN

For instructions: *Removal and replacement: Front door assembly* See the Repair Service Manual for this product.

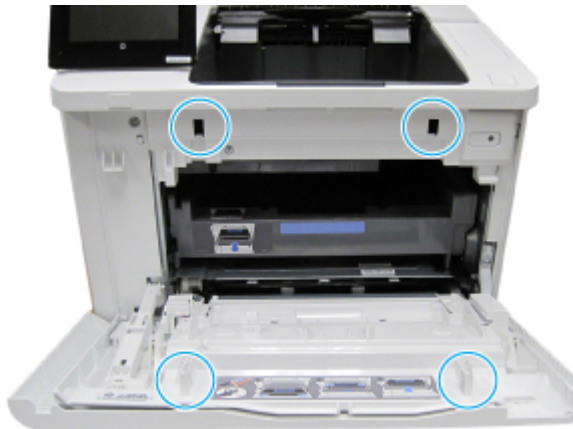


3. Check SW1 using the manual sensor test.
 - a. From the home screen on the printer control panel, touch “[Support Tools](#)”.
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - c. Select from the following tests:
 - [All Sensors](#) , [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#)(reset the selected sensor’s state)

- d. Test SW2 using folded paper or another object to defect the interlock. If the switch test fails, replace the laser shutter assembly.

Part number: RM2-6755-000CN



NOTE: Before replacing any parts check connector J308 on the DC controller.

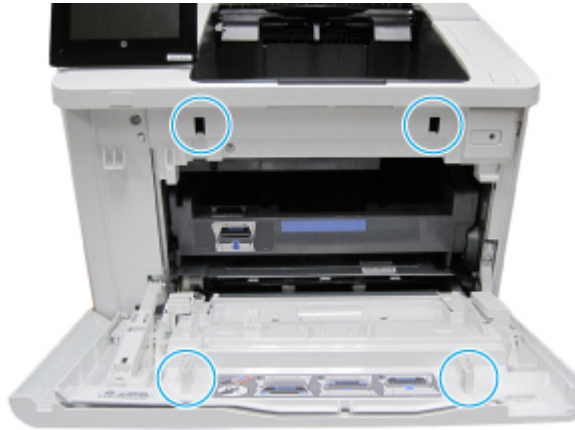

Close Rear Door

The rear door is open.

Recommended action for customers

- Close the rear door to allow the printer to attempt to clear the jam.

Recommended action for call-center agents and onsite technicians

1. Close the rear door to allow the printer to attempt to clear the jam.
2. Check the projection part on the rear door that defeats the rear door interlocks. If broken replace the rear door assembly.

Rear door part number: RM2-6746-000CN

For instructions: *Removal and replacement: Rear door assembly* See the Repair Service Manual for this product.

Rear door (LCD Simplex) part number: RM2-1249-000CN

For instructions: *Removal and replacement: Rear door assembly* See the Repair Service Manual for this product.



3. Check SW1 using the manual sensortest.
 - a. From the home screen on the printer control panel, touch “[Support Tools](#)”.
 - b. Open the following menus:
 - [Troubleshooting](#)
 - [Diagnostic Tests](#)
 - [Manual Sensor Test](#)
 - c. Select from the following tests:
 - [All Sensors](#) , [Engine Sensors](#)
 - [Done](#) (return to the [Troubleshooting](#) menu)
 - [Reset](#)(reset the selected sensor’s state)
 - d. Test SW1 using folded paper or another object to defect the interlock. If the switch test fails, replace the laser shutter assembly.

Part number: RM2-6755-000CN



NOTE: Before replacing any parts check connector J321 on the DC controller.



Communication lost

A Communication Lost message appears on the control panel in five different languages.

The communication path from the control panel to the formatter includes the Control Panel, USB cable, and the formatter.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call agent

Follow these troubleshooting steps in the order presented.

1. Turn off the printer.
2. Re-seat the USB cable connection at the rear of the control panel.



NOTE: The images below are for a small touchscreen control panel.

- a. Raise the control panel screen to 90-degrees (in the direction indicated by the arrow).

Figure 7-1 Raise the control panel screen



- b. Use a small flat-blade screw driver to release the control panel cover in the direction indicated by the arrow.

Figure 7-2 Lift and remove the control panel cover



- c. Remove one thumbscrew.

Figure 7-3 Remove one thumbscrew




- d. Lift the back edge of the control panel up (callout 1), and then slide the control panel toward the back of the printer (callout 2) to release it.

Figure 7-4 Lift and release the control panel



- e. Turn the control panel over to gain access to the bottom side.
- f. Disconnect two connectors (callout 1) and then reconnect the connectors.

Figure 7-5 Disconnect two connectors from the bottom side

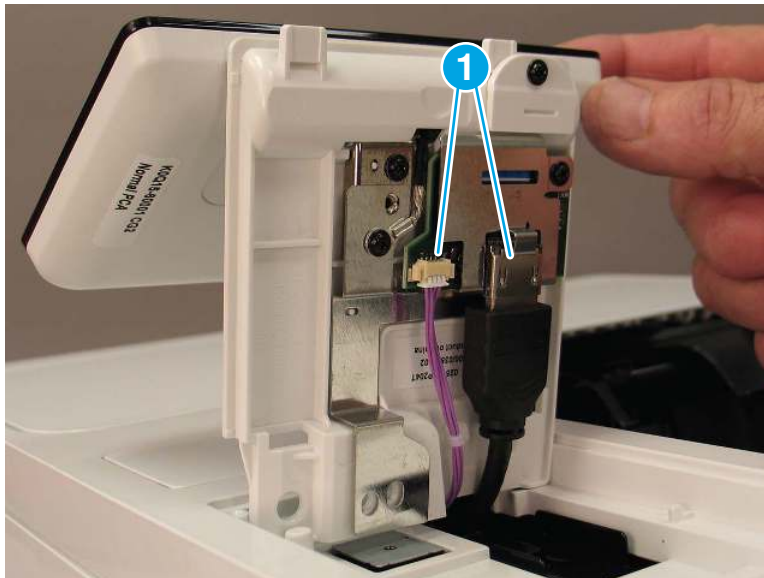

- g. Ensure the USB cable is connecting the control panel to the printer and is seated correctly.
 - h. Reverse the steps to reseat the control panel cover and secure the thumb screw.
3. Turn the printer on.

4. If the issue persists, replace the formatter.

Table 7-1 Formatter part numbers

Description	Part number
Formatter (main logic) PC board assembly	K0Q14-60001
For printer models: M608x/M609x	
Formatter (main logic) PC board assembly	K0Q14-60002
For printer models: M607n/dn, M608n/dn, M609n/dn, M610/M611/M612/E60055/E60065/E60075	
Formatter	7PS81-67901
For printer models: M611x/M612x (India/China)	
Formatter	7PS81-67902
For printer models: M611x/M612x	
Formatter	7PS81-67905
For printer models: M610n/dn, M611n/dn, M612n/dn (India/China)	
Formatter	7PS81-67906
For printer models: M610n/dn, M611n/dn, M612n/dn	
Formatter (main logic) PC board assembly	3GY09-67902
For printer models: E60155/ E60165/ E60175	
Kit- Formatter	3GY09-67903
For printer models: E60155/ E60165/ E60175 (India/China)	

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

Recommended action for service technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the printer.
2. Re-seat the USB cable connection at the rear of the control panel.



NOTE: The images below are for a small touchscreen control panel.

- a. Raise the control panel screen to 90-degrees (in the direction indicated by the arrow).

Figure 7-6 Raise the control panel screen



- b. Use a small flat-blade screw driver to release the control panel cover in the direction indicated by the arrow.

Figure 7-7 Lift and remove the control panel cover



- c. Remove one thumbscrew.

Figure 7-8 Remove one thumbscrew



- d. Lift the back edge of the control panel up (callout 1), and then slide the control panel toward the back of the printer (callout 2) to release it.


Figure 7-9 Lift and release the control panel



- e. Turn the control panel over to gain access to the bottom side.

- f. Disconnect two connectors (callout 1) and then reconnect the connectors.

Figure 7-10 Disconnect two connectors from the bottom side

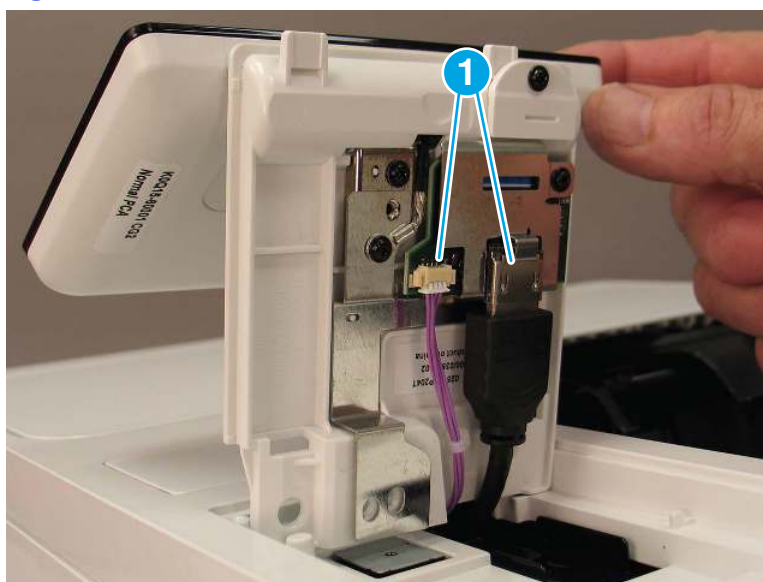

- g. Ensure the USB cable is connecting the control panel to the printer is seated correctly.
 - h. Reverse the steps to reseat the control panel cover and secure the thumb screw.
3. Turn the printer on.
 4. If the printer returns to a Ready state, verify the functionality of the control panel.
 5. If the issue persists, turn off the printer, and then reseat (J51), HDMI, USB and HIP cable on the formatter.
 6. Turn on the printer.
 7. If the issue persists, replace the formatter.

Table 7-2 Formatter part numbers

Description	Part number
Formatter (main logic) PC board assembly	K0Q14-60001
For printer models: M608x/M609x	
Formatter (main logic) PC board assembly	K0Q14-60002
For printer models: M607n/dn, M608n/dn, M609n/dn, M610/M611/M612/E60055/E60065/E60075	
Formatter	7PS81-67901
For printer models: M611x/M612x (India/China)	
Formatter	7PS81-67902
For printer models:M611x/M612x	
Formatter	7PS81-67905
For printer models: M610n/dn, M611n/dn, M612n/dn (India/China)	

Table 7-2 Formatter part numbers (continued)

Description	Part number
Formatter	7PS81-67906
For printer models: M610n/dn, M611n/dn, M612n/dn	
Formatter (main logic) PC board assembly	3GY09-67902
For printer models: E60155/ E60165/ E60175	
Kit- Formatter	3GY09-67903
For printer models: E60155/ E60165/ E60175 (India/China)	

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

8. If the issue persists, replace the control panel.

Table 7-3 Control panel part numbers

Description	Part number
Control panel kit -With 2.7-inch display	5851-7975
For printer models (with keypad): M607n, M607dn/M608n, M608dn/M609n, M609dn/ E60065n, E60065dn/ E60075n, E60075dn	
Control panel kit - With 4.3-inch display	K0Q15-67901
For printer models (without keypad): M607x, M608x, M609x, E60065x, E60075x	

For instructions to remove and replace the control panel, see the Removal and Replacement sections in the Service Manual for the product.

Data received To print last page press “OK”

The printer is waiting for the command to print the last page.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the “OK” button on the control panel to print the last page of the job.

Data received To print last page press “OK”

The printer is waiting for the command to print the last page.

Recommended action

- Touch the OK button to print the last page of the job.

Event log is empty

No printer events are in the log.

Recommended action

See recommended action.

- No action necessary.

Expected drive missing

The printer cannot find the encrypted hard drive.

Recommended action

Follow these troubleshooting steps in the order presented.

- Install the encrypted hard disk drive.

External device initializing

An external device is initializing.

Recommended action

See recommended action.

- No action necessary.

Fuser Kit low

10.23.60 (event code)

The printer indicates when a supply is low.

Recommended action

- Replace the fuser.

110V part number: RM2-1256-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

Fuser Kit very low To continue, touch “OK”

10.23.70 (event code)

The printer indicates when a supply is very low.

After an HP supply has reached the very low threshold, the HP premium protection warranty for that supply has ended.

Recommended action

- Replace the fuser.

110V part number: RM2-1256-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

Gateways failed

There is an incorrect gateways configuration.

Recommended action

- Use the **EIO <X> Jetdirect** menu to configure the default gateway.

Genuine HP supply installed

A new genuine HP toner cartridge has been installed.

Recommended action

- Touch the **Hide** button to remove this message.

Incompatible <Supply>

The indicated supply is not compatible with this printer.

- **10.00.35:** (event code) Toner cartridge
- **10.23.35:** (event code) Fuser kit

Recommended action

- Replace the supply with one that is designed for this printer.

Incompatible supplies

Print cartridges or other supply items are installed that were not designed for this printer. The printer cannot print with these supplies installed.

Event codes are supply specific.

Recommended action

- Touch the **OK** button to identify the incompatible supplies.
- Replace the supplies with those that are designed for this printer.

Initializing...

The printer is starting.

Recommended action

See recommended action.

- No action necessary.

Install fuser unit

10.23.15: (event code) Fuser Kit

The fuser has been removed or installed incorrectly.

Recommended action

1. Turn the printer off and open the rear door.
2. Remove the fuser then reinstall it.

 **CAUTION:** The fuser might be hot.

3. If the message remains, replace the fuser.

110V part number: RM2-1256-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

220V part number: RM2-1257-000CN

For instructions: *Removal and replacement: Fuser* See the Repair Service Manual for this product.

Install Supplies

More than one supply is missing or is installed incorrectly.

- **10.00.15** (event code): Black toner cartridge
- **10.23.15** (event code): Fuser kit

Recommended action

Touch the **OK** button to identify which supplies need to be replaced.

Touch the **OK** button a second time for more information about the specific supply.

- Insert the supply item or make sure the installed supply item is fully seated.

Internal disk device failure To clear touch “OK”

82.0X.YY (event code)

The internal disk failed.

Recommended action

1. Touch the **OK** button to clear the error.
2. If the error persists, turn off the printer, and then remove and reinstall the hard drive.
3. Turn on the printer.
4. If the error persists, replace the internal hard disk drive.

320 HDD part number: 5851-6712

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

Secure HDD part number (new): B5L29A

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

Secure HDD part number (service): B5L29-67903

For instructions: *Removal and replacement: Hard disk drive* See the Repair Service Manual for this product.

Internal disk file operation failed

A PJJ system command attempted to perform an illogical operation, such as downloading a file to a nonexistent directory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

Internal disk file system is full

A PJJ system command attempted to write data to the internal hard disk drive but was unsuccessful because the hard disk drive is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

Internal disk is write protected

The internal hard disk drive is write protected and no new files can be written to it.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

Internal disk not found

The internal hard disk drive was not found at start up.

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn the printer off, and then on.

Internal disk not initialized

The internal hard disk drive file system must be initialized before it can be used.

Recommended action

Follow these troubleshooting steps in the order presented.

- Initialize the internal hard disk drive file system.

For information on performing various actions on the hard disk drive, go to:

Internal disk spinning up

The internal hard disk drive device is spinning up its platter. Jobs that require hard disk drive access must wait.

Recommended action

See recommended action.

- No action necessary.

Load Tray <X>: [Type], [Size] To use another tray, press “OK”

This message displays when the indicated tray is selected, but is not loaded, and other paper trays are available for use.

It also displays when the tray is configured for a different paper type or size than the print job requires.

Recommended action

1. Load the correct paper in the tray.
2. If prompted, confirm the size and type of paper loaded.
3. Otherwise, press the OK button to select another tray.
4. If error persists, use the cassette paper present sensor test in the Tray/bin manual sensor test to verify that the sensor is functioning correctly.
5. Make sure that the sensor flag on the paper presence sensor is not damaged and moves freely.
6. Reconnect the corresponding connector.

Loading program <XX> Do not power off

Programs and fonts can be stored on the printer's file system and are loaded into RAM when the printer is turned on. The number <XX> specifies a sequence number indicating the current program being loaded.

Recommended action

See recommended action.

- No action necessary.

Manually feed output stack Then touch "OK" to print second side

The printer has printed the first side of a manual duplex job and is waiting for you (or the applicable user) to insert the output stack to print the second side.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Maintaining the same orientation, remove the pages from the output bin.
2. Flip the document printed side up.

3. Load the document in Tray 1.
4. Touch the **OK** button to print the second side of the job.

Manually feed: <Type><Size>

This message appears when manual feed is selected, Tray 1 is not loaded, and other trays are empty.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Load the tray with requested paper.
2. If the paper is already in the tray, press the **Help** button to exit the message and then press the **OK** button to print.
3. To use another tray, clear paper from Tray 1, press the **Help** button to exit the message and then press the **OK** button.

No job to cancel

You have pressed the stop button but the printer is not actively processing any jobs.

Recommended action

See recommended action.

- No action necessary.

No USB drive or files found

The formatter was not able to detect the USB thumb drive.

If you experience the “No USB drive or files found” attempting to upgrade printer firmware via the walk up easy-access USB port perform the following.


Recommended action for customers

Follow these steps to try to resolve this error.

If you experience the “No USB drive or files found” attempting to upgrade printer firmware via the walk up easy-access USB port perform the following.

1. 1. After the firmware file has been downloaded from hp.com uncompress the file and copy the xxxxxx.bdl file to the root of a portable USB flash memory storage device (thumb drive), insert the USB flash memory storage device into the easy-access USB port, and attempt to flash the firmware.
2. If the issue persists, verify the USB flash drive is formatted as FAT32. If unsure, format the flash drive as FAT32 and/or try a different flash drive and repeat step 1.
3. If the issue persists, the USB flash drive can be inserted directly into a USB port on the printer’s formatter and the firmware flashed.
 - a. Locate the printer’s formatter interface located at the rear left side of printer.
 - b. If necessary, rotate the printer for easier access to the formatter ports.

- c. Locate the USB connection port (callout 2).

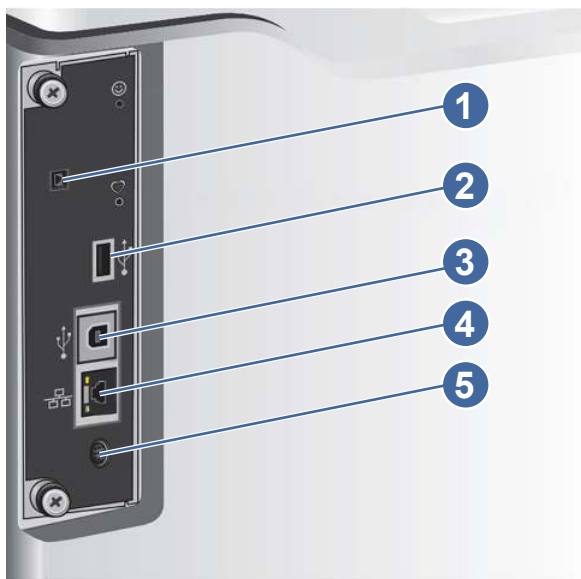

- d. Insert the USB flash drive (callout 2).
 - e. Attempt to flash the printer's firmware.
 - f. After the firmware update remove the USB flash drive.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these steps to try to resolve this error.

1. Try another thumb drive.
2. Use both the rear and walk up USB ports.
3. If the error persists, install another formatter board.

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

Table 7-4 Part information

Part numbers	Part description
K0Q14-60001	Formatter PCA (M608x/M609x)
K0Q14-60002	Formatter PCA (M607n/M607dn/M608n/M608dn/M609dn)
3GY09-67902	Formatter PCA (E60155/E60165/E60175)
3GY09-67903	Formatter PCA (E60155/E60165/E60175; India, China)

4. If the error persists, elevate using the standard support process.

Recommended action for onsite technicians

Follow these steps to try to resolve this error.

1. Try another thumb drive.
2. Use both the rear and walk up USB ports.
3. If the error persists, install another formatter board.

For instructions: *Removal and replacement: Formatter* See the Repair Service Manual for this product.

Table 7-5 Part information

Part numbers	Part description
K0Q14-60001	Formatter PCA (M608x/M609x)
K0Q14-60002	Formatter PCA (M607n/M607dn/M608n/M608dn/M609dn)
3GY09-67902	Formatter PCA (E60155/E60165/E60175)
3GY09-67903	Formatter PCA (E60155/E60165/E60175; India, China)

4. If the error persists, elevate using the standard support process.

NON HP Supply Installed

This message is displayed for about 6 seconds when a new non-HP supply is installed.

10.99.31 (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

1. Use a genuine HP supply for the printer.
2. If you believe a genuine HP supply is being used, go to www.hp.com/go/anticounterfeit.

Output Bin Full

The **Output Bin Full** message displays when the output bin is full and paper must be removed before printing can continue.

Recommended action

1. Remove the paper from the output bin.
2. If this message appears even though the output bin is not full.
 - a. Make sure that the output bin sensor flag is not damaged and can move freely. If the flag is damaged, replace the flag.
 - b. Use the output bin full sensor test in the manual sensor test to test the sensor. If it does not respond, replace the replace the delivery assembly.

Paper delivery assembly (except LCD simplex models) part number: RM2-6787-000CN

For instructions: *Removal and replacement: Paper delivery assembly* See the Repair Service Manual for this product.

Paper delivery assembly (LCD Simplex models) part number: RM2-4234-000CN

For instructions: *Removal and replacement: Paper delivery assembly* See the Repair Service Manual for this product.

Paused...

The printer is paused, and there are no error messages pending at the display. The I/O continues receiving data until the memory is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Press the [Stop](#) button.

Performing Paper Path Test

A paper path test is being performed.

Recommended action

See recommended action.

- No action necessary.

Please Wait...

The printer is in the process of clearing data.

Recommended action

See recommended action.

- No action necessary.

Printing Cleaning Page...

The printer is printing the cleaning page.

Recommended action

See recommended action.

- No action necessary.

Printing Configuration...

The printer is printing the Configuration page.

Recommended action

See recommended action.

- No action necessary.

Printing Demo Page

The demo page is being generated. The printer will return to the Ready state when the page is complete.

Recommended action

See recommended action.

- No action necessary.

Printing engine test...

The printer is printing an engine test page.

Recommended action

See recommended action.

- No action necessary.

Printing Event Log...

The printer is printing the Event Log page.

Recommended action

See recommended action.

- No action necessary.

Printing File Directory...

The printer is printing the File Directory pages.

Recommended action

See recommended action.

- No action necessary.

Printing Font List...

The printer is printing the Font List pages.

Recommended action

See recommended action.

- No action necessary.

Printing Menu Map...

The printer is printing the Menu Map pages.

Recommended action

See recommended action.

- No action necessary.

Printing stopped...

Time has expired on the Print/Stop test.

Recommended action

See recommended action.

- No action necessary.

Printing Supplies Status Page...

The printer is printing the Supplies Status page.

Recommended action

See recommended action.

- No action necessary.

Printing Usage Page...

The printer is printing the Usage page.

Recommended action

See recommended action.

- No action necessary.

Processing...

The printer is currently processing a job but is not yet picking pages. When paper motion begins, this message is replaced by a message that indicates the tray the job is using.

Recommended action

See recommended action.

- No action necessary.

Processing duplex job Do not grab paper until job completes

Paper temporarily comes into the output bin while printing a duplex job.

Recommended action

See recommended action.

- No action necessary.

Processing job from tray <x>... Do not grab paper until job completes

The printer is actively processing a job from the designated tray.

Recommended action

See recommended action.

- No action necessary.

Processing... copy <x> of <y>

The printer is currently processing or printing collated copies. The message indicates that copy number <x> of total copies <y> is currently being processed.

Recommended action

See recommended action.

- No action necessary.

RAM disk device failure To clear press “OK”

The specified device failed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

RAM disk file operation failed To clear press “OK”

A PJI command was received that attempted to perform an illegal operation, such as downloading a file to a nonexistent directory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

RAM disk file system is full To clear press “OK”

The RAM disk is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

RAM disk is write protected To clear press “OK”

The device is protected and no new files can be written to it.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

RAM disk not initialized

The RAM disk file system must be initialized before it can be used.

Recommended action

Follow these troubleshooting steps in the order presented.

- Initialize the RAM disk file system.

Ready

The printer is online and ready for data. No status or printer attendance messages are pending at the display.

Recommended action

See recommended action.

- No action necessary.

Ready <IP Address>

The printer is online and ready for data. No status or printer attendance messages are pending at the display. The printer IP address displays.

Recommended action

See recommended action.

- No action necessary.

Receiving Upgrade

The printer is receiving a firmware upgrade.

Recommended action

Follow these troubleshooting steps in the order presented.

- Do not turn the printer off until it reaches the [Ready](#) state.

Remove USB accessory

This message displays when an unsupported USB device is inserted into a host USB port on the printer.

Recommended action

Follow these troubleshooting steps in the order presented.

- Remove the unsupported USB device.

Replace <Supply>

This alert displays only if the printer is configured to stop when a supply reaches the very low threshold. The printer indicates when a supply level is at its estimated end of life. The actual life remaining might be different than estimated.

The supply does not need to be replaced now unless the print quality is no longer acceptable.

HP recommends that the customer have a replacement supply available to install when print quality is no longer acceptable.

The printer can be configured to stop when the supply level is very low. The supply might still be able to produce acceptable print quality.

- **10.00.70** : Toner cartridge (event code)
10.23.70 Fuser kit (event code)

Recommended action

- Replace the specified supply.

Or, configure the printer to continue printing using the [Manage Supplies](#) menu on the printer control panel.

Resend Upgrade

A firmware upgrade did not complete successfully.

Recommended action

Follow these troubleshooting steps in the order presented.

- Upgrade the firmware again.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

Restore Factory Settings

The printer is restoring factory settings.

Recommended action

See recommended action.

- No action necessary.

RFU Load Error Send full RFU on <X> Port

The printer displays this message before the firmware is loaded at initialization when an error has occurred during a firmware upgrade.

Recommended action

- Resend the firmware upgrade.

ROM disk device failed To clear press “OK”

The specified device failed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the [OK](#) button to clear the error.

ROM disk file operation failed To clear press “OK”

A PJJ command was received that attempted to perform an illegal operation, such as downloading a file to a nonexistent directory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the [OK](#) button to clear the error.

ROM disk file system is full To clear press “OK”

The specified device is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

ROM disk is write protected To clear press “OK”

The device is protected and no new files can be written to it.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

ROM disk not initialized To clear press “OK”

The ROM disk file system must be initialized before it can be used.

Recommended action

Follow these troubleshooting steps in the order presented.

- Initialize the ROM disk file system.

Sanitizing disk <X> complete Do Not power off

The hard disk is being cleaned.

Recommended action

- Contact the network administrator.

Size mismatch in Tray <X>

The paper in the listed tray does not match the size specified for that tray.

If using adhesive or self-sealing media, please see the instructions in *A "13.BY.XY paper jam" or "41.03.XY Size Mismatch" message displays on the printer control panel when printing on self-adhesive paper.* (ish_3199741-3199797-16).

Recommended action

1. Load the correct paper.
2. Make sure that the paper is positioned correctly.
3. Close the tray, and then make sure that the control panel lists the correct size and type for the specified tray.
4. If necessary, use the control panel menus to reconfigure the size and type settings for the specified tray.

5. If this message appears even though the correct size paper is loaded in the correct paper tray perform the following.
 - Use the Tray size switch test in the Tray/Bin manual sensor test to test the switch.
 - Reconnect tray connectors on the media size switch, and then reconnect connector on the DC controller to tray.
 - If the error persists, replace the size sensor PCA.

Part number: RM2-0866-000CN

Sleep mode on

The printer is in sleep mode. Pressing a control-panel button, receiving a print job, or occurrence of an error condition clears this message.

Recommended action

See recommended action.

- No action necessary.

Supplies low

Multiple supplies on the printer have reached the low threshold.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the supply when print quality is no longer acceptable.

Too many jobs in queue

This message displays when the user selects a USB file to print, and 100 files are already in the print queue.

Recommended action

- To select another file, touch the **OK** button.

Tray 2 empty: [Type], [Size]


Tray 2 is empty and the current job does not need this tray to print.

Recommended action

1. Check the tray, and refill it if it is empty.
2. If the error persists, unplug the printer cord and rotate the printer so that the rear door of the printer is in front of you.

3. Raise the primary transfer assembly.

Figure 7-11 Raise the transfer assembly

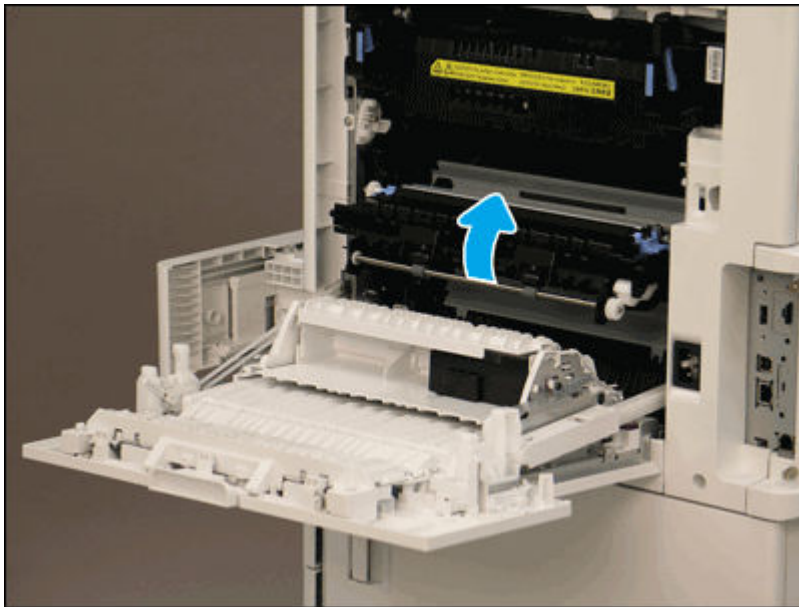

4. Open the rear door to check the feed rollers.
 - a. Pull the green tab located on the upper left-hand side to open the lower-access cover.

Figure 7-12 Open the jam access door



- b. Check the rollers to ensure that they are installed correctly.
 - If the flap of the blue roller tab is down, the rollers are not installed correctly.



NOTE: If the blue tab is DOWN, Tray 2 will not lift, and the control panel will indicate that Tray 2 is empty.

- If the flap of the blue roller tab is up, the rollers are installed correctly.

5. If the error persists, contact customer support.

Tray <X> empty: [Type], [Size]

The specified tray is empty and the current job does not need this tray to print.

- X = 1: Tray 1
- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5

Recommended action

- Refill the tray at a convenient time.



NOTE: This could be a false message. If the tray is loaded without removing the shipping lock, the printer does not sense that the paper is loaded. Remove the shipping lock, and then load the tray.

Tray <X> lifting

The printer is in the process of lifting paper in the indicated tray.

- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5

Recommended action

- No action necessary.

Tray <X> open

The specified tray is open or not closed completely.

- X = 2: Tray 2
- X = 3: Tray 3
- X = 4: Tray 4
- X = 5: Tray 5

Recommended action for customers

1. Close the tray.
2. If the message persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Close the tray.
2. If this message displays after the lifter drive assembly was removed or replaced, make sure that the connector of the assembly is connected correctly and fully seated.
3. If the error persists, use the Media size switches test in the Tray/Bin manual sensor test to test the switches. If they do not respond, replace the associated size sensor assembly.

Part number: RM2-0866-000CN

Tray <X> [type] [size]

The paper in the specified tray is detected as the specified size and type.

The custom switch was not changed.

Recommended action

- If the paper is a custom size or type, change the custom-size switch on the tray as necessary.

Tray 2 overfilled or roller issue

The upper pick roller is not seated correctly or the paper sensor is missing, damaged, or dislodged.

The error message displays the following message on the printer control panel

Check that the tray is not loaded above the fill lines. Remove any excess paper.

If a new pickup roller was recently installed, check to see that the parts are firmly seated, and the access latch is closed.

Recommended action for customers

1. Pull out tray 2 completely out of the printer to remove it.
2. Ensure that the stack of paper in the tray is not above the fill mark (line below the three triangles) as indicated in the image.

Figure 7-13 Paper height guides

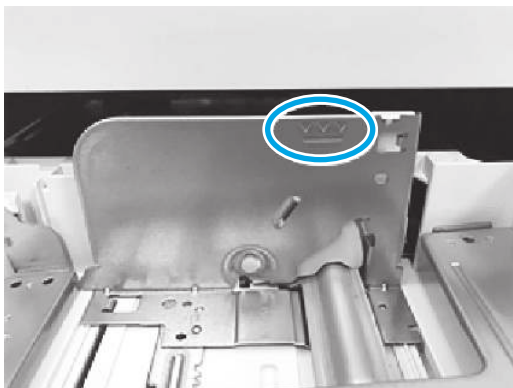


Figure 7-14 Overfilled tray

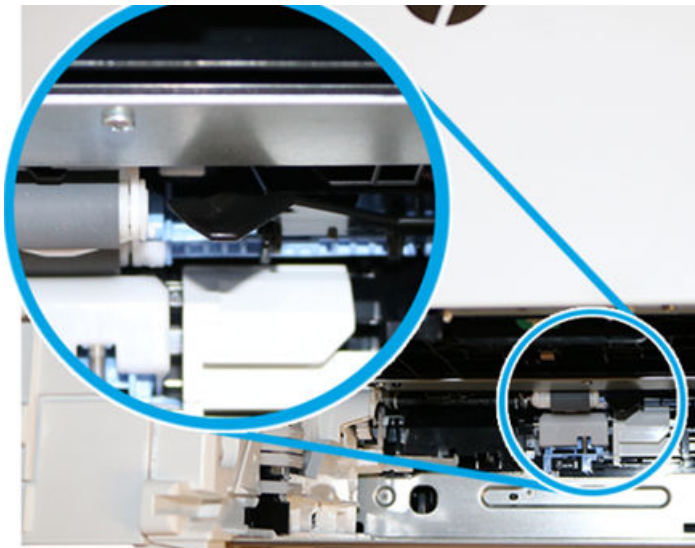


Figure 7-15 Stack of paper not overfilled in tray 2



3. Make sure to remove any excess pages from the tray.
4. Check if the paper sensor flag located inside tray 2 next to the roller is missing, damaged, or dislodged.
If the paper sensor flag is missing, damaged, or dislodged, contact customer support.

Figure 7-16 Paper sensor flag in Tray 2



5. Open the rear door.
6. Raise the transfer assembly.
7. Pull the green tab located in the left-hand side to open the lower-access cover.
8. Check if the rollers are installed correctly.
 - If the flap of the blue roller tab is down, the rollers are not installed correctly.
 - If the flap of the blue roller tab is up, the rollers are installed correctly.

Figure 7-17 Feed rollers flap is down and not installed correctly


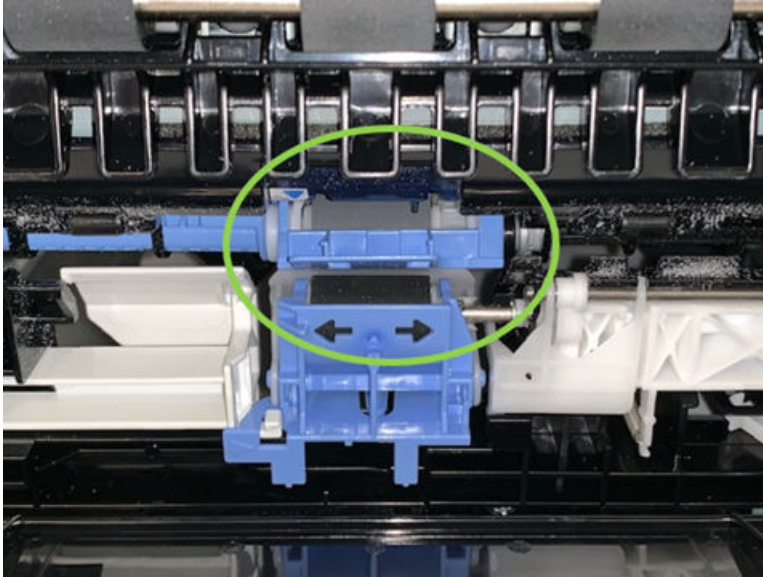


Figure 7-18 Feed rollers flap is up and installed correctly

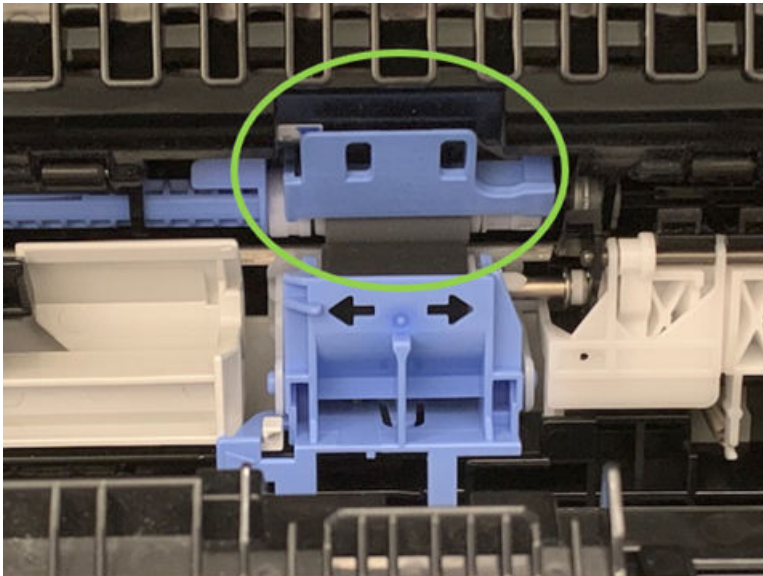

9. Remove any visible lint or dust from each of the feed, pickup and separation rollers using a clean lint-free cloth moistened with warm water.

10. If the pickup, feed, and separation rollers are damaged or worn out, replace the rollers.

- Part number: J8J70-67906
- Part description: Tray 2 roller assembly
- For instructions, go to [Removal and replacement: Trays 2-x rollers](#)

Figure 7-19 Worn out roller surface


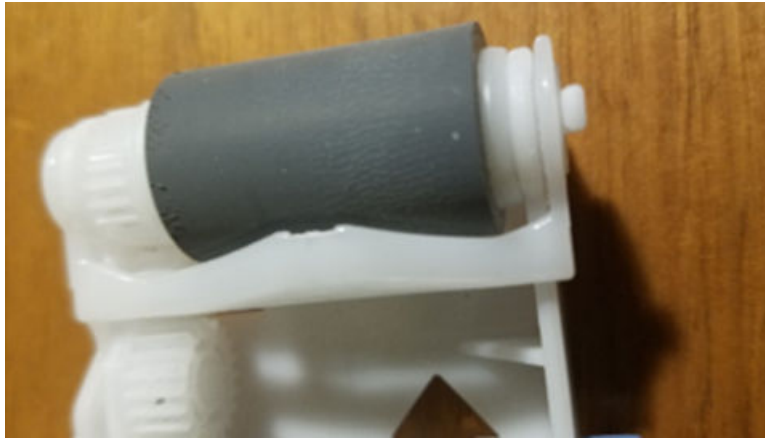


Figure 7-20 New roller surface

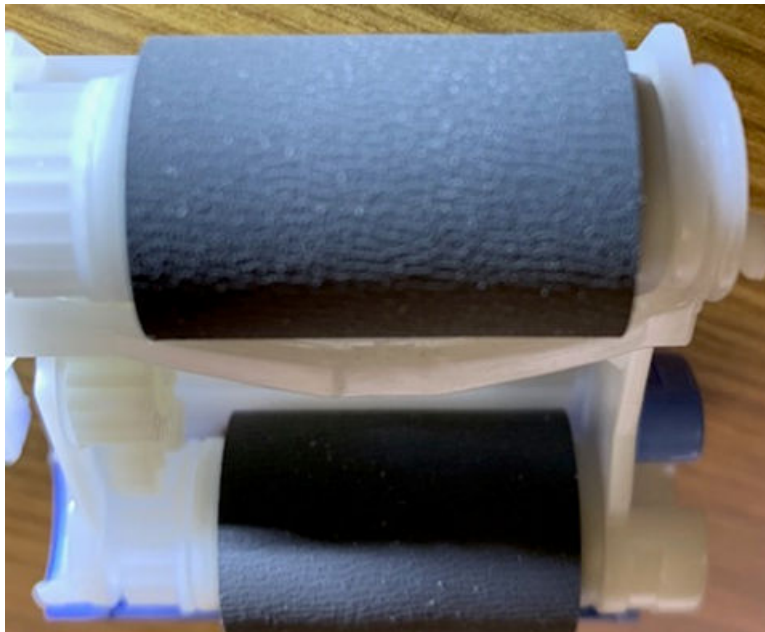

11. Reinstall tray 2.

Recommended action for call-center agents and onsite technicians

1. Pull out tray 2 completely out of the printer to remove it.

2. Ensure that the stack of paper in the tray is not above the fill mark (line below the three triangles) as indicated in the image.

Figure 7-21 Paper height guides

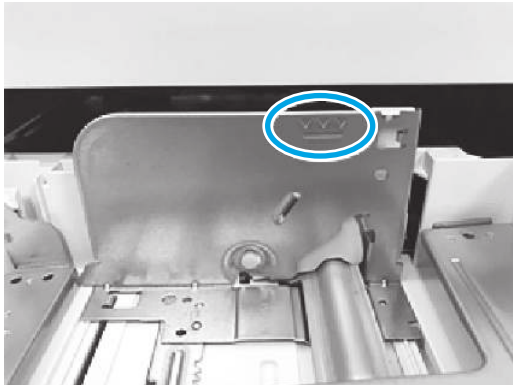


Figure 7-22 Overfilled tray


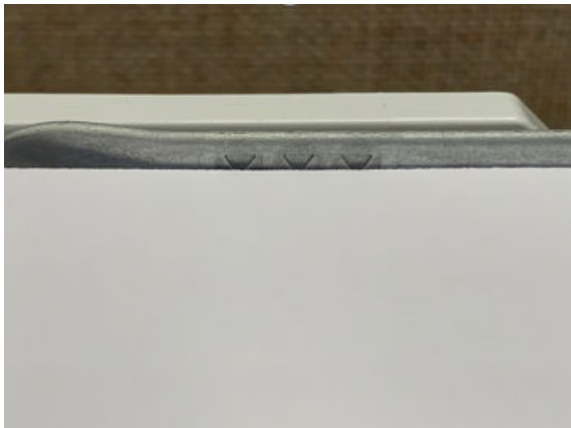


Figure 7-23 Stack of paper not overfilled in tray 2



3. Make sure to remove any excess pages from the tray.
4. Check if the paper sensor flag located inside tray 2 next to the roller is missing, damaged, or dislodged.
If the paper sensor flag is missing, damaged, or dislodged, elevate the case using the Standard Support Process.

Figure 7-24 Paper sensor flag in Tray 2

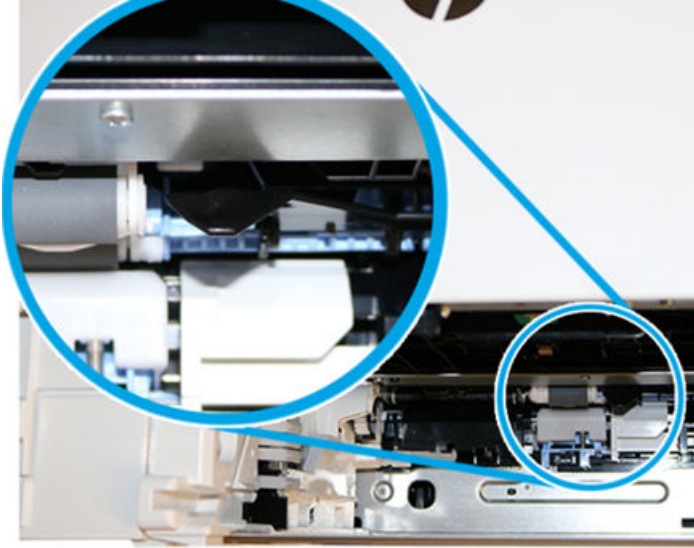

5. Open the rear door.
6. Raise the transfer assembly.
7. Pull the green tab located in the left-hand side to open the lower-access cover.
8. Check if the rollers are installed correctly.
 - If the flap of the blue roller tab is down, the rollers are not installed correctly.
 - If the flap of the blue roller tab is up, the rollers are installed correctly.

Figure 7-25 Feed rollers flap is down and not installed correctly


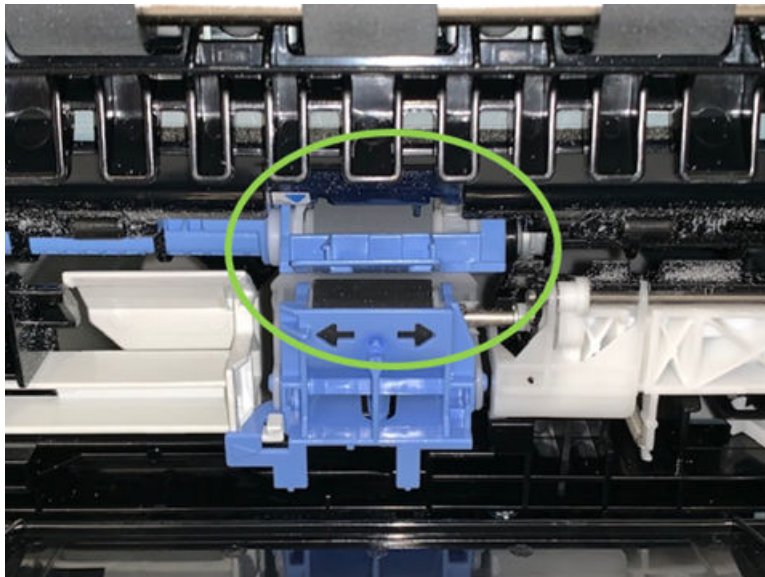


Figure 7-26 Feed rollers flap is up and installed correctly

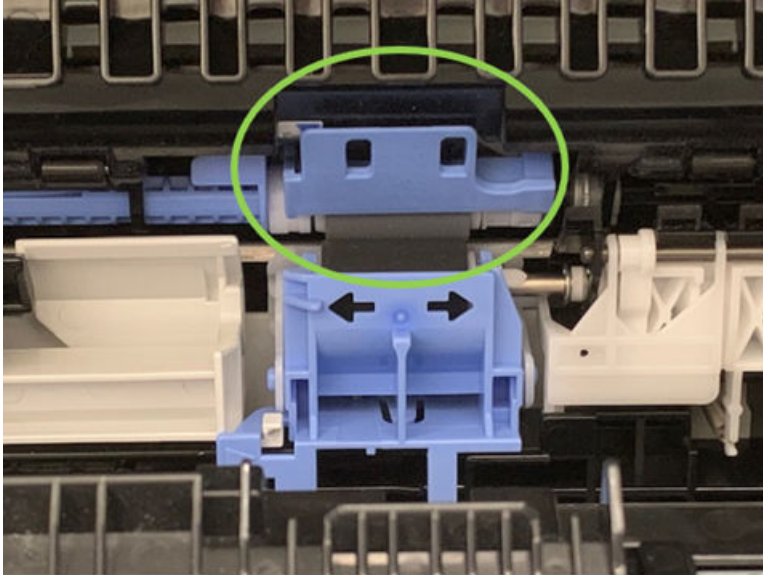

9. Remove any visible lint or dust from each of the feed, pickup and separation rollers using a clean lint-free cloth moistened with warm water.
10. If the pickup, feed, and separation rollers are damaged or worn out, replace the rollers.
 - Part number: J8J70-67906
 - Part description: Tray 2 roller assembly
 - For instructions, go to [Removal and replacement: Trays 2-x rollers](#)

Figure 7-27 Worn out roller surface


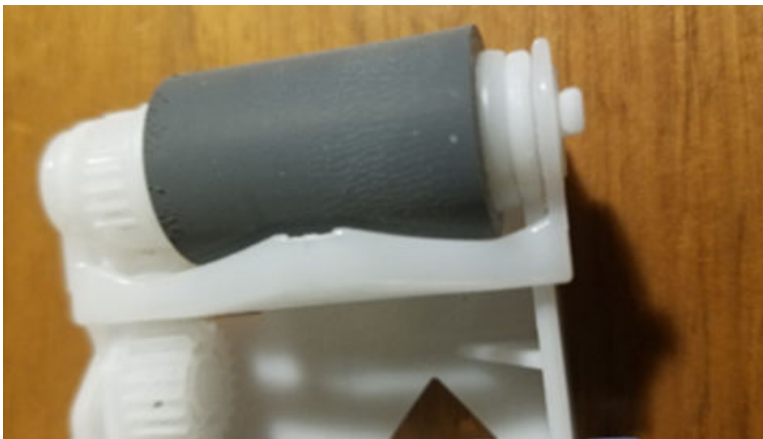


Figure 7-28 New roller surface

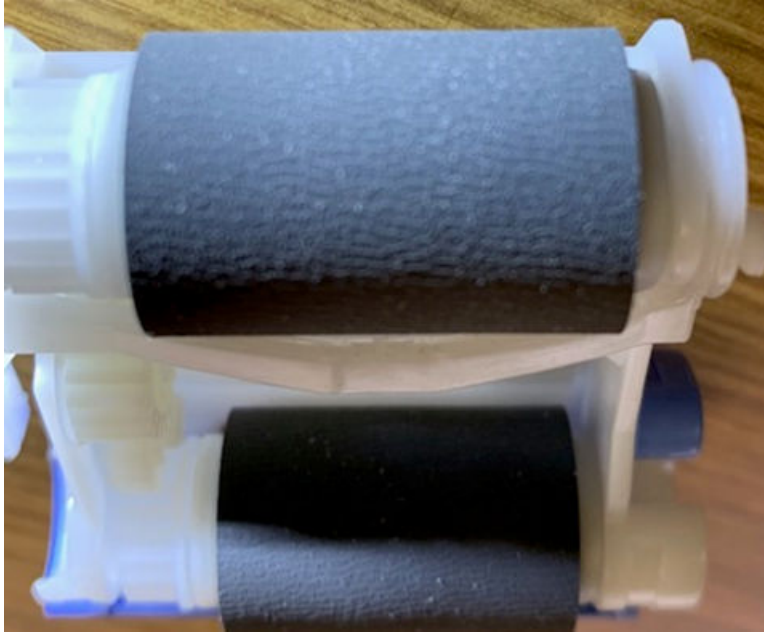

11. Reinstall tray 2.

Type mismatch Tray <x>

The specified tray contains a paper type that does not match the configured type.

Recommended action

Follow these troubleshooting steps in the order presented.

The specified tray will not be used until this condition is addressed. Printing can continue from other trays.

1. Load the correct paper in the specified tray.
2. On the printer control panel, make sure the paper type loaded in the tray matches the specified setting for the tray.

The unit has corrupt data

Data corruption has occurred in the firmware volume.

- 98.00.01 : Corrupt data in the firmware volume
- 98.00.02 : Corrupt data in the solutions volume
- 98.00.03 : Corrupt data in the configuration volume
- 98.00.04 : Corrupt data in the job data volume

Recommended action for 98.00.01, 98.00.02, and 98.00.03

Follow these troubleshooting steps in the order presented.

For 98.00.01 , 98.00.02 , and 98.00.03 , perform the following steps:

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - *Or click here: [HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives](#).*

3. Reload the firmware.

Recommended action for 98.00.04

Follow these troubleshooting steps in the order presented.

For **98.00.04**, perform the following steps:

1. Turn the printer off, and then on.
2. Run the file erase function.

For the steps to perform this procedure, go to WISE and search for the following document: HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure (c03398779).

Or click on the following link: [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#)

Unsupported drive installed To continue, touch “OK”

A non-supported hard disk drive has been installed. The hard disk drive is unusable by this printer.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the hard drive.
3. Turn the printer on.

Unsupported supply in use OR Unsupported supply installed To continue, touch “OK”

The printer has one or more HP genuine supplies, designed for a different printer, in use.

- **10.00.41** (event code): Toner cartridge

Recommended action

- Install the correct supplies for this printer. See the parts chapter in the service manual for supply part numbers.

Unsupported tray configuration

The printer has too many optional trays installed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn the printer off, remove the unsupported trays, and then turn the printer on.

Unsupported USB accessory detected Remove USB accessory

A non-supported USB accessory has been installed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn the printer off, remove the USB accessory, and then turn the printer on.

USB accessory not functional

A parameter in the USB accessory is not correctly functioning.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the USB accessory.
3. Insert a replacement USB accessory.
4. Turn the printer on.

USB hubs are not fully supported Some operations may not work properly

Some USB hubs require more power than the printer has available.

Recommended action

Follow these troubleshooting steps in the order presented.

- Remove the USB hub.

USB is write protected To clear press “OK”

The device is protected and no new files can be written to it.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

USB needs too much power Remove USB and then turn off and on

A USB accessory is drawing too much electrical current. Printing cannot continue.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, remove the USB accessory, and then turn the printer on.
2. Use a USB accessory that uses less power or that contains its own power supply.

USB not initialized

The USB device file system must be initialized before it can be used.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Enable the USB port using the following steps:
 - **FutureSmart 3:**
 - a. From the Home screen on the printer control panel, open the following menus:
 - i. Administration
 - ii. General Settings
 - b. Select **Enable Device USB**.
 - c. Select **Enabled**, and then select **Save**.
 - d. Touch the Back button  to return to the **General Settings** menu.
 - **FutureSmart 4:**
 - a. From the Home screen on the printer control panel, select **Settings**.
 - b. Select **Copy/Print**.
 - c. Select **Enable Device USB**, and then select **Enabled**.
 - d. Touch the Back button  to return to the **Settings** menu.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

USB storage accessory removed Clearing any associated data

This message displays for about 6 seconds after a USB device is removed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to remove this message.

USB storage device failure To clear press “OK”

The specified device failed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

USB storage file operation failed To clear press “OK”

A PJJL file system command was received that attempted to perform an illegal operation, such as downloading a file to a nonexistent directory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

USB storage file system is full To clear press “OK”

The file system on the installed USB device is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

Used supply installed To continue, touch “OK” OR Used supply in use Description

The toner cartridges or supplies has been previously used.

Recommended action

- If you believe you purchased a genuine HP supply, go to www.hp.com/go/anticounterfeit.

Verifying, Please Wait

This message displays when the printer is retrieving a print job from device memory, but can cause the printer control panel to lock up.

The user enter the **Retrieve from Device Memory** menu to print a job. After selecting the desired print jobs, **Verifying, Please Wait** displays on the control panel. The status bar will move for a moment, and then lock up. Typically, if the user waits a few minutes, the error will clear and the job will print.

In rare cases, the message will lock up permanently and force the user to power cycle the printer.

The event log might show the following errors as a result of power cycling the printer during lockup:

- 48.05.05
- 98.03.11

Recommended action

1. Turn the printer off and then on again.
2. Make sure the firmware is the latest revision.

Waiting for tray <x> to lift

The specified tray is in the process of lifting paper to the top of the tray (so it can correctly feed).

Recommended action

See recommended action.

- No action necessary.

Index

Symbols/Numerics

49.38.07 250, 251
76.00.24 5

B

backup error
 32.WX.YZ error 4
 reset error 4
 restore error 4

C

connector error
 65.WX.YZ error 5

D

DC controller communication error
 55.WX.YZ error 5
DC controller firmware error
 70.WX.YZ error 5
digital sending error (firmware)
 44.WX.YZ error 4
document feeder error
 31.WX.YZ error 4
Drive partition error
 98.WX.YZ error 5
duplexer error
 69.WX.YZ error 5

E

Embedded Jetdirect error
 80.WX.YZ error 5
engine error (LaserJet)
 46.WX.YZ error 5
 63.WX.YZ error 5
engine error (PageWide)
 61.WX.YZ error 5
event log error (firmware)
 42.WX.YZ error 4

F

fan error
 58.WX.YZ error 5
firmware communication error
 49.WX.YZ error 5
firmware install error
 99.WX.YZ error 6
 Drive error 6
 remote firmware upgrade error 6
fuser error
 41.WX.YZ error 4
 laser scanner error 4
 paper path error 4
fuser error (LaserJet)
 50.WX.YZ error 5

I

input accessory error
 67.WX.YZ error 5
input/output error
 40.WX.YZ error 4
internal diagnostics error
 90.WX.YZ error 5
video display error 5

J

jam error (LaserJet)
 13.WX.YZ error 4
jam error (PageWide)
 13.WX.YZ error 4
job accounting error (firmware)
 48.WX.YZ error 5
 job management error
 (firmware) 5
 job pipeline error (firmware) 5
job parser error (firmware)
 47.WX.YZ error 5
printer calibration error 5

L

laser scanner error (LaserJet)
 51.WX.YZ error 5
 52.WX.YZ error 5
last update 1

M

memory error
 82.WX.YZ error 5
 Drive error 5
 EMMC error 5
 SSD error 5
motor error (LaserJet)
 59.WX.YZ error 5

N

Near Field Communication error
 81.WX.YZ error 5
 Bluetooth error 5
 external I/O card error 5
 internal EIO error 5
 wireless error 5

O

output accessory error
 66.WX.YZ error 5
OXPD/Web kit error
 45.WX.YZ error 5

P

page error
 21.WX.YZ error 4
paper handling error (LaserJet)
 56.WX.YZ error 5
print bar error (PageWide)
 62.WX.YZ error 5
printer memory error
 20.WX.YZ error 4

R

real-time clock error
11.WX.YZ error 4

S

scanner error
30.WX.YZ error 4
security error
33.WX.YZ error 4
sensor error
54.WX.YZ error 5
58.WX.YZ error 5
supplies error (LaserJet)
10.WX.YZ error 4
supplies error (PageWide)
17.WX.YZ error 4
system error (LaserJet)
62.WX.YZ error 5

T

tray motor error (LaserJet)
60.WX.YZ error 5