



HP LaserJet Pro M501


HP LaserJet Enterprise M506, M507

HP LaserJet Enterprise MFP M527, M528

HP LaserJet Managed E50145, MFP E52645

HP LaserJet Managed E50045, MFP E52545

Control Panel Message Document (CPMD)

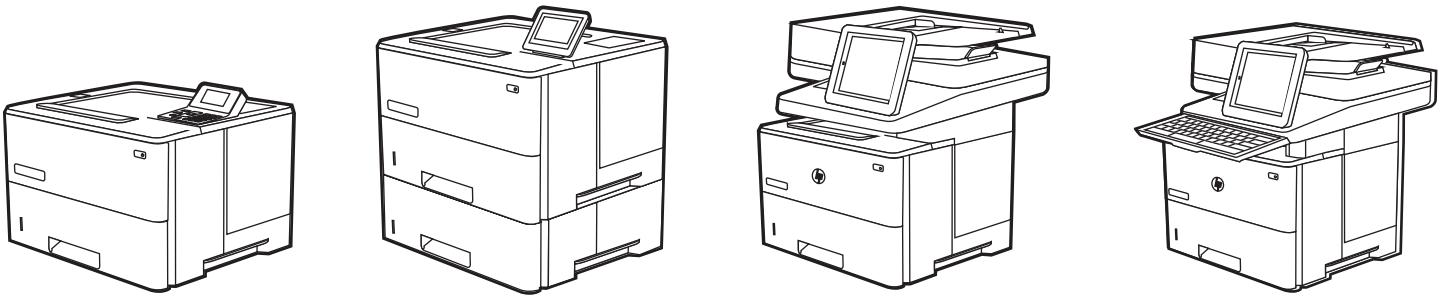

www.hp.com/support/ljM501

www.hp.com/support/ljM506

www.hp.com/support/ljM507

www.hp.com/support/ljM527mfp

www.hp.com/support/ljM528mfp

www.hp.com/support/ljE50045

www.hp.com/support/ljE50145

www.hp.com/support/ljE52545mfp

www.hp.com/support/ljE52645mfp



HP LaserJet Enterprise M506, M507, MFP M527, MFP M528, Pro M501, Managed E50045, E50145, MFP E52545, MFP E52645 - Control Panel Message Document (CPMD)

SUMMARY

This document provides error-code troubleshooting information

Legal information

Copyright and License

© Copyright 2022 HP Development Company, L.P.

Reproduction, adaptation, or translation without prior written permission is prohibited, except as allowed under the copyright laws.

The information contained herein is subject to change without notice.

The only warranties for HP products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. HP shall not be liable for technical or editorial errors or omissions contained herein.

Edition 2, 2/2025

Trademark Credits

Adobe®, Adobe Photoshop®, Acrobat®, and PostScript® are trademarks of Adobe Systems Incorporated.

Apple and the Apple logo are trademarks of Apple Inc., registered in the U.S. and other countries.

macOS is a trademark of Apple Inc., registered in the U.S. and other countries.

AirPrint is a trademark of Apple Inc., registered in the U.S. and other countries.

Google™ is a trademark of Google Inc.

Microsoft®, Windows®, and Windows Server® are U.S. registered trademarks of Microsoft Corporation.

UNIX® is a registered trademark of The Open Group.

Table of contents

1 Document last updated	1
2 About this document	2
3 Control-panel message types	3
Error-code and control-panel-message troubleshooting overview	3
Error codes (types and structure)	3
4 How to search for printer documentation	6
WISE - How to access and use	6
Accessing WISE	6
Using WISE to search for error codes	10
Using WISE to access repair and replace videos for FRUs	12
5 Printer service information	17
6 Numerical control panel messages	18
10.XX.YZ error messages	18
10.wx.yz error messages	18
10.00.00 or 10.00.01 e-Label Memory Error	19
10.00.10 e-Label Missing Memory Error	22
10.00.11, 10.00.12 Supply Memory Error	23
10.00.15 Install <supply>	24
10.00.33 Used Supply In Use	24
10.00.34 Used supply in use	24
10.00.35 Incompatible supply in use	25
10.00.40 Genuine HP supplies installed	25
10.00.41 Unsupported Supply in Use	25
10.00.59	25
10.00.60 Black cartridge low	26
10.00.69 Black cartridge very low	26
10.00.70 Printing past very low	26
10.00.91 Cartridge motor stall	26
10.23.15 Install <supply>	27
10.23.35 Incompatible <supply>	27
11.XX.YZ error messages	28
11.* errors	28
11.00.01 or 11.00.02 Internal clock error	28
13.XX.YZ error messages	30
13.* errors	30
13.00.00	37
13.00.EE	38
13.A2.D2	38
13.Ax.Dz	41

13.A2.FF	44
13.A3.FF	47
13.A5.FF	50
13.B2.Az Jam in top cover	53
13.B2.D1 Jam in top cover	56
13.B2.Dz Jam in top cover	57
13.B2.E2 Jam in top cover	67
13.B2.FF Jam in top cover	68
13.B9.Az Fuser jam	68
13.B9.Bz Fuser Jam.....	72
13.B9.Cz	75
13.B9.Dz	78
13.B9.FF	82
13.D3.yz	84
13.D3.FF	85
13.E5.FF	88
13.EA.FF	88
13.FF.EE	88
13.EE.FF	88
13.FF.FF.....	88
20.XX.YZ error messages.....	89
20.* errors.....	89
20.00.00 Insufficient memory <device>	89
21.XX.YZ error messages.....	90
21.00.00 Page Too ComplexEvent log error message 21.00.00	90
30.XX.YZ error messages.....	90
30.* errors.....	90
30.01.01.....	90
30.01.08 Home position error	95
30.01.14 Scan system EEPROM error	101
30.01.36 Upgrade error	103
30.01.41 Scanner error	105
30.01.43 Scanner memory failure	107
30.01.44 Scanner error.....	109
30.01.45 Scanner Error.....	112
30.01.46 Scanner Error	114
30.03.14	117
30.03.20.....	117
30.03.22 Scanner failure.....	120
30.03.23 Scanner failure.....	120
30.03.30 Scanner Failure	121
30.03.45 Scanner Error To continue turn off then on	122
31.XX.YZ error messages.....	125
31.* errors.....	125
31.01.47 Document feeder not detected.....	125
31.03.14	126
31.03.20 backside scanner not detected.....	127
31.03.22 Scanner calibration failure.....	129

31.03.30 Document feeder pick motor error	129
31.03.31 Document feeder motor stall	130
31.03.32	131
31.03.33 Backside scanner calibration area dirty.....	131
31.03.34 Background missing	132
31.13.00 Document feeder multi-pick error	132
31.13.01	151
31.13.02	170
31.13.13.....	189
31.13.14.....	190
32.XX.YZ error messages.....	209
32.* errors.....	209
32.08.A1, 32.08.A2, 32.08.A3	210
32.1C.05	210
32.1C.06 (event code).....	210
32.1C.07 (event code)	210
32.1C.08 (event code).....	211
32.1C.09 (event code).....	211
32.1C.0A (event code)	211
32.1C.0D (event code).....	211
32.1C.11 (event code)	212
32.1C.13, 32.1C.14	212
32.1C.15	212
32.1C.2E	212
32.1C.2F	212
32.1C.40	213
32.1C.41	213
32.1C.42	213
32.1C.43	213
32.1C.44	213
32.1C.45	213
32.1C.46	214
32.1C.47	214
32.1C.48	214
32.1C.49	214
32.1C.4A	214
32.1C.56	215
32.1C.57	215
32.1C.58	215
32.1C.60	215
32.1C.61	215
32.1C.62	216
32.1C.68	216
32.1C.69	216
32.1C.6A	216
32.1C.6D	216
33.XX.YZ error messages.....	217
33.* errors.....	217

33.01.xx	218
33.02.01 Used board/disk installed	219
33.02.02.....	220
33.03.02	220
33.03.03 Incompatible formatter installed	222
33.03.05 EFI Boot error	223
33.03.06.....	225
33.04.01 Missing TPM.....	226
33.04.02 Missing TPM	226
33.04.03 Unknown TPM	227
33.04.05.....	227
33.05.0X SureStart errors	228
33.05.0X SureStart errors	229
33.05.0z SureStart errors	229
33.05.1x Whitelisting errors	230
33.05.2x Intrusion detection errors	231
33.05.5z Intrusion detection errors	231
33.06.01.....	232
40.XX.YZ error messages.....	233
40.* errors.....	233
40.00.01 USB I/O buffer overflow To continue, touch "OK"	233
40.00.02 Embedded I/O buffer overflow To continue, touch "OK"	233
40.00.03 EIO [x] buffer overflow To continue, touch "OK"	234
40.00.04 EIO [x] bad transmission To continue, touch "OK"	234
40.00.05 Embedded I/O bad transmission To continue, touch OK	234
40.08.0x USB storage accessory removed	234
41.XX.YZ error messages.....	234
41.* errors.....	234
41.01.YZ.....	235
41.02.00 Error	238
41.03.01, 41.03.A1, 41.03.B1, 41.03.C1.....	239
41.03.02, 41.03.A2, 41.03.B2, 41.03.C2 Error	240
41.03.02 with slow printing.....	242
41.03.03, 41.03.A3, 41.03.B3, 41.03.C3 Error	248
41.03.04, 41.03.A4, 41.03.B4, 41.03.C4	250
41.03.05, 41.03.A5, 41.03.B5, 41.03.C5.....	252
41.03.0D, 41.03.AD, 41.03.BD, 41.03.CD.....	254
41.03.FZ Unknown Misprint Error	255
41.04.YZ Printer Error	256
41.05.YZ Unexpected type in tray <X>.....	259
41.XX.YZ Error To continue, touch "OK"	260
42.XX.YZ error messages.....	262
42.XX.YZ	262
42.B0.01 or 42.B0.02	263
44.XX.XX error messages - M527 only.....	264
44.* errors.....	264
44.01.xx Error Event log message	264
44.03.xx Error Event log message	265

44.10.xx Error Event log message (Multifunction product only).....	265
44.34.xx Error Event log message	265
44.34.03 Fax Modem Failure	266
44.34.E5 Fax Modem Failure	266
44.90.xx, 44.91.xx, 44.92.xx Error Event log message	267
47.XX.XX error messages.....	267
47.* errors	267
47.00.xx	268
47.01.xx	268
47.02.xx	269
47.03.xx	269
47.04.xx	270
47.05.xx	270
47.06.xx	271
48.XX.YY error messages	271
48.* errors.....	271
49.XX.YY error messages.....	272
49.XX.YY Error To continue turn off then on	272
49.2F.D8.....	273
49.38.07	274
49.38.0C	275
50.WX.YZ error messages	276
50.* errors.....	276
50.1X.YZ Fuser Error	276
50.2X.YZ Fuser Error	278
50.2F.00 Fuser Error.....	279
50.3X.YZ Fuser Error	283
50.4X.YZ Fuser Error	284
50.6X.YZ Fuser Error	285
50.7X.YZ Fuser Error.....	287
50.9X.YZ Fuser Error	287
51.XX.YZ, 52.XX.YZ error messages	292
51.* errors	292
51.00.10	292
52.* errors.....	293
52.XX.00	293
53.WX.YZ Error Messages	294
53.B0.0z.....	294
53.B1.0z	295
53.B2.0z	295
53.B3.0z	296
53.C1.0z Tray "Z" size mismatch.	296
54.XX.YZ error messages.....	297
54.* errors.....	297
54.06.21 error	298
55.XX.YZ, 56.XX.YZ error messages.....	299

55.* errors.....	299
55.00.yy To continue turn off then on.....	299
55.0x.yy to.continue.off.on.....	303
56.* errors.....	304
56.00.yy to.continue.off.on.....	304
57.XX.YZ error messages.....	306
57.* errors.....	306
57.00.01 to.continue.off.on.....	307
57.00.02 to.continue.off.on.....	308
58.XX.YZ error messages.....	308
58.* errors.....	308
58.00.03 Error.....	309
58.00.04 Error.....	313
58.01.04 Error.....	313
58.02.04 Error.....	314
59.XX.YZ error messages.....	315
59.* errors.....	315
59.A2.02.....	315
59.A2.0X.....	316
59.00.20 Error – To.continue.off.on.....	320
59.00.30 – To.continue.off.on.....	320
59.00.40 – To.continue.off.on.....	321
60.00.0Y, 62.00.00 error messages.....	322
60.00.0X Tray X lifting error.....	322
60.01.0X Tray X lifting error.....	326
62.00.00 To continue turn off then on.....	330
65.X0.AZ error messages.....	331
65.* errors.....	331
65.80.A0, 65.80.A1: Output accessory Failure.....	331
66.WX.YZ error messages.....	332
66.* errors.....	332
66.00.20.....	332
66.00.40.....	332
66.00.50.....	333
66.00.77.....	333
66.00.79.....	334
66.80.YY Stapler/Stacker failure.....	334
70.XX.YY error messages.....	337
70.* errors.....	337
70.00.00 Error To continue turn off then on.....	337
80.XX.YY, 81.XX.YY, 82.XX.YY error messages.....	339
80.* errors.....	339
80.0X.YY Embedded Jetdirect Error.....	342
81.09.00 Error.....	345
82.* errors.....	346
82.73.46, 82.73.47.....	348

98.OX.OY error messages	349
98.* errors.....	349
98.00.0C.....	349
98.00.00	352
98.00.00, 98.00.01, or 98.01.00 Corrupt data in firmware volume	354
98.00.02 Corrupt data in the solutions volume	354
98.00.03 Corrupt data in the configuration volume	356
98.00.04 Corrupt data in the job data volume	357
99.XX.YY error messages	357
99.* errors.....	357
99.00.01 Upgrade not performed file is corrupt	358
99.00.02 Upgrade not performed timeout during receive	358
99.00.03 Upgrade not performed error writing to disk	359
99.00.04 Upgrade not performed timeout during receive	360
99.00.05 Upgrade not performed timeout during receive	360
99.00.06 Upgrade not performed error reading upgrade	361
99.00.07 Upgrade not performed error reading upgrade	361
99.00.08 Upgrade not performed error reading upgrade	362
99.00.09 Upgrade canceled by user	363
99.00.10 Upgrade canceled by user	363
99.00.11 Upgrade canceled by user	363
99.00.12 Upgrade not performed the file is invalid	364
99.00.13 Upgrade not performed the file is invalid	364
99.00.14 Upgrade not performed the file is invalid	364
99.00.2x	365
99.01.xx	365
99.02.01	366
99.02.09	366
99.07.22 Firmware install error	366
99.09.60 Unsupported disk	369
99.09.61 Unsupported disk	369
99.09.62 Unknown disk	369
99.09.63 Incorrect disk	376
99.09.64 Disk malfunction	378
99.09.65 Disk data error	378
99.09.66 No boot device.....	378
99.09.67 Disk is not bootable please download firmware	379
99.39.64 eMMC Nonfunctional	380
99.39.67 eMMC Not Bootable	380
99.XX.YY	381

7 Alphabetical control panel messages.....382

Alphabetical messages	382
Accept bad signature	382
Bad optional tray connection	382
<binname> full Remove all paper from bin	382
Canceling	382
Canceling...<jobname>	383
Cartridge Low	383

Cartridge memory abnormal.....	383
Cartridge out	383
Checking engine	383
Checking paper path	384
Chosen personality not available To continue touch "OK"	384
Cleaning	384
Cleaning do not grab paper	384
Clearing event log	384
Clearing paper path	385
Close top cover	385
Cooling device	385
Creating cleaning page... ..	385
Data received To print last page press "OK"	386
Event log is empty	386
Expected drive missing	386
External device initializing	386
Face Down Tray Full.....	386
FIM Load Error Send full FIM on <X> port	393
Fuser Kit low	393
Fuser Kit very low To continue, touch "OK"	393
Genuine HP cartridge installed	394
Genuine HP supply installed	394
HP Secure hard drive disabled	394
Incompatible <supply>.....	394
Incompatible supplies.....	395
Initializing... ..	395
Install Black Cartridge.....	395
Install Fuser	395
Install supplies	396
Internal disk device failure To clear touch "OK"	396
Internal disk file operation failed	396
Internal disk file system is full	396
Internal disk is write protected	397
Internal disk not found	397
Internal disk not functional.....	397
Internal disk not initialized	398
Internal disk spinning up	398
Job not stapled due to mixed sizes	398
Load Tray <X>: [Type], [Size].....	398
Load Tray <X>: [Type], [Size] To use another tray, press "OK"	399
Loading program <XX> Do not power off	399
Manually feed: <Type><Size>	399
Manually feed: <Type><Size> To use another tray, press "OK"	399
Manually feed output stack Then touch "OK" to print second side	400
Moving solenoid.....	400
Moving solenoid and motor.....	400
No job to cancel	400
NON HP Supply Installed	400
Output Bin Full.....	401

Paused...	407
Performing Paper Path Test	407
Please Wait... ..	407
Printing Cleaning Page... ..	407
Printing Configuration... ..	408
Printing engine test... ..	408
Printing Event Log... ..	408
Printing File Directory... ..	408
Printing Font List... ..	408
Printing Help Page... ..	408
Printing Menu Map... ..	409
Printing Registration Page	409
Printing stopped... ..	409
Printing Supplies Status Page... ..	409
Printing Usage Page... ..	409
Processing... ..	410
Processing... copy <x> of <y>	410
Processing duplex job Do not grab paper until job completes	410
Processing job from tray <x>... Do not grab paper until job completes	410
Ready	410
RAM disk device failure To clear press "OK"	410
RAM disk file operation failed To clear press "OK"	411
RAM disk file system is full To clear press "OK"	411
RAM disk is write protected To clear press "OK"	411
RAM disk not initialized	411
Ready <IP Address>	411
Receiving Upgrade	412
Remove USB accessory	412
Replace <supply>.....	412
Replace supplies.....	412
Resend external accessory firmware	413
Resend Upgrade	413
Restore Factory Settings	413
ROM disk device failed To clear press "OK"	413
ROM disk file operation failed To clear press "OK"	414
ROM disk file system is full To clear press "OK"	414
ROM disk is write protected To clear press "OK"	414
ROM disk not initialized To clear press "OK"	414
Rotating Motor	414
Size Mismatch.....	415
Size mismatch in Tray <x>	415
Sleep mode on	415
Supplies low	415
Supply memory warning	416
Supply low	416
Supply very low OR Supplies very low.....	416
The unit has corrupt data	417
Tray <X> empty: [Type], [Size].....	417
Tray <X> lifting	420

Tray <X> open	420
Tray <X> overfilled	421
Type mismatch Tray <x>	421
Unsupported drive installed To continue, touch “OK”	421
Unsupported supply in use OR Unsupported supply installed To continue, touch “OK”	422
Unsupported tray configuration	422
Unsupported USB accessory detected Remove USB accessory	422
Upgrade Error	422
USB accessory not functional	422
USB hubs are not fully supported Some operations may not work properly	423
USB is write protected To clear press “OK”	423
USB needs too much power Remove USB and then turn off and on	423
USB not initialized	423
USB storage accessory removed Clearing any associated data	424
USB storage device failure To clear press “OK”	424
USB storage file operation failed To clear press “OK”	424
USB storage file system is full To clear press “OK”	424
Used supply installed To continue, touch “OK” OR Used supply in use.....	425
Waiting for tray <x> to lift	425
Windows Login Required to Use this Feature	425

Index.....	426
------------	-----

1 Document last updated

The following is the last time this document was updated:

Last update: February 27, 2025

2 About this document

This document provides error-code troubleshooting information.



IMPORTANT: Procedures and part numbers change. For current information, use the browser-based format.

Verify PDF is the most current before use. PDF part numbers must be verified with web-based error code information or parts look-up before parts are ordered.

Choose the format that best meets your needs.

Table 2-1 Content format types

Format	Document title example	Recommended use
Web-based	Go to: Product Detail page > Error Code Look-up	Quick access to individual web-based error code troubleshooting TIP: Save Product Detail page URL location in favorites
Web-Base	Go To: WISE default Search page > Enter [Product] and error code	- Access to individual web-based error code troubleshooting - Web-based: Most up-to-date information available
PDF	[Product] - Control Panel Message Document (CPMD) PDF	- Use when support portals are NOT accessible at time of service - Use when a printable document is needed NOTE: Always refer to the printer service manual for removal and replacement procedures NOTE: For current information, use the Web-based format.

3 Control-panel message types

The control-panel messages and event code entries indicate the current printer status or situations that might require action.



NOTE: Event log errors do not appear on the control-panel display. Open the event log to view or print the event log errors.

A control-panel message displays temporarily and might require you (or the applicable user) to acknowledge the message by touching the **OK** button to resume printing or by touching the **Stop** button to cancel the job.

With certain messages, the job might not finish printing, or the print quality might be affected. If the message is related to printing and the auto-continue feature is on, the printer will attempt to resume printing after the message has appeared for 10 seconds without acknowledgement.

For some messages, restarting the printer might fix the problem. If a critical error persists, the printer might require service.

Error-code and control-panel-message troubleshooting overview

This section provides information on error codes and searching for information.

Error codes (types and structure)

Error codes and control-panel messages display on the printer control panel to indicate the current printer status or situations that might require action. Error codes are numerical, or alphanumerical, and have a set structure with six characters (example: 13.WX.YZ).

- The first two characters are numeric and represent the system component that is causing the error. For example, in error code 10 . 22 . 15, **10** = **Supplies** for HP LaserJets.
- The remaining four characters (W, X, Y, and Z values) further define the error.

HP LaserJet and HP PageWide Enterprise error codes are documented in the control panel message document (CPMD) for each printer.

The CPMD is a comprehensive list of error codes, diagnostic and troubleshooting steps to clear or resolve the error, and other helpful information such as service mode pins and part numbers.

The CPMD is continually updated and republished with the latest information for the following error codes.

Table 3-1 ERROR CODES: The first two characters

Error code	System Component	System Error Description
10.WX.YZ	Supplies (LaserJet)	Supply error or supply memory error.
11.WX.YZ	Real-time clock	Internal error with the clock on the formatter.
13.WX.YZ	Jam (LaserJet)	Paper jam or open door jam error.

Table 3-1 ERROR CODES: The first two characters (continued)

Error code	System Component	System Error Description
15.WX.YZ	Jam (PageWide)	Paper jam or open door jam error.
17.WX.YZ	Supplies (PageWide)	Supply error or supply memory error.
20.WX.YZ	Printer memory	Insufficient memory or buffering error.
21.WX.YZ	Page	Page complexity causing a decompression error when trying to process job.
30.WX.YZ	Scanner	Flatbed scanner error occurring inside the unit.
31.WX.YZ	Document feeder	Document feeder, scanner, or jam error.
32.WX.YZ	Backup, restore, or reset	Backup, restore, or reset notification or error.
33.WX.YZ	Security	Backup, Disk, EFI BIOS, Firmware integrity (SureStart), or Trusted Platform Module (TPM) notification or error.
40.WX.YZ	Input/Output (I/O)	Partition manager, secure erase, or USB accessory error.
41.WX.YZ	Fuser, Laser scanner, or Paper path	Miscellaneous error including general and misprint or mismatch errors typically involving (but not limited to) the fuser, the laser scanner, or the paper path.
42.WX.YZ	Firmware	Firmware failure involving the Event Log, Shell, System Manager, or other component.
44.WX.YZ	Firmware	Firmware failure involving a digital sending component.
45.WX.YZ	OXPd/Web Kit (PageWide)	Informational notifications involving the OXPd Web Kit (communications log).
46.WX.YZ	Engine (LaserJet)	Engine communication error.
47.WX.YZ	Firmware	Job parser or printer calibration error.
48.WX.YZ	Firmware	PJA job accounting, job management, or job pipeline error.
49.WX.YZ	Firmware	Firmware communication error.
50.WX.YZ	Fuser (LaserJet)	Fuser error.
51.WX.YZ	Laser scanner (LaserJet)	Laser scanner beam error.
52.WX.YZ	Laser scanner (LaserJet)	Laser scanner startup error.
54.WX.YZ	Sensor	Sensor error (not jam related).
55.WX.YZ	DC controller (LaserJet)	DC controller communication error.
56.WX.YZ	Paper handling (LaserJet)	Paper input/output or accessory error.
57.WX.YZ	Fan	Fan error.
58.WX.YZ	Sensor	Engine sensor failure.
59.WX.YZ	Motor (LaserJet)	Motor error.
60.WX.YZ	Tray motor error (LaserJet)	Tray lifting or pick up error.
61.WX.YZ	Engine (PageWide)	Print engine error with the 8-bit data package.

Table 3-1 ERROR CODES: The first two characters (continued)

Error code	System Component	System Error Description
62.WX.YZ	System (LaserJet)	LaserJet internal system error.
	Print bar (PageWide)	PageWide print system error.
63.WX.YZ	Engine (LaserJet)	General engine error (electrical, communication, etc.).
65.WX.YZ	Connector	Output accessory connection error.
66.WX.YZ	Output accessory	Output accessory error.
67.WX.YZ	Input accessory	Input accessory connection error
69.WX.YZ	Duplexer	Duplexer error.
70.WX.YZ	DC controller (LaserJet)	DC controller firmware error.
76.WX.YZ	DC controller (LaserJet)	Power supply fluctuations causes formatter and DC controller communication issue and results them not to be in synchronization.
80.WX.YZ	Managed device	Embedded Jetdirect error.
81.WX.YZ	Near Field Communication (NFC)	Wireless, Bluetooth or internal EIO error.
82.WX.YZ	Memory (SSD, HDD, EMMC, etc.)	Disk hardware error.
90.WX.YZ	Internal diagnostics	Internal test of systems (i.e. disk, CPB, display) or interconnection error.
98.WX.YZ	SSD or HDD	SSD or Hard disk partition error.
99.WX.YZ	Firmware installer	Remote Firmware Upgrade (RFU), firmware install (engine or accessory), or disk error.

4 How to search for printer documentation

The CPMD, error codes, and other support documentation for each printer is available on the HP portals.

For HP internal access to WISE, go to [WISE](#).

For HP channel partners access WISE, see [Accessing WISE for HP channel partners \(HP Partner Portal\) on page 6](#) or [Accessing WISE for HP channel partners \(CSDP\)](#).

WISE is available to call agents, service technicians, and HP internal users. The level of detail available depends on your access credentials. To learn how to find support content in WISE, [watch the video here](#).

WISE - How to access and use

Learn how to access and use Web-based Interactive Search Engines (WISE) to locate available support information. WISE is a repository of technical support documentation including service manuals, user guides, videos, and general support information.

Accessing WISE

Learn how to access Web-based Interactive Search Engines (WISE) if you are an HP channel partner or an internal HP user.

Accessing WISE for HP channel partners (HP Partner Portal)


Learn how to access WISE by accessing the HP Partner Portal if you are an HP Channel Partner.

 **NOTE:** If this is your first visit to the HP Partner Portal, you will be asked to create an account. Follow the setup directions using your HP Partner credentials.

 [View a video of how to access WISE for HP channel partners](#)


1. Sign-in to the HP Partner Portal (click <https://partner.hp.com> to access the sign-in page).

Figure 4-1 HP Partner Portal sign-in page

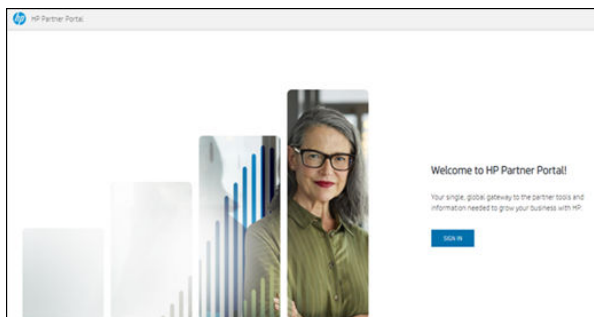


2. On the HP Partner Portal home page, click the **Services & Support** item.

Figure 4-2 HP Partner Portal home page

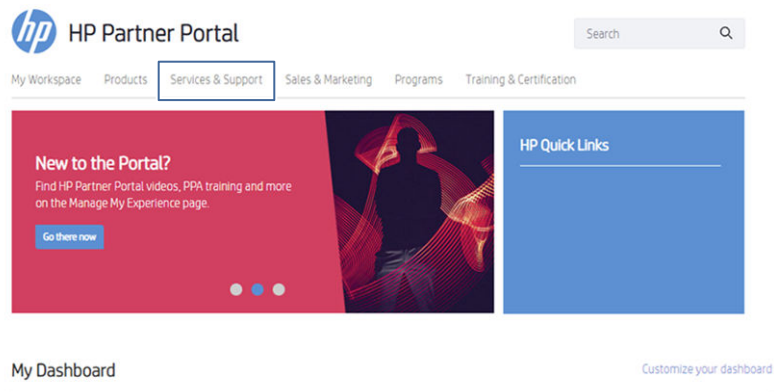


3. Select the **Technical Support (WISE)** item.

Figure 4-3 HP Partner Portal Service & Support page

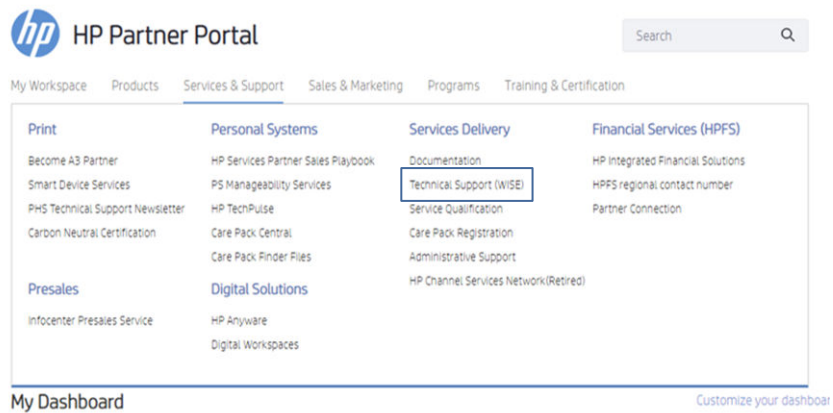


4. Select the **Technical Documentation** item.

Figure 4-4 HP Partner Portal Technical Support (WISE)page

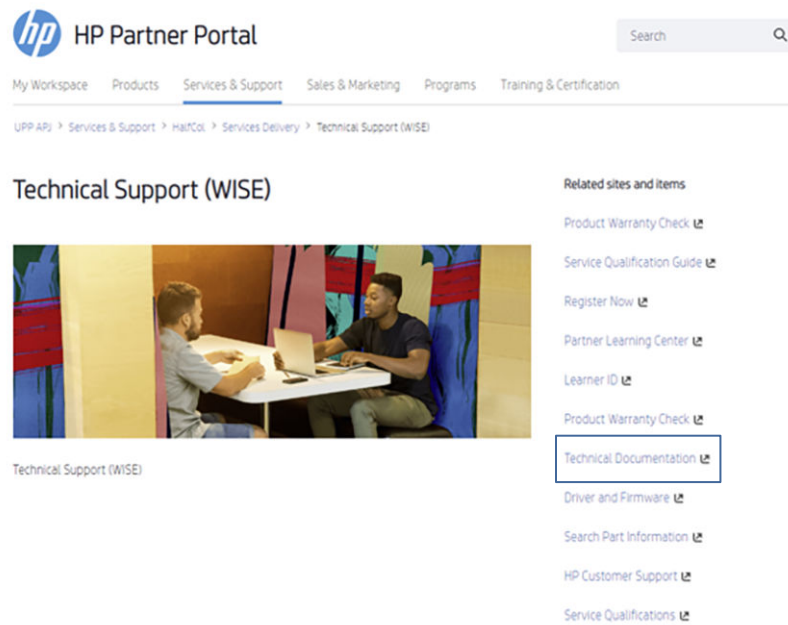

5. Use the WISE portal to search for printer information.

Figure 4-5 WISE portal home page

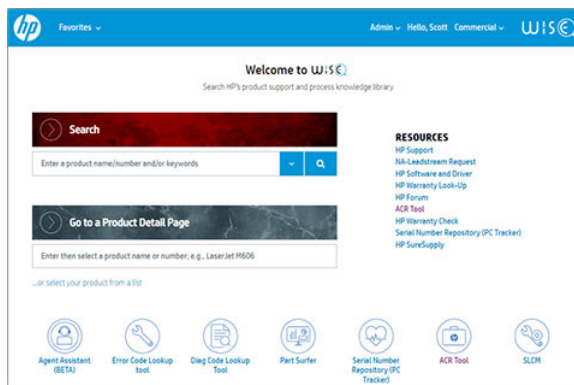

Accessing WISE for internal HP users

Learn how to access WISE if you are an internal HP user.

1. Open one of the Web-based Interactive Search Engines (WISE) URLs listed below.

Americas (AMS)

- [WISE - English](#)
- [WISE - Spanish](#)
- [WISE - Portuguese](#)
- [WISE - French](#)

Asia Pacific / Japan (APJ)


- [WISE - English](#)
- [WISE - Japanese](#)
- [WISE - Korean](#)
- [WISE - Chinese \(simplified\)](#)
- [WISE - Chinese \(traditional\)](#)
- [WISE - Thai](#)

Europe / Middle East / Africa (EMEA)


- [WISE - English](#)

2. Select **Commercial** from the drop-down menu.

Figure 4-6 Choose an experience

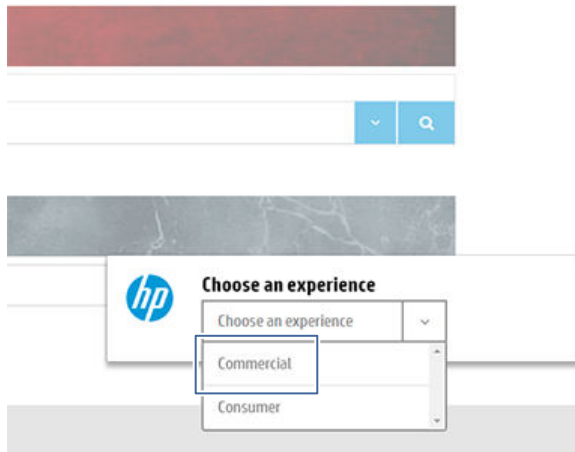

3. The WISE home page appears.

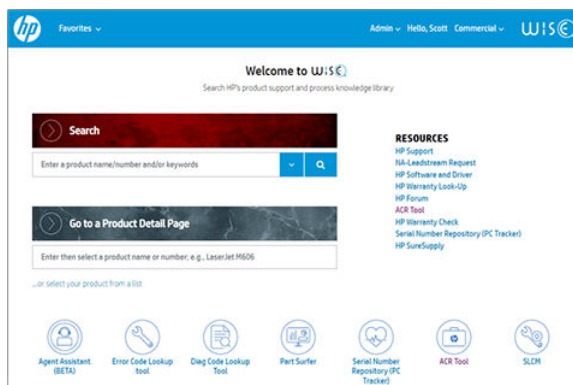

Play the video:



[View a video of how access WISE \(internal HP users\)](#)

Using WISE to search for error codes

Learn how to use WISE to look up error codes.



NOTE: The model used in the instructional videos is an example. The same steps apply to all printer models.

You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).

Search for error codes using the lookup widget

Learn how to search for a specific error code using the WISE Error Code Lookup widget.

1. Enter a printer model number (for example, M606) in the **Go to a Product Detail page** dialog box.



TIP: To find a Product Detail Page (PDP) from a list of products by product type, select the **...or select your product from a list** item just below the dialog box.

The screenshot shows the WISE search interface. At the top is a red 'Search' bar with a magnifying glass icon. Below it is a text input field with the placeholder 'Enter a product name/number and/or keywords' and a blue search button. Below the search bar is a dark blue 'Go to a Product Detail Page' dialog box. Inside the dialog box is a text input field with the placeholder 'Enter then select a product name or number; e.g., LaserJet M606'. Below the input field is a link that says '...or select your product from a list'.

2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.



NOTE: Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

The screenshot shows the 'Go to a Product Detail Page' dialog box with a drop-down list. The input field contains 'M606'. The drop-down list is open, showing several options. The first option, 'HP LaserJet Enterprise M606 series', is circled in blue. Below it are several other options: 'E6B73AR', 'E6B72A', 'E6B73V', 'E6B73A', and 'E6B72V'.

3. Type the error code (for example, 13.E1.D3) in the **Error Code Lookup** field, and then select the search icon.

Error Code Lookup

Enter a specific error code in the field below, e.g. 13.b7 d7

1 2

Other Content

- Advisories (0)
- Bulletins (21)
- Guides, Manuals, etc. (76)
- Notices (1)
- Product Change Not... (0)
- Software-Drivers-F...
- Top Issues (7)
- Videos (127)

4. The error code troubleshooting content displays in the **All Search Results** area.

All Search Results

13.E1.D3 Fuser Area Jam
Last Modified Date: "2022/03/11"

Click on the article to see the full content.

Recommended action for customers

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size...

13.* errors
Last Modified Date: "2022/11/30"

Click on the article to see the full content.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open....

HP LaserJet Enterprise M607, M608, M608nk, M609, M610, M611, M612, HP LaserJet Managed E60055-E60075, E60155-E60175 printers - Control Panel Messages Document (CPMD)
Last Modified Date: "2022/11/22"

Play the video:



[View a video of how to search for error codes using the Product Detail Page \(PDP\) or the Error Code Lookup tool.](#)

Search for error codes from the WISE home page

Learn how to search for a specific error code from the WISE home page.

1. On the WISE home page, enter a printer model number (for example, M606) in the **Search** dialog box.

Search

Enter a product name/number and/or keywords

Go to a Product Detail Page


Enter then select a product name or number; e.g., LaserJet M606

...or select your product from a list

2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.




NOTE: Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

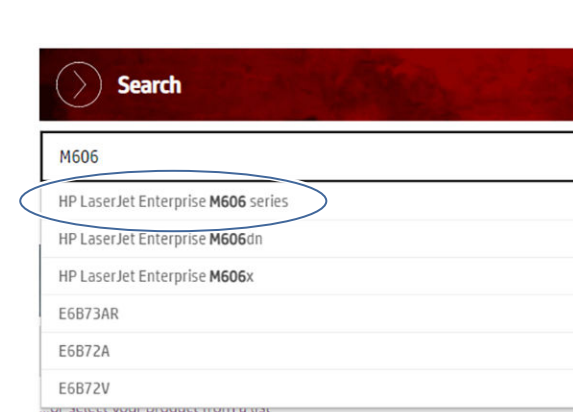

3. Type the error code (for example, 13.E1.D3) in the **Search** keyword field, and then select the search icon.



4. The error code troubleshooting content displays in the **All Search Results** area.

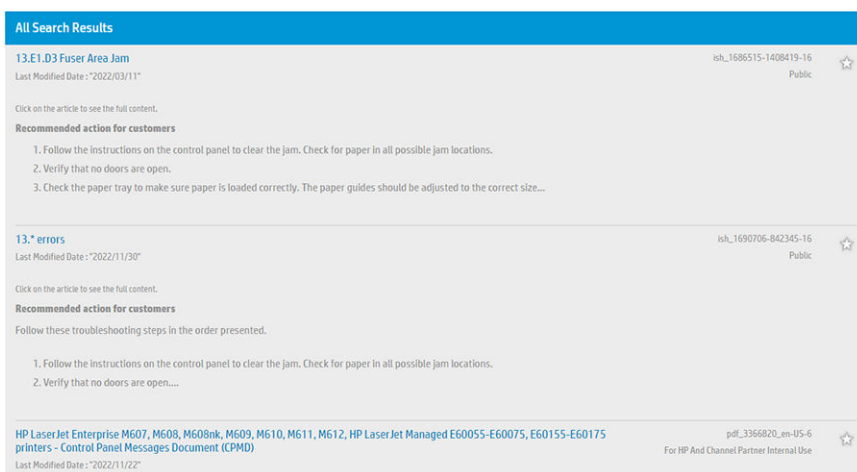

Using WISE to access repair and replace videos for FRUs

Learn how to use WISE to access repair and replace videos for FRUs.



NOTE: The model used in the instructional videos is an example. The same steps apply to all printer models.


You will need the printer type (e.g. HP LaserJet), model number (e.g. M607), and bundle option (e.g. dn, dh, z).

Search for videos using the Product Detail Page (PDP)

Learn how to search WISE for product specific information. Quickly review the steps and then play the video.


1. Enter a printer model number (for example, M606) in the **Go to a Product Detail page** dialog box.

 **TIP:** To find a Product Detail Page (PDP) from a list of products by product type, select the **...or select your product from a list** item just below the dialog box.

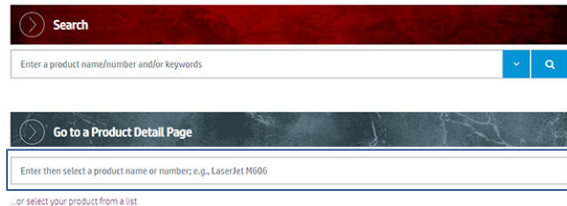


2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.

 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

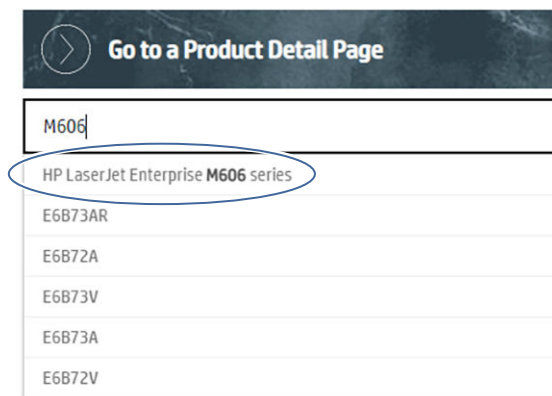


3. Select the link to **Videos** in the **Other Content** menu at the bottom-right of the screen.

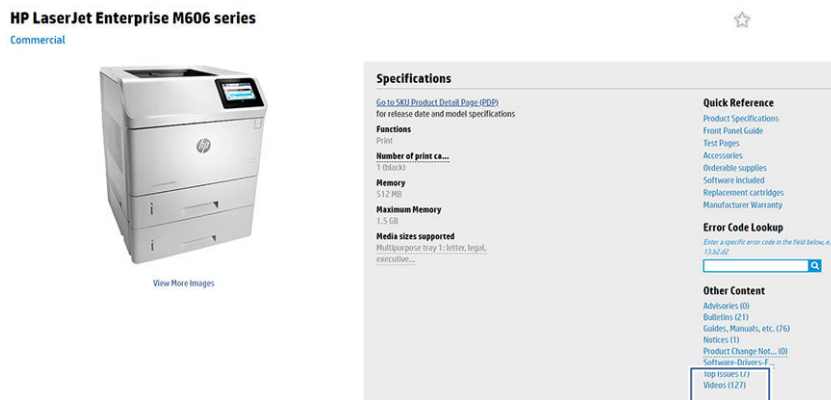

4. Select the desired video from the list of videos.



TIP: Select the **Add Or Remove Hardware & Customer Self Repair** filter under **Troubleshooting** to limit the search results to repair and replace videos.

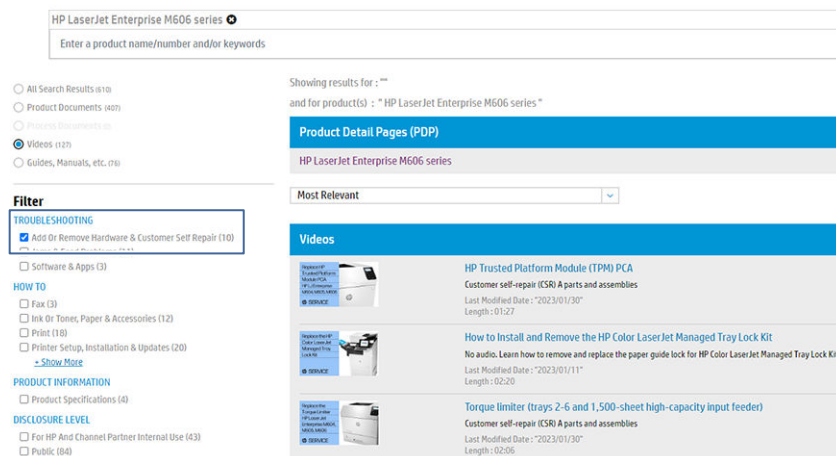

Play the video:




[View a video of how to search for the printer's Product Detail Page \(PDP\)](#)

Search for videos using the WISE search function


Learn how to search WISE using the model number. Quickly review the steps and then play the video.

1. On the WISE home page, enter a printer model number (for example, M606) in the **Search** dialog box.

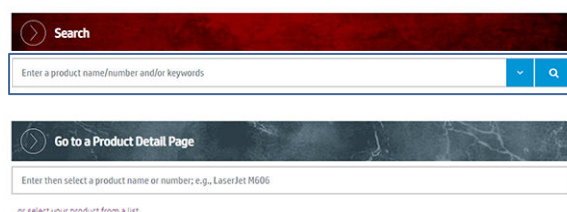


2. A drop-down list appears. Click on the full printer series name (for example, HP LaserJet Enterprise M606 series) in the list.


 **NOTE:** Selecting the **series** item from the drop-down list is recommended for the most accurate search return.

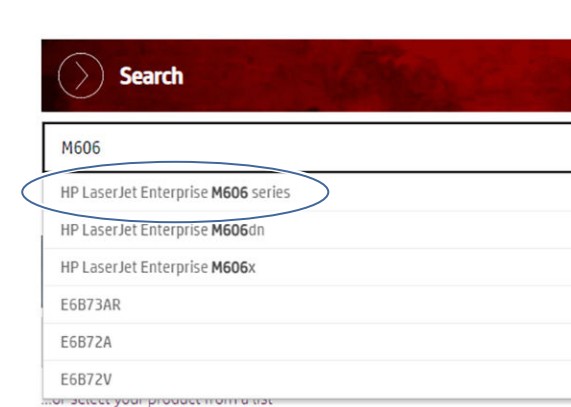

3. Select the search icon.

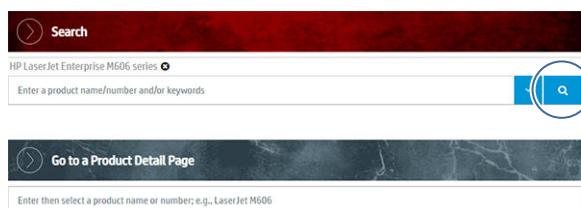

4. To refine the search results, select the radio button labeled **Videos** in the upper-right portion of the screen.

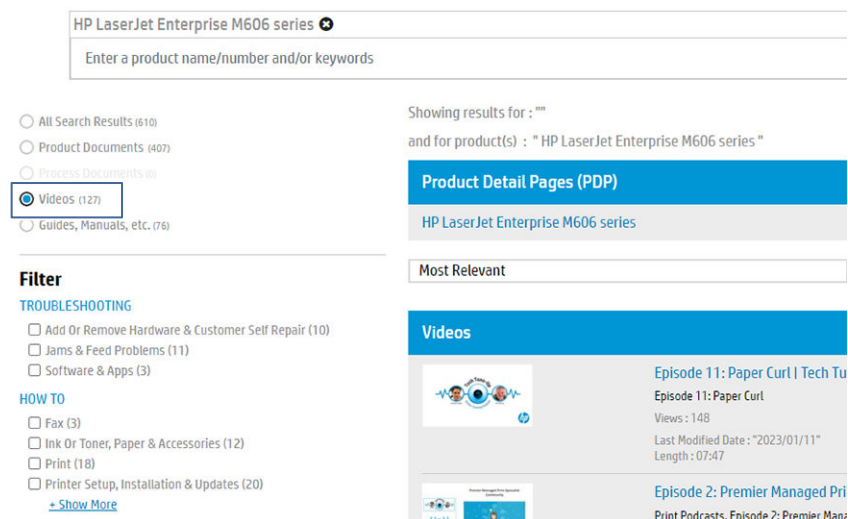

 **TIP:** To refine video search results, type a part name in the keyword search bar, and then select the search icon. For example, entering the word **fuser** to the keyword search bar returns videos related to repair and replacement of the fuser.

HP LaserJet Enterprise M606 series

Fuser

All Search Results (34)

Product Documents (28)

Process Documents (3)

Videos (2)

Guides, Manuals, etc. (4)

Filter

TRUBLESHOOTING

☐ Add Or Remove Hardware & Customer Self Repair (1)
 ☐ Jams & Feed Problems (1)

DISCLOSURE LEVEL

☐ Public (2)

Showing results for: "fuser" and for product(s) : "HP LaserJet Enterprise M606 series"

Product Detail Pages (PDP)

HP LaserJet Enterprise M606 series

Most Relevant

Videos

Paper Jams

HP LaserJet Enterprise M606 series

HOW TO

Clear paper jams in the fuser area

Clear paper jams

Last Modified Date : "2022/08/03"

Length : 01:51

Replace the Fuser

HP LaserJet Enterprise M606 series

Service

Fuser

No audio. Customer self-repair (CSR) A parts and assemblies.

Last Modified Date : "2022/08/03"

Length : 01:54

Play the video:

 [View a video of how to perform a model number search](#)

16 Chapter 4 How to search for printer documentation

5 Printer service information

Service pin for printer

Last update: February 27, 2025

Service mode PIN numbers:

- M506, E50045: 10050615



NOTE: When possible, always update the printer firmware to the latest available version at [HP.com](https://www.hp.com) as part of the troubleshooting performed for any of the following errors.

6 Numerical control panel messages

Use the following numerical error message troubleshooting to resolve your issue.

10.XX.YZ error messages

10.wx.yz error messages

Errors in the 10.* family are related to toner cartridges and other supply items that require regular replacement as part of routine printer maintenance.

Order replacement supplies and install them as necessary. To order parts, go to <https://www.hp.com/buy/parts>.

Use the following list to identify the supply item affected:



NOTE: Not all printers have all of these supplies.

- 10.00.XX = Black toner cartridge
- 10.01.XX = Cyan toner cartridge
- 10.02.XX = Magenta toner cartridge
- 10.03.XX = Yellow toner cartridge
- 10.10.XX = Transfer roller
- 10.22.XX = Transfer Belt
- 10.23.XX = Fuser kit
- 10.31.XX = Toner collection unit
- 10.39.XX = Document feeder kit
- 10.99.XX = One or more supply items have been installed

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

To order parts, go to <https://www.hp.com/buy/parts>.

1. For toner cartridges:
 - a. Remove and reinstall the cartridge.
 - b. Check the electronic chip on the cartridge if it is visible. If the chip is damaged, replace the toner cartridge.

- c. If print quality is unacceptable, or if printing cannot continue, replace the toner cartridge.
- 2. For the transfer kit:
 - a. Remove and then reinstall the transfer unit.
 - b. If print quality is unacceptable, or if printing cannot continue, replace the transfer kit.
- 3. For the fuser kit:
 - a. Remove and then reinstall the fuser.

 **CAUTION:** The fuser might be hot.

- b. If print quality is unacceptable, or if printing cannot continue, replace the fuser kit.
- 4. For the toner collection unit:
 - a. Remove the toner collection unit and reinstall it.
 - b. If the toner collection unit is nearly full, replace it with a new one. Using a toner collection unit until it is overfilled can damage the printer.
- 5. For the document feeder kit:
 - a. Open the document feeder top cover and inspect the rollers for obvious dirt or wear. Clean the rollers if necessary.
 - b. Install a new roller kit.

10.00.00 or 10.00.01 e-Label Memory Error

The printer is unable to read the cartridge data.

This message indicates that the printer cannot read or write to the e-label of the toner cartridge.

This error can cause the supplies status feature to be disabled.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Remove, and then reinstall the toner cartridge.
2. If the error reappears, turn the power off, and then on.
3. If the error persists, replace the toner cartridge.
4. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Remove, and then reinstall the toner cartridge.
2. If the error reoccurs, use the power button to turn off the printer, and then turn on the printer.
3. Check the toner cartridge memory chip. If it is damaged, replace the toner cartridge.

4. If the error persists and the toner cartridge has not been replaced, replace the toner cartridge.
5. If the error persists, replace the Memory PCA.

Table 6-1 Memory PCA part number

Printer models	Part description	Part number
M506	Memory PC board assembly	RM2-7955-000CN
M507		
M527		
M528		
E50045		
E50145		
E52545		
E52645		

6. If the error persists after replacing the Memory PCA, replace the High-voltage power supply (HVPS).

Table 6-2 High-voltage power supply (HVPS) assembly part number

Part description	Part number
High-voltage power supply (HVPS) assembly	RM2-7945-000CN

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.

1. Remove, and then reinstall the toner cartridge.
2. If the error reoccurs, use the power button to turn off the printer, and then turn on the printer.
3. Check the toner cartridge memory chip. If it is damaged, replace the toner cartridge.



NOTE: Make sure not to touch the imaging drum when checking the cartridge memory chip. Fingerprints on the imaging drum can cause print-quality problems.

Figure 6-1 Memory chip location

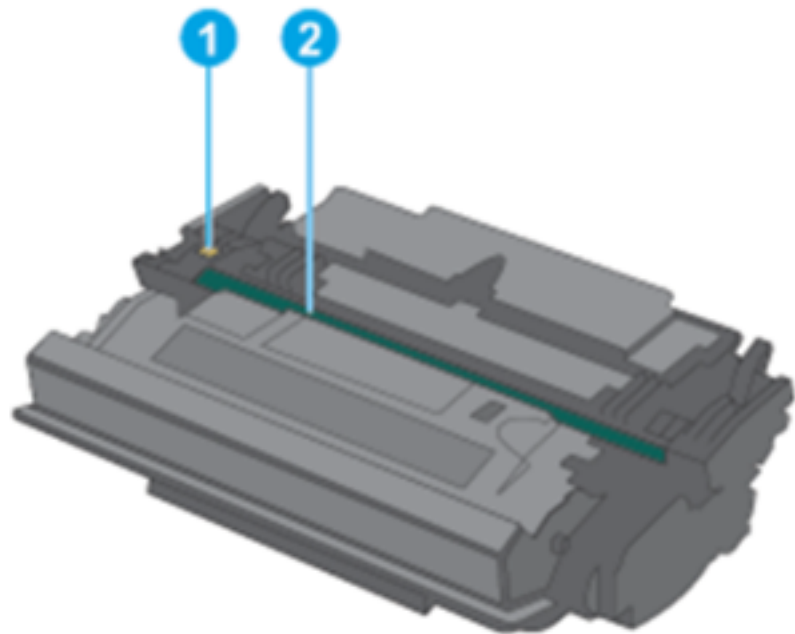

- 1. Memory chip
 - 2. Imaging drum
 - 4. If the error persists and the toner cartridge has not been replaced, replace the toner cartridge.
 - 5. If the error persists, check the e-label reader inside the unit.
 - 6. Check if the error persists, and then check whether the Memory PCA has been replaced.
- If the Memory PCA has not been replaced, replace the Memory PCA.

Table 6-3 Memory PCA part number

Printer models	Part description	Part number
M506	Memory PC board assembly	RM2-7955-000CN
M507		
M527		
M528		
E50045		
E50145		
E52545		
E52645		

- 7. If the error persists, disconnect and reconnect the connections between the DC controller and the HVPS.

Ensure that the cables are connected and seated correctly before replacing any part.

8. If the error persists, replace the HVPS.

Table 6-4 High-voltage power supply (HPVS) assembly part number

Part description	Part number
High-voltage power supply (HPVS) assembly	RM2-7945-000CN

For instructions: See the Repair Service Manual for this product.

9. If the error persists, replace the DC Controller.

Table 6-5 DC Controller part numbers

Printer models	Part description	Part number
M501dn/ M501n	DC controller PCA	RM2-8711-030CN
M506 M527 E52545	For duplex models - DC controller PC board assembly (PCA)	RM2-8612-000CN
M506 E50045	For simplex models - DC controller PC board (PCA)	RM2-8614-000CN
M507 M528 E52645	For duplex models - DC controller PC board assembly (PCA)	RM3-7475-010CN
M507 E50145	For simplex models - DC controller PC board assembly (PCA)	RM3-7476-000CN

For instructions: See the Repair Service Manual for this product.

10.00.10 e-Label Missing Memory Error

The printer is unable to detect the e-label.

This message indicates that the printer has determined that the e-label is missing.

This error can cause the supplies status feature to be disabled.

Recommended action

Follow these troubleshooting steps in the order presented.


1. Remove and then reinstall the indicated toner cartridge.
2. If the message displays again, turn the printer off and then on using the power button.
3. Check the cartridge memory tag. If it is damaged, replace the toner cartridge.
4. If the error persists, replace the indicated toner cartridge.

10.00.11, 10.00.12 Supply Memory Error

The printer is unable to read the toner cartridge e-label.

The **Supply Memory Error** can also display on the control panel of an HP LaserJet Enterprise or HP LaserJet Managed printer after performing a partial clean or cold reset three or four times in succession. This issue causes the following symptoms:

- The customer is unable to print with the existing toner cartridge.
- The toner cartridge cannot be used in another printer.

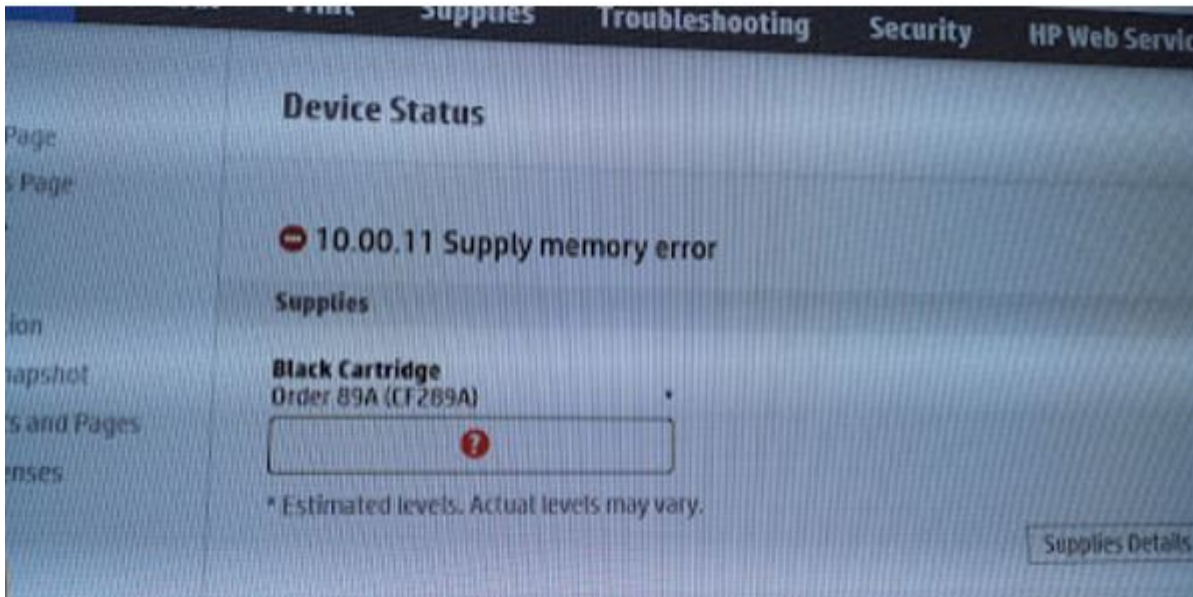

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Remove and the reinstall the indicated print cartridge.
2. If the message displays again, turn the printer off then on.
3. Ensure that a genuine HP toner cartridge is installed in the printer and the cartridge is under warranty.



NOTE: If you believe this is a genuine HP supply, go to www.hp.com/go/anticounterfeit.

4. Install a genuine HP Toner cartridge.
5. If the error persists, please contact customer support at: www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ensure that the printer has FutureSmart firmware version 4.10 or later.

2. Request the customer to limit a partial clean or cold reset and perform it only when required.



NOTE: Performing a partial clean or cold reset three to four times in succession will log in a 10.00.11 event code error and render the toner cartridge unusable.

3. Remove and ensure that a genuine HP toner cartridge is installed in the printer and the cartridge is under warranty.



NOTE: If this is not a genuine HP toner cartridge, inform the customer to install a genuine HP toner cartridge.

4. Install the toner cartridge and see if the error persists.
5. If the error persists, replace the customer's existing toner cartridge under warranty.

Table 6-6

Part description	Toner cartridge part number
HP 89A Black Original LaserJet Toner Cartridge	CF289A
HP 89X High Yield Black Original LaserJet Toner Cartridge	CF289X
HP 89Y Extra High Yield Black Original LaserJet Toner Cartridge	CF289Y
HP Black contract LaserJet Toner	CF289YC
HP Black Managed LaserJet Toner Cartridge	W9008MC

10.00.15 Install <supply>

The indicated supply has been removed or installed incorrectly.

10.00.15 (event code) Black Toner cartridge

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace or install the indicated supply.

10.00.33 Used Supply In Use

A used supply is installed in the printer (end of life).

10.00.33 (event code) Black toner cartridge

Recommended action

Follow these troubleshooting steps in the order presented.

- No action necessary.

If you believe this is a genuine HP supply, go to www.hp.com/go/antcounterfeit.

Using a cartridge that is near its end-of-life can cause this event code.

10.00.34 Used supply in use

The toner cartridge is used.

10.00.34 (event code) Black toner cartridge

Recommended action

Follow these troubleshooting steps in the order presented.

- If you believe this is a genuine HP supply, go to www.hp.com/go/anticounterfeit.



NOTE: Removing a cartridge from one printer and then installing it in a different printer (for testing functionality) will cause this event code.

10 . 00 . 35 Incompatible supply in use

An incompatible cartridge is in use.

10.00.35 (event code) Black toner cartridge

Recommended action

Follow these troubleshooting steps in the order presented.

- Install the correct HP print cartridge for this printer.



NOTE: The toner cartridge is not compatible with the printer.

10 . 00 . 40 Genuine HP supplies installed

A genuine HP print cartridge has been installed.

10.00.40 (event code) Black toner cartridge

Recommended action

There is no action needed for this message.

- No action necessary.

10 . 00 . 41 Unsupported Supply in Use

The installed toner cartridge is for a different printer.

10.00.41 (event code) Black toner cartridge

Recommended action

Follow these troubleshooting steps in the order presented.

- Remove the toner cartridge, and then install the correct cartridge for this printer.

10 . 00 . 59

Black cartridge has been replaced with non-new cartridge

This is an **Event Log Only** message.

Recommended action

There is no action needed for this message.

- No action necessary.

10 . 00 . 60 Black cartridge low

The black cartridge is low.

Recommended action

Follow these troubleshooting steps in the order presented.

- If print quality is no longer acceptable, replace the print cartridge.

 **TIP:** HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

10 . 00 . 69 Black cartridge very low

The black cartridge is very low.

Recommended action

Follow these troubleshooting steps in the order presented.

- If print quality is no longer acceptable, replace the print cartridge.

 **TIP:** Advise the customer that HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

10 . 00 . 70 Printing past very low

The printer indicates when a supply level is very low. The actual remaining toner cartridge life might vary.

You do not need to replace the toner cartridge at this time unless print quality is no longer acceptable. After an HP supply has reached the very low threshold, the HP premium protection warranty ends.

10.00.70 (event code) Black toner cartridge

Recommended action

Follow these troubleshooting steps in the order presented.

- If print quality is no longer acceptable, the customer must order and pay for a replacement toner cartridge.

Advise the customer that HP recommends that they have replacement supplies available to install when the print quality is no longer acceptable.

10 . 00 . 91 Cartridge motor stall

Cartridge motor stall.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the toner cartridge.

10.23.15 Install <supply>

The indicated supply has been removed or installed incorrectly.

10.23.15 (event code) Fuser kit

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents or onsite technicians

Follow these troubleshooting steps in the order presented.

- Replace or install the indicated supply.

Table 6-7 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

See the Repair Service Manual for this product.

10.23.35 Incompatible <supply>

The indicated supply is not compatible with this printer.

10.23.35 (event code) Fuser kit

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

- Install a supply that is designed for this printer.

Table 6-8 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

See the Repair Service Manual for this product.

 **CAUTION:** The fuser might be hot. Be careful when removing the fuser.

11.XX.YZ error messages

11.* errors

Errors in the 11.* family are related to the printer real-time clock.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Set the time and date on the printer control panel.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Set the time and date on the printer control panel.
2. If the error persists, remove and reinstall the formatter. Make sure it is fully seated.
3. If the error still persists, replace the formatter.

11.00.01 or 11.00.02 Internal clock error

The printer real time clock has experienced an error.

01=dead clock

02=dead real time clock

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Set the time and date on the printer control panel.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Make sure to set the time and date on the control panel whenever the printer is turned off and then turned on.
2. If the error persists, perform a [Partial Clean](#) using the Preboot menu or the Embedded Web Server (EWS).



NOTE: A Partial Clean erases all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system. It automatically reboots the printer and restores the firmware files from the repository.

3. If the error persists, try to update the firmware.
4. If the error persists, dispatch a service technician to replace the formatter.

Use the following table to order the correct part number for your printer.

Table 6-9 Formatter PCA part numbers

Product models	Part description	Part number
M501dn	Formatter PC board	J8H61-67901
M501dn (China)	Formatter PC board	J8H61-67902
M501n	Formatter PC board	J8H60-67901
M501n (China)	Formatter board assembly	J8H60-67902
M506n/ M506dn	Formatter PC board assembly	F2A68-67915
E50045n/ E50045dn		
M506x	Formatter PC board assembly	F2A68-67916
E50045x		
M507	Formatter PC board	1PV87-60001
E50145		
M527	Formatter PC board assembly	F2A76-67910
E52545		
M528	Formatter PC board	1PV64-60002
E52645		

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Make sure to set the time and date on the control panel whenever the printer is turned off and then turned on.
2. If the error persists, remove and reinstall the formatter making sure it is seated correctly.
3. If the error persists, perform a [Partial Clean](#) using the Preboot menu or the Embedded Web Server (EWS).



NOTE: A Partial Clean erases all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system. It automatically reboots the printer and restores the firmware files from the repository.

4. If the error still persists, update the firmware.
5. If the error persists, replace the formatter.

Table 6-10 Formatter PCA part numbers

Product models	Part description	Part number
M501dn	Formatter PC board	J8H61-67901
M501dn (China)	Formatter PC board	J8H61-67902
M501n	Formatter PC board	J8H60-67901
M501n (China)	Formatter board assembly	J8H60-67902
M506n/ M506dn	Formatter PC board assembly	F2A68-67915
E50045n/ E50045dn		
M506x	Formatter PC board assembly	F2A68-67916
E50045x		
M507	Formatter PC board	1PV87-60001
E50145		
M527	Formatter PC board assembly	F2A76-67910
E52545		
M528	Formatter PC board	1PV64-60002
E52645		

For instructions: See the Repair Service Manual for this product.

13.XX.YZ error messages

13.* errors

Errors in the 13.* family are related to jams.

More than 1000 unique error codes are possible. Use the following information to understand the jam code. Not all codes apply to all printers.

Message format: 13.WX.YZ

- W represents the jam location.
- X represents the sensor or door that triggered the jam.
- Y represents the jam condition (delay, stay, wrap, etc.)
- Z represents the paper source, fuser mode, or destination

Table 6-11 Potential values for W and X

W	Jam location	X	Sensor or door
A	Input area	0	Envelope feeder
A	Input area	1	Tray 1 feed (unless Tray 1 feed is the registration sensor)
A	Input area	2	Tray 2 feed (unless Tray 2 feed is the registration sensor)
A	Input area	3	Tray 3 feed
A	Input area	4	Tray 4 feed NOTE: If available for specified printer
A	Input area	5	Tray 5 feed NOTE: If available for specified printer
A	Input area	6	Tray 6 feed NOTE: If available for specified printer
A	Input area	7	Optional tray exit sensor
A	Input area	A	Door 1
A	Input area	B	Door 2
A	Input area	C	Door 3 NOTE: If available for specified printer
A	Input area	D	Door 4 NOTE: If available for specified printer
A	Input area	E	Door 5 NOTE: If available for specified printer
A	Input area	F	Multiple sensors or doors
B	Image area	0	Media sensor for forbidden transparencies
B	Image area	2	Registration/top of page
B	Image area	3	Top of page
B	Image area	4	Loop
B	Image area	5	Fuser input

Table 6-11 Potential values for W and X (continued)

W	Jam location	X	Sensor or door
B	Image area	9	Fuser output
B	Image area	A	Door 1
B	Image area	B	Door 2
B	Image area	F	Multiple sensors or doors
C	Switchback area (between the fuser and the output bin)	1	Intermediate switchback sensor
C	Switchback area (between the fuser and the output bin)	2	Switchback media stay sensor
C	Switchback area (between the fuser and the output bin)	3	Paper delivery sensor
D	Duplex area	1	Duplex switchback
D	Duplex area	2	Duplex delivery
D	Duplex area	3	Duplex refeed
D	Duplex area	A	Door 1 (if different than the imaging area)
D	Duplex area	B	Door 2 (if different than the imaging area)
D	Duplex area	F	Multiple sensors or doors
E	Output or intermediate paper transport unit (IPTU) area	1	Output bin full sensor
E	Output or intermediate paper transport unit (IPTU) area	2	IPTU feed sensor 1
E	Output or intermediate paper transport unit (IPTU) area	3	IPTU sensor 2
E	Output or intermediate paper transport unit (IPTU) area	4	IPTU sensor 3
E	Output or intermediate paper transport unit (IPTU) area	5	IPTU bin full sensor 4
E	Output or intermediate paper transport unit (IPTU) area	6	Output sensor
E	Output or intermediate paper transport unit (IPTU) area	A	Door 1
E	Output or intermediate paper transport unit (IPTU) area	F	Multiple sensors or doors
F	Multiple subsystems (occurs when paper is stuck in several areas)	F	Multiple sensors or doors
1	Jetlink input device	4	Tray 4 feed sensor NOTE: If available for specified printer
1	Jetlink Input device	5	Tray 5 feed sensor NOTE: If available for specified printer
1	Jetlink Input device	6	Tray 6 feed sensor NOTE: If available for specified printer

Table 6-11 Potential values for W and X (continued)

W	Jam location	X	Sensor or door
1	Jetlink Input device	7	Tray 7 feed sensor NOTE: If available for specified printer
1	Jetlink Input device	8	Tray 8 feed sensor NOTE: If available for specified printer
1	Jetlink Input device	9	Tray 9 feed sensor NOTE: If available for specified printer
1	Jetlink Input device	A	Door 1
1	Jetlink Input device	B	Door 2
1	Jetlink Input device	F	Multiple sensors or doors
2	Buffer pass unit	0	Buffer pass inlet sensor
2	Buffer pass unit	9	Buffer pass exit sensor
2	Buffer pass unit	A	Door 1
3	Page insert unit	0	Page insertion inlet sensor
3	Page insert unit	1	Page insertion tray 1 feed sensor
3	Page insert unit	2	Page insertion tray 2 feed sensor
3	Page insert unit	3	Page insertion tray 3 feed sensor
3	Page insert unit	4	Page insertion tray 4 feed sensor
3	Page insert unit	7	Output path feed sensor
3	Page insert unit	9	Page insertion exit sensor
3	Page insert unit	A	Door 1
4	Punch unit	0	Puncher inlet sensor
4	Punch unit	1	Puncher jam sensor
4	Punch unit	9	Puncher exit sensor
4	Punch unit	A	Door 1
5	Folding unit	0	Folder inlet sensor
5	Folding unit	1	Folder sensor
5	Folding unit	9	Folder exit sensor
5	Folding unit	A	Door 1
6	Stacker unit	0	Stacker inlet sensor
6	Stacker unit	4	Stacker outlet sensor
6	Stacker unit	7	Stacker switchback entrance sensor
6	Stacker unit	8	Stacker switchback registration sensor
6	Stacker unit	9	Stacker switchback lower sensor
7	Multi-bin mailbox (MBM) unit	0	MBM inlet sensor

Table 6-11 Potential values for W and X (continued)

W	Jam location	X	Sensor or door
7	Multi-bin mailbox (MBM) unit	1	MBM middle sensor
7	Multi-bin mailbox (MBM) unit	9	Stapler sensor
7	Multi-bin mailbox (MBM) unit	A	Door 1
7	Multi-bin mailbox (MBM) unit	B	Door 2
7	Multi-bin mailbox (MBM) unit	C	Door 3
7	Multi-bin mailbox (MBM) unit	F	Multiple sensors or doors
8	Stapler/stacker (SS) unit	0	SS inlet sensor
8	Stapler/stacker (SS) unit	1	SS Bin Z
8	Stapler/stacker (SS) unit	3	SS unit middle sensor
8	Stapler/stacker (SS) unit	4	SS unit outlet sensor 1
8	Stapler/stacker (SS) unit	5	SS unit outlet sensor 2
8	Stapler/stacker (SS) unit	9	Stapler sensor
8	Stapler/stacker (SS) unit	A	Door 1
8	Stapler/stacker (SS) unit	B	Door 2
9	Booklet maker unit	0	Booklet maker input sensor
9	Booklet maker unit	2	Booklet maker feed sensor 2
9	Booklet maker unit	2	Booklet maker feed sensor 3
9	Booklet maker unit	4	Booklet maker delivery sensor
9	Booklet maker unit	5	Booklet maker vertical paper path sensor
9	Booklet maker unit	6	Booklet unit front staple sensor
9	Booklet maker unit	7	Booklet unit rear staple sensor
9	Booklet maker unit	8	Booklet unit outlet sensor
9	Booklet maker unit	A	Door 1
9	Booklet maker unit	B	Door 2
9	Booklet maker unit	C	Door 3
9	Booklet maker unit	F	Multiple sensors or doors
0	Unknown	0	Unknown

Table 6-12 Potential values for Y (jam condition)

Y	Jam condition
0	Unknown
1	Unexpected sheet (duplex)
2	Staple jam
3	Jam caused by an open door (duplex)

Table 6-12 Potential values for Y (jam condition) (continued)

Y	Jam condition
4	Stay jam (the page never left the tray - duplex)
A	Stay jam (the page never left the tray - simplex)
B	Multifeed
C	Wrap
D	Delay (the page did not reach the sensor within the expected time - simplex)
E	Door open
F	Residual (paper is detected in the paper path when it should not be there)

The information represented by the value for Z depends on where the paper is in the paper path.

Table 6-13 Potential values for Z (source, fuser mode, or destination)

Paper location	Z	Source, fuser mode, or destination
When paper has not reached the fuser, Z represents the paper source.	1	Tray 1
Z represents the paper source.	2	Tray 2
Z represents the paper source.	3	Tray 3
Z represents the paper source.	4	Tray 4 If available for specified printer
Z represents the paper source.	5	Tray 5 If available for specified printer
Z represents the paper source.	6	Tray 6 If available for specified printer
Z represents the paper source.	D	Duplexer
Z represents the paper source.	E	Envelope feeder
When paper has reached the fuser, is in the duplex path, or in the output path, Z represents the fuser mode. Jams can occur when there is a mismatch between the actual paper and the fuser mode setting.	0	Photo 1, 2, or 3 Designated 2 or 3
Z represents the fuser mode.	1	Normal (automatically sensed rather than based on the paper type set at the control panel)
Z represents the fuser mode.	2	Normal (based on the paper type set at the control panel)
Z represents the fuser mode.	3	Light 1, 2, or 3
Z represents the fuser mode.	4	Heavy 1
Z represents the fuser mode.	5	Heavy 2
Z represents the fuser mode.	6	Heavy 3

Table 6-13 Potential values for Z (source, fuser mode, or destination) (continued)

Paper location	Z	Source, fuser mode, or destination
Z represents the fuser mode.	7	Glossy 1
Z represents the fuser mode.	8	Glossy 2
Z represents the fuser mode.	9	Glossy 3
Z represents the fuser mode.	A	Glossy Film
Z represents the fuser mode.	B	Transparency
Z represents the fuser mode.	C	Label
Z represents the fuser mode.	D	Envelope 1, 2, or 3
Z represents the fuser mode.	E	Rough
When paper has entered the output bin, Z represents the output bin, numbered from top to bottom.	0	Unknown bin
Z represents the output bin	1	Bin 1
Z represents the output bin	2	Bin 2
Z represents the output bin	3	Bin 3
Z represents the output bin	4	Bin 4
Z represents the output bin	5	Bin 5
Z represents the output bin	6	Bin 6
Z represents the output bin	7	Bin 7
Z represents the output bin	8	Bin 8
Z represents the output bin	9	Bin 9
All paper locations	E	Door open jam
All paper locations	F	Residual jam
All paper locations	0	Forbidden OHT jam (when Y=2)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size, and the tray should not be filled above the maximum fill marks or tabs.
4. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
5. Use a damp, lint-free cloth to clean the rollers in the appropriate tray. Replace rollers that are worn.
6. Open all doors and covers and ensure the paper path is completely clear of paper or obstructions.

7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

To prevent future paper jams in the printer, follow these recommendations:

- Use only paper that meets HP specifications for this printer.
For more information, refer to the printer User Guide or search for the "HP LaserJet Printers - Print Media Guide" (c06117757).
- Make sure the printing environment is within recommended specifications.
- Do not use paper that is wrinkled, folded, or damaged.
- Do not overload the tray with paper.
- Make sure that the paper guides in the tray are adjusted correctly for the size of paper.
- Make sure that the tray is fully inserted in the printer.
- If printing on heavy, embossed, or perforated paper, use the manual feed feature and feed sheets one at a time.
- Open the [Trays](#) menu on the printer control panel. Verify that the tray is configured correctly for the paper type and size.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size, and the tray should not be filled above the maximum fill marks or tabs.
4. Verify that the paper meets specifications for this printer.
5. Use a damp, lint-free cloth to clean the rollers in the appropriate tray. Replace rollers that are worn.
6. If the issue persists, open the [Administration > Troubleshooting > Diagnostic Tests > Component Test](#) menu, and perform the appropriate pickup/feed motor drive test. Replace the pickup assembly if the test fails.
7. Verify the sensors are functioning correctly. If the sensors fail the test, first verify that all connections on the DC controller are correctly seated. If possible, replace the sensor or assembly it is associated with.
8. If the sensors pass the test, look for blockage or damaged parts and replace any damaged parts.
9. If the error persists, elevate the case using the Standard Support Process.

13.00.00

Generic jam event code.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Check the printer for a paper jam.
 - a. Open toner cartridge access and output door.
 - b. Remove any paper present.
 - c. Check all paper trays for jammed or wrinkled paper and remove as needed.
2. If the error persists, please contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Check the printer for a paper jam. Check all sensor locations and the complete paper path.
2. Use the [Manual sensors test](#) or [Tray/Bin manual sensors test](#) to isolate a faulty door switch or sensor.
3. Replace parts as needed.

13.00.EE

Unknown door open.

Recommended action

Follow these troubleshooting steps in the order presented.

- Make sure that all of the doors and covers are closed.

13.A2.D2

Tray 2 paper feed jam.

This jam occurs when the paper does not reach the pre-feed sensor (SR11) in the designated amount of time after the start of paper pickup from Tray 2.

This is a no-pick jam from tray 2.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Verify the customer has followed the on the steps control panel for clearing the jam.
2. Open Tray 2, then remove any jammed paper, and then close the tray.
3. Open and close the upper TOP cover to allow the printer to attempt to clear the jam.

4. Remove the paper from the tray and check that the paper tray size guides are properly set and that the tray is not over filled with paper.

Figure 6-2 Paper Tray guides


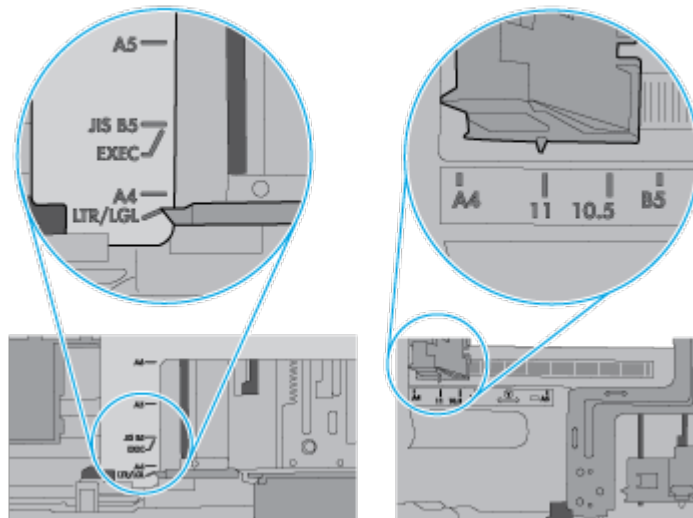


Figure 6-3 Paper Tray overfill guide

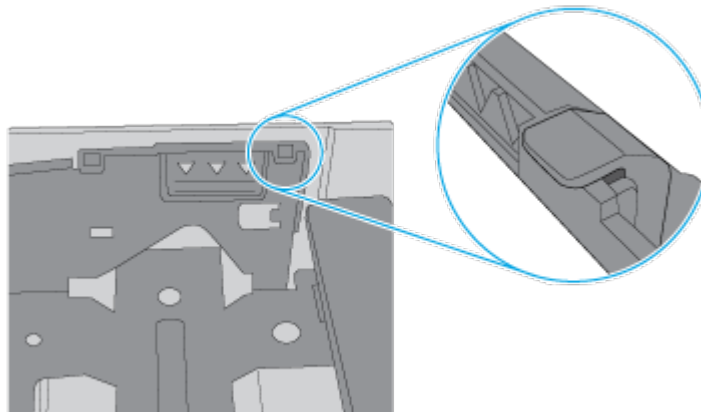

5. Make sure that the Tray 2 pickup, feed, and separation roller are installed correctly and show no damage or wear.
6. Clean or replace the pickup and/or feed rollers as needed.
Use a damp, lint-free cloth to gently clean the rollers.
Part number: F2A68-67913
7. Verify that the paper in use meets the printer's specifications.
8. If the error persists, please contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Verify the customer has followed the steps control panel for clearing the jam.
2. Open Tray 2, then remove any jammed paper, and then close the tray.
3. Open and close the upper top cover to allow the printer to attempt to clear the jam.
4. Remove the paper from the tray and check that the paper tray size guides are properly set and that the tray is not over filled with paper.

Figure 6-4 Paper Tray guides


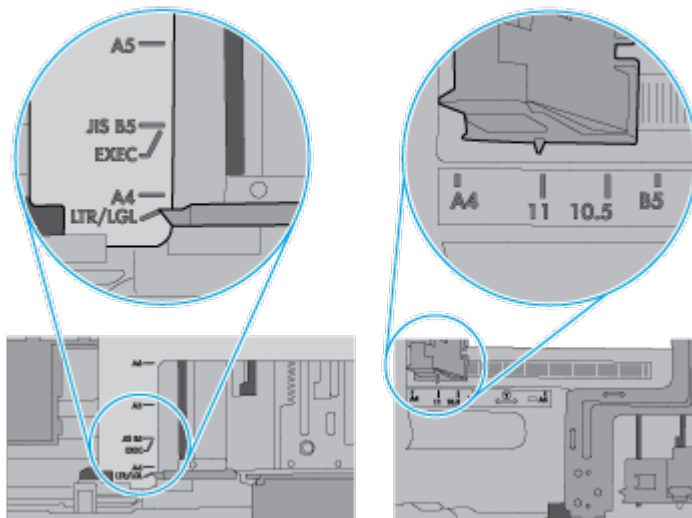


Figure 6-5 Paper Tray overfill guide



5. Make sure that the Tray 2 pickup, feed, and separation roller are installed correctly and show no damage or wear.
6. Clean or replace the pickup and/or feed rollers as needed.
Use a damp, lint-free cloth to gently clean the rollers.
Part number: F2A68-67913
7. Verify that the paper in use meets the printer's specifications.

8. Open the following menus:
 - **Administration**
 - **Troubleshooting**
 - **Diagnostic Tests**
9. Run the Tray 2 pickup/feed motor drive test to verify that the feed motor is functioning correctly. If it is not, replace the pickup assembly.
10. Test SR11 using the **Tray/Bin Manual sensor test** to verify that the sensor is functioning correctly.
11. If SR11 fails the test, elevate the issue using the Standard Support Process for a possible printer replacement.

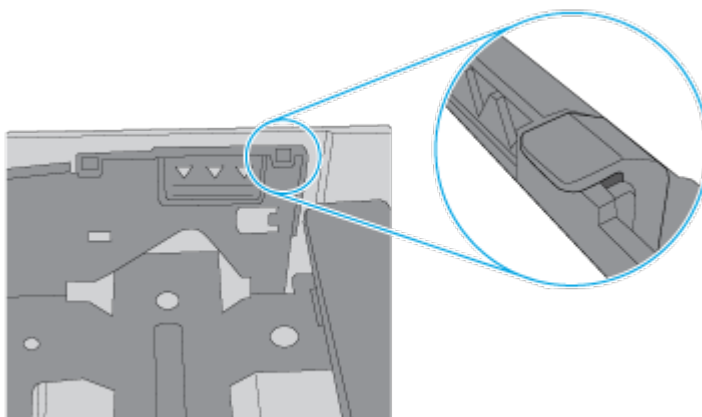

NOTE: On-site technicians should check the following connections on the DC Controller before elevating the issue. (J157-SR11) (J110 and J144 – Tray 2 feed drive assy and solenoid)

13.Ax.Dz

Optional tray paper feed jam.

This jam occurs when the paper does not reach the tray pre-feed sensor PS432 for trays 3-5 in the designated amount of time after the start of paper pickup from Tray.

This is a no-pick jam from the specified tray.

X = The tray feed sensor where the jam occurred.

Z = The tray being used to print the job.

- **13.A3.D3, 13.A3.D4, 13.A3.D5 = Tray 3:**

Paper did not reach Tray 3 paper Feed Sensor (PS432) when pulling from Tray 3-5

- **13.A4.D4, 13.A4.D5 = Tray 4:**

Paper did not reach Tray 4 paper Feed Sensor (PS432) when pulling from Tray 4-5

- **13.A5.D5 = Tray 5**

Paper did not reach Tray 5 paper Feed Sensor (PS432) when pulling from Tray 5

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Verify that the customer has followed the on the steps control panel for clearing the jam.
2. Open and close the upper TOP cover to allow the printer to attempt to clear the jam.
3. Open the specified tray then remove any jammed paper.

Remove the paper from the tray and check that the paper tray size guides are properly set and that the tray is not over filled with paper.

Figure 6-6 Paper Tray guides


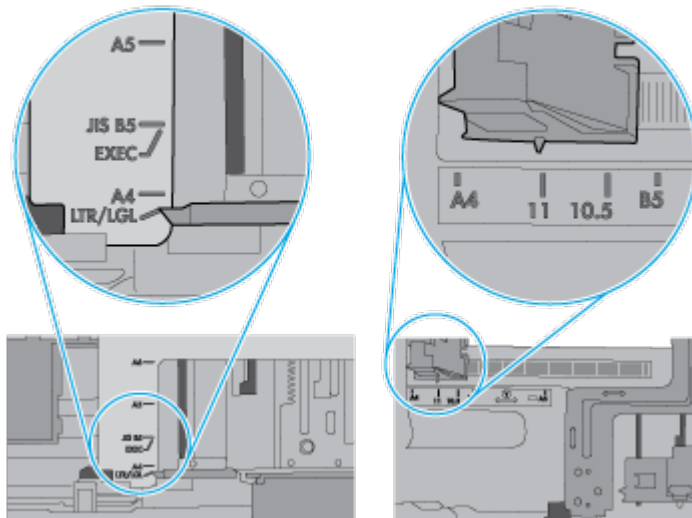


Figure 6-7 Paper Tray overfill guide

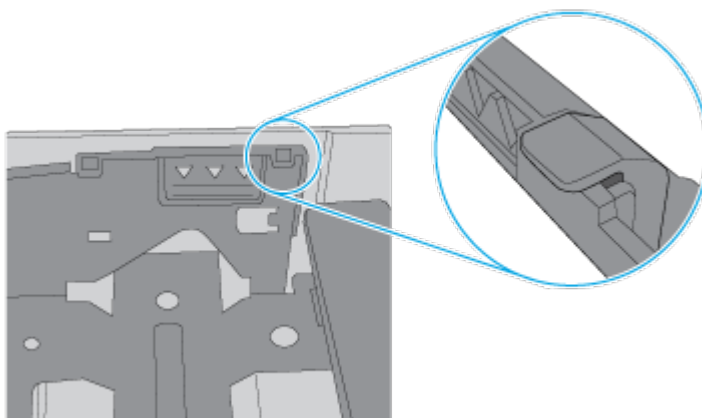

4. Make sure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup and/or feed rollers as needed.
Part number: F2A68-67913
Use a damp, lint-free cloth to gently clean the rollers.
6. Verify that the paper in use meets the printer's specifications.
7. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Verify that the customer has followed the on the steps control panel for clearing the jam.
2. Open and close the upper TOP cover to allow the printer to attempt to clear the jam.

3. Open the specified tray then remove any jammed paper.

Remove the paper from the tray and check that the paper tray size guides are properly set and that the tray is not over filled with paper.

Figure 6-8 Paper Tray guides


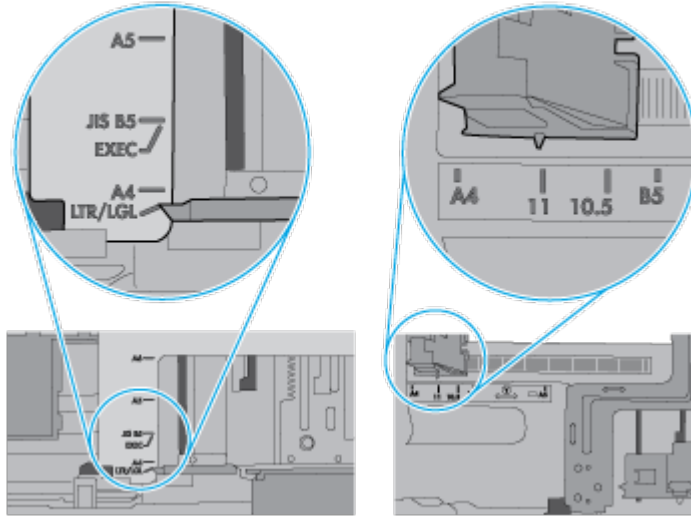


Figure 6-9 Paper Tray overfill guide

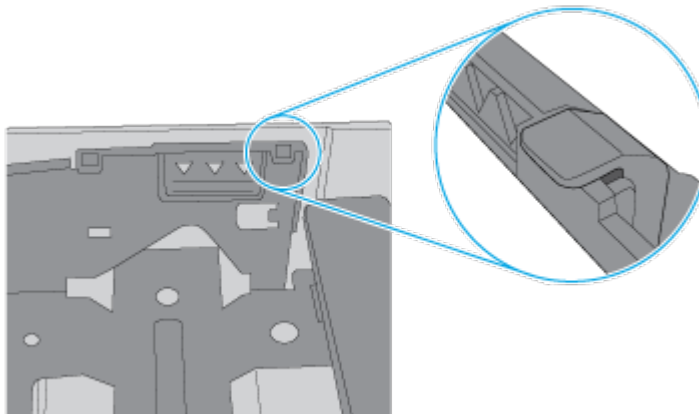

4. Make sure that the tray pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup and/or feed rollers as needed.
Part number: F2A68-67913
Use a damp, lint-free cloth to gently clean the rollers.
6. Verify that the paper in use meets the printer's specifications.
7. Open the following menus:
 - **Administration**

- Troubleshooting
- Diagnostic Tests

8. Run the tray pickup/feed motor drive test to verify that the feed motor is functioning correctly. If it is not, replace the pickup assembly.
9. Test all PS432 sensors in the HCI using the Tray/Bin Manual sensor test to verify that the sensors are functioning correctly.
10. If either of the previous steps fail, elevate the issue using the Standard Support Process for a possible printer replacement.



NOTE: On-site technicians should check ALL the connections on the Paper Feed Controller PCA before elevating the issue.

13.A2.FF

Residual paper Jam in Tray 2.

This jam occurs when residual paper is detected at the Tray 2 feed sensor (SR11).

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Make sure to follow the steps on the control panel on how to clear the jam.
2. Open Tray 2, remove any jammed paper, and then close the tray.
3. Open and close the upper right door to allow the printer to attempt to clear the jam.
4. Remove the paper from the specified tray and check that the paper tray size guides are set correctly and that the tray is not overfilled with paper.

Figure 6-10 Paper Tray guides


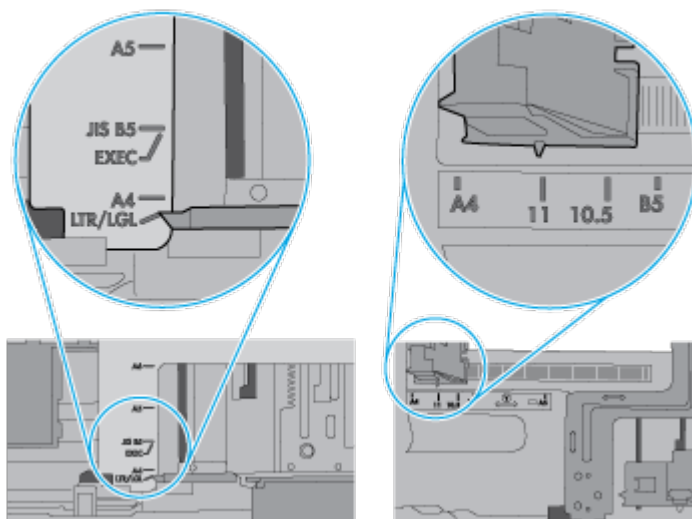


Figure 6-11 Paper Tray overfill guide

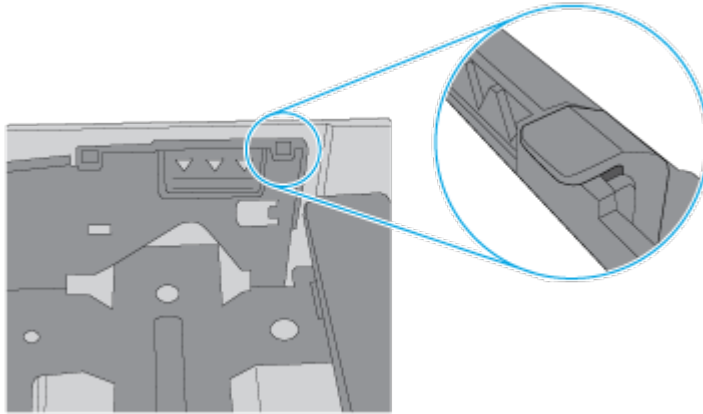

5. Make sure that the Tray 2 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
6. Clean or replace the pickup and/or feed rollers as needed.
Part number: F2A68-67913
Use a damp, lint-free cloth to gently clean the rollers.
7. Verify that the paper in use meets the printer's specifications.
8. If the error persists, contact customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open Tray 2, remove any jammed paper, and then close the tray.
2. Open and close the upper right door to allow the printer to attempt to clear the jam.

3. Remove the paper from the tray and check that the paper tray size guides are set correctly and that the tray is not overfilled with paper.

Figure 6-12 Paper Tray guides


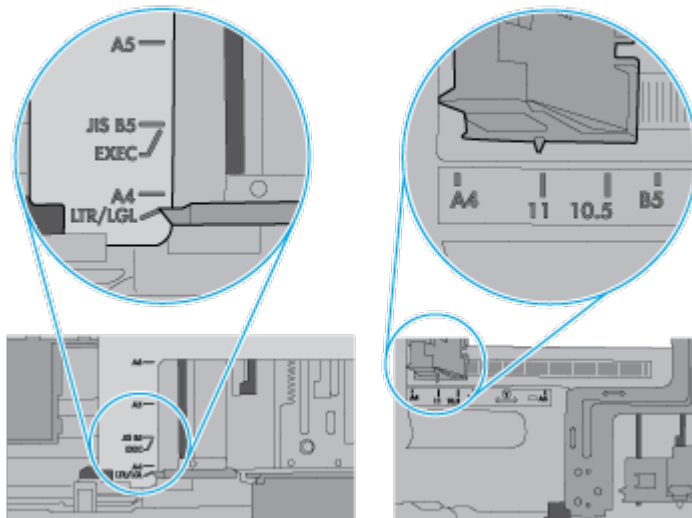


Figure 6-13 Paper Tray overfill guide

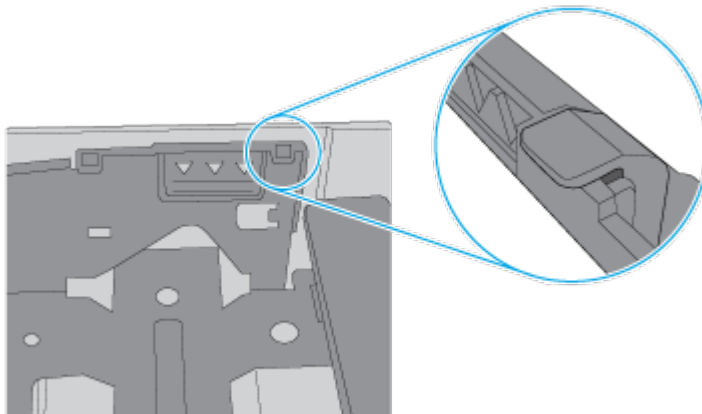

4. Make sure that the Tray 2 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
5. Clean or replace the pickup and/or feed rollers as needed.
Part number: F2A68-67913
Use a damp, lint-free cloth to gently clean the rollers.
6. Check the connectors at the sensor, feed motor, and the DC controller PCA.
7. Open the following menus:
 - **Administration**
 - **Troubleshooting**

- **Diagnostic Tests**
8. Test SR11 using the Tray/Bin Manual sensor test to verify that the sensors are functioning correctly.
 9. Run the Tray 2 pickup/feed motor drive test to verify that the feed motor is functioning correctly (listen for the motor to activate). If it is not, replace the pickup assembly.
 10. If either of the previous steps fail, elevate the issue using the Standard Support Process for a possible printer replacement.

 **NOTE:** On-site technicians should check the following connections on the DC Controller before elevating the issue.

(J157-SR11) (J110 and J144) – Tray 2 feed drive assembly and solenoid.

13.A3.FF

Residual paper Jam in Tray 3.

This jam occurs when residual paper is detected at the Tray 3 feed sensor (PS432).

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Make sure to follow the steps on the control panel on how to clear the jam.
2. Open the tray specified on the control panel, remove any jammed paper, and then close the tray.
3. Open and close the upper right door to allow the printer to attempt to clear the jam.
4. Remove the paper from the specified tray and check that the paper tray size guides are set correctly and that the tray is not overfilled with paper.

Figure 6-14 Paper Tray guides


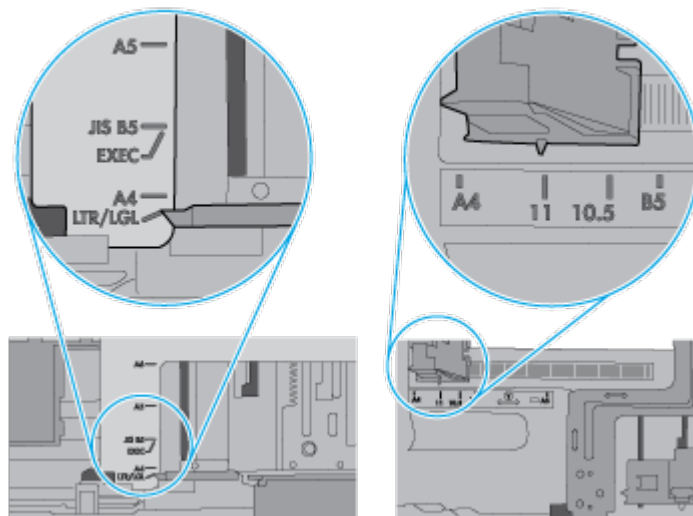


Figure 6-15 Paper Tray overfill guide

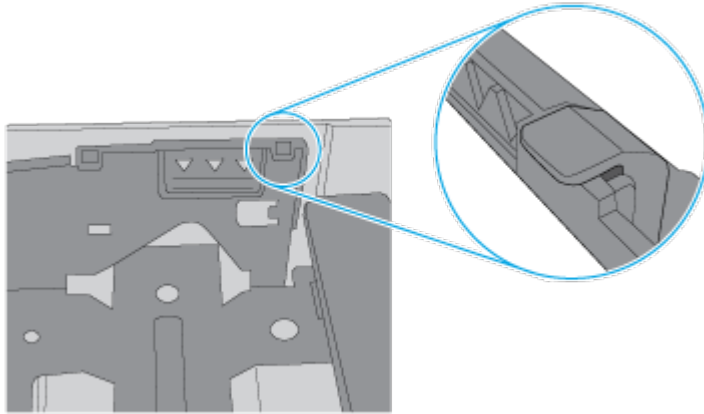

5. Make sure that the specified tray pickup, feed, and separation rollers are installed correctly and show no damage or wear.
6. Clean or replace the pickup and/or feed rollers as needed.
Part number: F2A68-67913
Use a damp, lint-free cloth to gently clean the rollers.
7. Verify that the paper in use meets the printer's specifications.
8. If the error persists, contact customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open Tray 4, remove any jammed paper, and then close the tray.
2. Open and close the upper right door to allow the printer to attempt to clear the jam.

3. Remove the paper from the tray and check that the paper tray size guides are properly set and that the tray is not over filled with paper.

Figure 6-16 Paper Tray guides


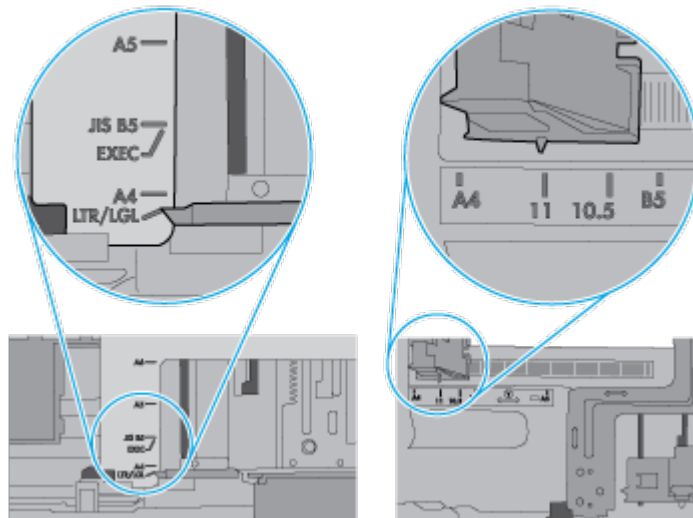


Figure 6-17

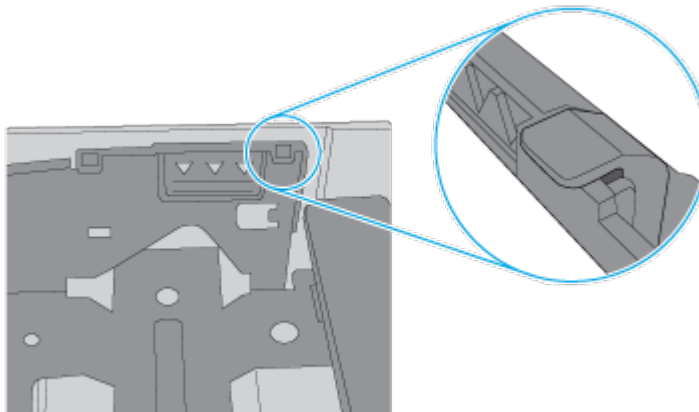

4. Make sure that the Tray 4 pickup, feed, and separation roller are installed correctly and show no damage or wear.
5. Clean or replace the pickup and/or feed rollers as needed.
Part number: F2A68-67913
Use a damp, lint-free cloth to gently clean the rollers.
6. Check the connectors at the sensor, feed motor, and the DC controller PCA.
7. Open the following menus:
 - **Administration**
 - **Troubleshooting**

- **Diagnostic Tests**

8. Test PS432 using the Tray/Bin Manual sensor test to verify that the sensor is functioning correctly.
9. Run the Tray 4 pickup/feed motor drive test to verify that the feed motor is functioning correctly (listen for the motor to activate). If it is not, replace the optional paper feeder assembly.
10. If either of the previous steps fail, elevate the issue to HP for a possible printer replacement.



NOTE: On-site technicians should check ALL connections on the Paper feed controller PCA before elevating the issue.

13.A5.FF

Residual paper jam in Tray 5.

This jam occurs when residual paper is detected at the Tray 5 feed sensor (PS432).

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Make sure to follow the steps on the control panel on how to clear the jam.
2. Open the tray specified on the control panel, remove any jammed paper, and then close the tray.
3. Open and close the upper right door to allow the printer to attempt to clear the jam.
4. Remove the paper from the specified tray and check that the paper tray size guides are set correctly and that the tray is not overfilled with paper.

Figure 6-18 Paper Tray guides


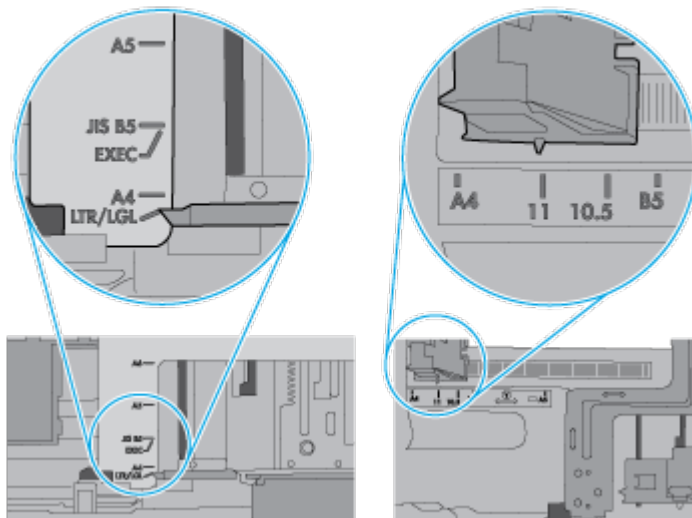


Figure 6-19 Paper Tray overfill guide

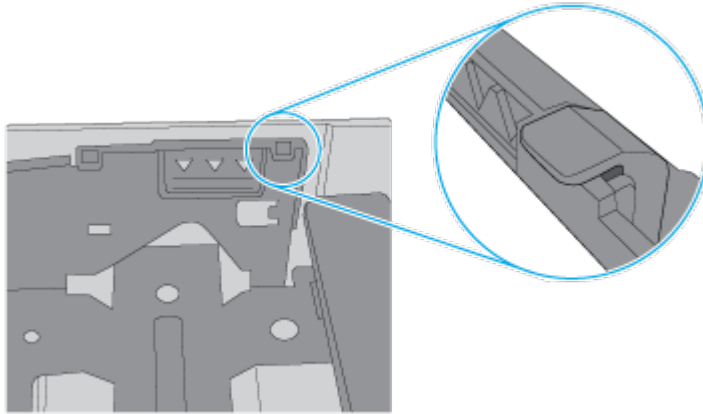

5. Make sure that the specified tray pickup, feed, and separation rollers are installed correctly and show no damage or wear.
6. Clean or replace the pickup and/or feed rollers as needed.
Part number: F2A68-67913
Use a damp, lint-free cloth to gently clean the rollers.
7. Verify that the paper in use meets the printer's specifications.
8. If the error persists, contact customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open Tray 5, remove any jammed paper, and then close the tray.
2. Open and close the upper right door to allow the printer to attempt to clear the jam.

3. Remove the paper from the tray and check that the paper tray size guides are properly set and that the tray is not over filled with paper.

Figure 6-20 Paper Tray guides


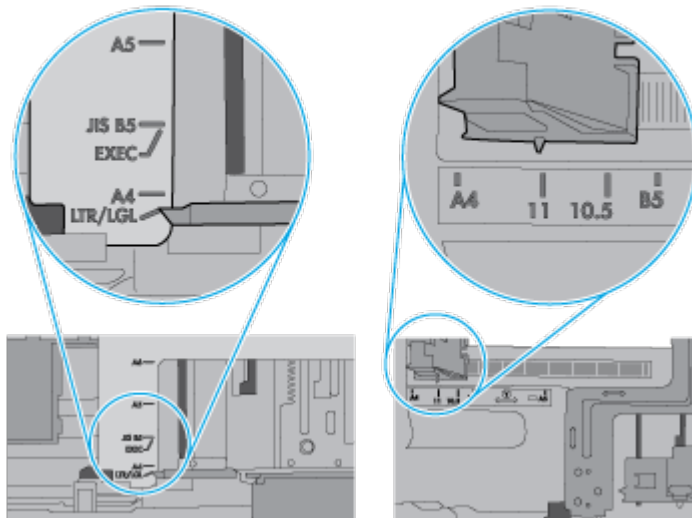


Figure 6-21 Paper Tray overfill guide



4. Make sure that the Tray 5 pickup, feed, and separation roller are installed correctly and show no damage or wear.
5. Clean or replace the pickup and/or feed rollers as needed.
Part number: F2A68-67913
Use a damp, lint-free cloth to gently clean the rollers.
6. Check the connectors at the sensor, feed motor, and the DC controller PCA.
7. Open the following menus:
 - **Administration**
 - **Troubleshooting**

- **Diagnostic Tests**
- 8. Test PS432 using the Tray/Bin Manual sensor test to verify that the sensors are functioning correctly.
- 9. Run the Tray 5 pickup/feed motor drive test to verify that the feed motor is functioning correctly (listen for the motor to activate). If it is not, replace the optional paper feeder assembly.
- 10. If either of the previous steps fail, elevate the issue using the Standard Support Process for a possible printer replacement.

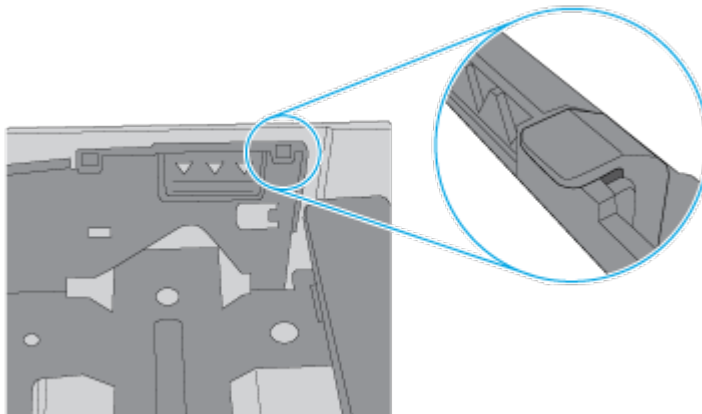

NOTE: On-site technicians should check ALL connections on the Paper feed controller PCA before elevating the issue.

13 . B2 . Az Jam in top cover

Paper STAY jam in the top cover at the image area.

Paper present at SR2 after a specified time limit has passed.

- **13.B2.A1**

This jam occurs when the registration sensor (SR2) detects paper present longer than the expected time based on the paper size when printing from the Tray 1.

- **13.B2.A2**

This jam occurs when the registration sensor (SR2) detects paper present longer than the expected time based on the paper size when printing from the Tray 2.

- **13.B2.A3**

This jam occurs when the registration sensor (SR2) detects paper present longer than the expected time based on the paper size when printing from the Tray 3.

- **13.B2.A4**

This jam occurs when the registration sensor (SR2) detects paper present longer than the expected time based on the paper size when printing from the Tray 4.

- **13.B2.A5**

This jam occurs when the registration sensor (SR2) detects paper present longer than the expected time based on the paper size when printing from the Tray 5.

- **13.B2.AD**

This jam occurs when the registration sensor (SR2) detects paper present longer than the expected time based on the paper size when printing from the Duplexer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the top cover and check for paper jammed in the feed area.
2. Ensure that the paper being printed on is not glossy paper.
Glossy paper is not supported on this printer and will cause this issue.

3. Verify that the tray guides have been set to the proper size and that the same size is reflected on the Configuration Page.

Figure 6-22 Paper Tray guides


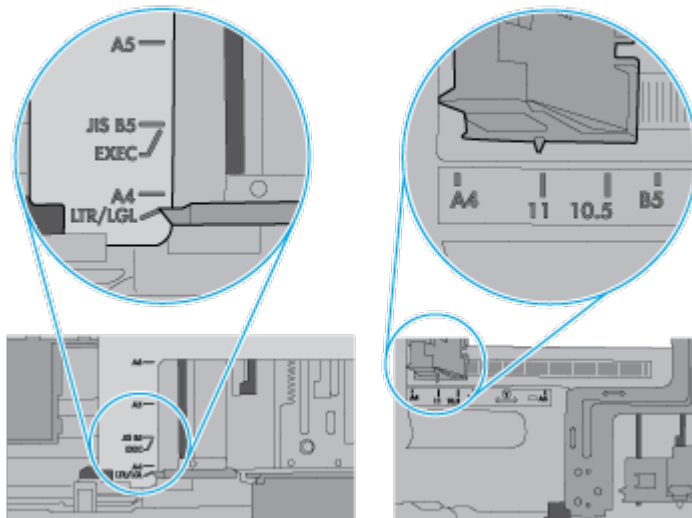


Figure 6-23 Paper Tray overfill guide

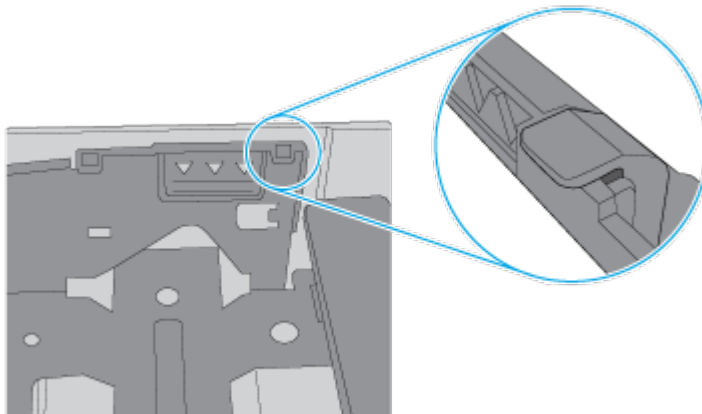

4. Ensure the type and quality of the paper that the customer is using meet HP specifications.
5. Check under the toner cartridge at the transfer area, make sure everything is properly seated and that there are no damaged parts.
6. If the error persists, please contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the top cover and check for paper jammed in the feed area.
2. Ensure the customer is not trying to print on glossy paper.

Glossy paper is not supported on this printer and will cause this issue.

3. Verify that the tray guides have been set to the proper size and that the same size is reflected on the Configuration Page.
4. Ensure the type and quality of the paper that the customer is using meet HP specifications.
5. Check under the toner cartridge at the transfer area, make sure everything is properly seated and that there are no damaged parts.
6. Test the registration sensor (TOP sensor) (SR2) to ensure that it moves freely.
7. Open the following menus:
 - **Administration**
 - **Troubleshooting**
 - **Diagnostic Tests**
8. Test the registration sensor (TOP sensor) (SR2) using the Tray/Bin manual sensor test to verify that the sensor is functioning correctly.
9. Test the paper width sensors SR1a and SR2b.
10. If either of the sensors steps fail, elevate the issue using the Standard Support Process for a possible printer replacement.



NOTE: On-site technicians should check the following connections on the DC controller PCA to ensure they are properly seated and connected before elevating the issue. (J151, J110, J144)

11. If the sensors are functioning properly, run a few pages to check where the leading edge of the paper actually stops.
12. Test and check the registration assembly and look for damage, if it is faulty replace the registration assembly.

Part Number (M501/M506/E50045/M527/E52545): RM2-5671-000CN

Part Number (M507/E50145/M528/E52645): RM2-2577-000CN

13. Look for blockage or damaged parts that stops the paper from continuing on through the printer. Check the fuser, if the fuser or any other part is found to be defective replace the part.

Table 6-14 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

See the Repair Service Manual for this product.

14. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

13 . B2 . D1 Jam in top cover

Paper delay jam in top cover at image area.

Paper did not reach SR2 in specified time.

Paper did not reach the registration sensor in the designated amount of time printing from Tray 1.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the top cover and check for paper jammed in the feed area.
2. Ensure the customer is not trying to print on glossy paper.
Glossy paper is not supported on this printer and will cause this issue.
3. Verify that the tray guides have been set to the proper size and that the same size is reflected on the Configuration Page.
4. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
5. Check the page count of the printer. If it is above 100,000 pages replace the feed and separation rollers.
Part Number: F2A68-67914
6. Check for worn or damaged tray feed and separation rollers, replace the rollers as needed.
Part Number: F2A68-67914
7. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the top cover and check for paper jammed in the feed area.
2. Ensure the customer is not trying to print on glossy paper.
Glossy paper is not supported on this printer and will cause this issue.
3. Verify that the tray guides have been set to the proper size and that the same size is reflected on the Configuration Page.
4. Ensure the type and quality of the paper that the customer is using meets the HP specifications for the printer.
5. Check the page count of the printer. If it is above 100,000 pages replace the feed and separation rollers.
Part Number: F2A68-67914
6. Check for worn or damaged tray feed and separation rollers, replace the rollers as needed.
Part Number: F2A68-67914

7. Open the following menus:
 - **Administration**
 - **Troubleshooting**
 - **Diagnostic Tests**
8. Test the top of page sensor (SR2) and the paper width sensors SR1a and SR2b.
9. If any of the sensors fail, elevate the issue using the Standard Support Process for a possible printer replacement.



NOTE: On-site technicians should check the following connections on the DC controller PCA to ensure they are properly seated and connected before elevating the issue. (J151, J110, J144)

10. If the sensors are functioning properly, run a few pages to check where the leading edge of the paper actually stops.
11. Check that the registration assembly is functioning correctly, if not replace the registration assembly.

Part Number (M501/M506/E50045/M527/E52545): RM2-5671-000CN
Part Number (M507/E50145/M528/E52645): RM2-2577-000CN
12. Ask the customer if they hear a grinding or clunking noise when printing. If a noise is heard run the diagnostics on fuser and pickup motors..
 - a. Open the following menus:
 - **Administration**
 - **Troubleshooting**
 - **Diagnostic Tests**
 - b. Run the Component test for the fuser and the pickup motors. If either is grinding or clunking replace the main motor.

Part number: RM2-8684-000CN

13 . B2 . Dz Jam in top cover

Paper delay jam in top cover at image area.

Paper did not reach SR2 in specified time.

- **13.B2.D2**
Paper did not reach the Registration sensor in the designated amount of time printing from Tray 2.
- **13.B2.D3**
Paper did not reach the Registration sensor in the designated amount of time printing from Tray 3.
- **13.B2.D4**
Paper did not reach the Registration sensor in the designated amount of time printing from Tray 4.

- **13.B2.D5**

Paper did not reach the Registration sensor in the designated amount of time printing from Tray 5.

- **13.B2.DD**

Paper did not reach the Registration sensor in the designated amount of time printing duplexed.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

View this video for more information. [How to Clear Paper Jams in the Toner-Cartridge Area for HP LaserJet Pro M501, Enterprise M50x, MFP/Flow M52x, Managed E50145, E52645](#)

1. Press the top-cover-release button on the left side of the printer.


Figure 6-24 Press the release button




2. Open the front door on the printer.




3. Remove the toner cartridge.

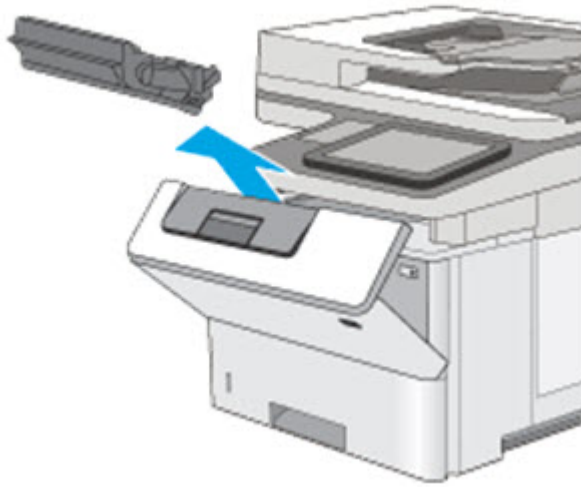


4. Lift the jam-access cover and slowly remove any jammed paper. Be careful not to tear the paper.

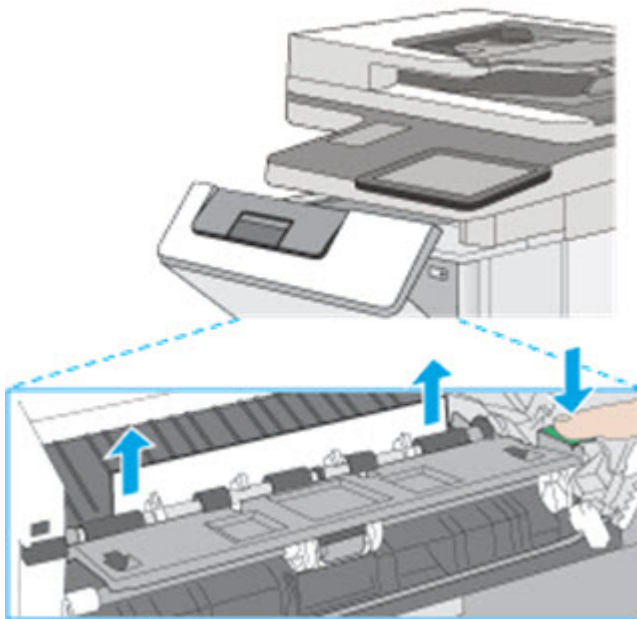

5. Reinsert the toner cartridge.

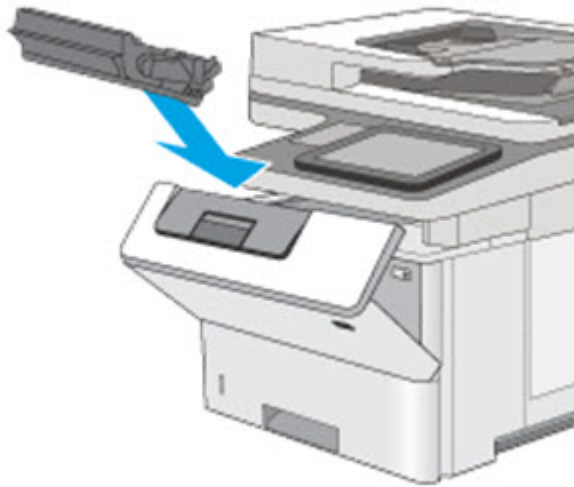

6. Close the front door.

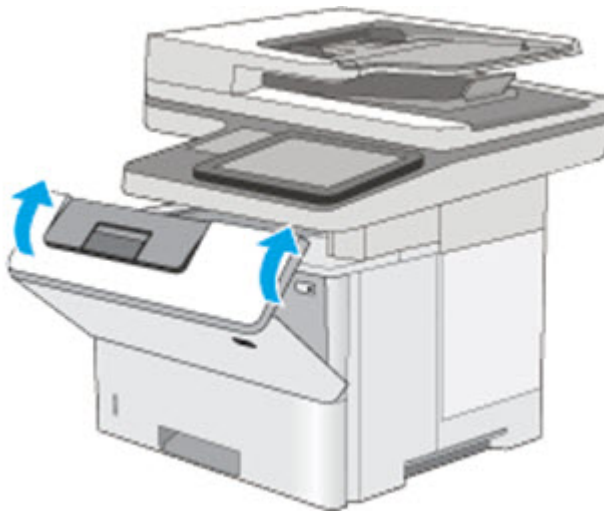


7. Verify that glossy paper is not being used.



NOTE: Glossy paper is not supported on this printer and will cause this issue. Please see [HP LaserJet Enterprise M506, MFP M527 - Supported paper sizes and types](#) for more information.

8. Verify that the tray guides have been set to the proper size and that the same size is reflected on the Configuration Page.

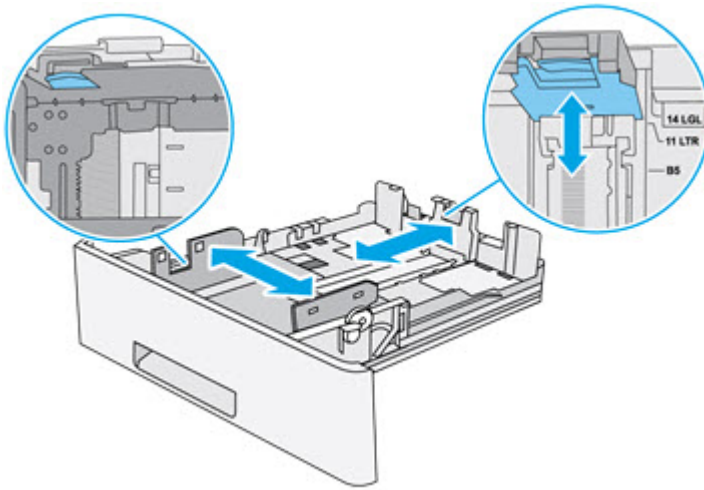


 **NOTE:** To print a Configuration Page from the front panel, select **ReportsConfiguration/Status PagesConfiguration Page**.

9. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
10. Check the page count of the printer. If it is above 100,000 pages replace the feed and separation rollers. The page count is listed on the Configuration Page.

Parts can be ordered at <https://parts.hp.com>.

Trays 2X Roller Kit part number: RM2-5752-000CN

11. Check for worn or damaged tray feed and separation rollers or separation pad. Replace the rollers as needed.

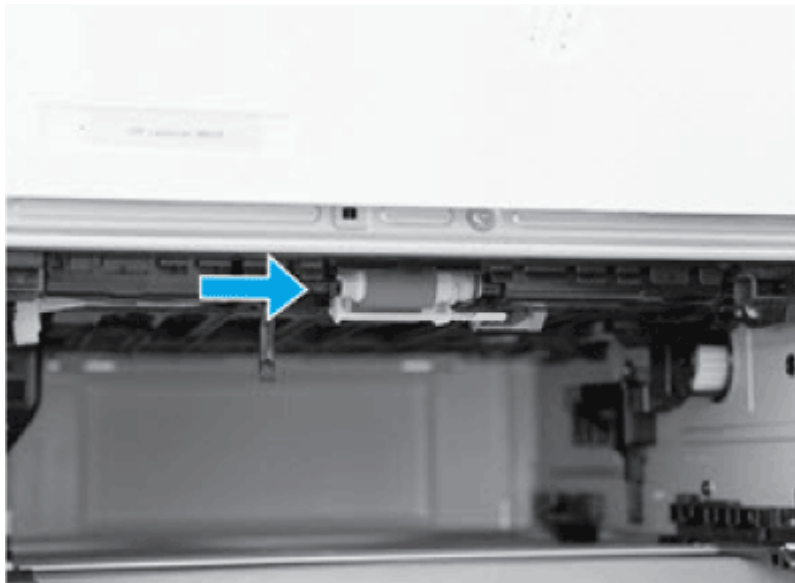

Parts can be ordered at <https://parts.hp.com>.

Trays 2X Roller Kit part number: RM2-5752-000CN

12. If the error persists, please contact customer support.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

View this video for more information. [How to Clear Paper Jams in the Toner-Cartridge Area for HP LaserJet Pro M501, Enterprise M50x, MFP/Flow M52x, Managed E50145, E52645](#)

1. Press the top-cover-release button on the left side of the printer.


Figure 6-25 Press the release button




2. Open the front door on the printer.




3. Remove the toner cartridge.

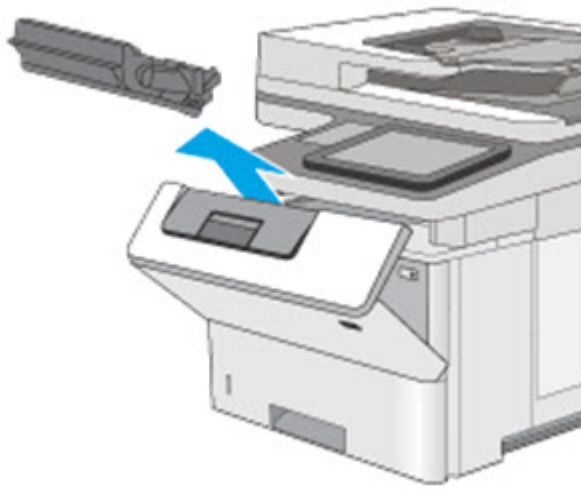


4. Lift the jam-access cover and slowly remove any jammed paper. Be careful not to tear the paper.

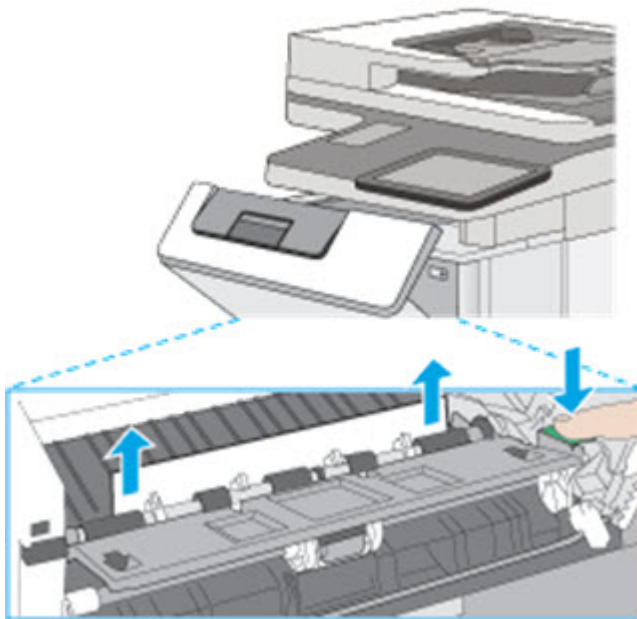

5. Reinsert the toner cartridge.

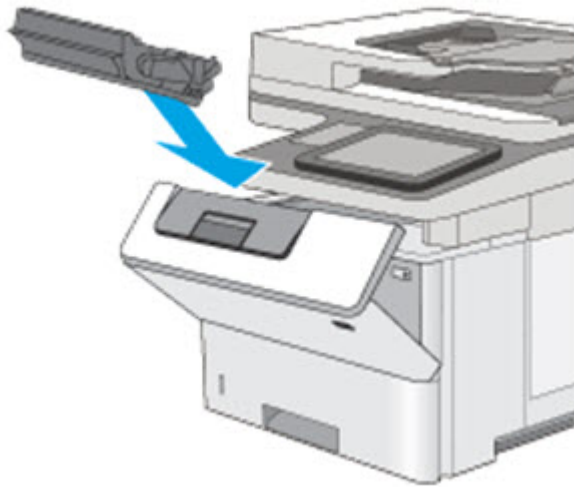

6. Close the front door.

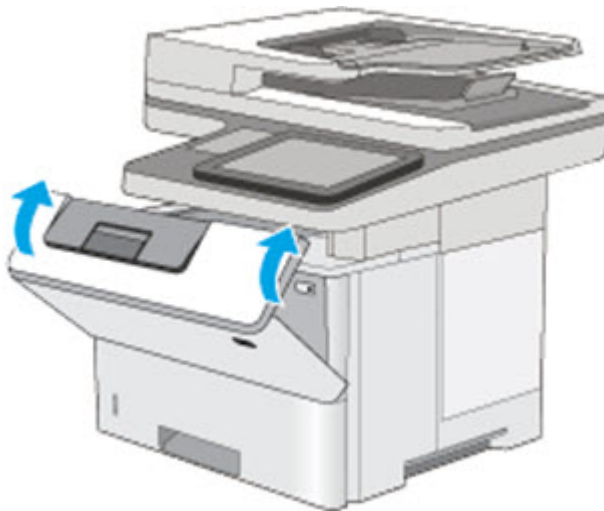


7. Verify that glossy paper is not being used.



NOTE: Glossy paper is not supported on this printer and will cause this issue. Please see [HP LaserJet Enterprise M506, MFP M527 - Supported paper sizes and types](#) for more information.

8. Verify that the tray guides have been set to the proper size and that the same size is reflected on the Configuration Page.

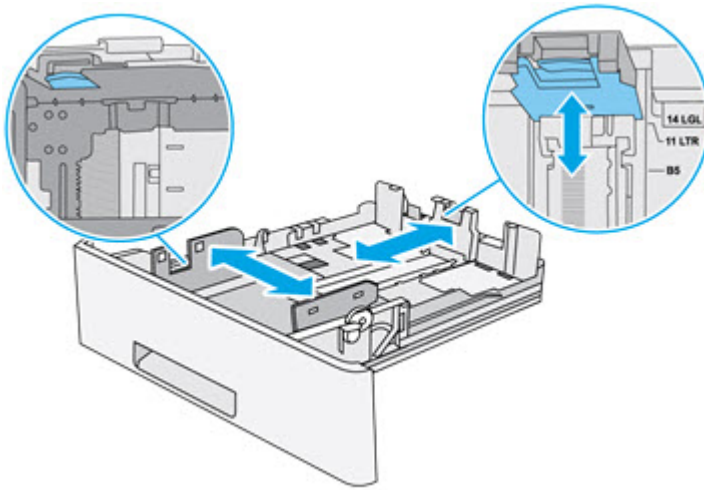


 **NOTE:** To print a Configuration Page from the front panel, select **ReportsConfiguration/Status PagesConfiguration Page**.

9. Ensure the type and quality of the paper being used meets the HP specifications for the printer.
10. Check the page count of the printer. If it is above 100,000 pages replace the feed and separation rollers. The page count is listed on the Configuration Page.

Parts can be ordered at <https://parts.hp.com>.

Trays 2X Roller Kit part number: RM2-5752-000CN

11. Check for worn or damaged tray feed and separation rollers or separation pad. Replace the rollers as needed.

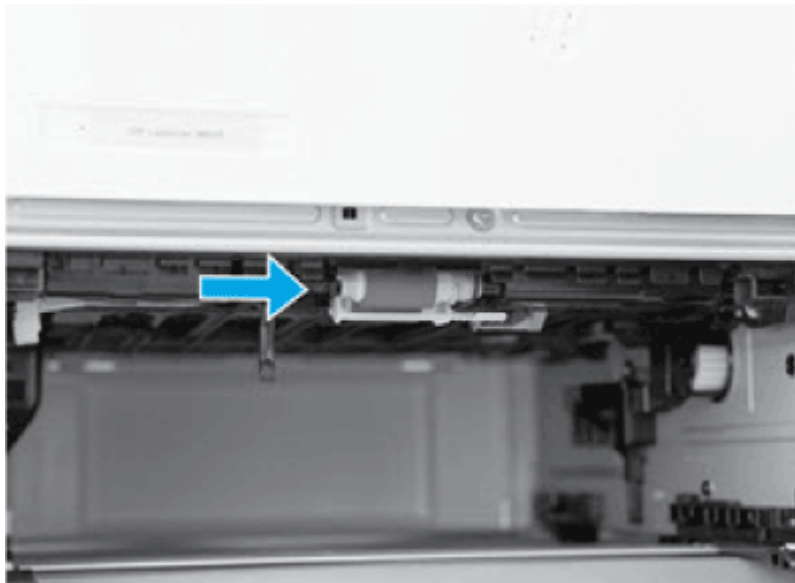

Parts can be ordered at <https://parts.hp.com>.

Trays 2X Roller Kit part number: RM2-5752-000CN

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

View this video for more information. [How to Clear Paper Jams in the Toner-Cartridge Area for HP LaserJet Pro M501, Enterprise M50x, MFP/Flow M52x, Managed E50145, E52645](#)

1. Open the top cover and check for paper jammed in the feed area.
2. Ensure the customer is not trying to print on glossy paper.

Glossy paper is not supported on this printer and will cause this issue.
3. Verify that the tray guides have been set to the proper size and that the same size is reflected on the Configuration Page.
4. Ensure the type and quality of the paper that the customer is using meets the HP specifications for the printer.
5. Check the page count of the printer. If it is above 100,000 pages replace the feed and separation rollers.

Part Number: RM2-5752-000CN

6. Check for worn or damaged tray feed and separation rollers, replace the rollers as needed.

Part Number: RM2-5752-000CN

7. Open the following menus:

- **Administration**
- **Troubleshooting**
- **Diagnostic Tests**

8. Test the top of page sensor (SR2) and the paper width sensors SR1a and SR2b.
9. If any of the sensors fail, elevate the issue using the Standard Support Process for a possible printer replacement.



NOTE: On-site technicians should check the following connections on the DC controller PCA to ensure they are properly seated and connected before elevating the issue. (J151, J110, J144)

10. If the sensors are functioning properly, run a few pages to check where the leading edge of the paper actually stops.
11. Check that the registration assembly is functioning correctly, if not replace the registration assembly.

Part Number (M501/M506/E50045/M527/E52545): RM2-5671-000CN

Part Number (M507/E50145/M528/E52645): RM2-2577-000CN

12. Check for a grinding or clunking noise when printing. If a noise is heard run the diagnostics on fuser and pickup motors. Capture a sound clip of the noise and attach to the case.

- a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
- b. Run the Component test for the fuser and the pickup motors. If either is making a grinding or clunking sound, replace the main motor.

Part number: RM2-9531-000CN

13 . B2 . E2 Jam in top cover

Paper jam in top cover at image area due to door open.

Recommended action

Follow these troubleshooting steps in the order presented.


1. Make sure that all of the doors and covers are closed and re-send the job.
2. If the error persists, please contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Make sure that all of the doors and covers are closed and re-send the job.
2. **M527/M528 MFP All Models & M506/M507 Duplex Models** - Ensure that the black plastic attached to the rear door is present. If it is broken or missing, replace the Rear Door Assembly.

Figure 6-26 Rear Door Assembly

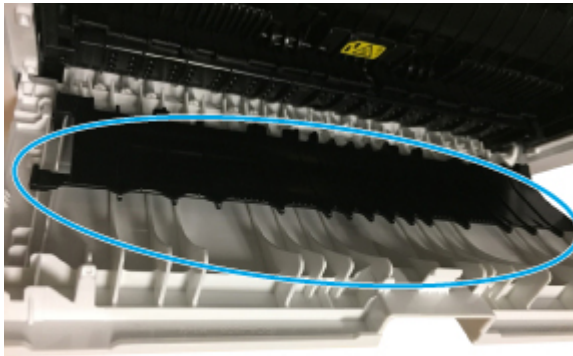

Door, rear (M501/M506/E50045/M507/E50145 duplex models) : RM2-5711-000CN

Door, rear (M501/M506/E50045/M507/E50145 simplex models): RM2-5712-000CN

Door, rear (M527/E52545/M528/E52645) : RM2-5711-000CN

For Instructions: See the Repair Service Manual for this product.

3. If all doors are closed and message still persists, Test SW2 top cover open detection switch using the diagnostic tests.

4. If the sensor fails the test, elevate the issue using the Standard Support Process for a possible printer replacement.



NOTE: On-site technicians should check the following connections on the DC controller PCA to ensure they are properly seated and connected before elevating the issue. (J151, J110, J144)

13 . B2 . FF Jam in top cover

Paper residual jam in top cover at image area.

Paper present at SR2 at power on or after clearing jam.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the top cover and check for paper jammed in feed area.
2. Check under the toner cartridge at the transfer area for any paper or obstructions.
3. If the error persists, please contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the top cover and check for paper jammed in feed area.
2. Check under the toner cartridge at the transfer area, make sure that everything is properly seated.
3. Test the top of page sensor (SR2).
4. If the sensor fails the test, elevate the issue using the Standard Support Process for a possible printer replacement.



NOTE: On-site technicians should check the following connections on the DC controller PCA to ensure they are properly seated and connected before elevating the issue. (J151, J110, J144)

13 . B9 . Az Fuser jam

Fuser delivery stay jam.

Paper stay jam at fuser area.

Paper present at SR13 after specified time limit.

This jam code can be caused by:

- An accordion paper jam at the fuser exit.
- Something blocking the paper before reaching the output rollers.
- The output bin rollers are not turning. Because there is very little distance from the fuser exit to the output bin, paper stopped at the rollers can cause a fuser jam.
- A sticky fuser exit flag. If the flag is stuck or even delayed momentarily in the activated position, it can cause this jam.

- When multiple pages are set for duplex printing, the Duplex paper delivery assembly component might also cause this error.
- **13.B9.A1**
Paper Stay jam is detected when printing from Tray 1.
- **13.B9.A2**
Paper Stay jam is detected when printing from Tray 2.
- **13.B9.A3**
Paper Stay jam is detected when printing from Tray 3.
- **13.B9.A4**
Paper Stay jam is detected when printing from Tray 4.
- **13.B9.A5**
Paper Stay jam is detected when printing from Tray 5.
- **13.B9.AD**
Paper Stay jam is detected when printing from the Duplexer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

 **CAUTION:** Be careful: the fuser is HOT. Allow it to cool if you need to remove debris from in and around the pressure heating components.

1. Open the top and rear covers and then clear any jammed paper.
2. Ensure that the paper meets HP printer specifications.
3. Make sure that the paper being printed on is not a glossy paper.
Glossy paper is not supported on this printer and will cause this issue.

4. Verify that the tray guides have been set to the proper size and that the same size is reflected on the Configuration Page.

Figure 6-27 Paper Tray guides


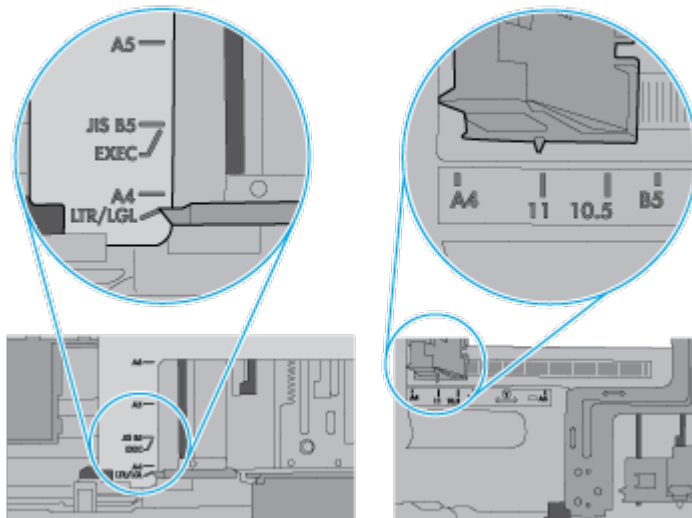


Figure 6-28 Paper Tray overfill guide

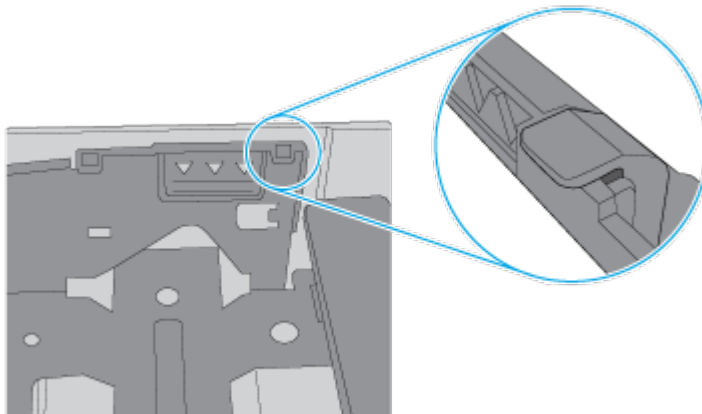

5. Verify in which of the following conditions a duplex print job causes a jam for all jobs:
(Duplex print job or Duplex printing means the printer supports printing on both sides of a paper.)
 - When using a single page for duplex printing.
 - or
 - When multiple pages are set for duplex printing.
6. Remove the toner cartridge and open the rear door and verify that there is no debris from a previous jam stuck in the fuser or the rollers leading into or out of the fuser.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.


 **CAUTION:** Be careful: the fuser is HOT. Allow it to cool if you need to remove debris from in and around the pressure heating components.

1. Open the top and rear covers and then clear any jammed paper.
2. Ensure sure that the paper meets HP printer specifications.
3. Ensure the customer is not trying to print on glossy paper.

Glossy paper is not supported on this printer and will cause this issue.
4. Ensure that the customer has verified that the tray guides have been set to the proper size and that the same size is reflected on the Configuration Page.
5. Identify if the jam occurs during duplex print jobs (or duplex printing).
6. Check if the jam occurs when multiple sheets of paper are set for duplex printing.
7. If the paper jam occurs for multiple page duplex jobs, replace the duplex paper delivery assembly for M527/M528 MFP All Models and M506/M507 Duplex Models.
 - Part number for Duplex paper delivery assembly: RM2-5683-000CN
 - For instructions to remove and replace a part, refer the Service Repair manual: [pdf_584095_en-US-6.pdf](#)
8. Check if the error persists after replacing the duplex paper assembly
 - If the error does not persist, there is no need to continue troubleshooting.
 - If the error persists, see the next step.
9. Check the fuser delivery sensor for proper functionality and movement.
10. Remove the toner cartridge and open the rear door and verify that there is no debris from a previous jam stuck in the fuser or the rollers leading into or out of the fuser.
11. Confirm the output bin rollers are turning.

12. For **M527/M528 MFP All Models and M506/M507 Duplex Models** - Ensure that the black plastic attached to the rear door is present. If it is broken or missing, replace the rear door assembly.

Figure 6-29 Rear Door Assembly

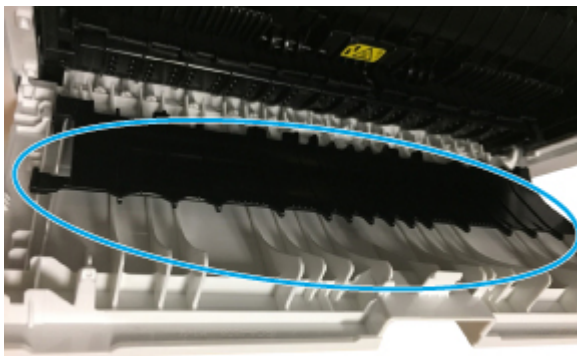

Door, rear (M501/M506/E50045/M507/E50145 duplex models) : RM2-5711-000CN

Door, rear (M501/M506/E50045/M507/E50145 simplex models): RM2-5712-000CN

Door, rear (M527/E52545/M528/E52645) : RM2-5711-000CN

For Instructions: , refer the Repair Service Manual for this product.

13. Perform a Manual Sensor Test and check SR13 the fuser delivery sensor. If found faulty then replace the fuser assembly.

Table 6-15 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

For instructions : , see the Repair Service Manual for this product.

13 .B9 .Bz Fuser Jam

A multifeed jam has occurred ion the fuser.

- **13.B9.B1**

Paper multifeed jam is detected when printing from Tray 1.

- **13.B9.B2**

Paper multifeed jam is detected when printing from Tray 2.

- **13.B9.B3**

Paper multifeed jam is detected when printing from Tray 3.

- **13.B9.B4**

Paper multifeed jam is detected when printing from Tray 4.

- **13.B9.B5**

Paper multifeed jam is detected when printing from Tray 5.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

⚠ CAUTION: Be careful: the fuser is HOT. Allow it to cool if you need to remove debris from in and around the pressure heating components.

1. Open the top and rear covers and then clear any jammed paper.
2. Ensure that the paper meets HP printer specifications.
3. Make sure that the paper being printed on is not a glossy paper.
Glossy paper is not supported on this printer and will cause this issue.
4. Verify that the tray guides have been set to the proper size and that the same size is reflected on the Configuration Page.

Figure 6-30 Paper Tray guides


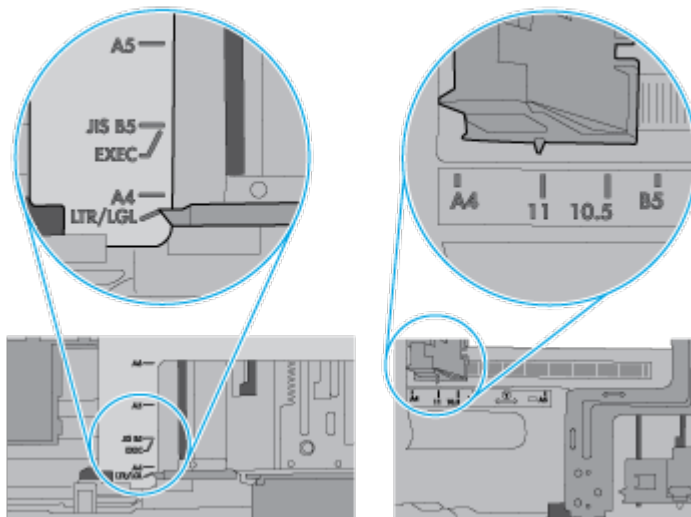


Figure 6-31 Paper Tray overfill guide

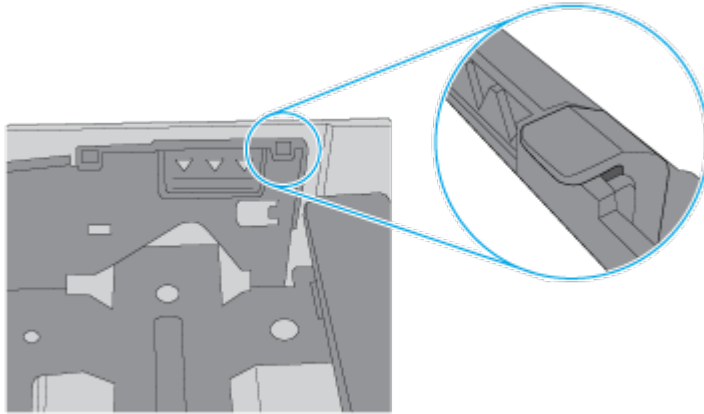

5. Remove the toner cartridge and open the rear door and verify that there is no debris from a previous jam stuck in the fuser or the rollers leading into or out of the fuser.
6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians


Follow these troubleshooting steps in the order presented.

⚠ CAUTION: Be careful: the fuser is HOT. Allow it to cool if you need to remove debris from in and around the pressure heating components.

1. Open the top and rear covers and then clear any jammed paper.
2. Ensure sure that the paper meets HP printer specifications.
3. Ensure the customer is not trying to print on glossy paper.
Glossy paper is not supported on this printer and will cause this issue.
4. Ensure that the customer has verified that the tray guides have been set to the proper size and that the same size is reflected on the Configuration Page.
5. Check the fuser delivery sensor for proper functionality and movement.
6. Remove the toner cartridge and open the rear door and verify that there is no debris from a previous jam stuck in the fuser or the rollers leading into or out of the fuser.
7. Confirm the output bin rollers are turning.

8. For **M527/M528 MFP All Models and M506/M507 Duplex Models** - Ensure that the black plastic attached to the rear door is present. If it is broken or missing, replace the rear door assembly.

Figure 6-32 Rear Door Assembly

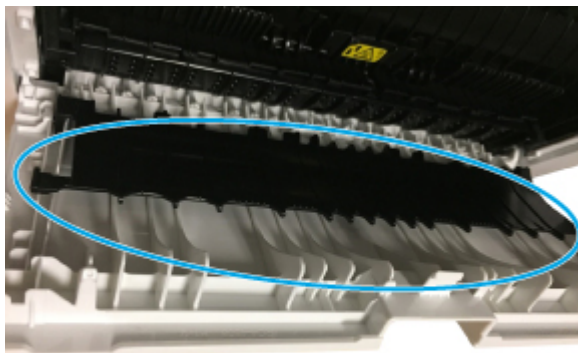

Door, rear (M501/M506/E50045/M507/E50145 duplex models) : RM2-5711-000CN

Door, rear (M501/M506/E50045/M507/E50145 simplex models): RM2-5712-000CN

Door, rear (M527/E52545/M528/E52645) : RM2-5711-000CN

For Instructions: , refer the Repair Service Manual for this product.

9. Perform a Manual Sensor Test and check SR13 the fuser delivery sensor. If found faulty then replace the fuser assembly.

Table 6-16 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

For instructions : , see the Repair Service Manual for this product.

13.B9.Cz

Fuser wrap jam.

This jam occurs when the paper disappears from the fuser output sensor before a designated amount of time after the paper reached the fuser output sensor (SR13).

(The printer has determined that the paper is being wrapped around the fuser roller.)

Z = Fuser mode

- **13.B9.C1 (event code)**

Fuser wrap jam when **Auto Sense (Normal)**.

- **13.B9.C2 (event code)**
Fuser wrap jam when **Normal**.
- **13.B9.C3 (event code)**
Fuser wrap jam when **Light 1** or **Light 2** (see event log secondary jam information for specific code).
- **13.B9.C4 (event code)**
Fuser wrap jam when **Heavy 1**.
- **13.B9.C5 (event code)**
Fuser wrap jam when **Heavy 2**.
- **13.B9.C6 (event code)**
Fuser wrap jam when **Heavy paper 3**.
- **13.B9.CB (event code)**
Fuser wrap jam when **Transparency**.
- **13.B9.CC (event code)**
Fuser wrap jam when **Label**.
- **13.B9.CD (event code)**
Fuser wrap jam when **Envelope 1** or **Envelope 2** (see event log secondary jam information for specific code).

Recommended action for customers

Follow these troubleshooting steps in the order presented.

 **CAUTION:** Be careful: the fuser is HOT. Allow it to cool if you need to remove debris from in and around the pressure heating components.

1. Open the top and rear covers and then clear any jammed paper.
2. Ensure that the paper meets HP printer specifications.
3. Make sure that the paper being printed on is not a glossy paper.
Glossy paper is not supported on this printer and will cause this issue.

4. Verify that the tray guides have been set to the proper size and that the same size is reflected on the Configuration Page.

Figure 6-33 Paper Tray guides


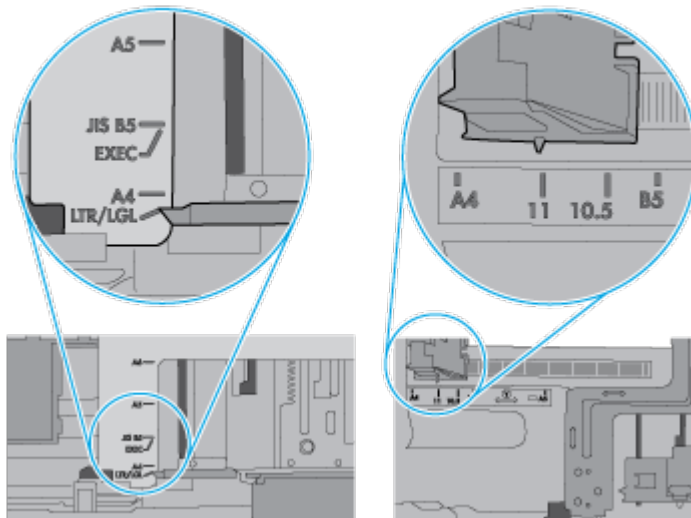


Figure 6-34 Paper Tray overfill guide

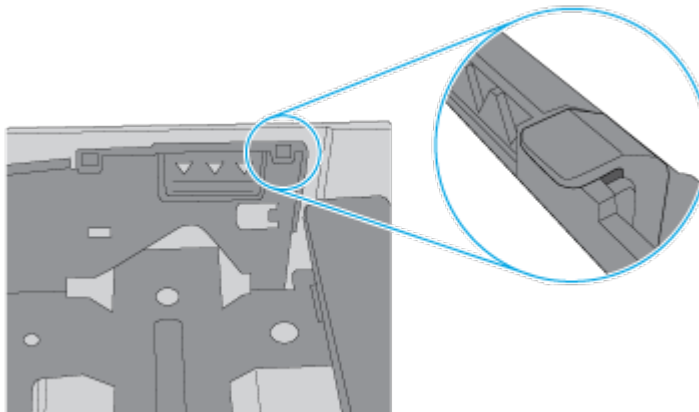

5. Remove the toner cartridge and open the rear door and verify that there is no debris from a previous jam stuck in the fuser or the rollers leading into or out of the fuser.
6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the top and rear covers and then clear any jammed paper.
2. Ensure sure that the paper meets HP printer specifications.

If the customer paper is within specifications, but curls up on the output bin, you can recommend:

- Open input tray and rotate new paper so the top page is now the bottom page.

- Explain that the paper curls and it is better if it curls down than up for printing to avoid fuser wrap jams.
3. Check to see if the paper jam is found wrapped around the fuser roller. If so and the paper is within HP specifications for this printer replace the fuser assembly.

Table 6-17 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

See the Repair Service Manual for this product.

13.B9.Dz

Fuser delivery delay jam.

Paper did not reach Fuser sensor SR13 specified time.

- **13.B9.D1**

Fuser delivery delay jam when printing from Tray 1.

- **13.B9.D2**

Fuser delivery delay jam when printing from Tray 2.

- **13.B9.D3**

Fuser delivery delay jam when printing from Tray 3.

- **13.B9.D4**

Fuser delivery delay jam when printing from Tray 4.

- **13.B9.D5**

Fuser delivery delay jam is detected when printing from Tray 5.

- **13.B9.DD**

Fuser delivery delay jam when printing with the Duplexer.

The following are possible causes and areas that should be investigated.

- The paper jam is found wrapped around the fuser roller. In this case it is a sign of a worn out fuser.
- The paper jam is found underneath the toner cartridge or in the transfer area. In this case it could be the drum drive or the white collar that holds the toner cartridge in position has broken or even a damaged or defective toner cartridge.
- Fuser drive or fuser delivery issue.

- The Duplex paper delivery assembly component might also cause this error when multiple pages are set for duplex printing.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

⚠ CAUTION: Be careful: the fuser is HOT. Allow it to cool if you need to remove debris from in and around the pressure heating components.

1. Open the top and rear covers and then clear any jammed paper.
2. Ensure that the paper meets HP printer specifications.
3. Make sure that the paper being printed on is not a glossy paper.

Glossy paper is not supported on this printer and will cause this issue.

4. Verify that the tray guides have been set to the proper size and that the same size is reflected on the Configuration Page.

Figure 6-35 Paper Tray guides


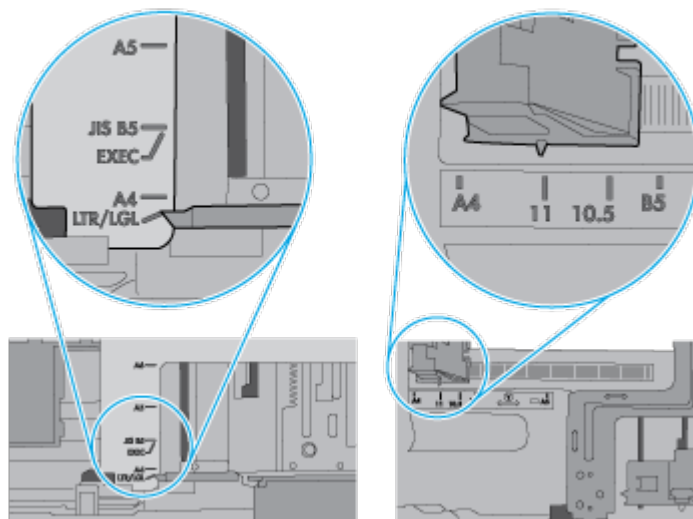


Figure 6-36 Paper Tray overfill guide

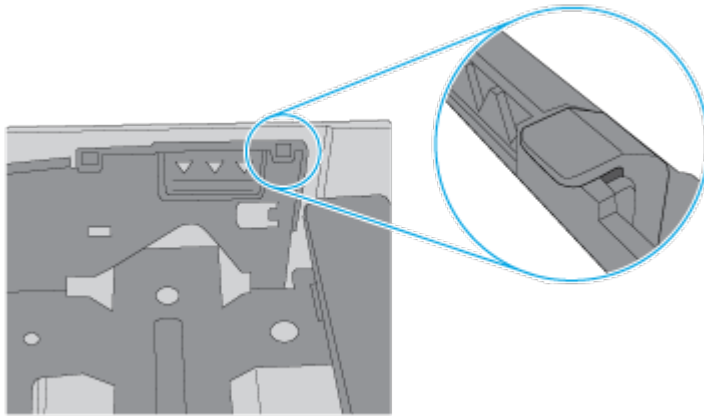

5. Verify in which of the following conditions a duplex print job causes a jam for all jobs:
(Duplex print job or Duplex printing means the printer supports printing on both sides of a paper.)
 - When using a single page for duplex printing.
 - or
 - When multiple pages are set for duplex printing.
6. Remove the toner cartridge and open the rear door and verify that there is no debris from a previous jam stuck in the fuser or the rollers leading into or out of the fuser.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Determine where the jam is located.

Follow these troubleshooting steps in the order presented.

1. Open the top cover and check under the toner cartridge for paper or debris.
2. Open the rear output bin and check for paper or obstructions.

Paper stopped in the toner/transfer area (stopped before the fuser)

Follow these troubleshooting steps in the order presented.

1. Open the top cover and check under the toner cartridge for paper or obstructions.
2. Ensure the toner cartridge and transfer roller are seated properly. If damaged replace the toner cartridge or the transfer roller.

Transfer roller part number: RM2-2039-000CN
3. Check the toner cartridge guides and the transfer roller assembly. If either are damaged elevate the issue using the Standard Support Process for a possible printer replacement.
4. Inspect the white plastic collar that cradles the drum cartridge that is positioned around the drum drive gear. If the collar portion is broken and/or missing a section it will allow the cartridge to insert further than designed to and not allow the drum drive to engage with the toner cartridge. elevate the issue using the Standard Support Process for a possible printer replacement.

5. If the collar is not broken, test the main drive motor using the diagnostic test. If the test fails, elevate the issue using the Standard Support Process for a possible printer replacement.

Paper stopped in or at the fuser

Follow these troubleshooting steps in the order presented.

CAUTION: Be careful: the fuser is HOT. Allow it to cool if you need to remove debris from in and around the pressure heating components.

1. Remove the fuser and inspect the fuser sleeve, pressure roller and the delivery roller for blockage and/or damage. Replace the fuser as needed.

Table 6-18 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

See the Repair Service Manual for this product.

2. Verify that the fuser inlet guide is not detached or broken. Replace the fuser as needed.
3. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
4. Test the fuser delivery sensor (SR13) using the manual sensor test. Verify the sensor is functioning correctly. If it is not, replace the fuser.
5. Run the fuser motor drive test to verify that the fuser drive and gears are functioning correctly. If they are not, elevate the issue using the Standard Support Process for a possible printer replacement.

Paper did not stop in the fuser or at the toner/transfer area

Follow these troubleshooting steps in the order presented.

1. Check the paper path between the transfer area and the fuser.
2. If the paper has stopped in this area and will not progress beyond the feed-guide assembly clean the area and retest. If issue persists, elevate the issue using the Standard Support Process for a possible printer replacement.

Paper stopped after exiting the fuser

Follow these steps to resolve a **13.B2.D2** error.

1. Open the top cover and check under the toner cartridge for paper or obstructions.
2. Ensure the toner cartridge and transfer roller are seated properly. If damaged replace the toner cartridge or the transfer roller.

Transfer roller part number: RM2-2039-000CN

3. Check the toner cartridge guides and the transfer roller assembly, If either are damaged elevate the issue using the Standard Support Process for a possible printer replacement.
4. Identify if the jam occurs during duplex print jobs (or duplex printing).
5. Check if the jam occurs when multiple sheets of paper are set for duplex printing.
6. If the paper jam occurs for multiple page duplex jobs, replace the duplex paper delivery assembly for M527/M528 MFP All Models and M506/M507 Duplex Models.
 - Part number for Duplex paper delivery assembly: RM2-5683-000CN
 - For instructions to remove and replace a part, refer the Service Repair manual: [pdf_584095_en-US-6.pdf](#)
7. If the error persists after replacing the duplex paper assembly and if the printer is under warranty, elevate the issue using the Standard Support Process.

13.B9.FF

Residual paper jam at the fuser output sensor.

Paper present at SR13 after specified time limit or on power up.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

 **CAUTION:** Be careful: the fuser is HOT. Allow it to cool if you need to remove debris from in and around the pressure heating components.

1. Open the top and rear covers and then clear any jammed paper.
2. Ensure that the paper meets HP printer specifications.
3. Make sure that the paper being printed on is not a glossy paper.

Glossy paper is not supported on this printer and will cause this issue.

4. Verify that the tray guides have been set to the proper size and that the same size is reflected on the Configuration Page.

Figure 6-37 Paper Tray guides


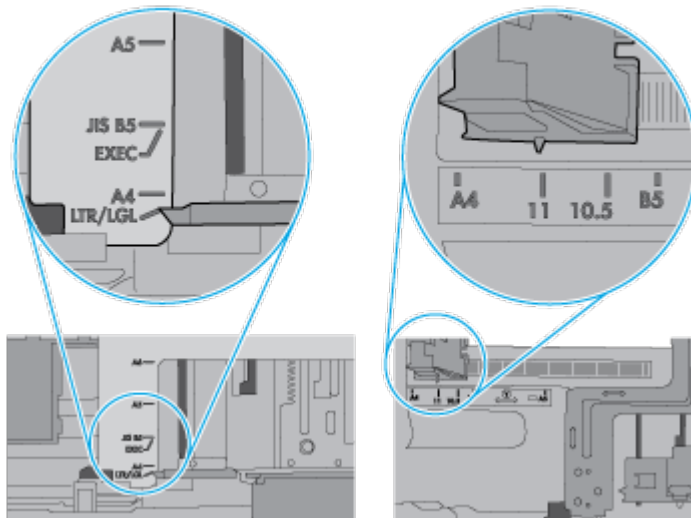


Figure 6-38 Paper Tray overfill guide

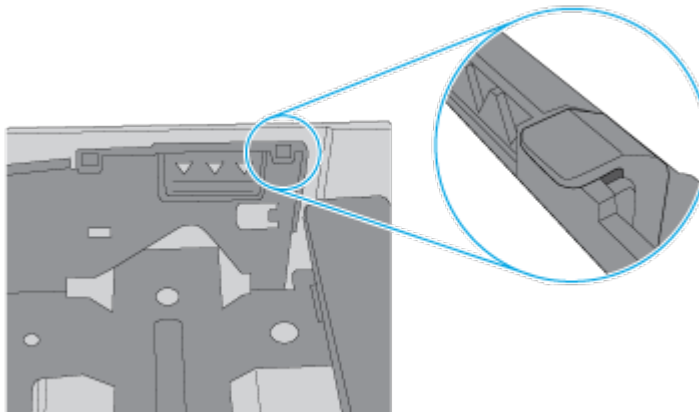

5. Remove the toner cartridge and open the rear door and verify that there is no debris from a previous jam stuck in the fuser or the rollers leading into or out of the fuser.
6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the top and rear cover and clear the jam in the indicated area.
2. Close the covers to allow the printer to attempt to clear the jam.
3. Verify the paper meets the HP specification for the printer.

4. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
5. Test the fuser delivery sensor (SR13) using the manual sensor test. Verify the sensor is functioning correctly. If it is not, replace the fuser.

Table 6-19 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

See the Repair Service Manual for this product.

6. Run the fuser motor drive test to verify that the fuser drive and gears are functioning correctly. If they are not, elevate the issue using the Standard Support Process for a possible printer replacement.
7. Remove the fuser and inspect the fuser sleeve, pressure roller, and delivery roller for blockage and/or damage. Replace the fuser as needed.

Table 6-20 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

For instructions: See the Repair Service Manual for this product.

13.D3.yz

The paper jammed while attempting to duplex.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Make sure that the customer is using a HP genuine cartridge. Retest with another working or new cartridge.


2. Verify the media meets HP specification for the printer.



NOTE: Glossy Media is NOT supported on this printer.

3. Perform the continuous test in simplex mode at least 50 pages to make sure that issue is occurring while printing duplex printing only.
4. Send duplex jobs from multiple trays to see if the issue is TRAY specific or not. If the jam occurs from a specific tray, troubleshoot pick and feed issues for that tray.
5. Make sure the tray is set-up correctly through the control panel. If the the tray is set to ANY Size ANY Type, set it to the specific size and type the customer is trying to print on.
6. Check and clean the status charge eliminator; it is located next to the transfer roller.
7. Ensure all the connections to the duplexer on the DC controller are properly seated, but **DO NOT** replace the DC controller.
8. Ensure that the black plastic guide attached to the rear door assembly is present. If it is broken or missing, replace the rear door assembly.

Part number: RM2-5726-000CN

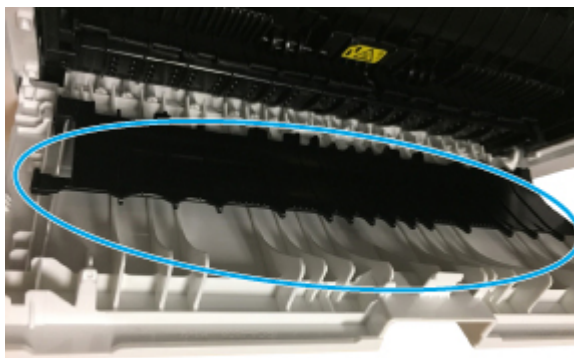

9. If the issue persists, elevate the issue using the Standard Support Process.

13.D3.FF

Power on jam, duplex refeed sensor.

A residual jam is detected at the duplex refeed sensor at power on or after clearing printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Go to the following support document and follow the instructions: [HP LaserJet Enterprise MFP M527 - 13.D3 jam error in the duplexer](#).
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents


Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Troubleshoot the error by following the instructions in this document: [HP LaserJet Enterprise MFP M527 - 13.D3 jam error in the duplexer](#).
3. Ensure that the duplex refeed sensor moves freely.

If the printer has been turned on its side or service performed the sensor flag could have become dislodged causing the power on jam.

- a. Remove tray 2 (cassette tray) from the printer.
- b. Press on the green latch on the right side of the roller to release the duplex pan.
- c. Check if the lever behind the roller is not stuck and can move freely.

Figure 6-39 Duplex refeed sensor

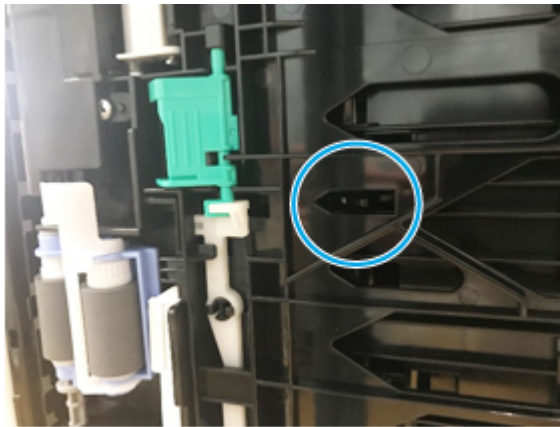

4. If the error persists, dispatch a service technician to clean the sensor correctly.



NOTE: The sensor cannot be replaced.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ensure that the duplex refeed sensor moves freely.




NOTE: If the printer has been turned on its side or service performed, the sensor flag could be dislodged causing the power on jam.

- a. Remove tray 2 (cassette tray) from the printer.
- b. Turn the printer on to its side to view the tray pick/feed area and duplex sensor.

- c. Ensure the duplex refeed sensor moves freely and is not dislodged.

Figure 6-40 Duplex refeed sensor

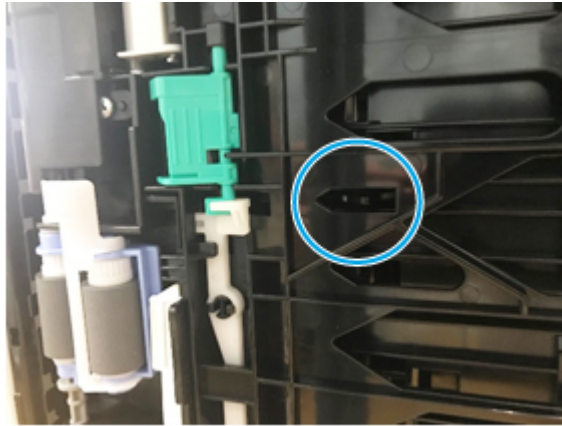

- d. If the sensor is adjusted, test the printer to verify functionality.
2. If the sensor moves freely, check connector J141 on the DC Controller to ensure it is seated correctly and not damaged.
3. If the error persists, clean the sensor using a small clean swab or blow air carefully to remove any dust particles.



NOTE: Paper and toner dust might block the sensor windows.

4. If the error persists, replace the DC Controller.

Use the following table to order the correct part number for simplex or duplex printer models.

Table 6-21 DC Controller part numbers

Printer models	Part description	Part number
M501dn/ M501n	DC controller PCA	RM2-8711-030CN
M506	For duplex models - DC controller PC board assembly (PCA)	RM2-8612-000CN
M527		
E52545		
M506	For simplex models - DC controller PC board (PCA)	RM2-8614-000CN
E50045		
M507	For duplex models - DC controller PC board assembly (PCA)	RM3-7475-010CN
M528		
E52645		
M507	For simplex models - DC controller PC board assembly (PCA)	RM3-7476-000CN
E50145		

For instructions: See the Repair Service Manual for this product.

5. If the error persists after replacing the DC Controller, follow the standard process to escalate the error.

13.E5.FF

A power on jam has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check the printer for a paper jam. Check all the sensor locations and the complete paper path.
2. Use the manual sensors test or Tray/Bin manual sensors test to isolate a faulty door switch or sensor.

13.EA.FF

A door jam has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check the printer for a paper jam. Check all the sensor locations and the complete paper path.
2. Use the manual sensors test or Tray/Bin manual sensors test to isolate a faulty door switch or sensor.

13.FF.EE

A power on jam has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check the printer for a paper jam. Check all the sensor locations and the complete paper path.
2. Use the manual sensors test or Tray/Bin manual sensors test to isolate a faulty door switch or sensor.

13.EE.FF

A door jam has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check the printer for a paper jam. Check all the sensor locations and the complete paper path.
2. Use the manual sensors test or Tray/Bin manual sensors test to isolate a faulty door switch or sensor.

13.FF.FF

A power on residual paper jam has occurred.

This error has no specific sensor designated. It could be any sensor in the paper feed path.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check the printer for a paper jam.
2. Look for paper present or obstructions in the paper path.
View the event log to determine if other jam errors are occurring and troubleshoot those errors.
3. Use the manual sensors test or Tray/Bin manual sensors test to isolate a faulty door switch or sensor.
4. Replace parts as determined by sensor tests or obstructions.

If sensor can not be replaced, elevate the issue for a possible printer replacement.

20.XX.YZ error messages

20.* errors

Errors in the 20.* family are related to the printer memory. The page might require more memory than the printer has available.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the **OK** button to continue.
2. Reduce the page complexity.
3. Add product memory.

20 . 00 . 00 Insufficient memory <device>

The printer does not have enough memory to print the page.

Event log message 20.00.00.

The printer received more data than can fit in the available memory. You might have tried to transfer too many macros, soft fonts, or complex graphics.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to print the transferred data. Some data might be lost. Reduce the page complexity or add printer memory.

21.XX.YZ error messages

21 . 00 . 00 Page Too ComplexEvent log error message 21 . 00 . 00

The printer displays this message to indicate that the page decompression process was too slow for the printer.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to continue. There might be some data loss on the page that was being formatted when the error occurred.

30.XX.YZ error messages

30.* errors

Errors in the 30.* family are related to the flatbed scanner.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Calibrate the scanner. Open these menus: [Device Maintenance > Calibrate-Cleaning > Calibrate Scanner](#).
2. Clean the scanner glass and glass strips.
3. Perform the tests for scanner diagnostics. Open these menus: [Administration > Troubleshooting > Diagnostic Tests > Scanner Tests](#).
4. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

5. Check all connections on the scanner control board and from the scanner control board to the formatter and the DC controller or the engine control board. If all connections are good, replace the scanner control board.
6. Replace the formatter.
7. If the error persists, replace the scanner assembly.

30 . 01 . 01

The flatbed cover sensor was interrupted.

The scanner flatbed cover is open.

This message appears only in the event log and is not posted on the control panel.

The control panel will read **Flatbed Cover Open**.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.



NOTE: This error message should automatically clear.

1. If the error message reoccurs or will not clear from the control panel, check the sensor in the flatbed assembly is damaged or stuck.
2. Access the [Manual Sensor Test](#) on the printer control panel to verify the functionality of the [Flatbed cover](#) sensor.
 - a. From the Home screen on the control panel, scroll to and touch [Administration](#) (FutureSmart 3 firmware) or [Support Tools](#) (FutureSmart 4 firmware).




NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.

- b. Open the following menus: **Troubleshooting > Diagnostics > Manual Sensor Test**.

- c. Select **Flatbed cover**.

Figure 6-41 Flatbed cover option in Manual Sensor Test menu on the printer control panel

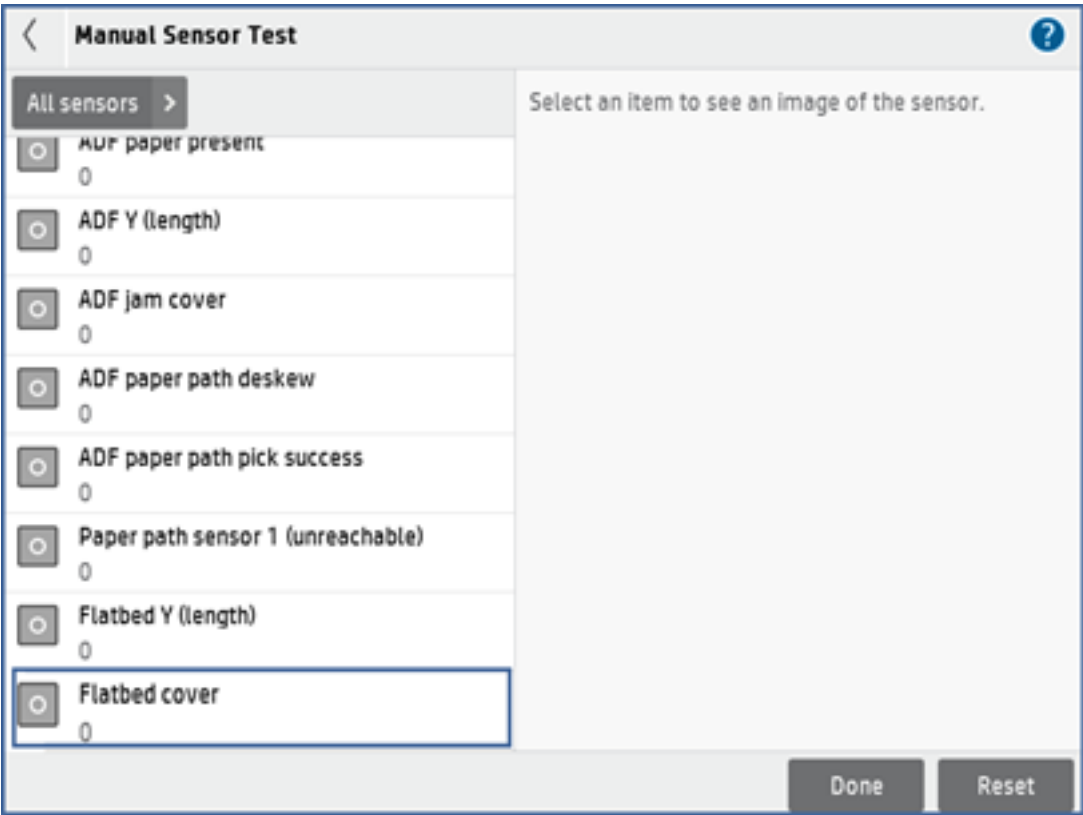

- d. Open and close the flatbed cover.



NOTE: The Flatbed cover sensor counter under the sensor name should increment by one (from "0" to "1", for example) each time the cover is opened or closed.

- e. Check the control panel display to verify the sensor is activated and incremented by one each time you open and close the flatbed cover.
3. If the flatbed cover sensor is not activated/triggered and the counter is not incremented, replace the image scanner assembly.

Table 6-22 Kit-Image Scanner Whole Unit (Image scanner assembly) part number

Part description	Part number
Image scanner assembly (includes white backing and retention clips)	F2A76-67914

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: This error message should automatically clear.


1. If the error message reoccurs or will not clear from the control panel, check the sensor in the flatbed assembly is damaged or stuck.
2. To verify if the flatbed cover sensor is damaged and to check the functionality of the sensor, access the [Manual Sensor Test](#) on the printer control panel.
 - a. From the Home screen on the control panel, scroll to and touch [Administration](#) (FutureSmart 3 firmware) or [Support Tools](#) (FutureSmart 4 firmware).



NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.

- b. Open the following menus: **Troubleshooting > Diagnostics > Manual Sensor Test** .
- c. Select [Flatbed cover](#).

Figure 6-42 Flatbed cover option in Manual Sensor Test menu on the printer control panel

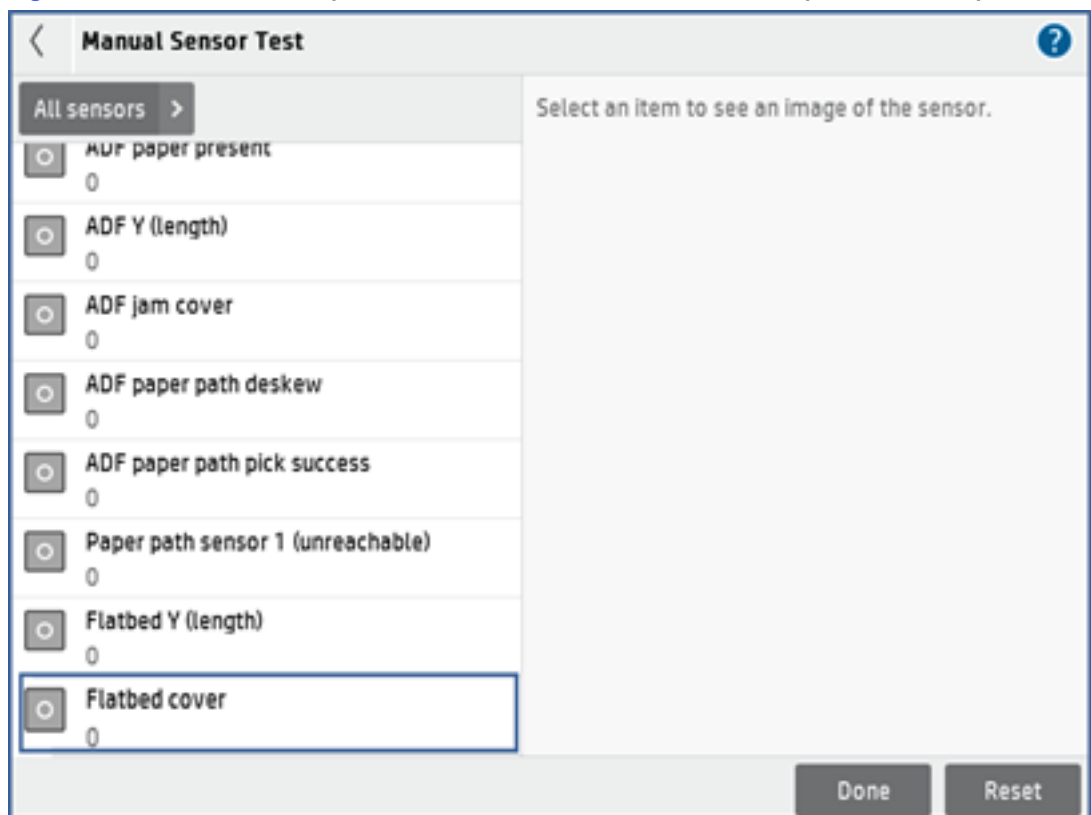

- d. Open and close the flatbed cover.



NOTE: The Flatbed cover sensor counter under the sensor name should increment by one (from "0" to "1", for example) each time the cover is opened or closed.

- e. Check the control panel display to verify the sensor is activated and incremented by one each time you open and close the flatbed cover.

3. If the flatbed cover sensor is not activated/triggered and the counter is not incremented, replace the image scanner assembly.

Table 6-23 Kit-Image Scanner Whole Unit (Image scanner assembly) part number

Part description	Part number
Image scanner assembly (<i>includes white backing and retention clips</i>)	F2A76-67914

For instructions: See the Repair Service Manual for this product.

4. If the error persists, check the cables on the scanner control board (SCB) for loose connections. Attempt to disconnect and reconnect all the cables on the SCB.

Figure 6-43 Scanner control board (SCB) connections

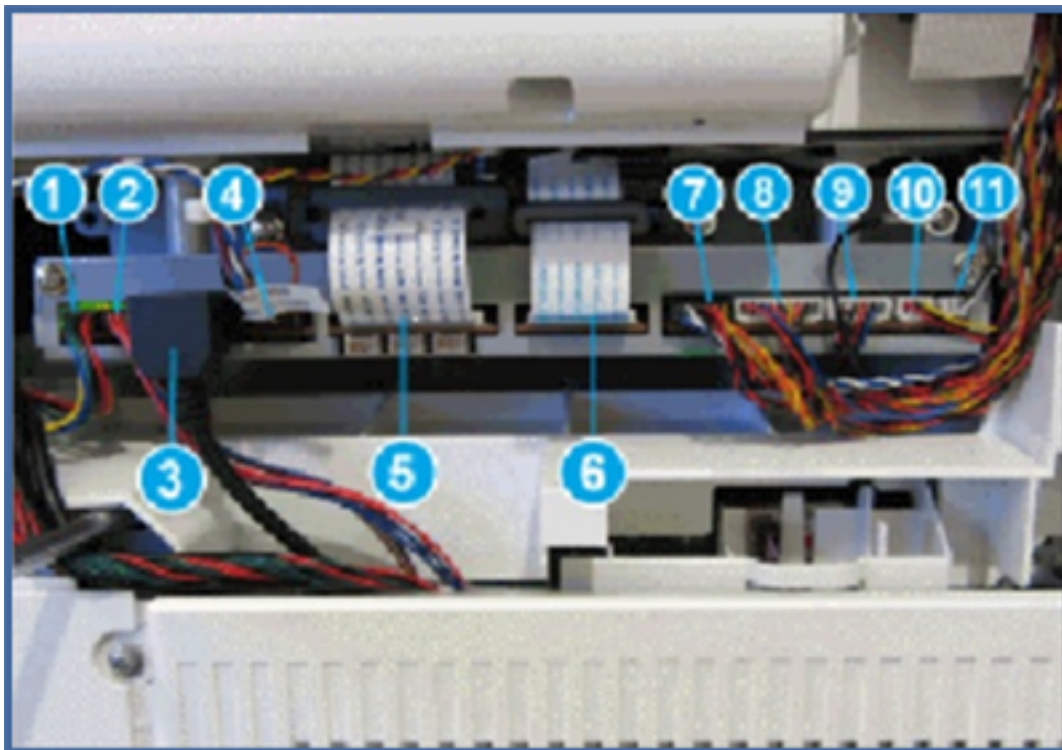


Table 6-24 Scanner control board (SCB) connections callout descriptions

Callout	Description
1	Staple power
2	SCB power (24v)
3	Cable, PAB to SCAM communication (HDMI)
4	Flatbed sensors (Document feeder open and flatbed paper length-and cave LED)
5	Flatbed (S1) flat flexible cable (scanner data and flatbed motor)
6	Document feeder (S2) flat flexible cable (Scanner data)

Table 6-24 Scanner control board (SCB) connections callout descriptions (continued)

Callout	Description
7	Document feeder motors (Feed and deskew)
8	Document feeder sensors (Prescan, Paper present receiver and top hatch)
9	Document feeder ultra sonic sensor receiver and deskew sensor
10	Letter/Legal (LTR/LGL) Input tray sensor
11	Ultra sonic sensor transmitter

5. Ensure that all the cables on the SCB are connected and seated correctly before replacing any part.
6. If the error persists, replace the scanner control board (SCB).

Table 6-25 Scanner control board assembly part number

Part description	Part number
Scan control PC board assembly part number	B5L47-67903

For instructions: See the Repair Service Manual for this product.

30 . 01 . 08 Home position error

The scanner optic failed to return to the home position.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page to check if the latest version of the printer firmware is installed.

If the latest printer firmware version is not installed, update the firmware.

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware* (ish_4158468-4158516-16).

3. Observe the movement of the optics assembly.
4. If the error persists (optics assembly fails to move correctly) after the firmware update, perform a Continuous Scan diagnostic test using the printer control panel to test the functionality of the scan optics.


- a. From the Home screen on the control panel, scroll to and touch [Support Tools](#) (FutureSmart 4 firmware).



NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.


- b. Open the following menus: **Troubleshooting > Diagnostic Tests**.
- c. Select [Continuous Scan](#).

Figure 6-44 Continuous Scan option in the Diagnostic Tests menu

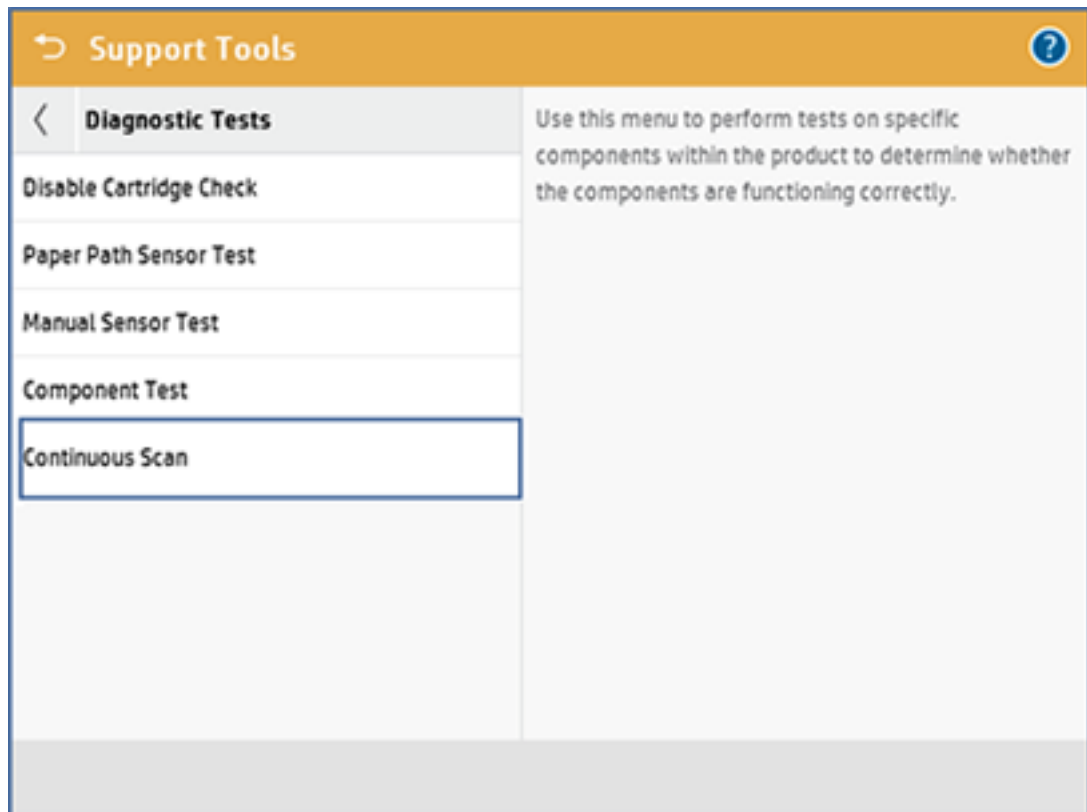

- d. Select **Start** to run the test.

Figure 6-45 Start the Continuous Scan test

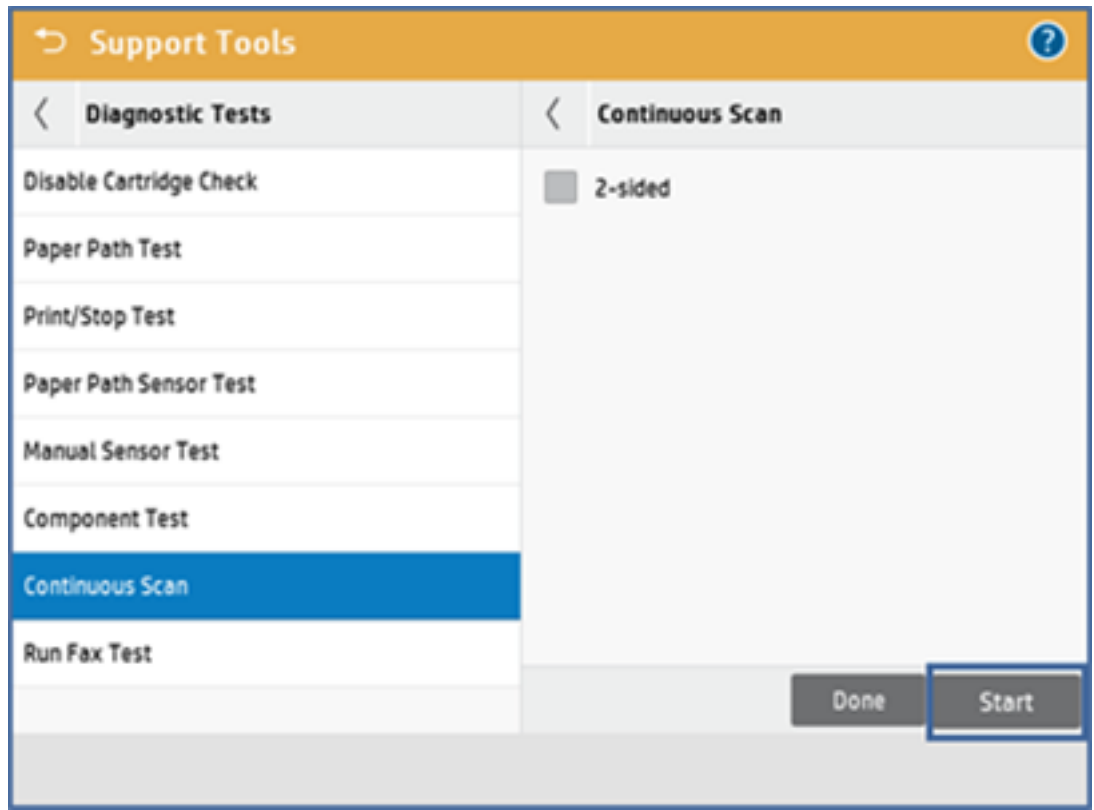

- e. Check if the scan head moves from the home position through the scan, and back to the home position.



NOTE: The scan head should actuate, moving from the home position through a scan, and back to the home position. This process will repeat until interrupted.

5. If the scan head does not actuate or operate correctly, replace the image scanner assembly (ISA).

Table 6-26 Kit-Image Scanner Whole Unit (Image scanner assembly) part number

Part description	Part number
Image scanner assembly (<i>includes white backing and retention clips</i>)	F2A76-67914

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print a Configuration Page to check if the latest version of the printer firmware is installed.

If the latest printer firmware version is not installed, update the firmware.

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware* (ish_4158468-4158516-16).


3. Observe the movement of the optics assembly.
4. If the error persists (optics assembly fails to move correctly) after the firmware update, perform a Continuous Scan diagnostic test using the printer control panel to test the functionality of the scan optics.
 - a. From the Home screen on the control panel, scroll to and touch [Support Tools](#) (FutureSmart 4 firmware).



NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.


- b. Open the following menus: **Troubleshooting > Diagnostic Tests**.
- c. Select [Continuous Scan](#).

Figure 6-46 Continuous Scan option in the Diagnostic Tests menu

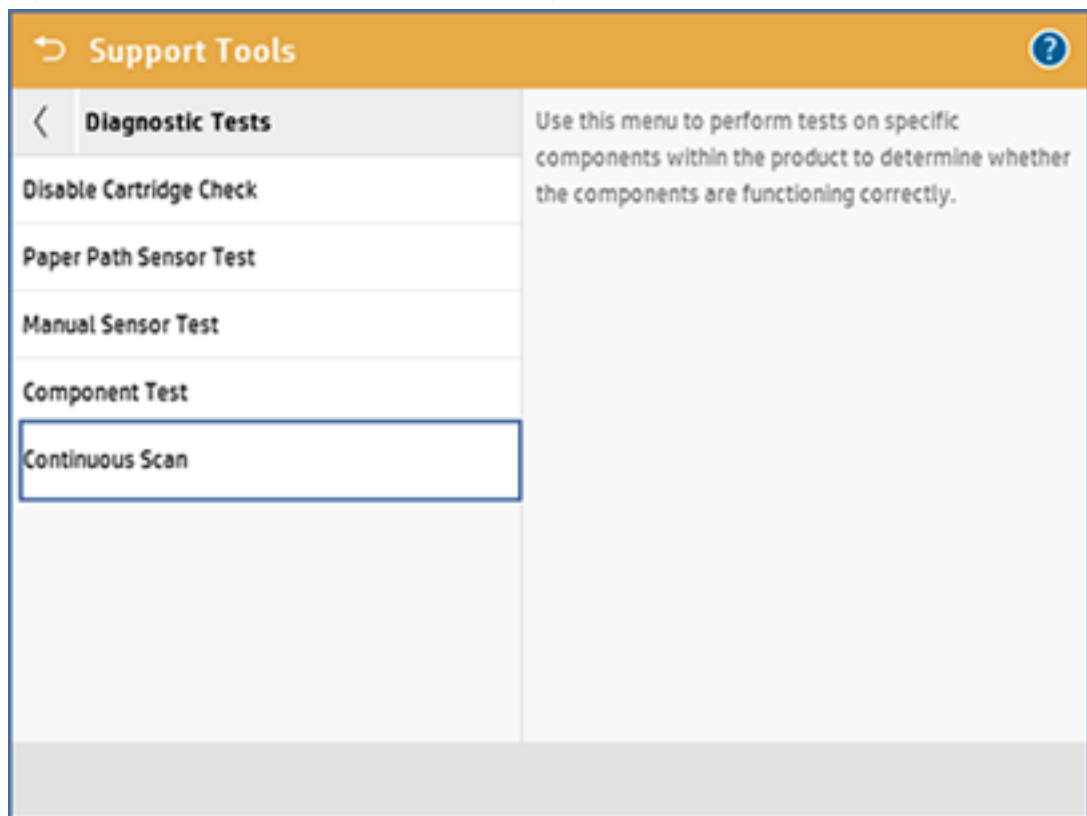

- d. Select **Start** to run the test.

Figure 6-47 Start the Continuous Scan test

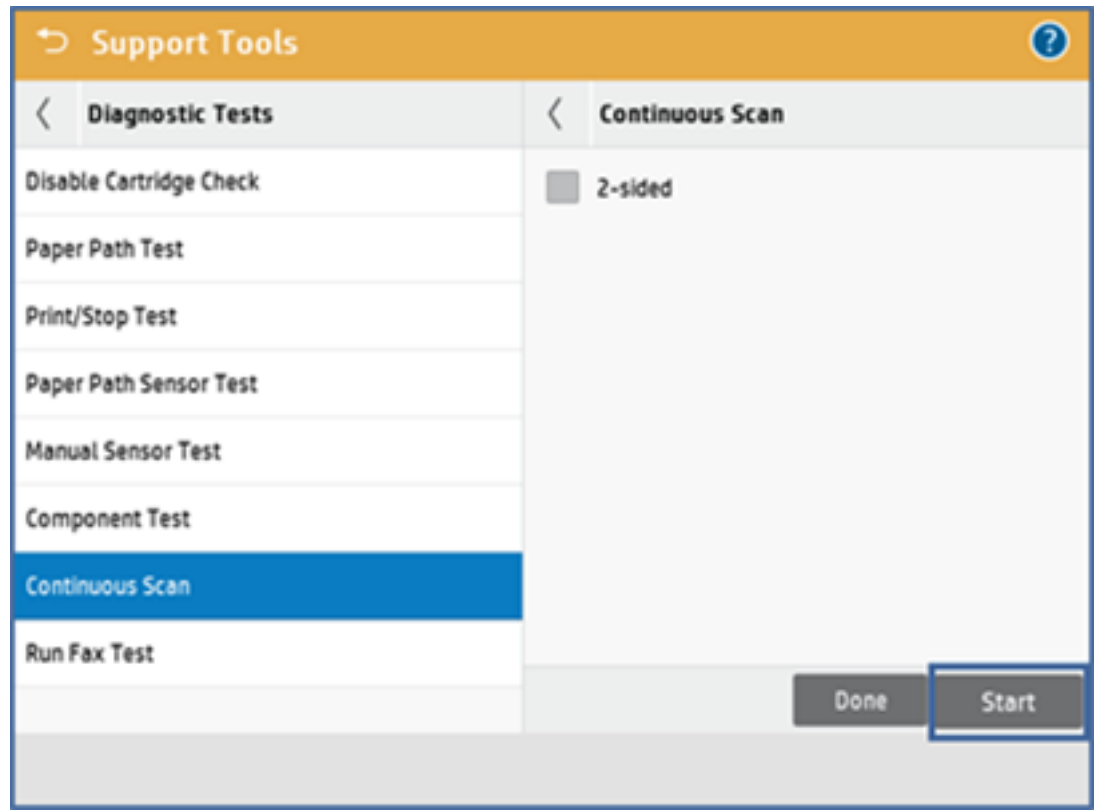

- e. Check if the scan head moves from the home position through the scan, and back to the home position.



NOTE: The scan head should actuate, moving from the home position through a scan, and back to the home position. This process will repeat until interrupted.

5. If the scan head does not actuate or operate correctly, remove and reconnect all the cables on the scanner control board (SCB).

6. Ensure that all the cables on the SCB are connected and seated correctly before replacing any part.

Figure 6-48 Scanner control board (SCB) connections

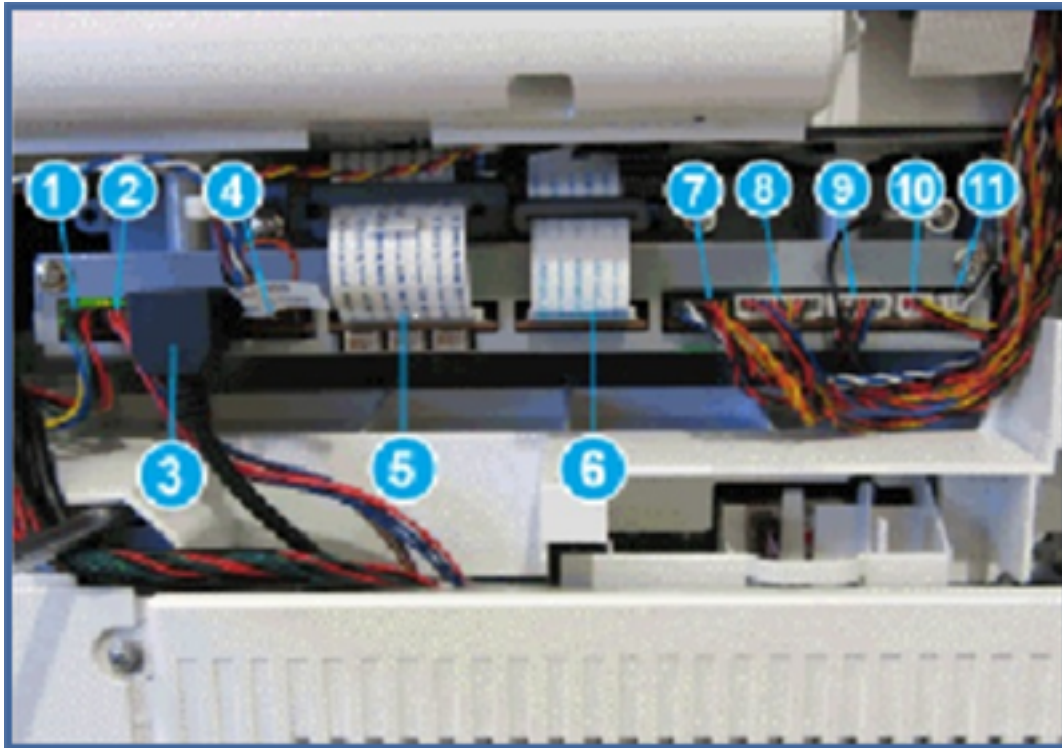


Table 6-27 Scanner control board (SCB) connections callout descriptions

Callout	Description
1	Staple power
2	SCB power (24v)
3	Cable, PAB to SCAM communication (HDMI)
4	Flatbed sensors (Document feeder open and flatbed paper length-and cave LED)
5	Flatbed (S1) flat flexible cable (scanner data and flatbed motor)
6	Document feeder (S2) flat flexible cable (Scanner data)
7	Document feeder motors (Feed and deskew)
8	Document feeder sensors (Prescan, Paper present receiver and top hatch)
9	Document feeder ultra sonic sensor receiver and deskew sensor
10	Letter/Legal (LTR/LGL) Input tray sensor
11	Ultra sonic sensor transmitter

7. If the error persists, replace the image scanner assembly (ISA).

Table 6-28 Kit-Image Scanner Whole Unit (Image scanner assembly) part number

Part description	Part number
Image scanner assembly (<i>includes white backing and retention clips</i>)	F2A76-67914

For instructions: See the Repair Service Manual for this product.

8. If the error persists after the SCB cables are connected correctly, replace the scanner control board (SCB).

Table 6-29 Scanner control board assembly part number

Part description	Part number
Scan control PC board assembly part number	B5L47-67903

For instructions: See the Repair Service Manual for this product.

30 . 01 . 14 Scan system EEPROM error

Scanner control board (SCB) EEPROM error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer using the power button.
2. Print a Configuration Page to check if the latest version of the printer firmware is installed.

If the latest printer firmware version is not installed, update the firmware.

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware* (ish_4158468-4158516-16).

3. If the error persists, dispatch a service technician to replace the scanner control board (SCB).

Table 6-30 Scanner control board assembly part number

Part description	Part number
Scan control PC board assembly part number	B5L47-67903

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer using the power button.
2. Print a Configuration Page to check if the latest version of the printer firmware is installed.

If the latest printer firmware version is not installed, update the firmware.

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware* (ish_4158468-4158516-16).
3. If the error persists, disconnect and reconnect all the cables on the scanner control board (SCB).
4. Ensure that all the cables on the SCB are connected and seated correctly before replacing any part.

Figure 6-49 Scanner control board (SCB): Sensor connections

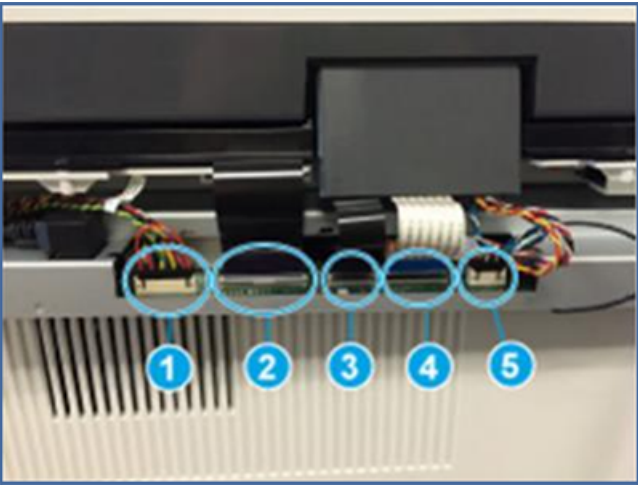


Table 6-31 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

5. If the error persists after the SCB cables are connected correctly, replace the scanner control board (SCB).

Table 6-32 Scanner control board assembly part number

Part description	Part number
Scan control PC board assembly part number	B5L47-67903

For instructions: See the Repair Service Manual for this product.

30 . 01 . 36 Upgrade error

Scanner control board (SCB) upgrade error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, attempt to upgrade the firmware.

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware* (ish_4158468-4158516-16).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Update the printer firmware.

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware* (ish_4158468-4158516-16).

3. If the error persists, dispatch a service technician with the following part to replace the scanner control board (SCB).

Table 6-33 Scanner control board assembly part number

Part description	Part number
Scan control PC board assembly part number	B5L47-67903

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, remove and reconnect all the cables on the scanner control board (SCB).

3. Ensure that all connections are seated correctly before replacing any part.

Figure 6-50 Scanner control board (SCB) connections

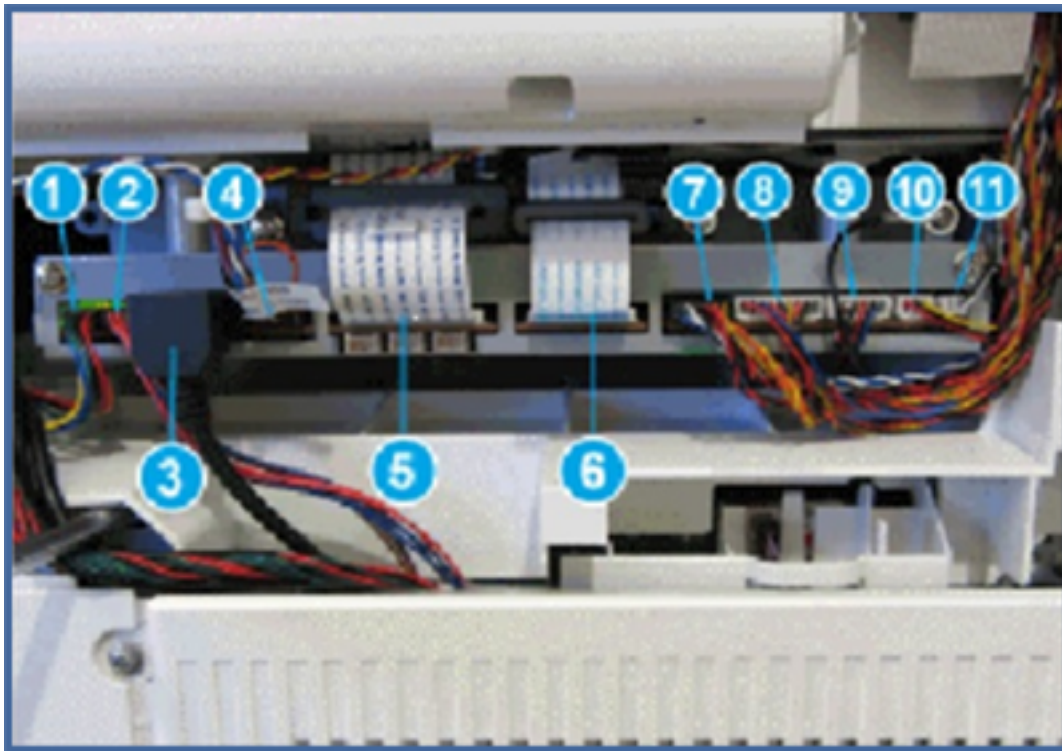


Table 6-34 Scanner control board (SCB) connections callout descriptions

Callout	Description
1	Staple power
2	SCB power (24v)
3	Cable, PAB to SCAM communication (HDMI)
4	Flatbed sensors (Document feeder open and flatbed paper length-and cave LED)
5	Flatbed (S1) flat flexible cable (scanner data and flatbed motor)
6	Document feeder (S2) flat flexible cable (Scanner data)
7	Document feeder motors (Feed and deskew)
8	Document feeder sensors (Prescan, Paper present receiver and top hatch)
9	Document feeder ultra sonic sensor receiver and deskew sensor
10	Letter/Legal (LTR/LGL) Input tray sensor
11	Ultra sonic sensor transmitter

4. If the error persists, update the printer firmware.

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware* (ish_4158468-4158516-16).

5. If the error persists after a firmware upgrade, replace the scanner control board (SCB).

Table 6-35 Scanner control board assembly part number

Part description	Part number
Scan control PC board assembly part number	B5L47-67903

For instructions: See the Repair Service Manual for this product.

30.01.41 Scanner error

The formatter lost connections with the scanner control board (SCB) or communication was corrupted.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Check the voltage of the unit on the regulatory sticker. Ensure that the voltage of the outlet matches the voltage of the printer.

 **NOTE:** This event is directly related to a 220V printer being plugged into a 110V outlet.

2. Turn the printer off, and then on.
3. If the error persists, attempt to upgrade the firmware.

 **NOTE:** A fix has been implemented in FutureSmart 3.8 firmware version.

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware* (ish_4158468-4158516-16).

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Check the voltage of the unit on the regulatory sticker. Ensure that the voltage of the outlet matches the voltage of the printer.

 **NOTE:** This event is directly related to a 220V printer being plugged into a 110V outlet.

2. Upgrade the firmware.

 **NOTE:** A fix has been implemented in FutureSmart 3.8 firmware version.

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware* (ish_4158468-4158516-16).

3. Turn the printer off, and then on.
4. If the issue persists, dispatch a service technician to continue troubleshooting.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

- 1. Check the voltage of the unit on the regulatory sticker. Ensure that the voltage of the outlet matches the voltage of the printer.

 **NOTE:** This event is directly related to a 220V printer being plugged into a 110V outlet.

- 2. Upgrade the firmware.

 **NOTE:** A fix has been implemented in FutureSmart 3.8 firmware version.

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware* (ish_4158468-4158516-16).

- 3. Turn off the printer, and then turn on the printer.
- 4. If the error persists, turn the product off, and then disconnect and reconnect all the cable connections between the formatter and the SCB.
- 5. Ensure that all the cables on the formatter and the SCB are connected correctly and seated correctly.
- 6. If the error persists, remove and reconnect all the cables on the scanner control board (SCB).
- 7. Ensure that all connections are seated correctly before replacing any part.

Figure 6-51 Scanner control board (SCB): Sensor connections

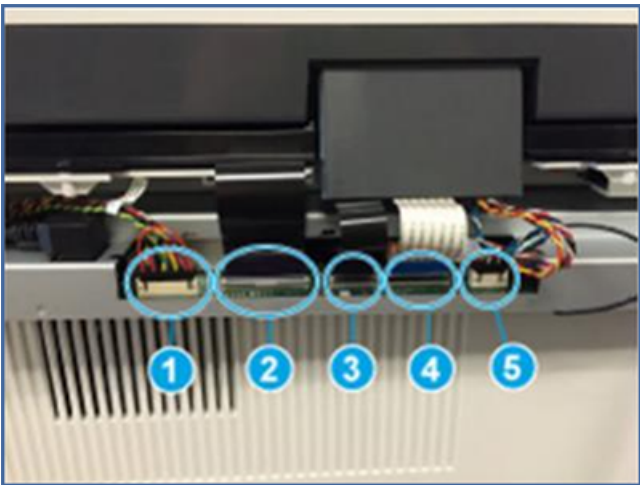


Table 6-36 SCB sensor callout descriptions

Callout	Description
1	Flatbed sensor/motor
2	Flatbed FFC
3	ADF sensor
4	ADF FFC
5	ADF Motor

8. If the error persists after the SCB cables are connected correctly, replace the scanner control board (SCB).

Table 6-37 Scanner control board assembly part number

Part description	Part number
Scan control PC board assembly part number	B5L47-67903

For instructions: See the Repair Service Manual for this product.

9. After replacing the SCB, turn on the printer.
10. If the issue persists, replace the document feeder.

Use the following table to order the correct part number for the printer model.

Table 6-38 ADF part number

Description	Part number
ADF Whole Unit Enterprise	B5L47-67908
ADF Whole Unit Workflow	B5L47-67909

For instructions: See the Repair Service Manual for this product.

30 . 01 . 43 Scanner memory failure

Scan memory error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, perform a [Partial Clean](#) using the Preboot menu or the Embedded Web Server (EWS).



NOTE: A Partial Clean erases all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system. It automatically reboots the printer and restores the firmware files from the repository.

3. If the error persists, try to update the firmware.

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware* (ish_4158468-4158516-16).

4. If the error persists, dispatch a service technician to replace the scanner control board (SCB).

Table 6-39 Scanner control board assembly part number

Part description	Part number
Scan control PC board assembly part number	B5L47-67903

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the error persists, perform a [Partial Clean](#) using the Preboot menu or the Embedded Web Server (EWS).



NOTE: A Partial Clean erases all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system. It automatically reboots the printer and restores the firmware files from the repository.

3. If the error persists, try to update the firmware.

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware* (ish_4158468-4158516-16).
4. Disconnect and reconnect all the cable connections between the formatter and the SCB.
5. Ensure that all the cables on the formatter and the SCB are connected correctly and seated correctly.
6. If the error persists, replace the scanner control board (SCB).

Table 6-40 Scanner control board assembly part number

Part description	Part number
Scan control PC board assembly part number	B5L47-67903

For instructions: See the Repair Service Manual for this product.

7. If the error persists after replacing the SCB, replace the formatter.

Use the following table to order the correct part number for your printer.

Table 6-41 Formatter PCA part numbers

Product models	Part description	Part number
M501dn	Formatter PC board	J8H61-67901
M501dn (China)	Formatter PC board	J8H61-67902
M501n	Formatter PC board	J8H60-67901
M501n (China)	Formatter board assembly	J8H60-67902
M506n/ M506dn	Formatter PC board assembly	F2A68-67915
M506x	Formatter PC board assembly	F2A68-67916

Table 6-41 Formatter PCA part numbers (continued)

Product models	Part description	Part number
M527 E52545	Formatter PC board assembly	F2A76-67910
M528 E52645	Formatter PC board	1PV64-60002

For instructions: See the Repair Service Manual for this product.

30.01.44 Scanner error

Scanner control board (SCB) communication error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Update the printer firmware to the latest version available at HP Customer Support - Software and Driver Downloads (<https://support.hp.com/drivers>).
2. Turn the printer off, and then on.
3. If the error persists, dispatch a service technician to replace the following parts in the order presented to resolve the issue.



IMPORTANT: Do not send the SCB and the formatter.

Table 6-42 Part numbers to resolve the issue

Product models	Part description	Part number
M527 M528 E52545	Image scanner assembly (<i>includes white backing and retention clips</i>)	F2A76-67914
M527c/ M527z	ADF Whole Unit Workflow	B5L47-67909
M527dn/ M527f	ADF Whole Unit Enterprise	B5L47-67908

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Update the printer firmware to the latest version available at HP Customer Support - Software and Driver Downloads (<https://support.hp.com/drivers>).
2. Turn the printer off, and then on.
3. If the error persists, turn off the printer, and then disconnect and reconnect all the cable connections between the formatter and the SCB.

Use the image below for SCB connections.

Figure 6-52 Scanner control board (SCB) connections

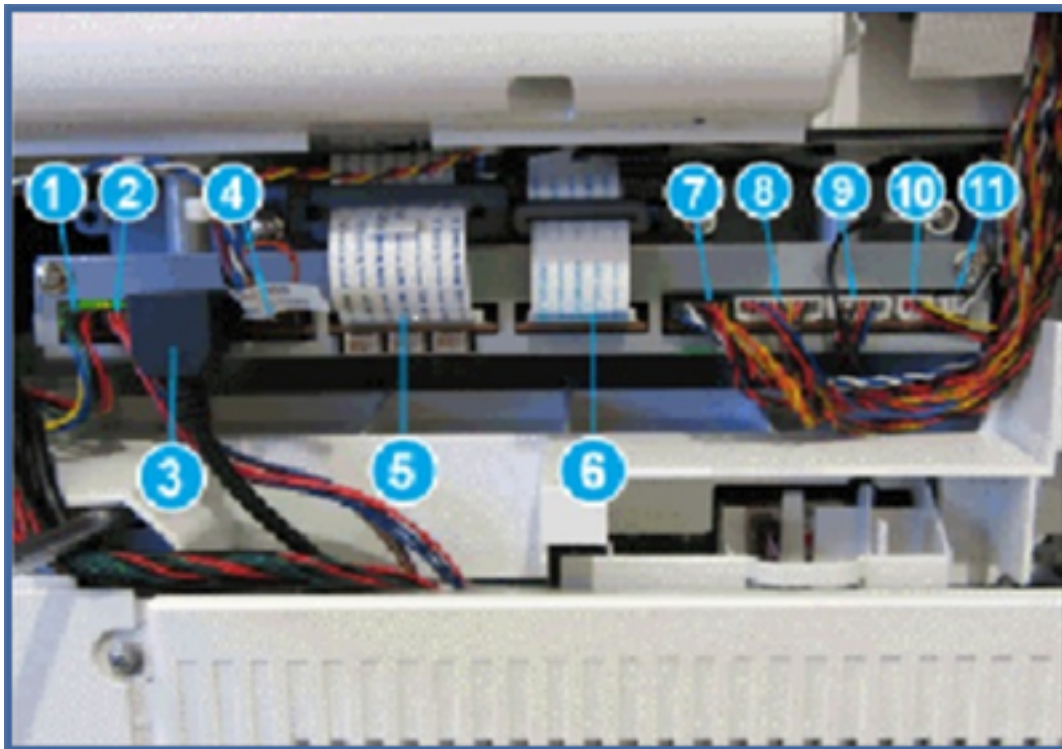


Table 6-43 Scanner control board (SCB) connections callout descriptions

Callout	Description
1	Staple power
2	SCB power (24v)
3	PAB to SCAM communication (HDMI)
4	Flatbed sensors (document feeder open and flatbed paper length-and cave LED)
5	Flatbed (S1) flat flexible cable (scanner data and flatbed motor)
6	Document feeder (S2) flat flexible cable (scanner data)
7	Document feeder motors (feed and deskew)
8	Document feeder sensors (prescan, paper present receiver and top hatch)
9	Document feeder ultra sonic sensor receiver and deskew sensor

Table 6-43 Scanner control board (SCB) connections callout descriptions (continued)

Callout	Description
10	LTR/LGL (letter/legal) Input tray sensor
11	Ultra sonic sensor transmitter

4. Ensure that all the cables on the formatter and the SCB are connected correctly and seated correctly.
5. If the error persists, replace the image scanner assembly.

Table 6-44 Kit-Image Scanner Whole Unit (Image scanner assembly) part number

Part description	Part number
Image scanner assembly (<i>includes white backing and retention clips</i>)	F2A76-67914

For instructions: See the Repair Service Manual for this product.

6. If the issue persists, replace the automatic document feeder assembly.

Table 6-45 ADF part numbers

Product models	Part description	Part number
M527c/ M527z	ADF Whole Unit Workflow	B5L47-67909
M527dn/ M527f	ADF Whole Unit Enterprise	B5L47-67908

For instructions: See the Repair Service Manual for this product.

7. If the error persists after replacing the ADF, replace the scanner control board (SCB).

Table 6-46 Scanner control board assembly part number

Part description	Part number
Scan control PC board assembly part number	B5L47-67903

For instructions: See the Repair Service Manual for this product.

8. If the error persists after replacing the SCB, replace the formatter.

Use the following table to order the correct part number for your printer.

Table 6-47 Formatter PCA part numbers

Product models	Part description	Part number
M501dn	Formatter PC board	J8H61-67901
M501dn (China)	Formatter PC board	J8H61-67902
M501n	Formatter PC board	J8H60-67901
M501n (China)	Formatter board assembly	J8H60-67902

Table 6-47 Formatter PCA part numbers (continued)

Product models	Part description	Part number
M506n/ M506dn	Formatter PC board assembly	F2A68-67915
M506x	Formatter PC board assembly	F2A68-67916
M527	Formatter PC board assembly	F2A76-67910
E52545		
M528	Formatter PC board	1PV64-60002
E52645		

For instructions: See the Repair Service Manual for this product.

30.01.45 Scanner Error

Scanner firmware assertion failure

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Update the printer firmware to the latest version available at HP Customer Support - Software and Driver Downloads (<https://support.hp.com/drivers>).
2. Turn the printer off, and then on.
3. If the error persists, dispatch a service technician to replace the required part and resolve the issue.



IMPORTANT: Do not send the SCB and the formatter.

Table 6-48 Part numbers to resolve the issue

Product models	Part description	Part number
M527c/ M527z	ADF Whole Unit Workflow	B5L47-67909
M527dn/ M527f	ADF Whole Unit Enterprise	B5L47-67908

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Update the printer firmware to the latest version available at HP Customer Support - Software and Driver Downloads (<https://support.hp.com/drivers>).

2. Turn the printer off, and then on.
3. If the error persists, turn off the printer, and then disconnect and reconnect all the cable connections on the formatter and the SCB.

Use the image below for SCB connections.

Figure 6-53 Scanner control board (SCB) connections

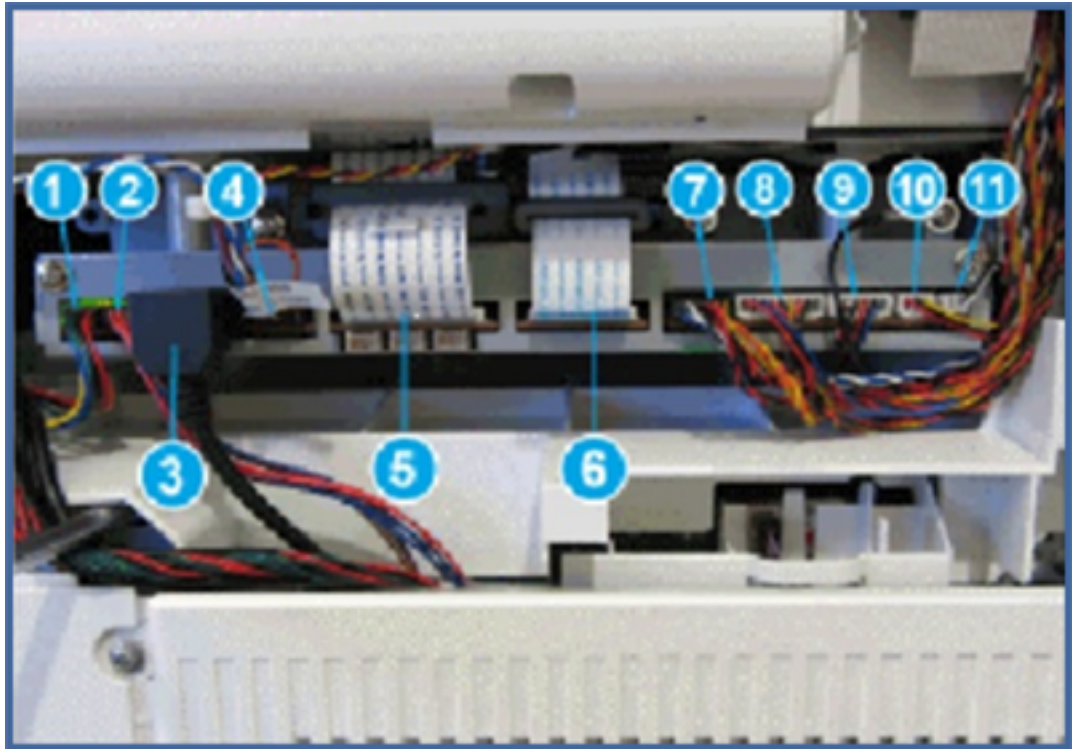


Table 6-49 Scanner control board (SCB) connections callout descriptions

Callout	Description
1	Staple power
2	SCB power (24v)
3	Cable, PAB to SCAM communication (HDMI)
4	Flatbed sensors (Document feeder open and flatbed paper length-and cave LED)
5	Flatbed (S1) flat flexible cable (scanner data and flatbed motor)
6	Document feeder (S2) flat flexible cable (Scanner data)
7	Document feeder motors (Feed and deskew)
8	Document feeder sensors (Prescan, Paper present receiver and top hatch)
9	Document feeder ultra sonic sensor receiver and deskew sensor
10	Letter/Legal (LTR/LGL) Input tray sensor
11	Ultra sonic sensor transmitter

4. Ensure that all the cables on the formatter and the SCB are connected correctly and seated correctly before replacing a part.
5. If the issue persists, replace the automatic document feeder assembly.

Table 6-50 ADF part numbers

Product models	Part description	Part number
M527c/ M527z	ADF Whole Unit Workflow	B5L47-67909
M527dn/ M527f	ADF Whole Unit Enterprise	B5L47-67908

For instructions: See the Repair Service Manual for this product.

6. If the issue persists after replacing the ADF, replace the scanner control board (SCB).

Table 6-51 Scanner control board assembly part number

Part description	Part number
Scan control PC board assembly part number	B5L47-67903

For instructions: See the Repair Service Manual for this product.

7. If the error persists after replacing the SCB, replace the formatter.

Use the following table to order the correct part number for your printer.

Table 6-52 Formatter PCA part numbers

Product models	Part description	Part number
M501dn	Formatter PC board	J8H61-67901
M501dn (China)	Formatter PC board	J8H61-67902
M501n	Formatter PC board	J8H60-67901
M501n (China)	Formatter board assembly	J8H60-67902
M506n/ M506dn	Formatter PC board assembly	F2A68-67915
M506x	Formatter PC board assembly	F2A68-67916
M527	Formatter PC board assembly	F2A76-67910
E52545		
M528	Formatter PC board	1PV64-60002
E52645		

For instructions: See the Repair Service Manual for this product.

30.01.46 Scanner Error

Scanner firmware error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Update the printer firmware to the latest version available at HP Customer Support - Software and Driver Downloads (<https://support.hp.com/drivers>).
2. Turn the printer off, and then on.
3. If the error persists, dispatch a service technician with a scanner control board (SCB) to troubleshoot the issue and replace the part, if applicable.

Table 6-53 Scanner control board assembly part number

Part description	Part number
Scan control PC board assembly part number	B5L47-67903

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Update the printer firmware to the latest version available at HP Customer Support - Software and Driver Downloads (<https://support.hp.com/drivers>).
2. Turn the printer off, and then on.

3. If the error persists, turn off the printer, and then disconnect and reconnect all the cable connections between the formatter and the SCB. Use the image below for SCB connections.

Figure 6-54 Scanner control board (SCB) connections

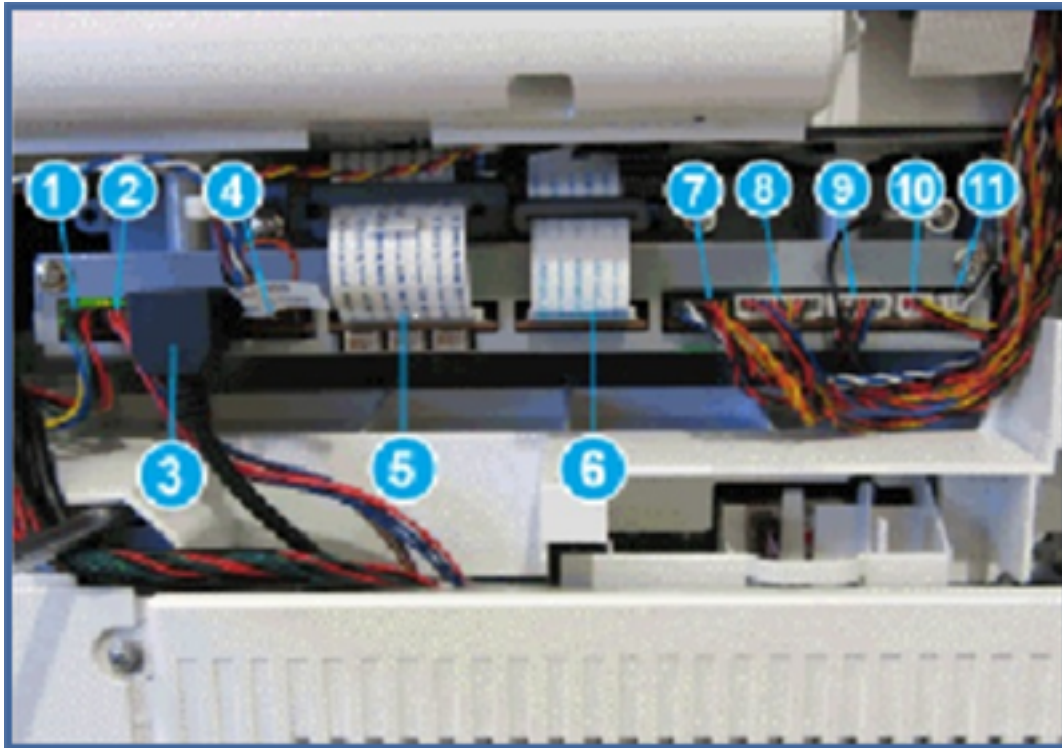


Table 6-54 Scanner control board (SCB) connections callout descriptions

Callout	Description
1	Staple power
2	SCB power (24v)
3	Cable, PAB to SCAM communication (HDMI)
4	Flatbed sensors (Document feeder open and flatbed paper length-and cave LED)
5	Flatbed (S1) flat flexible cable (scanner data and flatbed motor)
6	Document feeder (S2) flat flexible cable (Scanner data)
7	Document feeder motors (Feed and deskew)
8	Document feeder sensors (Prescan, Paper present receiver and top hatch)
9	Document feeder ultra sonic sensor receiver and deskew sensor
10	Letter/Legal (LTR/LGL) Input tray sensor
11	Ultra sonic sensor transmitter

4. Ensure that all the cables on the formatter and the SCB are connected and seated correctly before replacing a part.

5. If the error persists, replace the scanner control board (SCB).

Table 6-55 Scanner control board assembly part number

Part description	Part number
Scan control PC board assembly part number	B5L47-67903

For instructions: See the Repair Service Manual for this product.

30.03.14

A scanner EEPROM (NVM) error has occurred.

A non-fatal error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

- This is an informational message only, no action is required.

30.03.20

The firmware cannot communicate with the PCA on the assembly.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Update the printer firmware to the latest version available at HP Customer Support - Software and Driver Downloads (<https://support.hp.com/drivers>).
2. Turn the printer off, and then on.
3. If the error persists, dispatch a service technician to replace the following part and troubleshoot the issue.



IMPORTANT: Do not send the SCB and the formatter.

Table 6-56 Part numbers to resolve the issue

Part description	Part number
Image scanner assembly (<i>includes white backing and retention clips</i>)	F2A76-67914

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Update the printer firmware to the latest version available at HP Customer Support - Software and Driver Downloads (<https://support.hp.com/drivers>).
2. Turn the printer off, and then on.
3. If the error persists, turn off the printer, and then disconnect and reconnect all the cable connections between the SCB and the image scanner assembly.

Use the image below for SCB connections.

Figure 6-55 Scanner control board (SCB) connections

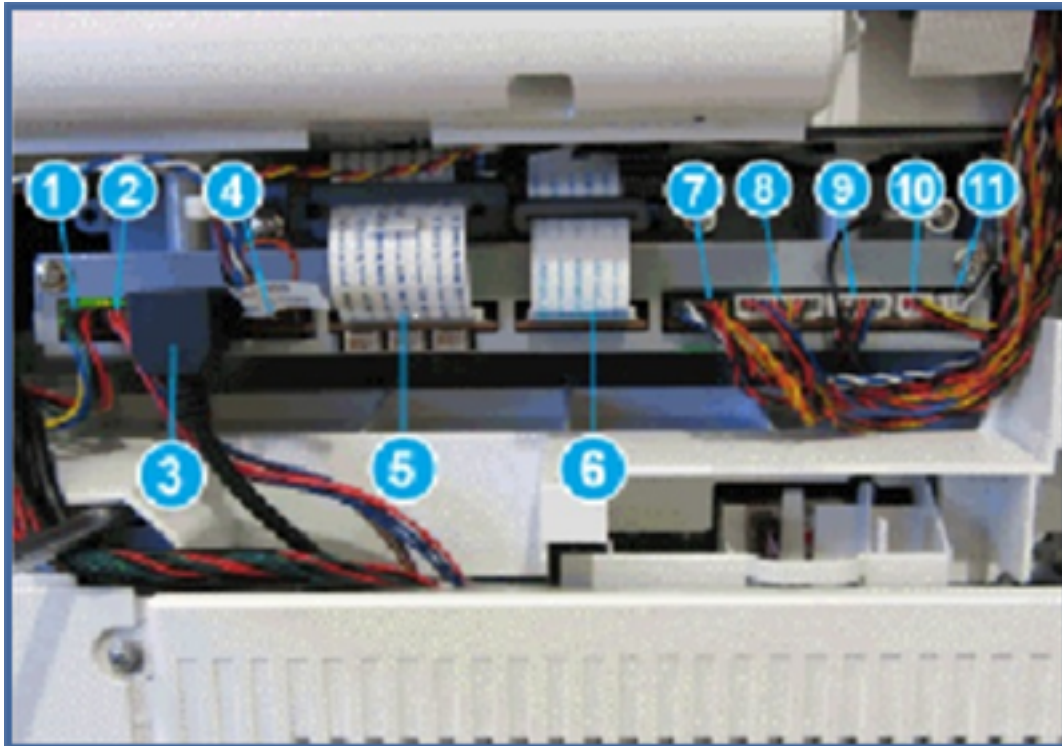



Table 6-57 Scanner control board (SCB) connections callout descriptions

Callout	Description
1	Staple power
2	SCB power (24v)
3	Cable, PAB to SCAM communication (HDMI)
4	Flatbed sensors (Document feeder open and flatbed paper length-and cave LED)

Table 6-57 Scanner control board (SCB) connections callout descriptions (continued)

Callout	Description
5	Flatbed (S1) flat flexible cable (scanner data and flatbed motor)
6	Document feeder (S2) flat flexible cable (Scanner data)
7	Document feeder motors (Feed and deskew)
8	Document feeder sensors (Prescan, Paper present receiver and top hatch)
9	Document feeder ultra sonic sensor receiver and deskew sensor
10	Letter/Legal (LTR/LGL) Input tray sensor
11	Ultra sonic sensor transmitter

Figure 6-56 M527: Scanner to Formatter cable connections

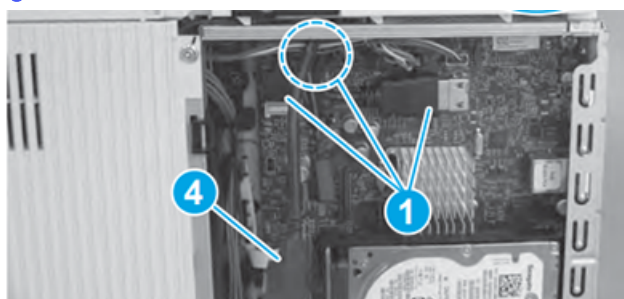

4. Ensure that all the cables on the formatter and the SCB are connected and seated correctly before replacing a part.
5. If the error is still present, check to see if there is power or if the green LED lights on the SCB are illuminated. If no power is available, check the SCB, DC controller (J108), and LVPS connector.
6. If the issue persists after the connectors are connected correctly, perform the appropriate task:
 - If the connectors are connected correctly and **there is power on the SCB**, replace the image scanner assembly (ISA).

Table 6-58 Kit-Image Scanner Whole Unit (Image scanner assembly) part number

Part description	Part number
Image scanner assembly (<i>includes white backing and retention clips</i>)	F2A76-67914

For instructions: See the Repair Service Manual for this product.

- If the connectors are connected correctly and **there is no power on the SCB**, replace the image scanner assembly (ISA), and then replace the scanner control board (SCB).

Table 6-59 Image scanner assembly and Scanner control board part numbers

Part description	Part number
Image scanner assembly (<i>includes white backing and retention clips</i>)	F2A76-67914
Scan control PC board assembly part number	B5L47-67903

- For instructions: See the Repair Service Manual for this product.
- For instructions: See the Repair Service Manual for this product.

30.03.22 Scanner failure

Front side illumination calibration failure.

The scan module cannot see the illumination module, or the illumination is marginal.

The optical assembly might not be parked under the calibration strip.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.
3. Check the event log for other scanner errors, and then resolve those errors.
4. Reseat the image scanner FFC connection.
5. Under the troubleshooting menu, run a “Continuous Scan” single sided to verify that the flatbed scan assembly moves freely and the scanner bulb is illuminated.
6. Replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: F2A76-67909

30.03.23 Scanner failure

Calibration error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.
3. Check the event log for other scanner errors. If the errors are present, resolve those errors.
4. Reseat the image scanner FFC connection.
5. Under the troubleshooting menu, run a "Continuous Scan" single sided to verify that the flatbed scan assembly moves freely and the scanner bulb is illuminated.
6. Replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: F2A76-67909

30 . 03 . 30 Scanner Failure

Flatbed motor shutdown.

The scanner control board (SCB) cannot communicate with the flatbed scanner motor.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on. As the printer turns on, verify that the scan head moves.
2. Verify that the drive belt is in the correct position.
3. Under the troubleshooting menu, run a "Continuous Scan" single sided to verify that the flatbed scan assembly moves freely and the scanner bulb is illuminated.
4. Run diagnostics test on the flatbed scanner to see if the scan bar moves.
(For this test, run the continuous scan from the scanner test menu)
5. Check the cable connection to the scanner control board (SCB).
6. Replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: F2A76-67909

30 . 03 . 45 Scanner Error To continue turn off then on

Scanner control board (SCB) firmware assertion failure. SCB firmware assertion controls the scan head motor.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Update the printer firmware to the latest version available at HP Customer Support - Software and Driver Downloads (<https://support.hp.com/drivers>).

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware* (ish_4158468-4158516-16).

2. Turn off the printer, and then turn on the printer.
3. If the error persists, dispatch a technician with the following parts to perform the service.



NOTE: Do not send the formatter.

Table 6-60 Scanner control board assembly and Image scanner assembly part numbers

Part description	Part number
Scan control PC board assembly part number	B5L47-67903
Image scanner assembly (<i>includes white backing and retention clips</i>)	F2A76-67914

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Update the printer firmware to the latest version available at [HP Support](#) or [HP Software and Driver Downloads page](#).

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware* (ish_4158468-4158516-16).

2. Turn the printer off, and then on.
3. Check the event log for other scanner errors. If the errors are present, resolve those errors.
 - a. From the Home screen of the control panel, select [Administration](#) or [Support Tools](#).
 - b. Select [Troubleshooting](#), and then select [Event Log](#) to access the Event Log

The Event Log will show the last 50 recorded events.

4. If the error persists, turn the product off, and then disconnect and reconnect all the cables between the scanner control board (SCB) and scanner assembly. Use the image below for SCB connections.

Use the image below for SCB connections. Callout 6 is the most likely connector related to this error

Figure 6-57 Scanner control board (SCB) connections


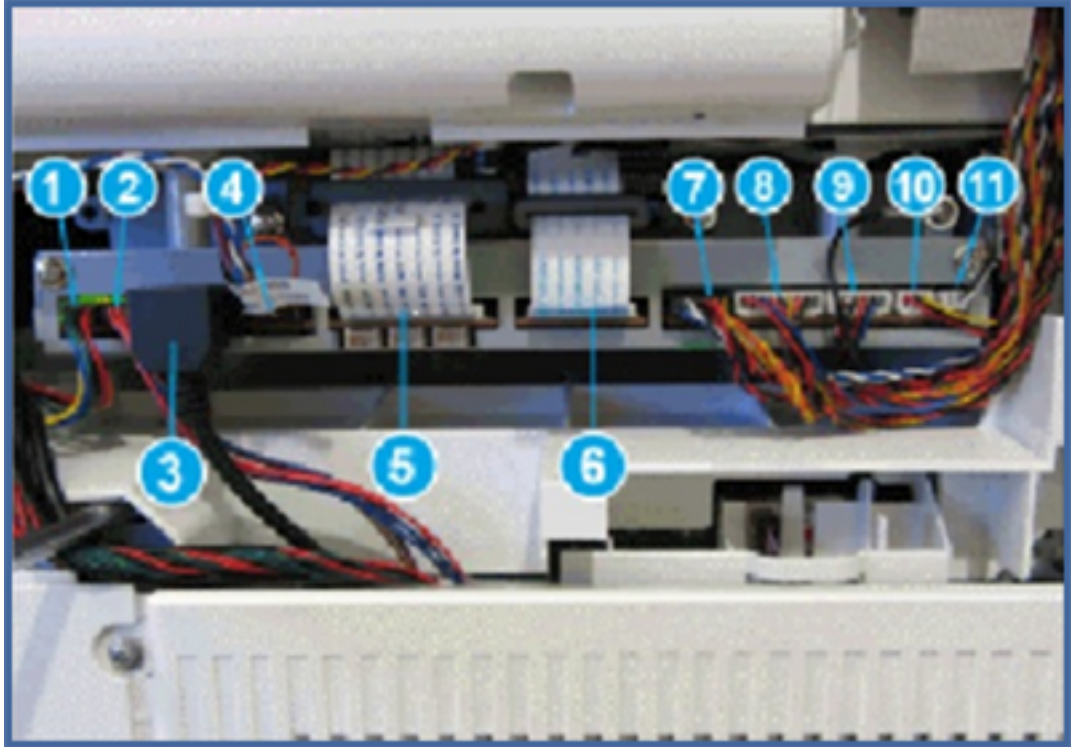


Table 6-61 Scanner control board (SCB) connections callout descriptions

Callout	Description
1	Staple power
2	SCB power (24v)
3	PAB to SCAM communication (HDMI)
4	Flatbed sensors (document feeder open and flatbed paper length-and cave LED)
5	Flatbed (S1) flat flexible cable (scanner data and flatbed motor)
6	Document feeder (S2) flat flexible cable (scanner data)
7	Document feeder motors (feed and deskew)
8	Document feeder sensors (prescan, paper present receiver and top hatch)
9	Document feeder ultra sonic sensor receiver and deskew sensor
10	LTR/LGL (letter/legal) Input tray sensor
11	Ultra sonic sensor transmitter

5. Verify the cables between scanner and scanner control board (SCB) are connected. (connection 6 – ADF (side 2) FFC). Also check the connection from the ADF to the PCA on the scanner. (Image 2)

Figure 6-58 SCB connections

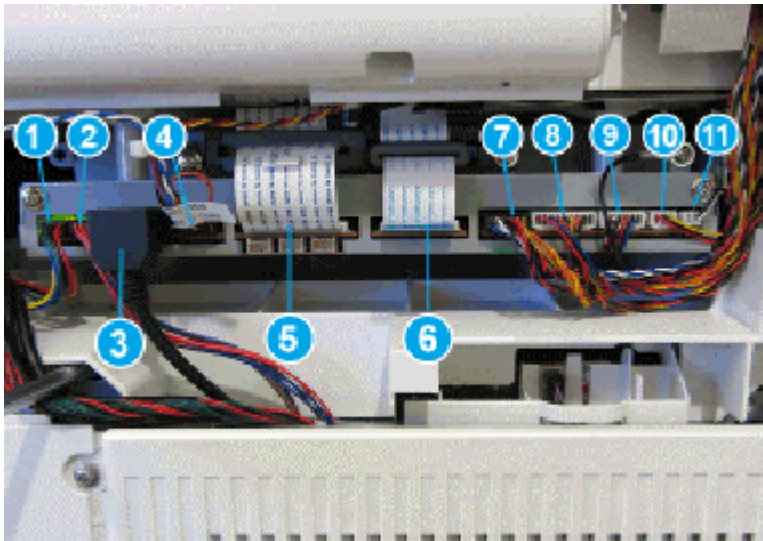

6. Replace the scanner control board (SCB).
For instructions: See the Repair Service Manual for this product.
Scanner control board, part number: B5L47-67903 (M527, M528).
7. If replacing the SCB does not resolve the issue, replace the image scanner assembly.
For instructions: See the Repair Service Manual for this product.
Part number: F2A76-67909
8. Replace the Low Voltage Power Supply. (LVPS).
For instructions: See the Repair Service Manual for this product.

Table 6-62 Parts

Description	Part number
Low-voltage power supply (LVPS) 110V-127V (M527)	RM2-7951-000CN
Low-voltage power supply (LVPS) 220V-240V (M527)	RM2-7952-000CN
Low-voltage power supply (LVPS) 110V-127V (M501/M506)	RM2-7941-000CN
Low-voltage power supply (LVPS) 220V-240V (M501/M506)	RM2-7942-000CN

9. If the issue persists, replace the automatic document feeder assembly.
For instructions: See the Repair Service Manual for this product.
Part number
 - Document feeder (M527c/z) kit: B5L47-67907
 - Document feeder (M527dn/f) kit: B5L47-67906
 - Document feeder (M528dn/f/c/z) kit: B5L47-67907

- Document feeder (E52545c) kit: B5L47-67907
- Document feeder (E52545dn) kit: B5L47-67906
- Document feeder (E52645dn/c) kit: B5L47-67907

31.XX.YZ error messages

31.* errors

Errors in the 31.* family are related to the document feeder.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Verify the document feeder top cover is completely closed when feeding pages through it.
2. Verify the document feeder input tray is not overloaded and that the guides are adjusted correctly.
3. Open the document feeder top cover and check the rollers. Clean or replace them if necessary.
4. Clean the scanner glass and all the calibration strips.
5. Calibrate the scanner. Open these menus: [Device Maintenance > Calibrate-Cleaning > Calibrate Scanner](#).
6. Clean the scanner glass and glass strips, and clean the white strips used for calibration.
7. Perform the tests for scanner diagnostics. Open these menus: [Administration > Troubleshooting > Diagnostic Tests > Scanner Tests](#). Look for tests related to the document feeder, such as the [Jam Cover Sensor](#) test.
8. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)
9. Check all connections from the document feeder to the scanner control board, and reseal them if necessary.
10. If the error persists, replace the document feeder assembly.

31 . 01 . 47 Document feeder not detected

The document feeder was not detected. The document feeder might not be connected.

The flatbed glass is still available for scanning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and then on.
2. If the issue persists, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

Part number

- Document feeder (M527c/z) kit: B5L47-67907
- Document feeder (M527dn/f) kit: B5L47-67906



NOTE: Before replacing the document feeder, technicians should verify that the connections between the document feeder and the printer are fully seated. The following connections: 6 – ADF (side 2) FFC, 7 – ADF Motors (feed and deskew), 8 – ADF Sensors (pre-scan, media presence and top hatch), 9 – ADF ultra-sonice sensor receiver and deskew sensor)

31.03.14

Backside scanner EEPROM (NVM) error.

A non-fatal error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Validate that the error code is persistent.
3. If image quality is a problem, ask for an example image.
4. Replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part numbers

- Document feeder (M527c/z) kit: B5L47-67907
- Document feeder (M527dn/f) kit: B5L47-67906
- Document feeder (M528dn/f/c/z) kit: B5L47-67907

- Document feeder (E52545c) kit: B5L47-67907
- Document feeder (E52545dn) kit: B5L47-67906
- Document feeder (E52645dn/c) kit: B5L47-67907

31 . 03 . 20 backside scanner not detected

Backside scanner is not detected.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

 **IMPORTANT:** Before troubleshooting please review the appropriate Service Action Advisory for the specific region needed.

- *HP LaserJet Enterprise MFP M527, M528, M577, M578, Managed MFP E52545, E52645, E57540, PageWide Enterprise MFP 586, Managed MFP E58650 - 31.03.20 error when duplexing from ADF, Workflow models (All regions, Service Action Advisory)*
- *HP LaserJet Enterprise MFP M527, M528, M577, M578, Managed MFP E52545, E52645, E57540, PageWide Enterprise MFP 586, Managed MFP E58650 - 31.03.20 error when duplexing from ADF, Non-workflow models (AMS, Service Action Advisory)*
- *HP LaserJet Enterprise MFP M527, M528, M577, M578, Managed MFP E52545, E52645, E57540, PageWide Enterprise MFP 586, Managed MFP E58650 - 31.03.20 error when duplexing from ADF, Non-Workflow models (APJ/EMEA, Service Action Advisory)*

1. Turn the printer off, and then on.
2. If the error persists, service is required. Dispatch a technician with the appropriate document feeder assembly.

Part numbers

- Document feeder (M527c/z) kit: B5L47-67907
- Document feeder (M527dn/f) kit: B5L47-67906
- Document feeder (M528dn/f/c/z) kit: B5L47-67907
- Document feeder (E52545c) kit: B5L47-67907
- Document feeder (E52545dn) kit: B5L47-67906
- Document feeder (E52645dn/c) kit: B5L47-67907

Recommended action for onsite technicians

Use the following steps to resolve the issue.

1. Turn the printer off, and then on.
2. Verify the cables between scanner and scanner control board (SCB) are connected. (connection 6 – ADF (side 2) FFC). Also check the connection from the ADF to the PCA on the scanner. (Image 2)

Figure 6-59 SCB connections


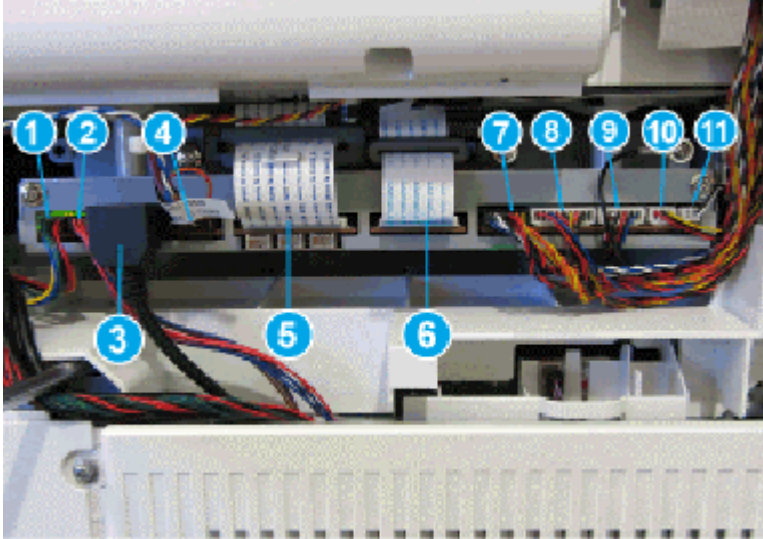


Figure 6-60 Scanner connection



3. Ensure the FFC cable routing from the ADF has been installed correctly and is not bent, torn or the edge nicked.

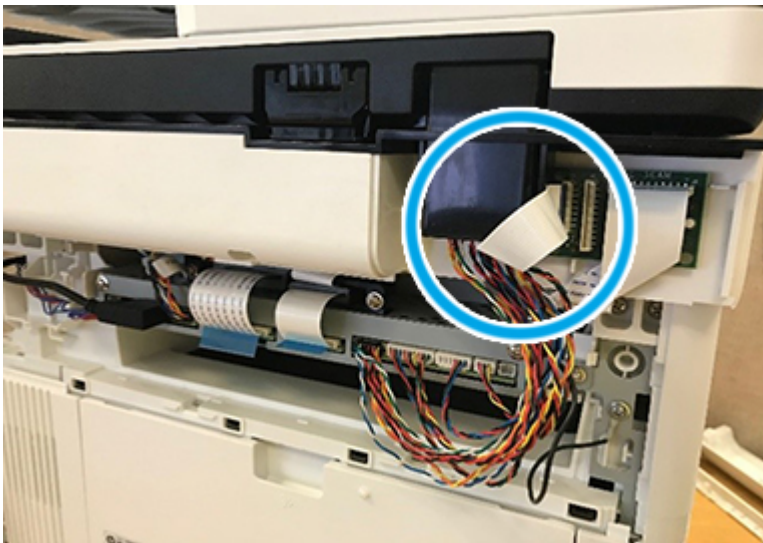

NOTE: If this occurs after the installation of a new ADF, remove the FFC, check for damage and re-route.

4. Replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part numbers

- Document feeder (M527c/z) kit: B5L47-67907
 - Document feeder (M527dn/f) kit: B5L47-67906
 - Document feeder (M528dn/f/c/z) kit: B5L47-67907
 - Document feeder (E52545c) kit: B5L47-67907
 - Document feeder (E52545dn) kit: B5L47-67906
 - Document feeder (E52645dn/c) kit: B5L47-67907
5. If the issue persists, replace the SCB.

For instructions: See the Repair Service Manual for this product.

Scanner control board, part number: B5L47-67903

31 . 03 . 22 Scanner calibration failure

Backside illumination calibration failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.
3. Verify the cables between scanner and scanner control board (SCB) are connected.
4. Replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number

- Document feeder (M527c/z) kit: B5L47-67907
- Document feeder (M527dn/f) kit: B5L47-67906

31 . 03 . 30 Document feeder pick motor error

The document feeder pick motor is not turning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Verify that the paper meets the HP printer specifications.
2. Make sure that the input tray is not overloaded and the tray guides are correctly aligned to both edges of the paper.
3. Check the event log for the document feeder errors, and resolve those errors first.
4. Open and close the top cover to see if the pick motor turns without posting this error. If the motor turns, then the motor is good.
5. Verify that the motor cables are connected. (Connection 7 – ADF Motor feed and skew).
6. Re-seat the document feeder connections to the scanner control board (SCB).
7. Replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number

- Document feeder (M527c/z) kit: B5L47-67907
- Document feeder (M527dn/f) kit: B5L47-67906

31.03.31 Document feeder motor stall

The document feeder feed motor is not turning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Verify that the paper meets the HP printer specifications.
2. Make sure that the input tray is not overloaded and the tray guides are correctly aligned to both edges of the paper.
3. Check the event log for document feeder errors, and then resolve those errors first.
4. Verify that the motor cables are connected. (Connection 7 – ADF Motor feed and skew).
5. Re-seat the document feeder connections to the scanner control board (SCB).

6. Replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number

- Document feeder (M527c/z) kit: B5L47-67907
- Document feeder (M527dn/f) kit: B5L47-67906

31 . 03 . 32

The document feeder de-skew motor is not turning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Verify that the paper meets the HP printer specifications.
2. Make sure that the input tray is not overloaded.
3. Check the event log for document feeder errors, and then resolve those errors first.
4. Verify that the motor cables are connected. (Connection 7 – ADF feed and deskew motor)
5. Re-seat the document feeder connections to the scanner control board (SCB) cables.
6. Replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number

- Document feeder (M527c/z) kit: B5L47-67907
- Document feeder (M527dn/f) kit: B5L47-67906

31 . 03 . 33 Backside scanner calibration area dirty

The white area used for backside scanner calibration is dirty.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Clean white strip on platen glass (side 2 glass).
2. Clean the scanner glass.
3. If issue remains replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number

- Document feeder (M527c/z) kit: B5L47-67907
- Document feeder (M527dn/f) kit: B5L47-67906

31 . 03 . 34 Background missing

The removable white backing for the backside scanner is either missing or not fully snapped into place.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Remove the white backing and clean it.
2. Clean the backside scanner glass.
3. If issue remains replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number

- Document feeder (M527c/z) kit: B5L47-67907
- Document feeder (M527dn/f) kit: B5L47-67906

31 . 13 . 00 Document feeder multi-pick error

A multiple pick error was reported by the document feeder assembly (ADF).

Issue might be described as the following:

- Picking multiple documents
- Picking more than one page
- Multiple sheets pulled from ADF


- Multiple pages picked

Recommended action for customer


Follow these troubleshooting steps in the order presented.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

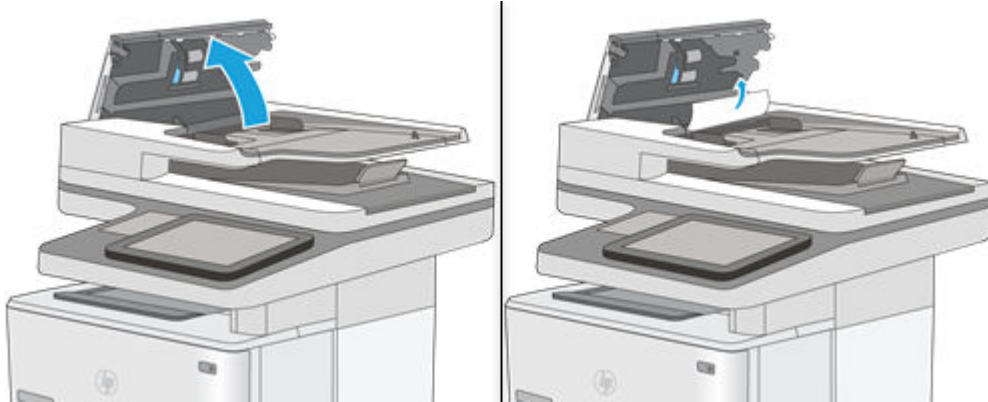

2. Lift the document-feeder input tray and remove any jammed paper.

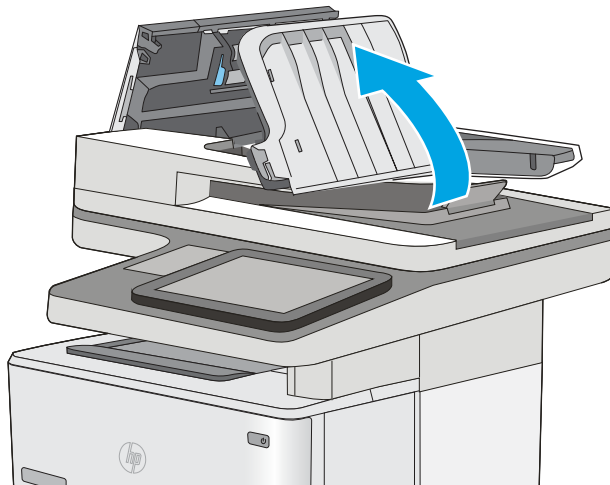

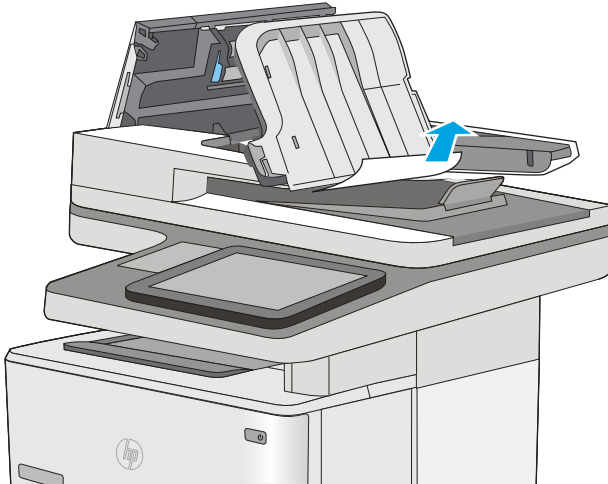

3. Lower the document-feeder input tray and then close the document feeder cover.



NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.


4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-61 Set the ADF guides

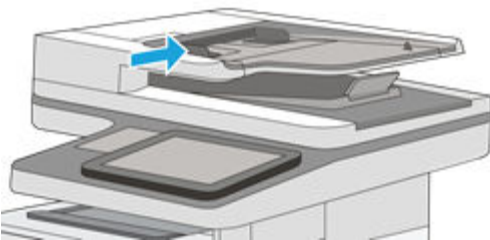


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.




NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

6. Check the Document Feeder Kit consumable status.


- a. Navigate to and select **Supplies** on the control panel.

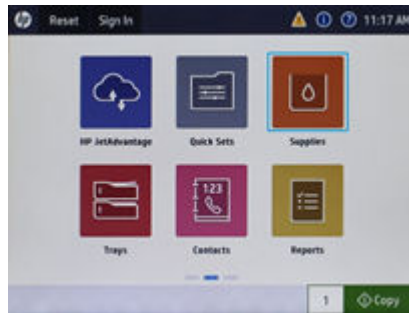

- b. Select **Document Feeder Kit**.

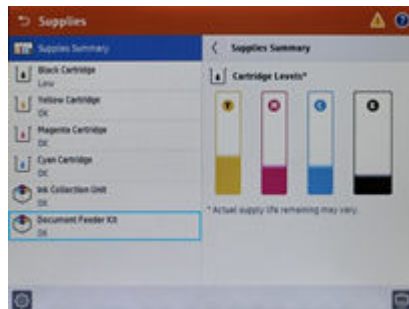

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

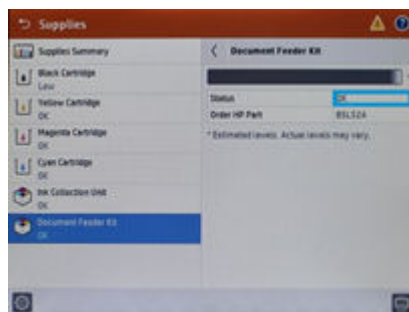


- d. Recommend that the customer replace the Document Feeder Kit if the status is **Low** or **Very Low**.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm

water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

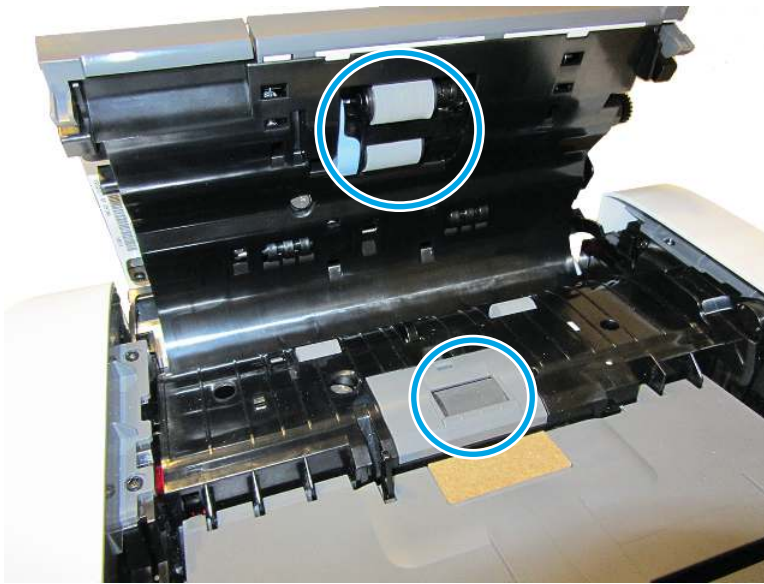

NOTE: Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23A/HP 200 ADF Roller Replacement Kit

To order parts, go to <https://store.hp.com>


9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent


Follow these troubleshooting steps in the order presented.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

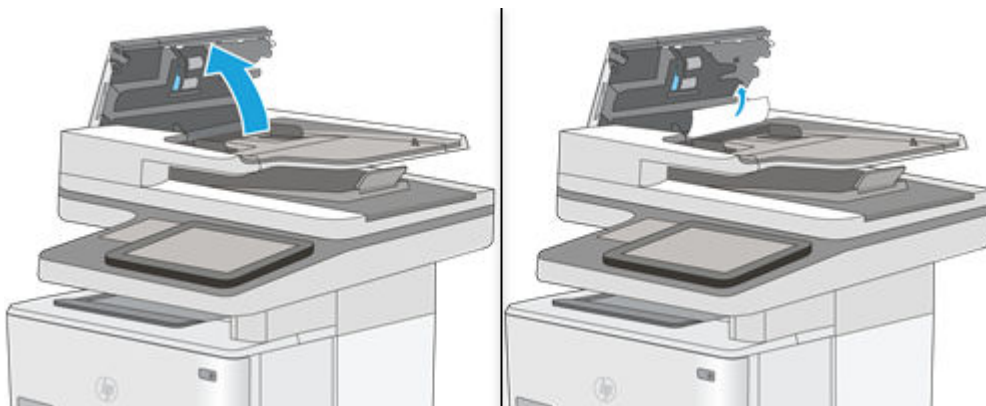

2. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

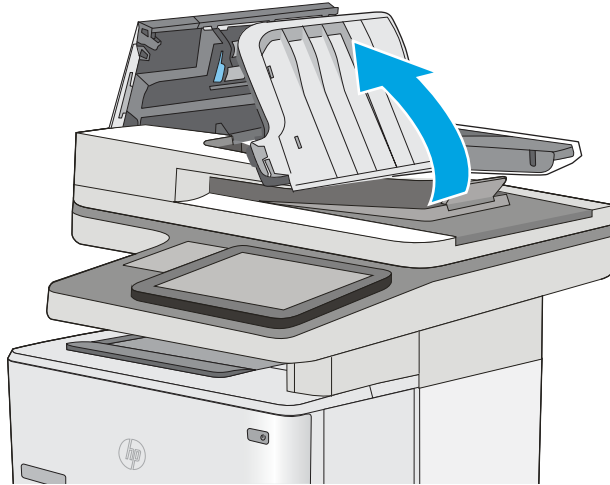

- b. Remove any paper found under the tray.

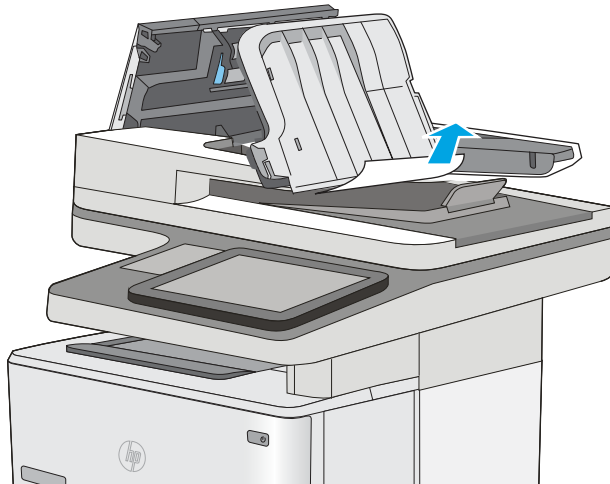


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

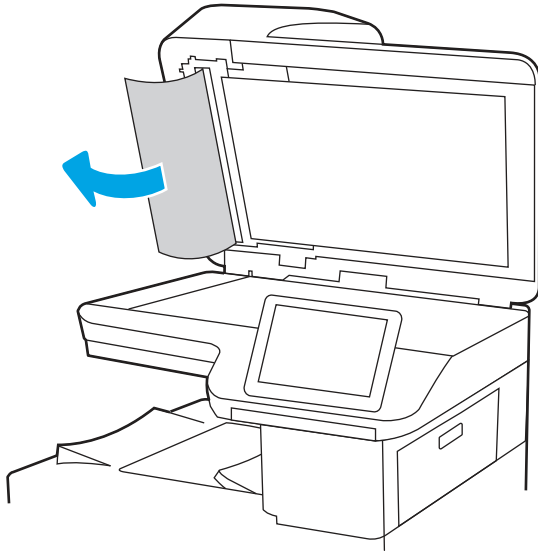

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

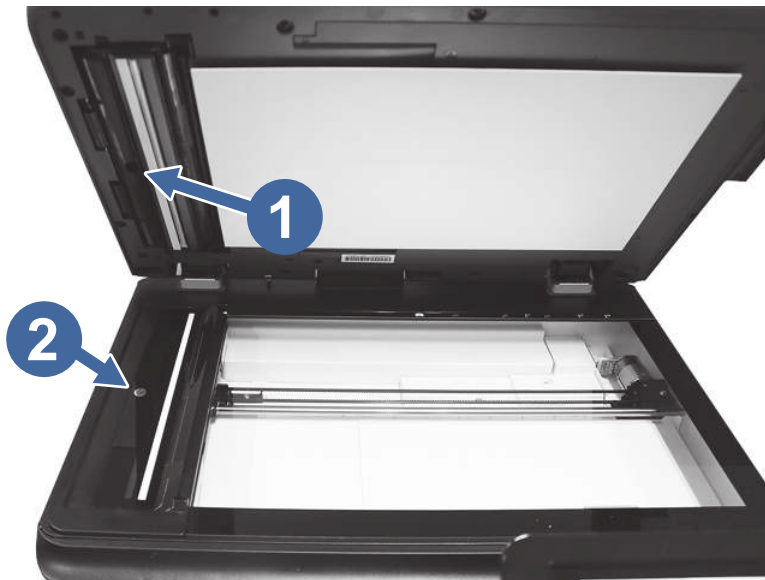

Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.


- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-62 Set the ADF guides

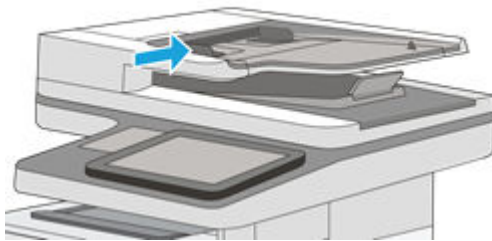


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

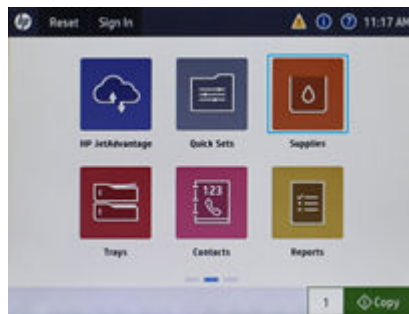

- b. Select **Document Feeder Kit**.

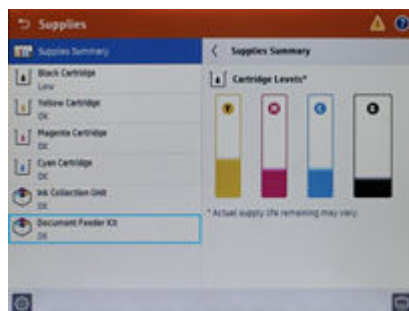

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

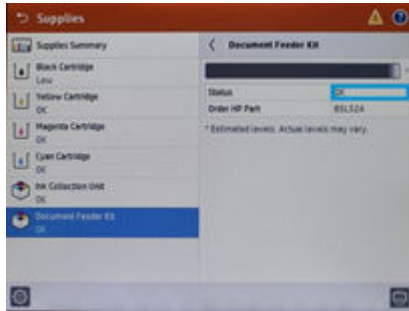


- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

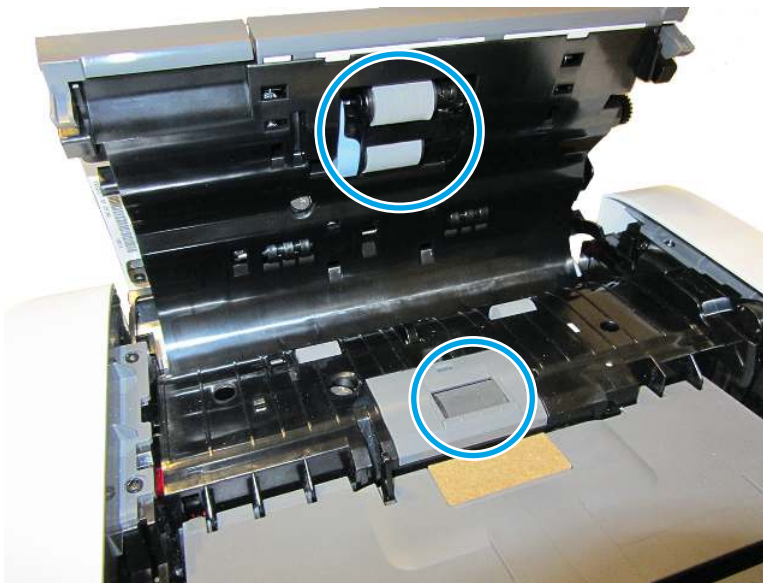

 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23-67901 ADF maintenance replacement roller kit

 **NOTE:** Note: Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder whole unit (ADF) part number:


- Flow models part number: B5L47-67909
- Non-Flow models part number: B5L47-67908

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

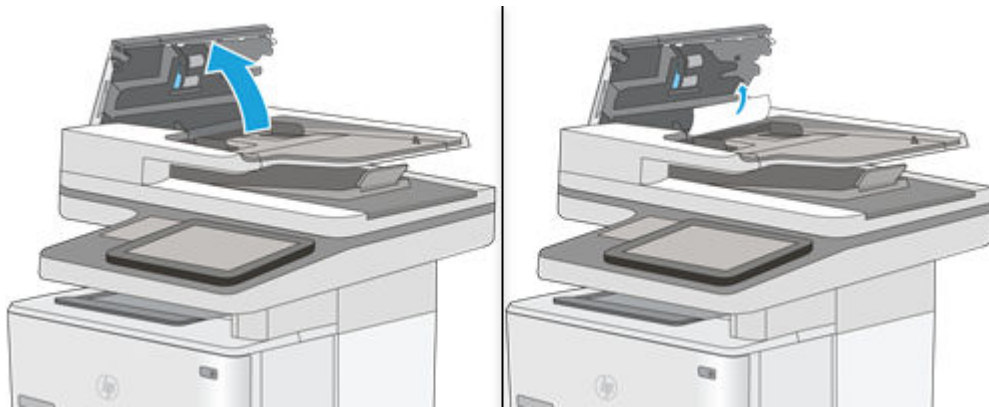

2. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

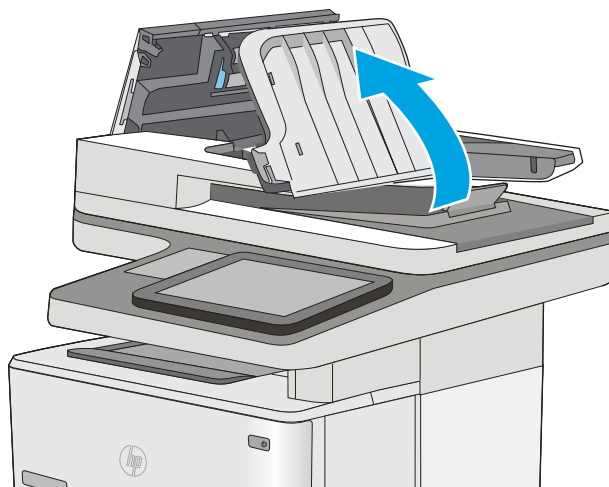

- b. Remove any paper found under the tray.

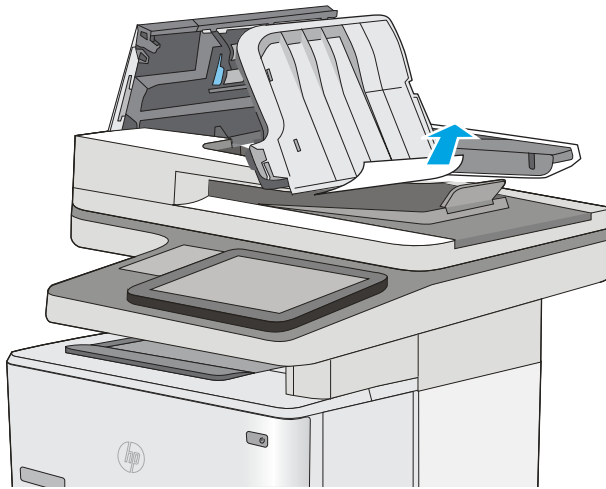


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

- 3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

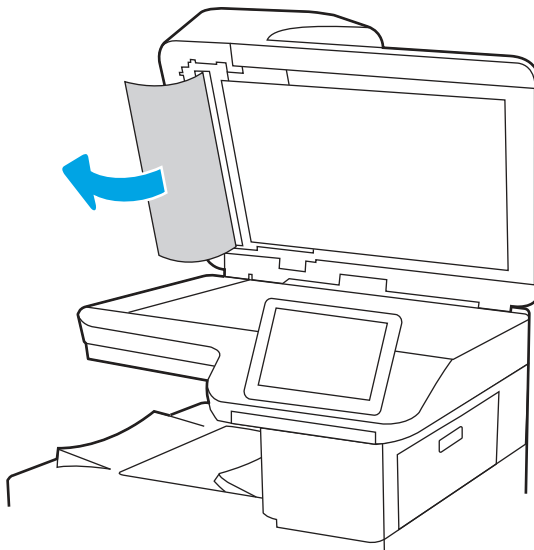

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

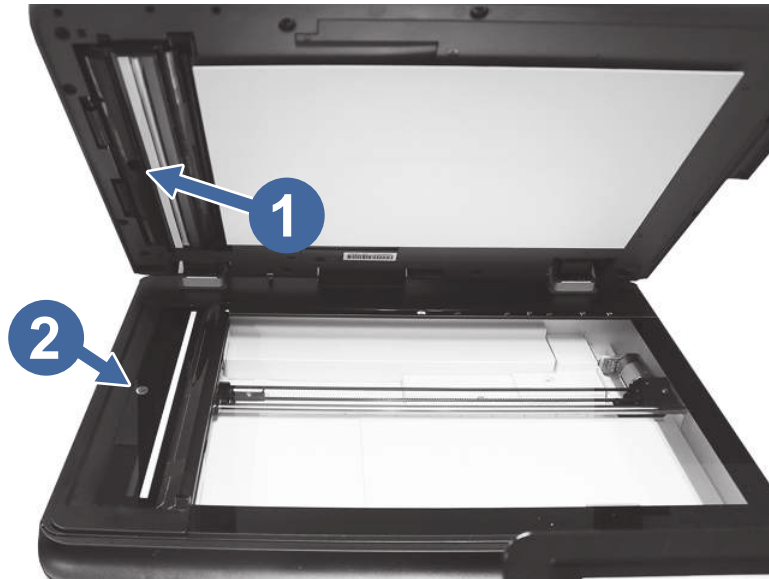


Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.
This document outlines the supported weights and sizes of the ADF including best practices:
Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):
 5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-63 Set the ADF guides

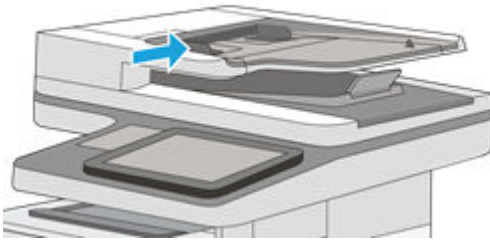


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

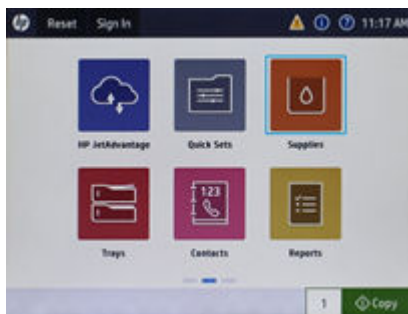

- b. Select **Document Feeder Kit**.

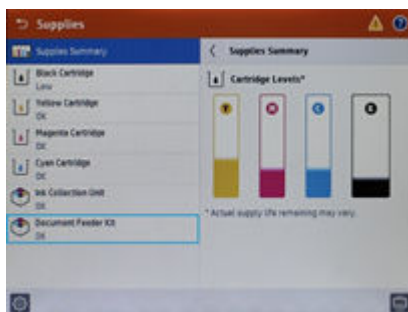

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

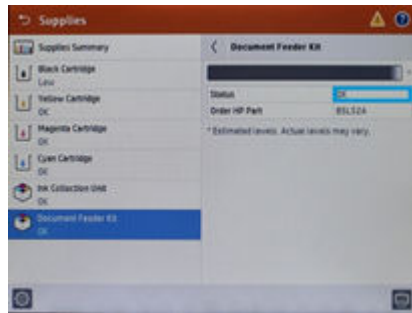


- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

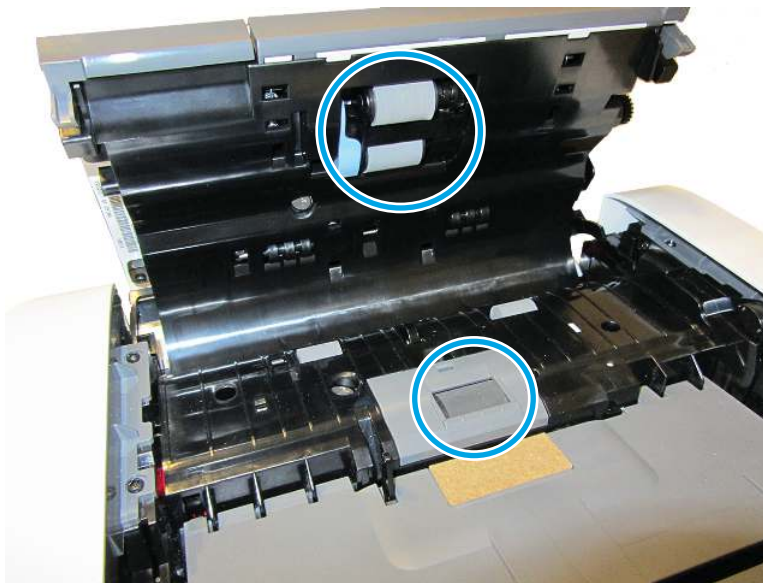


 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23-67901/(ADF maintenance replacement roller kit)

9. Inspect the ADF pick success sensor, cleaning both the REDI (paper pick success) sensor window and REDI (PAPER PICK SUCCESS) sensor reflector. If there is any dust or fiber remnants, clean by using a can of compressed air to blow out and clean.

Figure 6-64 ADF REDI sensor

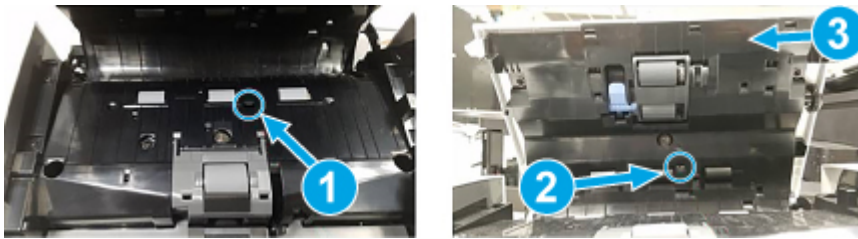


1 – REDI sensor window

2 – REDI sensor reflector

3 – ADF hatch

10. Check the REDI sensor reflector on flatbed. If there is any dust or fiber remnants, clean it by using a can of compressed air to blow out and clean. (related issue, ADF jam without paper inside)

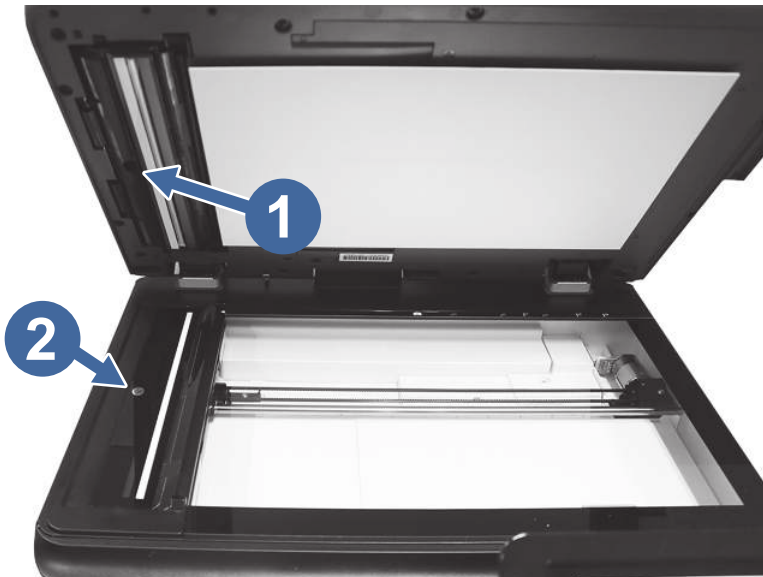


Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.


11. Verify that the connections between the automatic document feeder and the SCB are correctly seated.

Figure 6-65 SCB connections

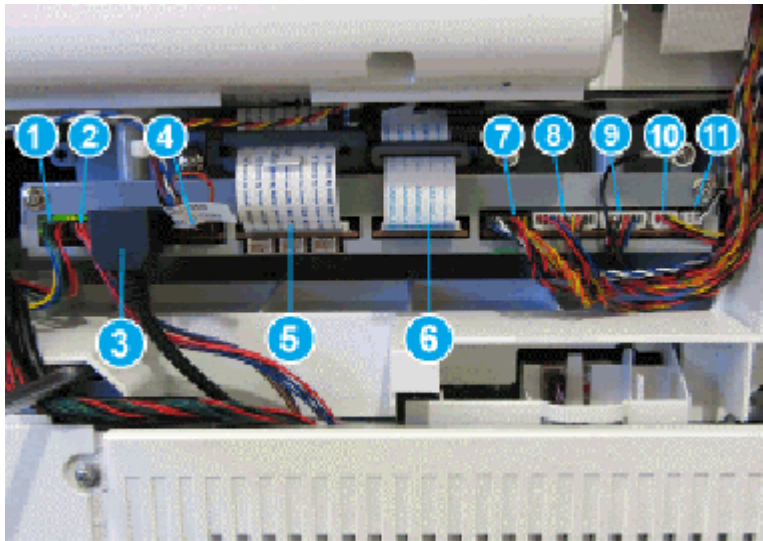


12. Using the Manual Scanner Sensor Test verify functionality of the ADF Paper Path Pick Success sensor.


- a. Navigate to and select **Support Tools**.

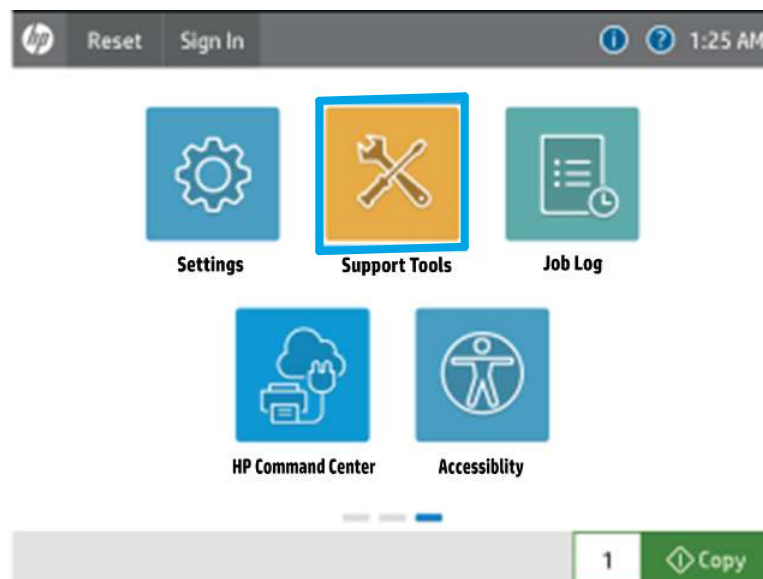


- b. Select **Troubleshooting**.

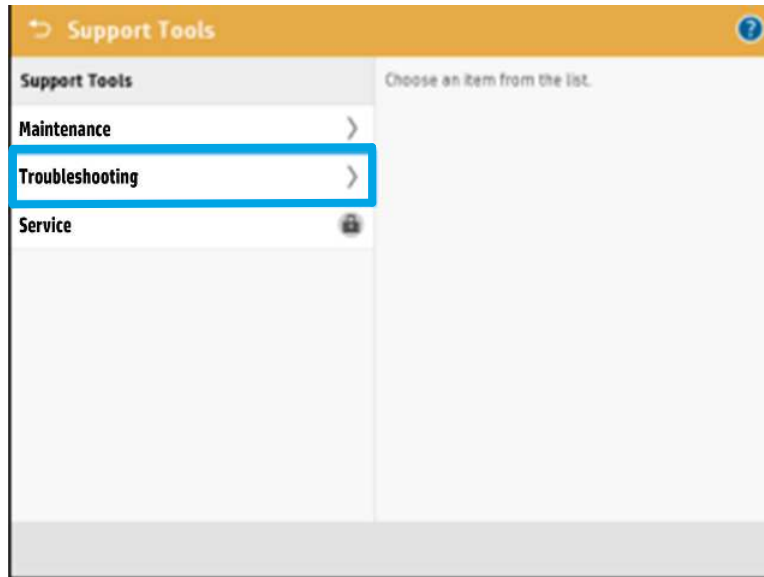


- c. Select **Diagnostic Tests**.

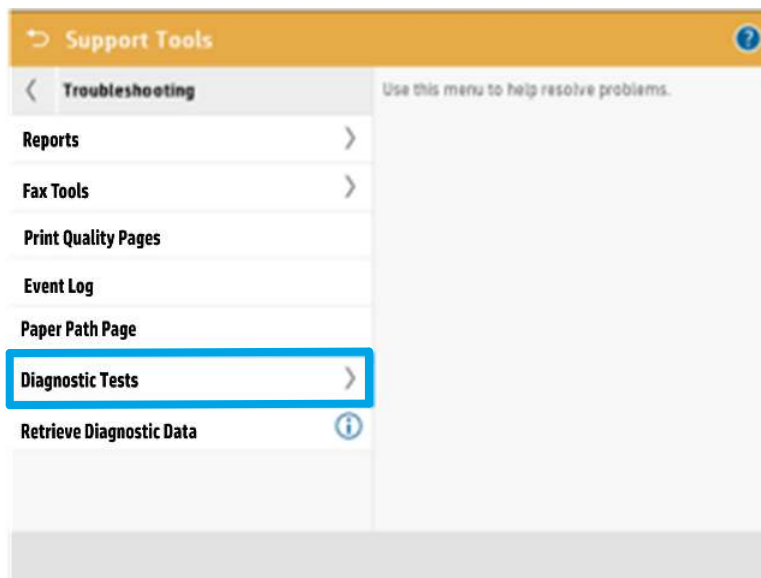


- d. Select **Continue**.

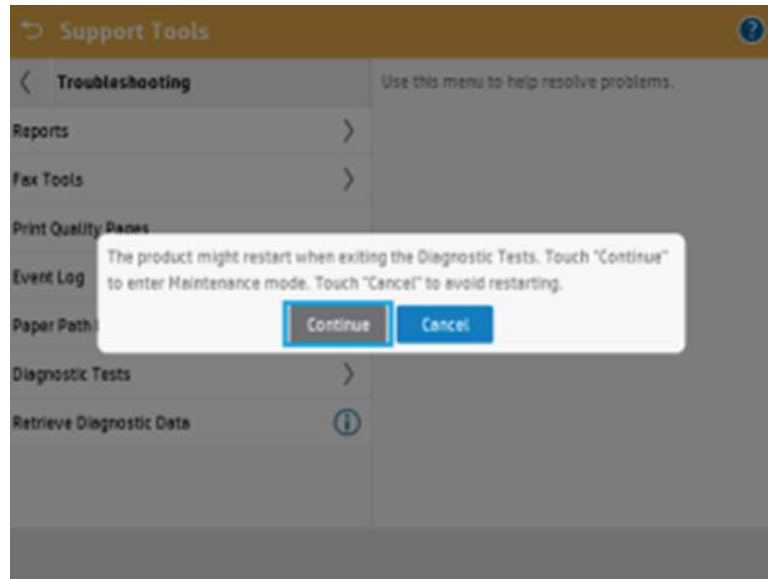

- e. Select **Manual Sensor Test**.

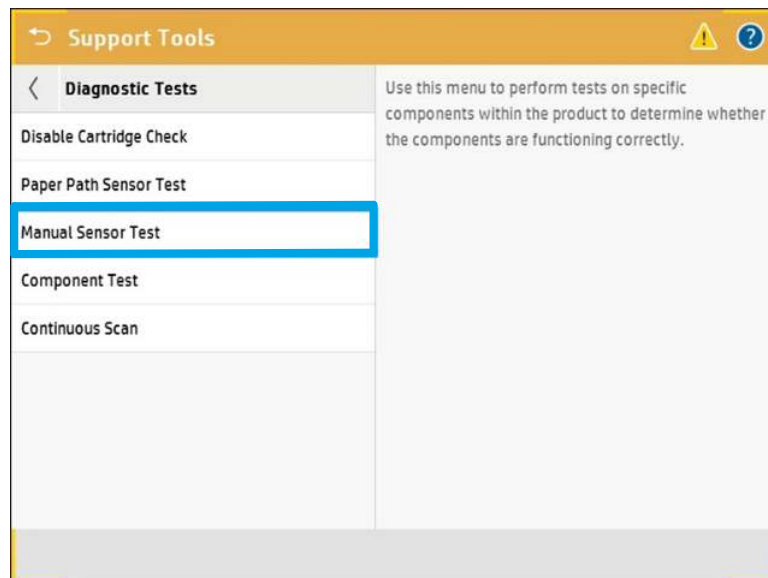

- f. Select **ADF Paper Path Deskew**.

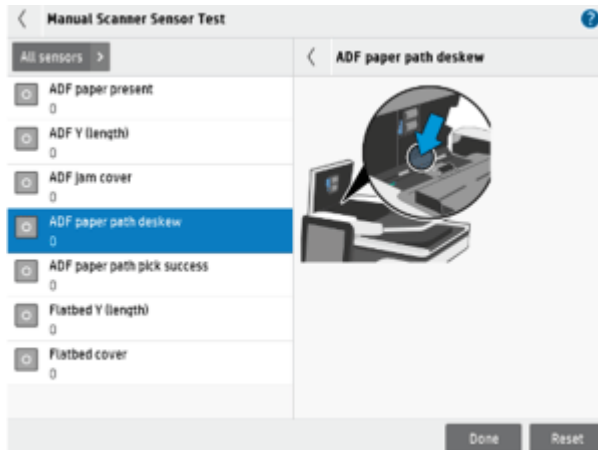


- g. Select **ADF Paper Path Pick Success**.

(Only in FLOW-MODELS)



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advancing.

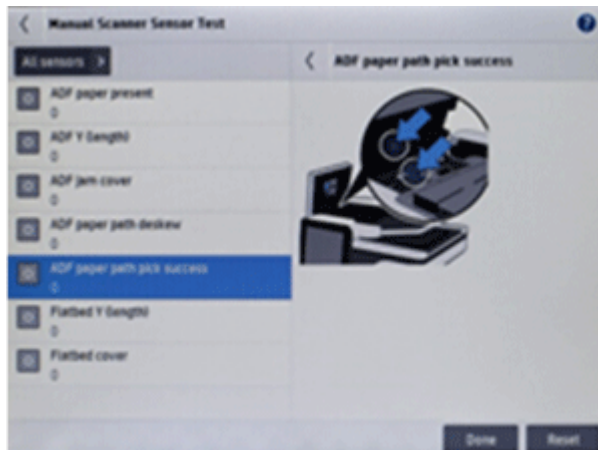

- h. Close the ADF cover and ensure that is secure and closed correctly.

13. Open and close the ADF cover to trigger the ADF Paper Path Pick Success sensor.



 **NOTE:** Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advanced.

14. If the ADF Paper Path Pick Success test fails to advance the count, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

Part number

- Flow models part number: B5L47-67907
- Non-Flow models part number: B5L47-67906

 **NOTE:** Note: Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder whole unit (ADF) part number:


- Flow models part number: B5L47-67909
- Non-Flow models part number: B5L47-67908

31.13.01

Document feeder job error, pick error.

Paper pick was initiated, but the page didn't make it to the pick success sensor.

Sensor location 4

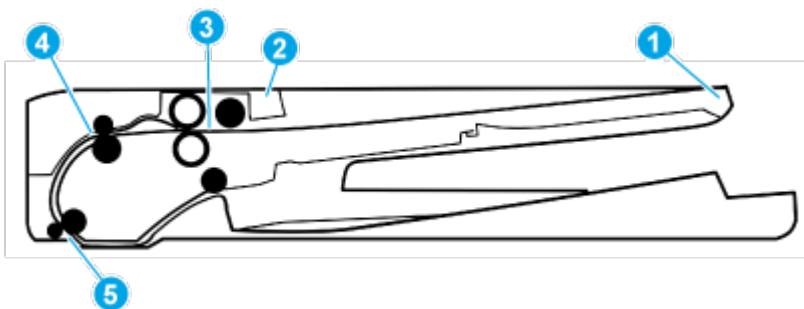

ADF Pick error.


ADF Pick Jam

Recommended action for customer


Follow these troubleshooting steps in the order presented.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

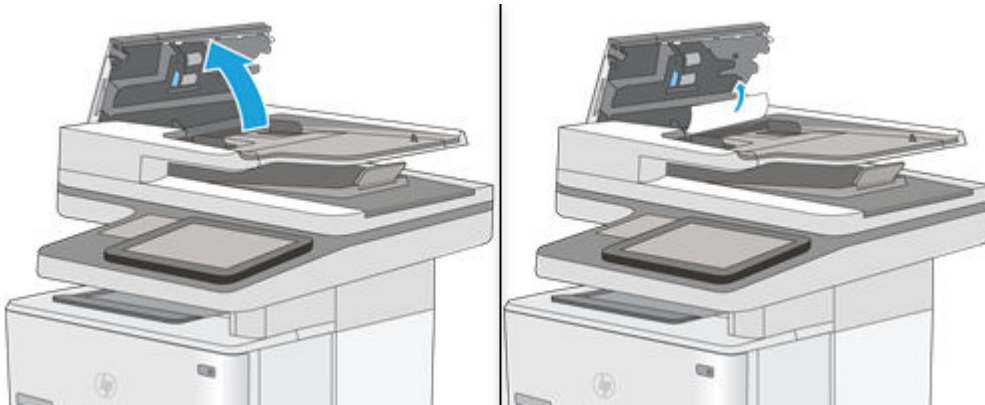

2. Lift the document-feeder input tray and remove any jammed paper.

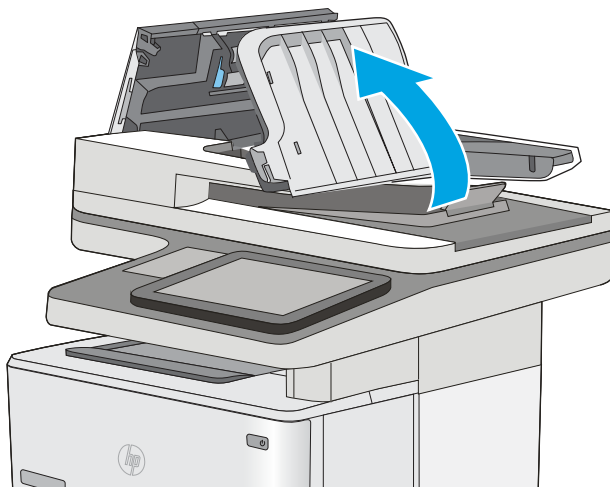

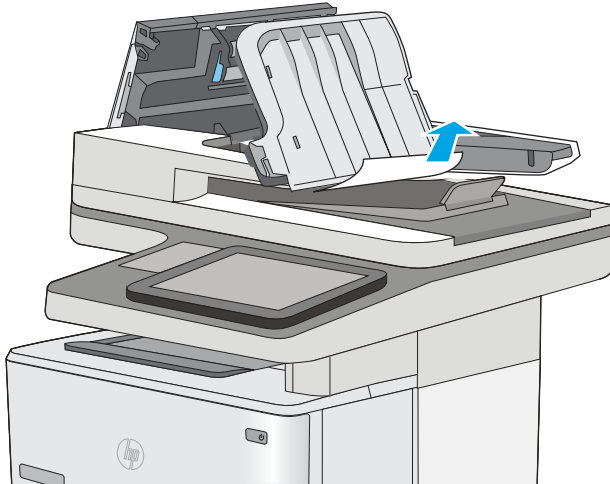

3. Lower the document-feeder input tray and then close the document feeder cover.



NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.


4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-66 Set the ADF guides

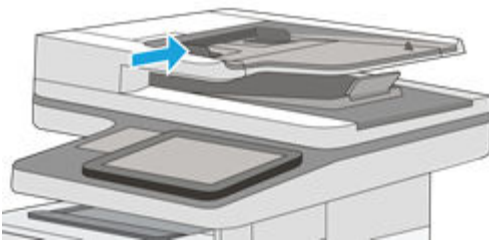


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.




NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

6. Check the Document Feeder Kit consumable status.


- a. Navigate to and select **Supplies** on the control panel.

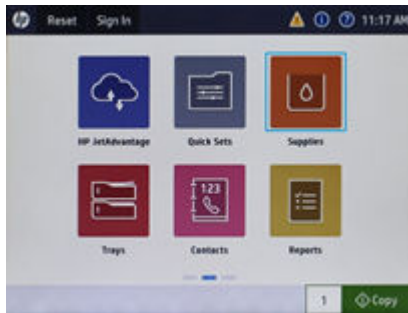

- b. Select **Document Feeder Kit**.

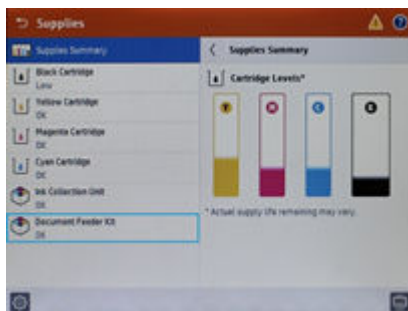

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

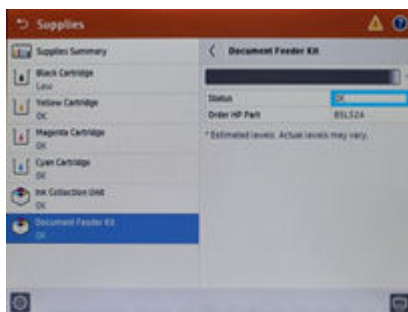


- d. Recommend that the customer replace the Document Feeder Kit if the status is **Low** or **Very Low**.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm

water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

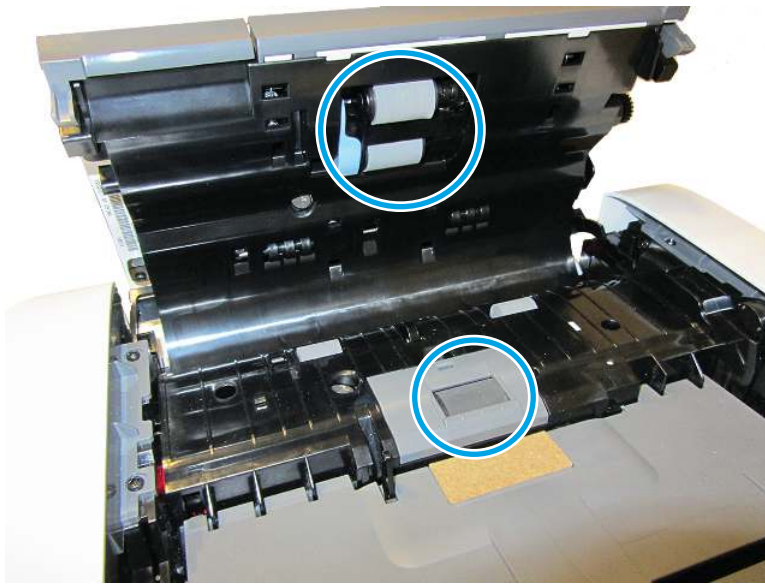

 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23A/HP 200 ADF Roller Replacement Kit

To order parts, go to <https://store.hp.com>


9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent


Follow these troubleshooting steps in the order presented.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

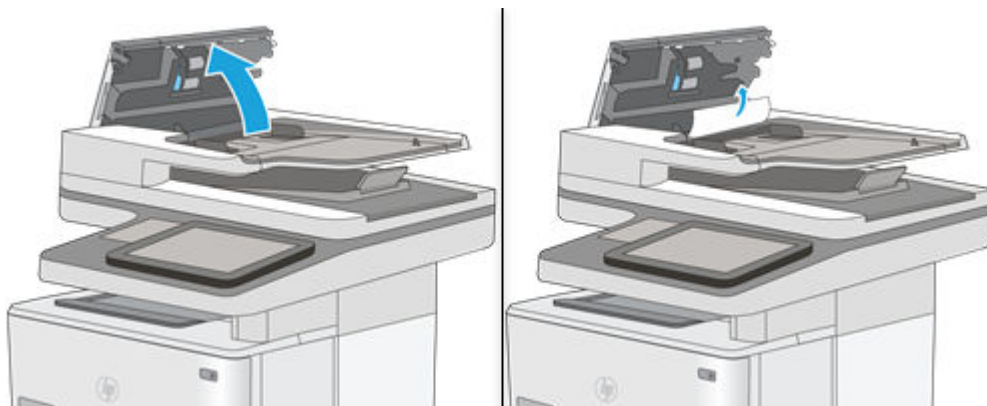

2. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

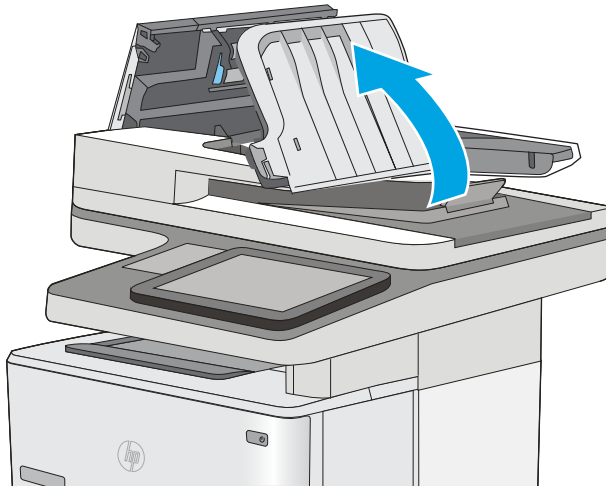

- b. Remove any paper found under the tray.

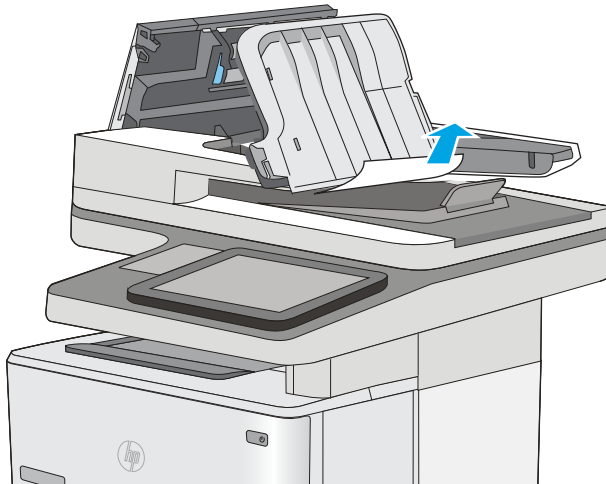


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

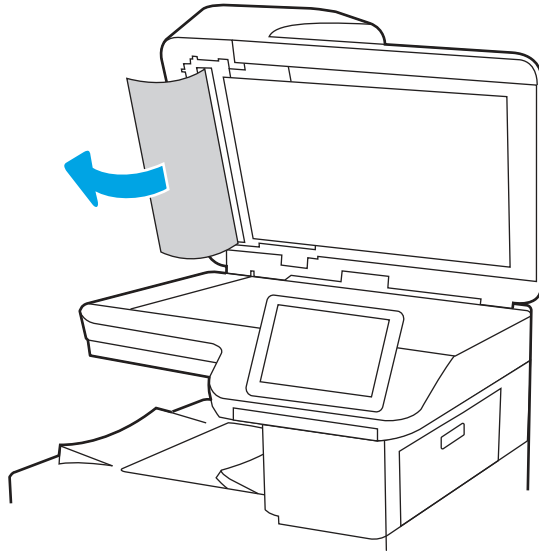

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

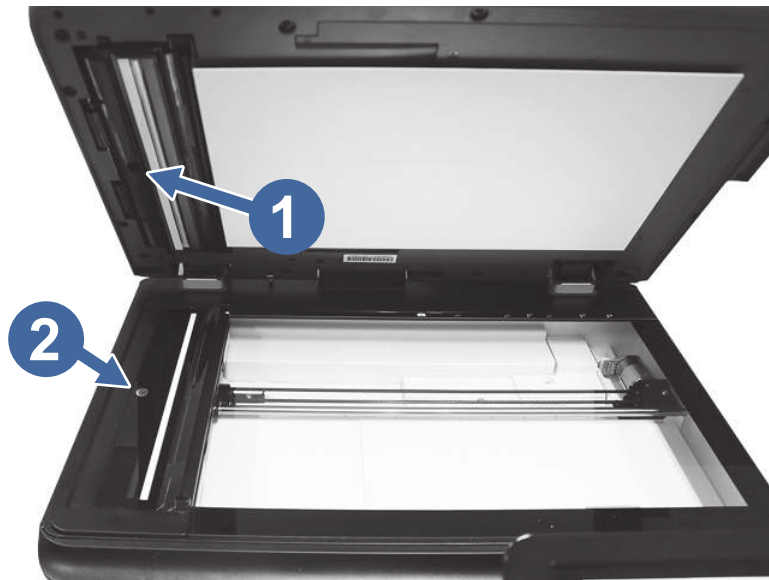

Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.


- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-67 Set the ADF guides

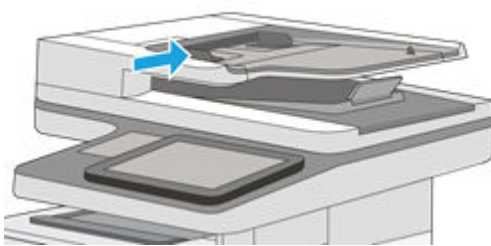


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

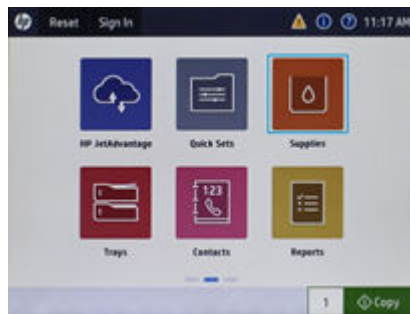

- b. Select **Document Feeder Kit**.

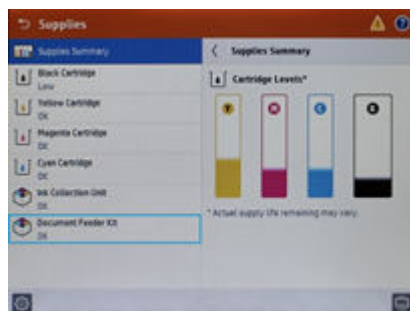

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

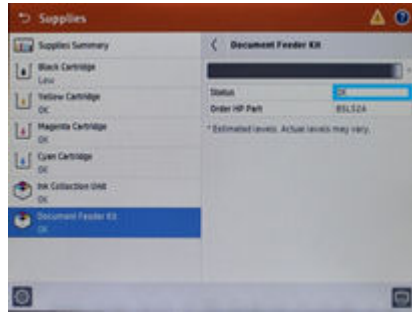


- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

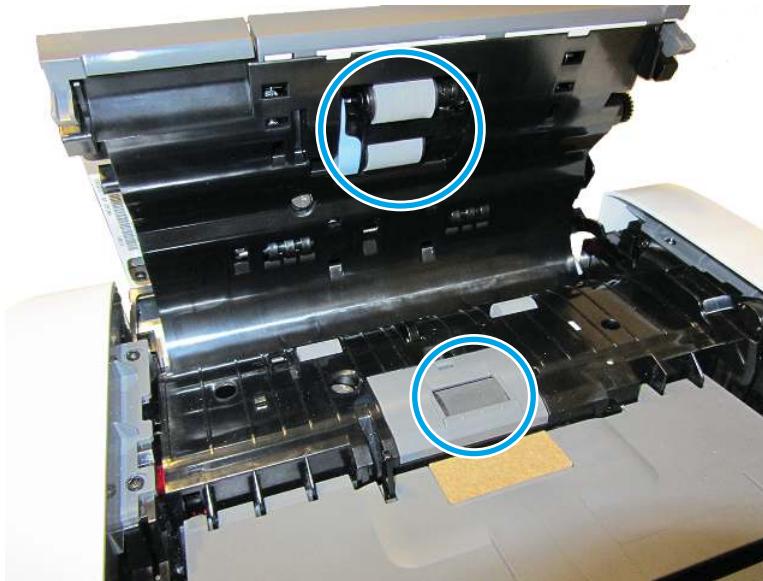

 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23-67901 ADF maintenance replacement roller kit



NOTE: Note: Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder whole unit (ADF) part number:


- Flow models part number: B5L47-67909
- Non-Flow models part number: B5L47-67908

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

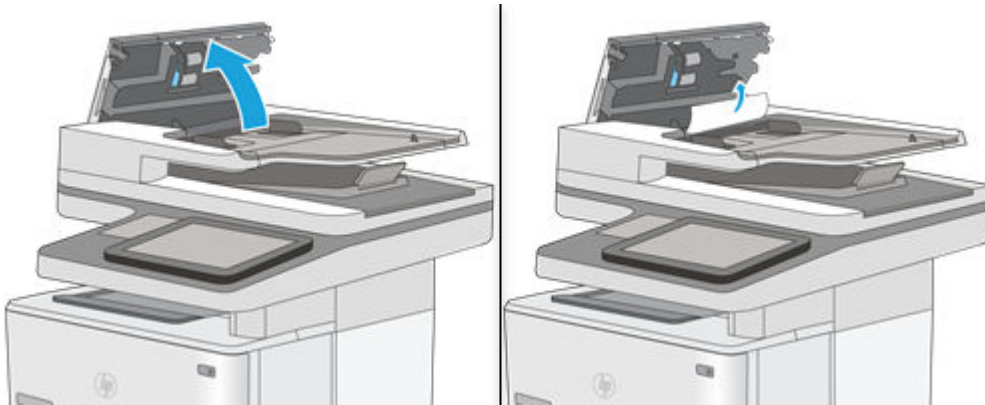

2. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

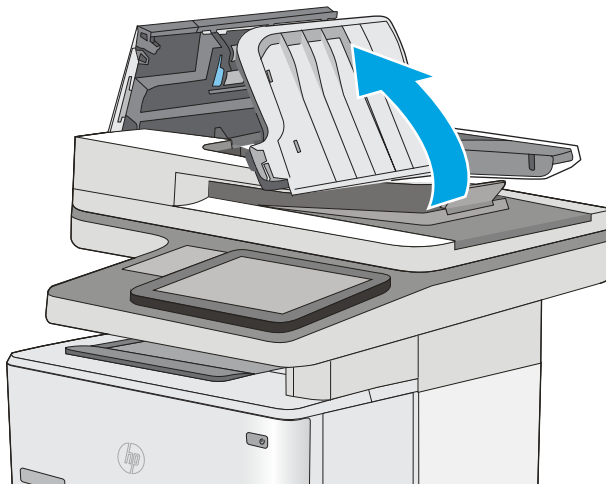

- b. Remove any paper found under the tray.

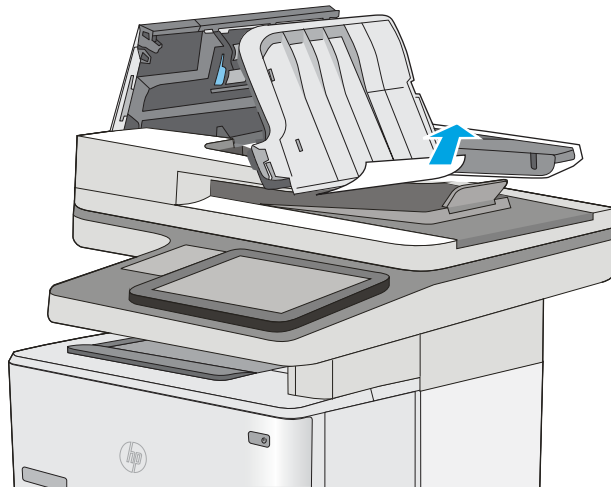


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

- 3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

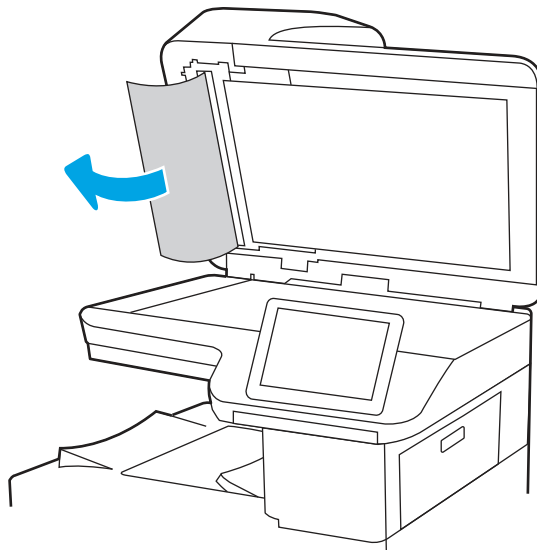

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

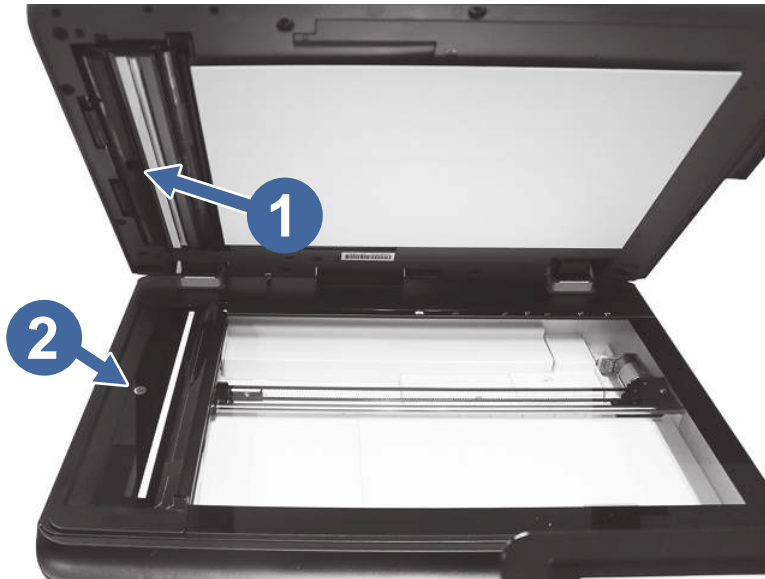


Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.
- 4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.
This document outlines the supported weights and sizes of the ADF including best practices:
Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF);
 - 5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-68 Set the ADF guides

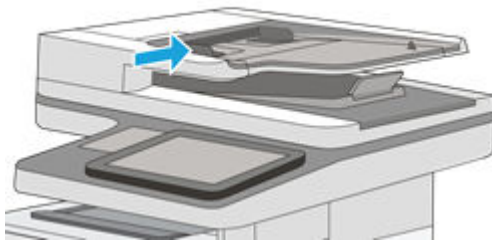


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

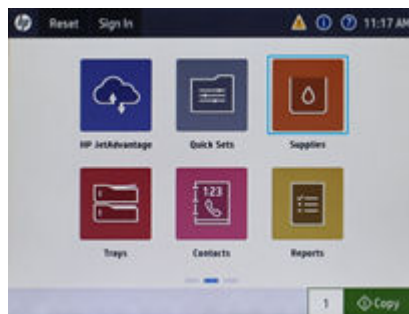

- b. Select **Document Feeder Kit**.

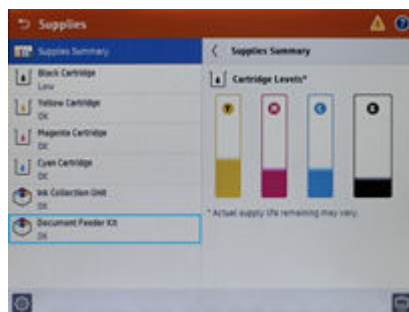

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

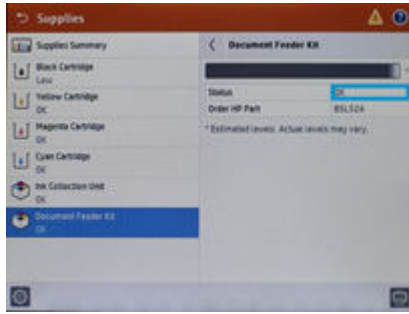

- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.


Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>



NOTE: Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

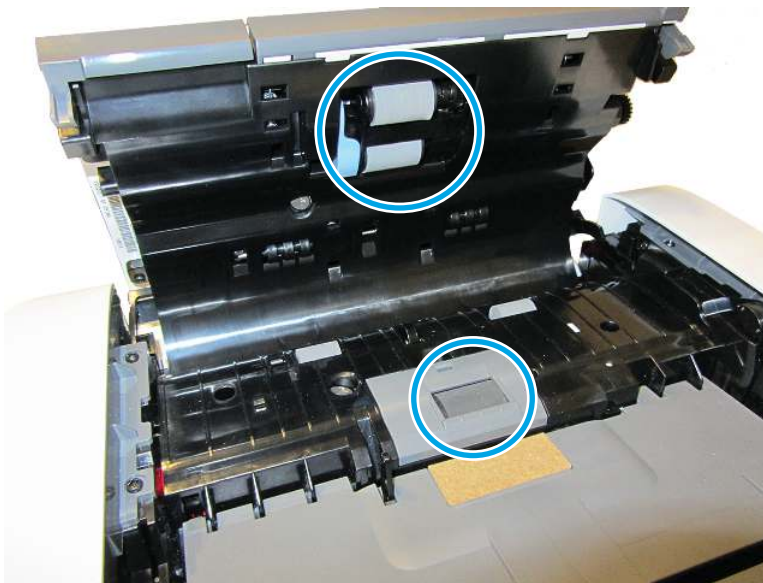

NOTE: Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23-67901/(ADF maintenance replacement roller kit)


9. Inspect the ADF pick success sensor, cleaning both the REDI (paper pick success) sensor window and REDI (PAPER PICK SUCCESS) sensor reflector. If there is any dust or fiber remnants, clean by using a can of compressed air to blow out and clean.

Figure 6-69 ADF REDI sensor



- 1 – REDI sensor window
- 2 – REDI sensor reflector
- 3 – ADF hatch

10. Check the REDI sensor reflector on flatbed. If there is any dust or fiber remnants, clean it by using a can of compressed air to blow out and clean. (related issue, ADF jam without paper inside)

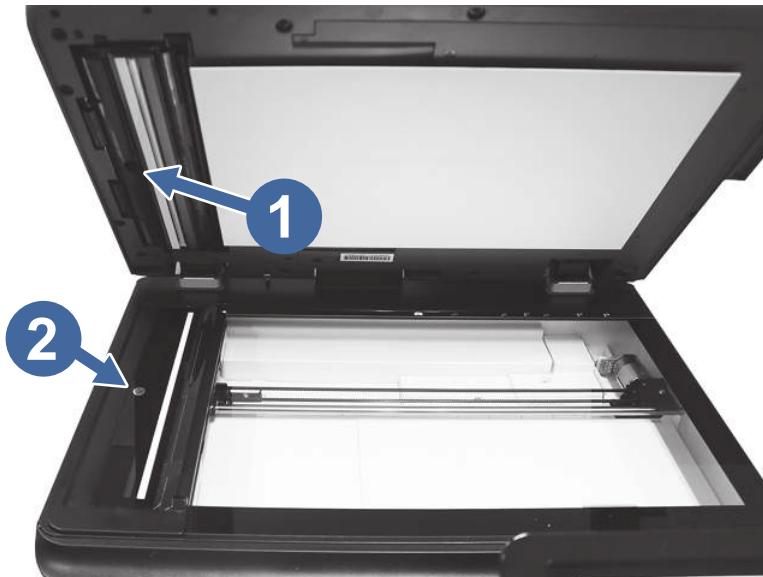


Callout 1: Check for paper blocking this area.


Callout 2: Clean this area with a damp lint free cloth.

11. Verify that the connections between the automatic document feeder and the SCB are correctly seated.


Figure 6-70 SCB connections

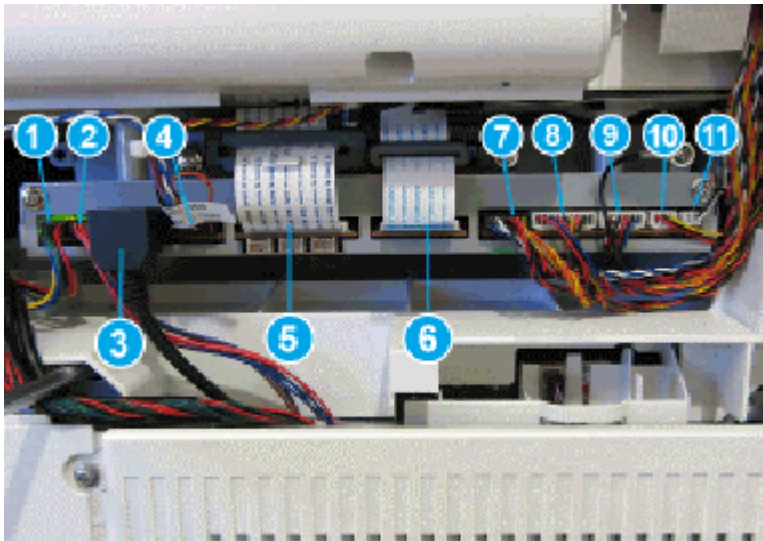


12. Using the Manual Scanner Sensor Test verify functionality of the ADF Paper Path Pick Success sensor.
 - a. Navigate to and select **Support Tools**.

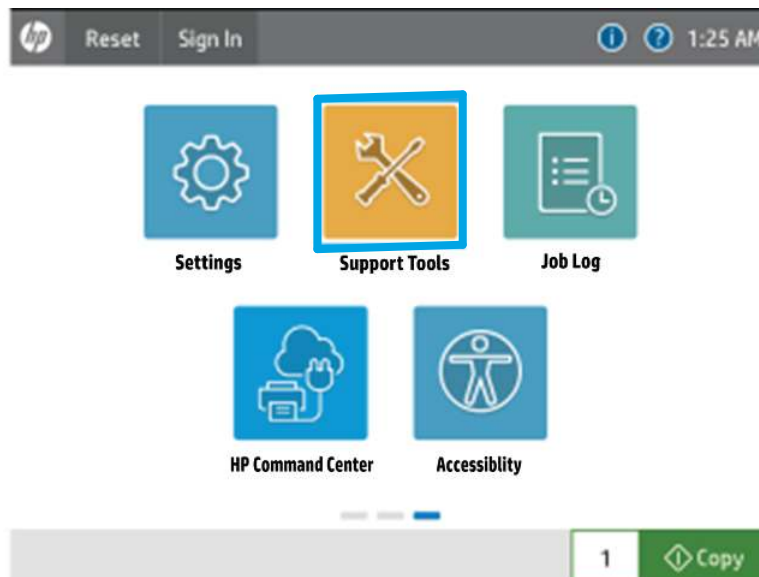


- b. Select **Troubleshooting**.

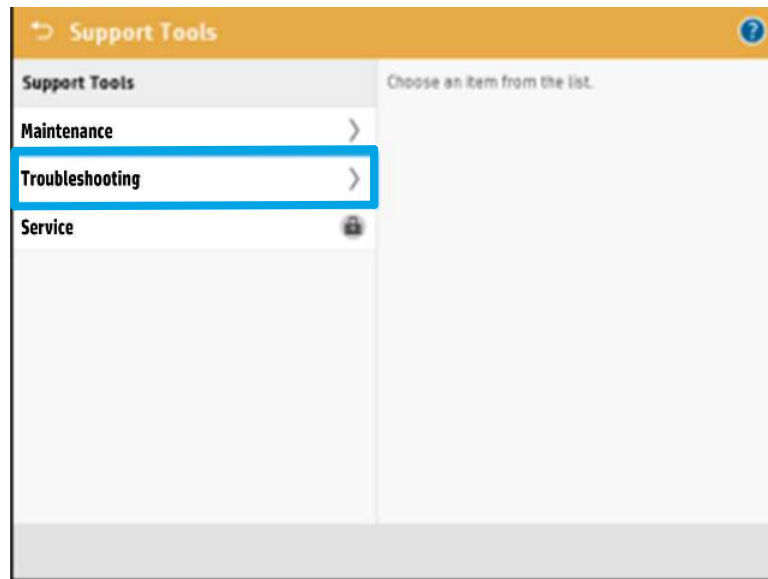


- c. Select **Diagnostic Tests**.

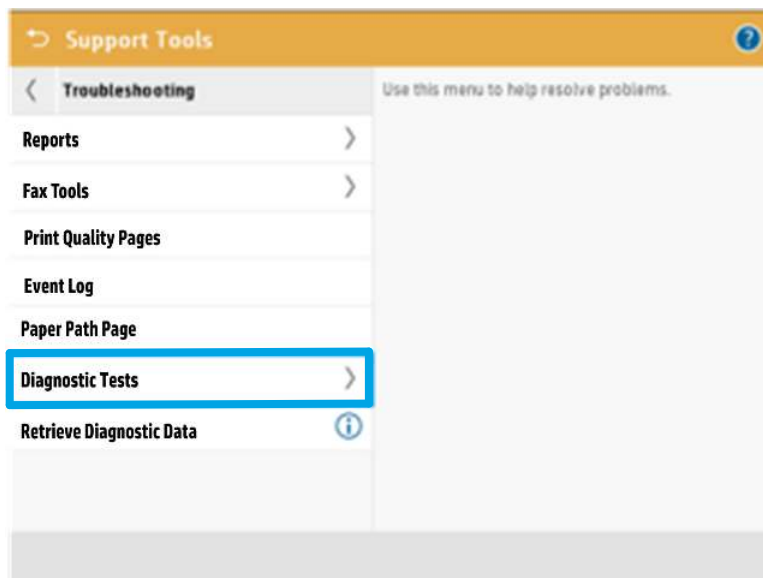


- d. Select **Continue**.

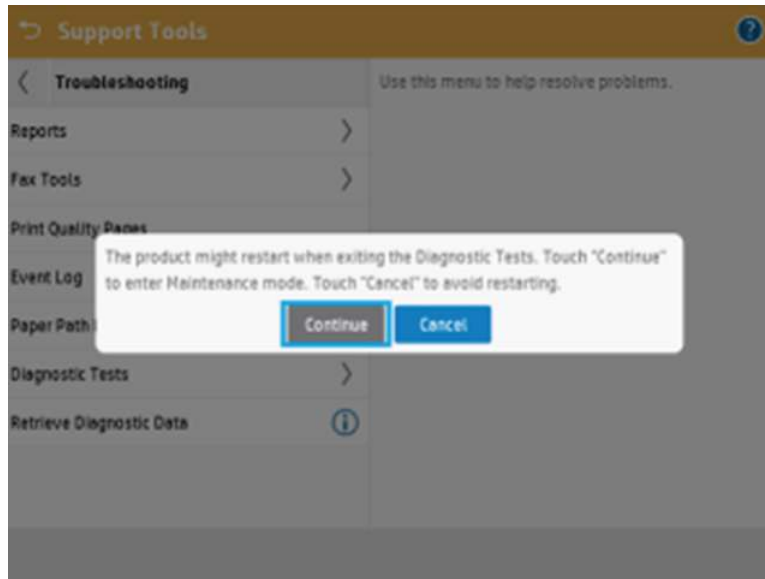

- e. Select **Manual Sensor Test**.

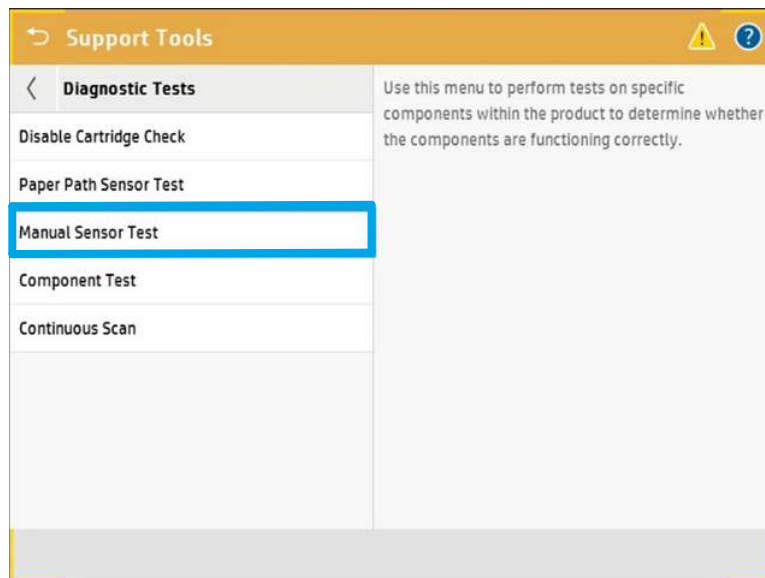

- f. Select **ADF Paper Path Deskew**.

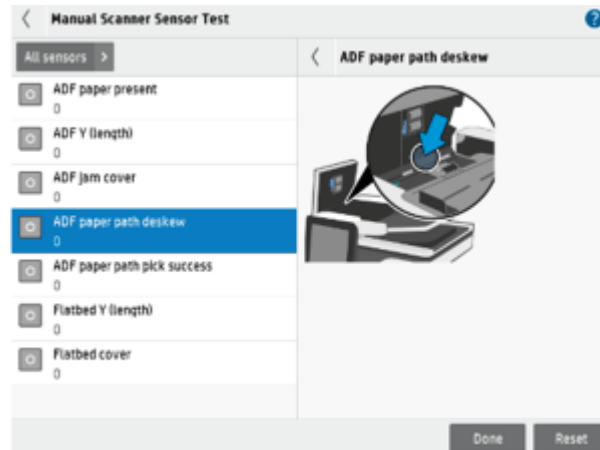

- g. Select **ADF Paper Path Pick Success**.

(Only in FLOW-MODELS)



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advancing.



- h. Close the ADF cover and ensure that is secure and closed correctly.

13. Open and close the ADF cover to trigger the ADF Paper Path Pick Success sensor.



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advanced.

14. If the ADF Paper Path Pick Success test fails to advance the count, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

Part number

- Flow models part number: B5L47-67907
- Non-Flow models part number: B5L47-67906



NOTE: Note: Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder whole unit (ADF) part number:


- Flow models part number: B5L47-67909
- Non-Flow models part number: B5L47-67908

31.13.02

Document feeder job error, feed jam.

The paper passed the pick success sensor, and then jammed in the document feeder paper path.

Between sensor location 4 and 5

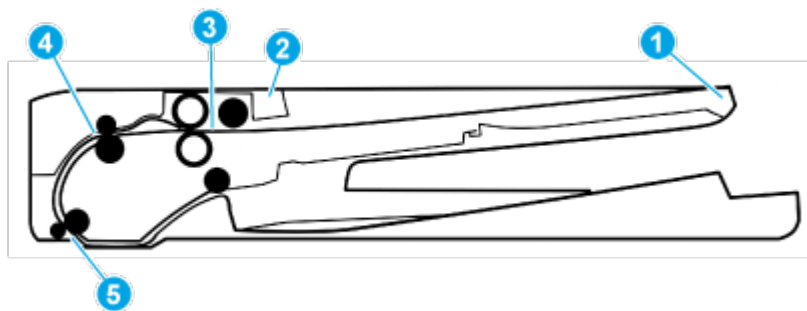

Issue might be described as the following:


- [ADF paper jam](#)
- [Automatic document feeder jam](#)
- [Jams in document feeder](#)

Recommended action for customer


Follow these troubleshooting steps in the order presented.


For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

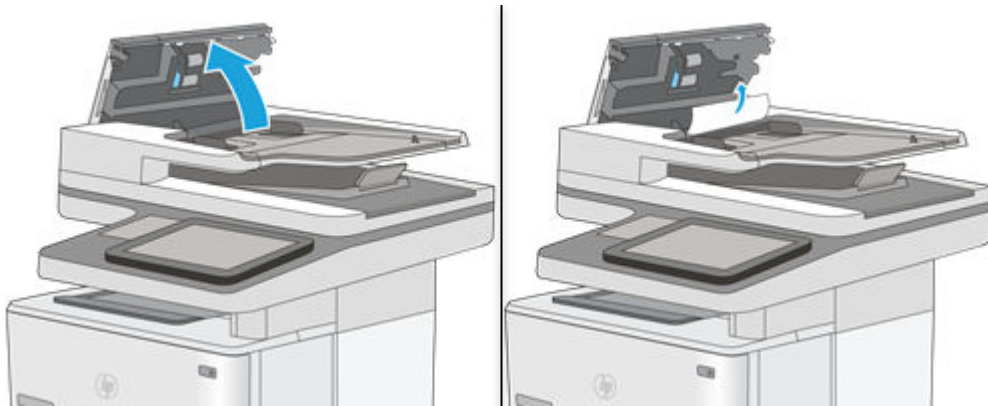

2. Lift the document-feeder input tray and remove any jammed paper.

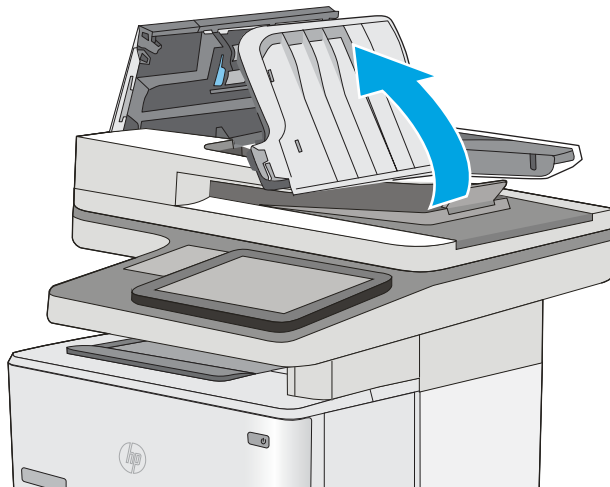

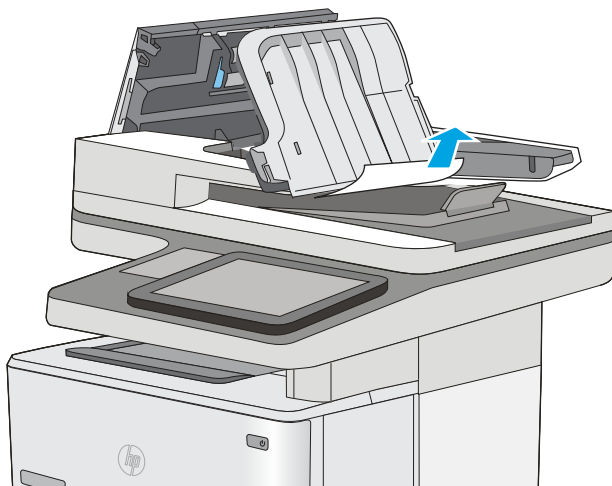

3. Lower the document-feeder input tray and then close the document feeder cover.



NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.


4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.

Figure 6-71 Set the ADF guides

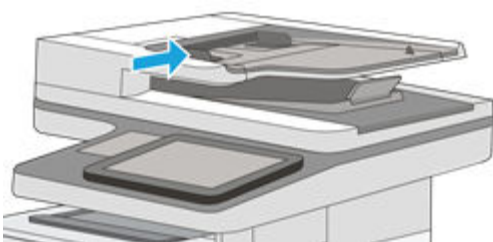


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.




NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.

6. Check the Document Feeder Kit consumable status.


- a. Navigate to and select **Supplies** on the control panel.

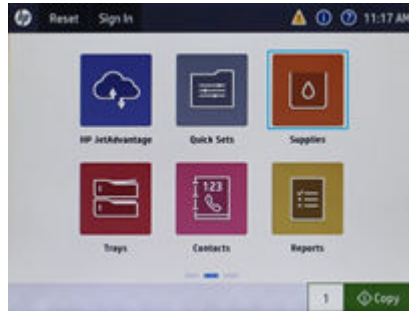

- b. Select **Document Feeder Kit**.

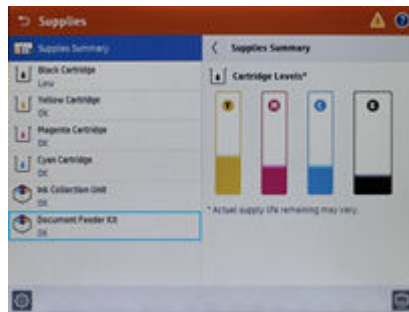

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

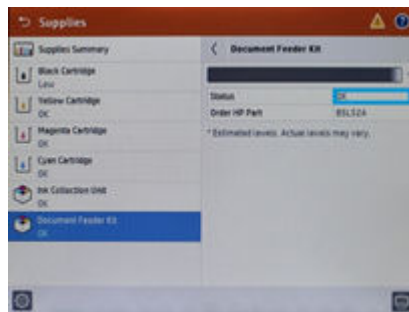


- d. Recommend that the customer replace the Document Feeder Kit if the status is **Low** or **Very Low**.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm

water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

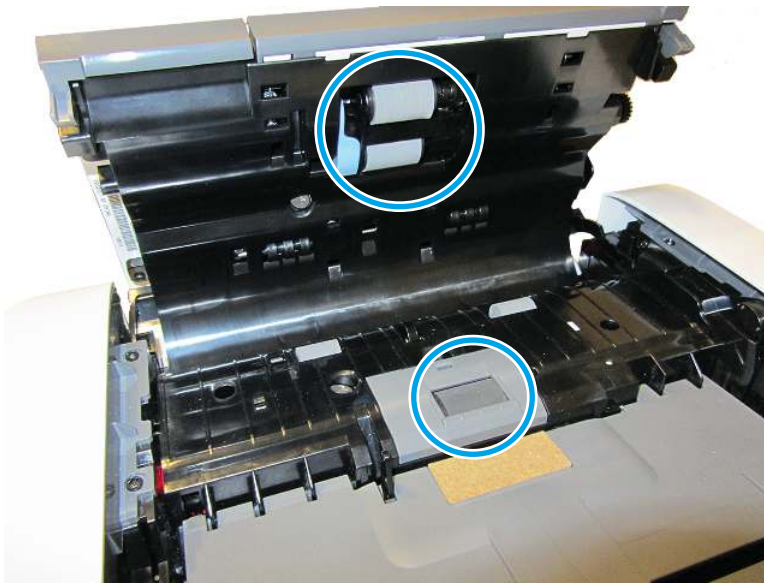

NOTE: Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23A/HP 200 ADF Roller Replacement Kit

To order parts, go to <https://store.hp.com>


9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent


Follow these troubleshooting steps in the order presented.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

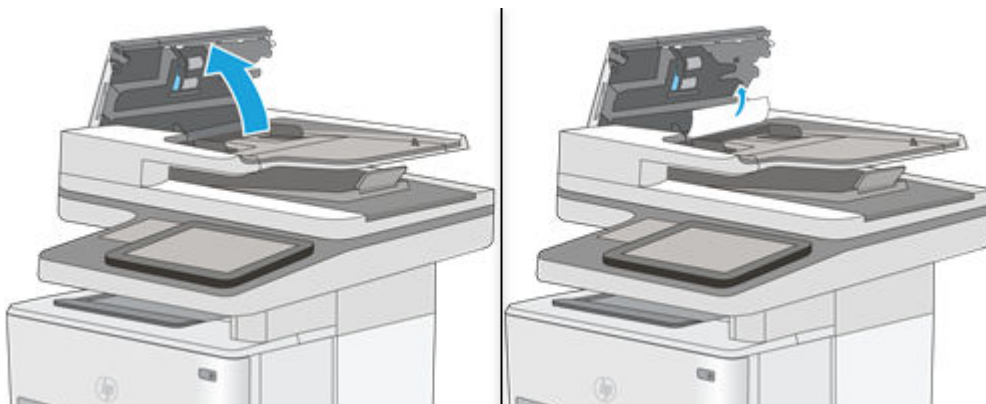

2. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

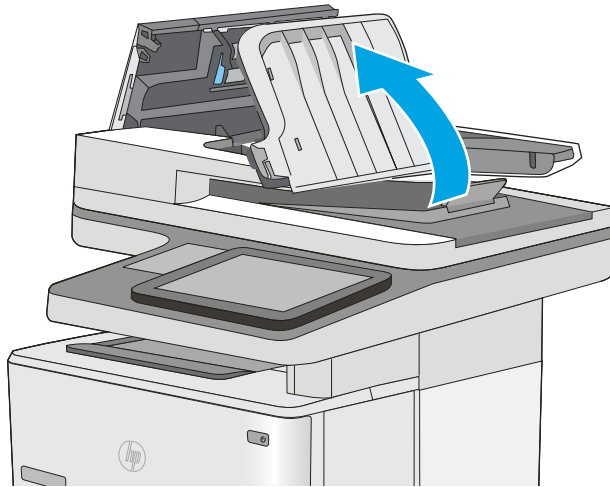

- b. Remove any paper found under the tray.

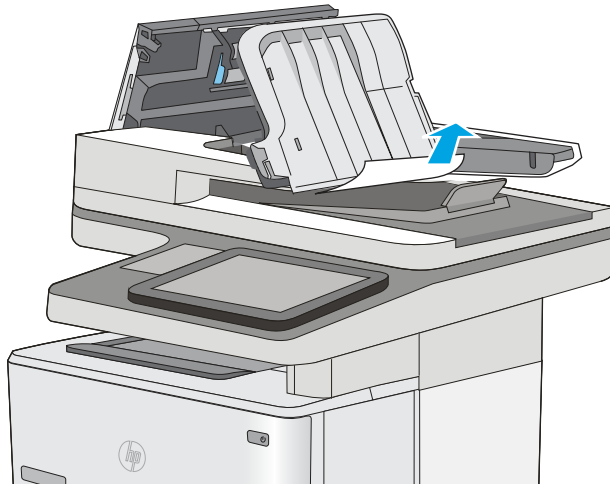


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

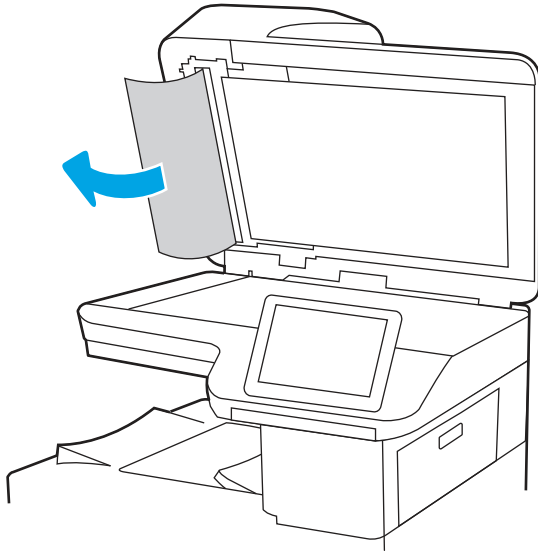

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

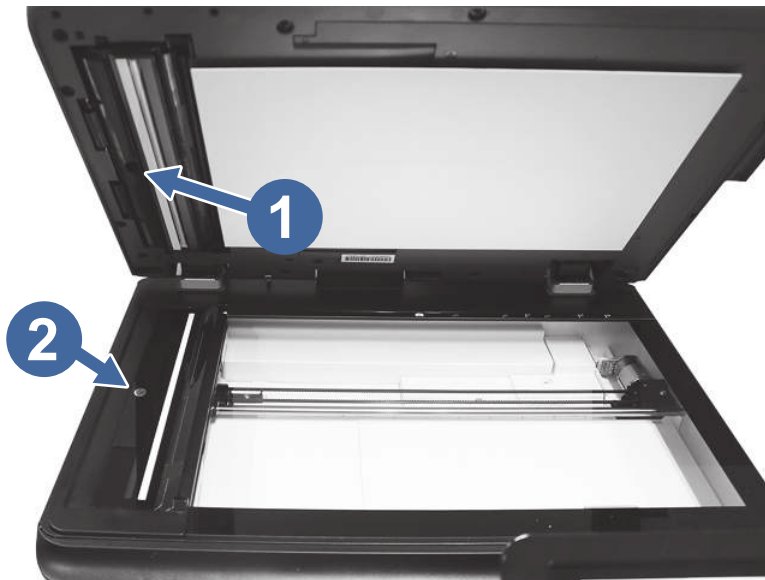

Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.


- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-72 Set the ADF guides

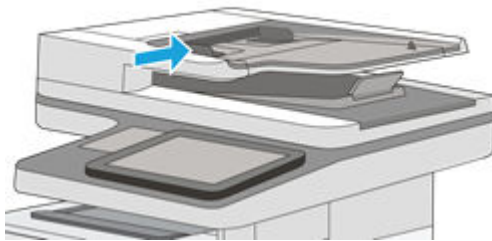


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

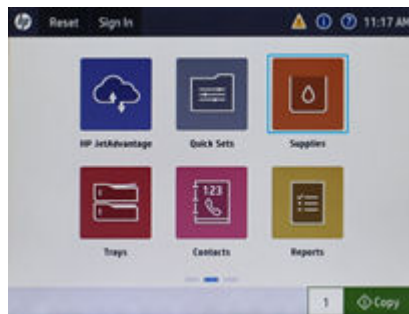

- b. Select **Document Feeder Kit**.

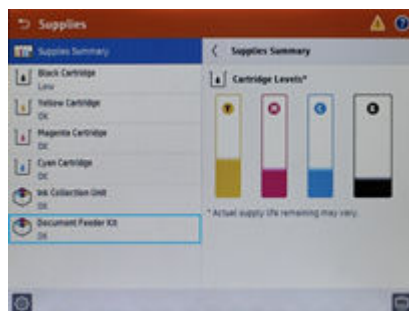

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

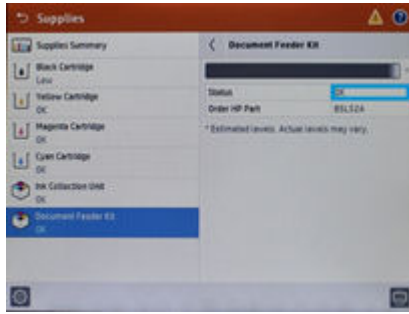

- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.


Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>



NOTE: Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

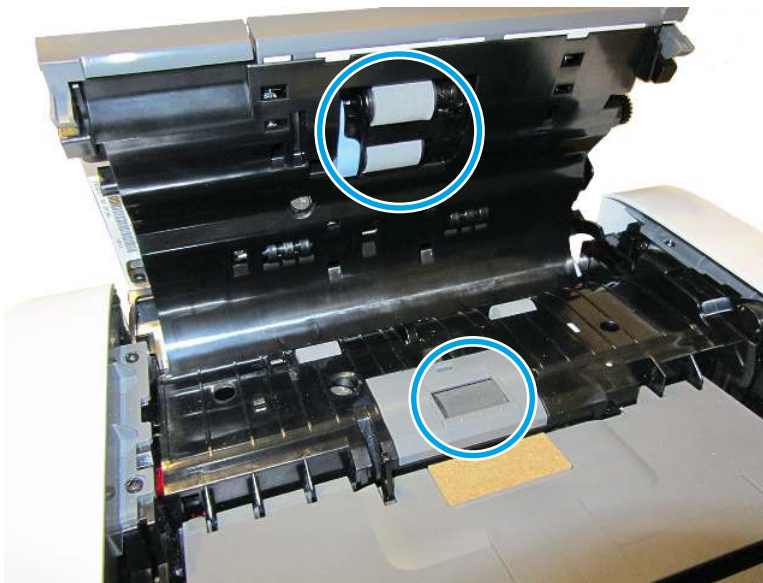

NOTE: Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23-67901 ADF maintenance replacement roller kit

 **NOTE:** Note: Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder whole unit (ADF) part number:


- Flow models part number: B5L47-67909
- Non-Flow models part number: B5L47-67908

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

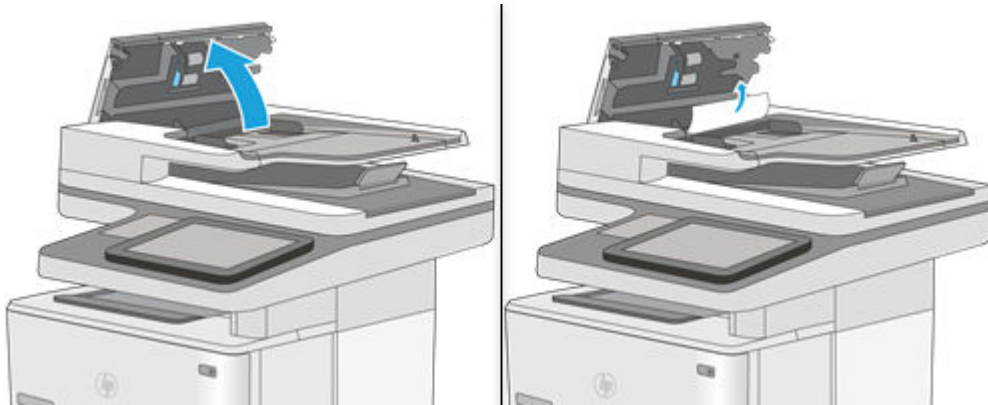

2. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

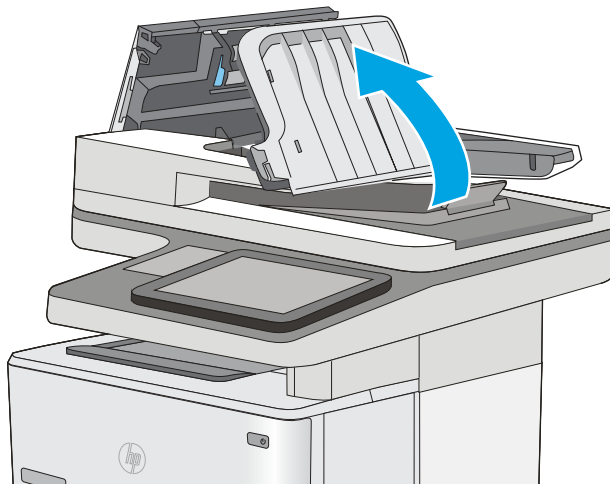

- b. Remove any paper found under the tray.

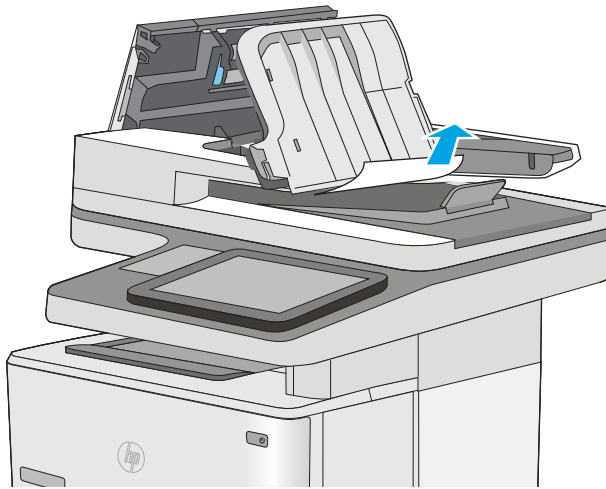


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

- 3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

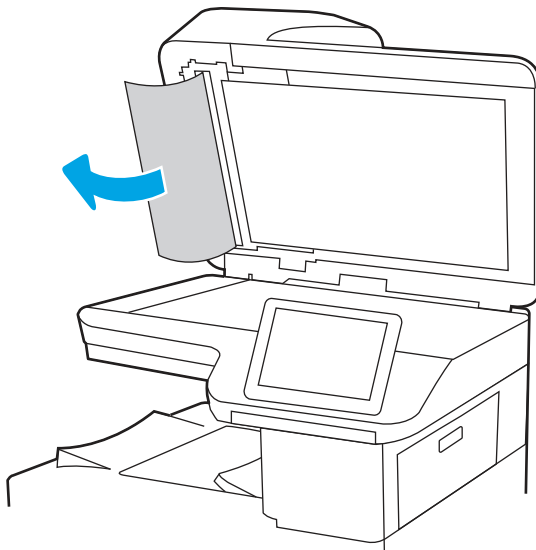

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

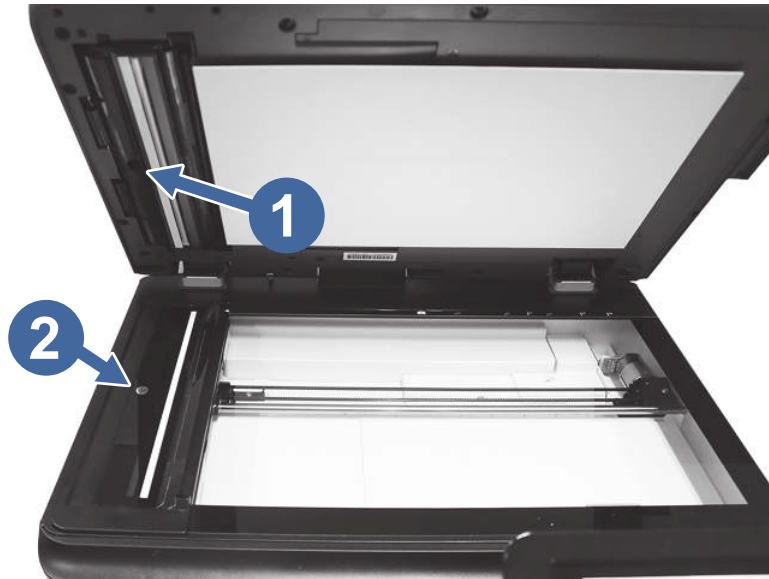


Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.
This document outlines the supported weights and sizes of the ADF including best practices:
Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):
 5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-73 Set the ADF guides

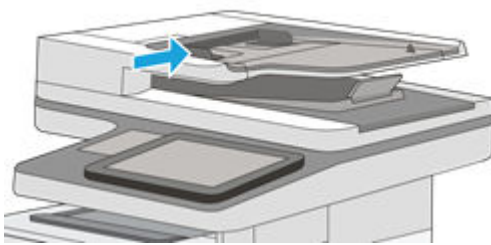


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

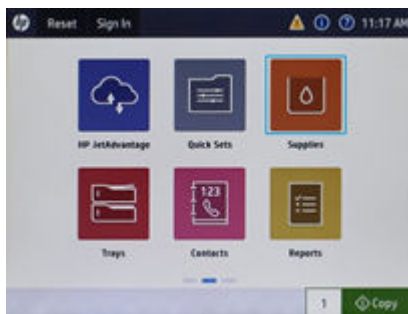

- b. Select **Document Feeder Kit**.

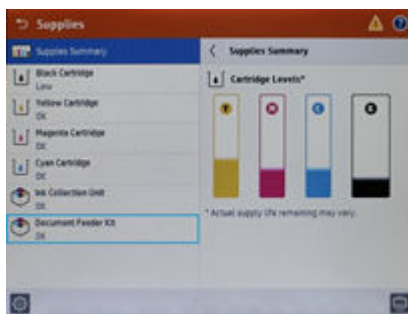

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

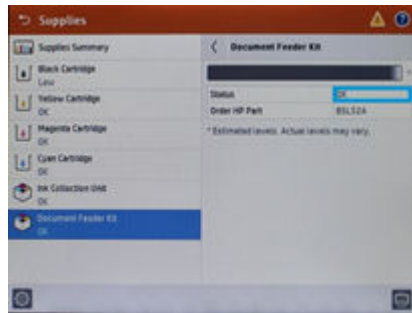


- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

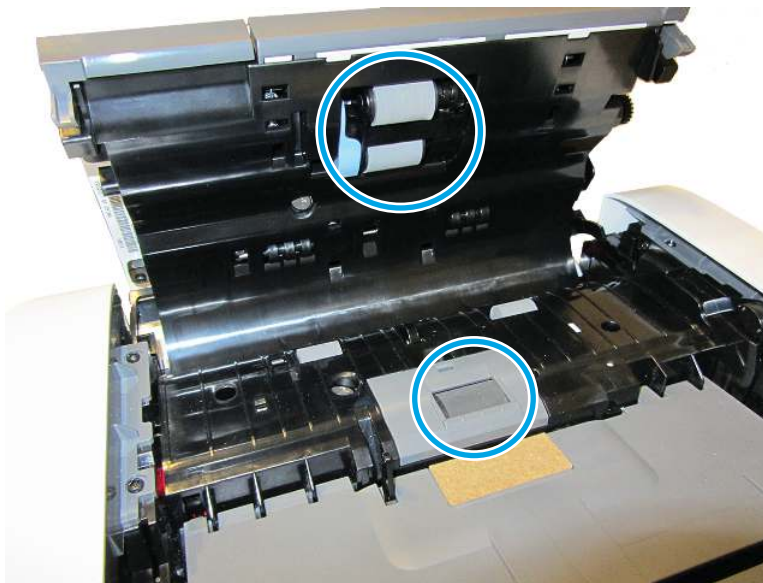


 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23-67901/(ADF maintenance replacement roller kit)

9. Inspect the ADF pick success sensor, cleaning both the REDI (paper pick success) sensor window and REDI (PAPER PICK SUCCESS) sensor reflector. If there is any dust or fiber remnants, clean by using a can of compressed air to blow out and clean.

Figure 6-74 ADF REDI sensor

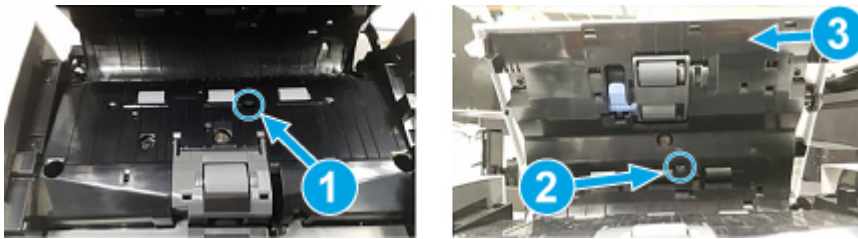


1 – REDI sensor window

2 – REDI sensor reflector

3 – ADF hatch

10. Check the REDI sensor reflector on flatbed. If there is any dust or fiber remnants, clean it by using a can of compressed air to blow out and clean. (related issue, ADF jam without paper inside)

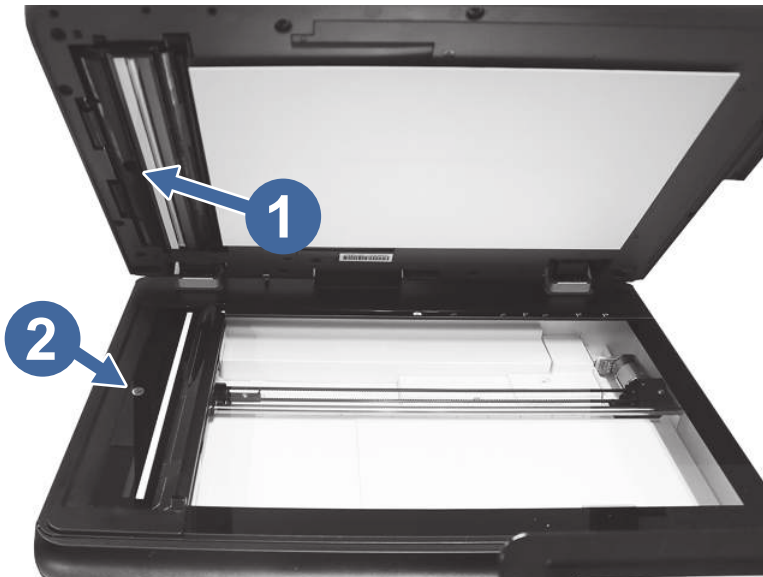


Callout 1: Check for paper blocking this area.


Callout 2: Clean this area with a damp lint free cloth.

11. Verify that the connections between the automatic document feeder and the SCB are correctly seated.


Figure 6-75 SCB connections

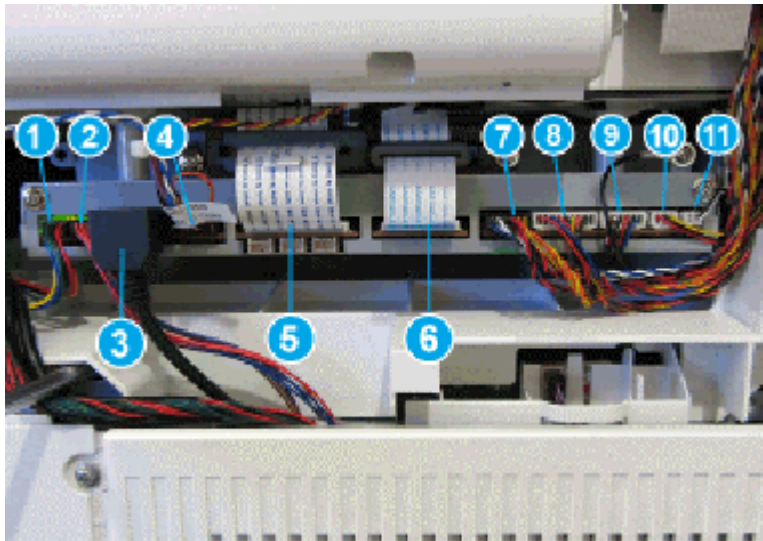


12. Using the Manual Scanner Sensor Test verify functionality of the ADF Paper Path Pick Success sensor.
 - a. Navigate to and select **Support Tools**.

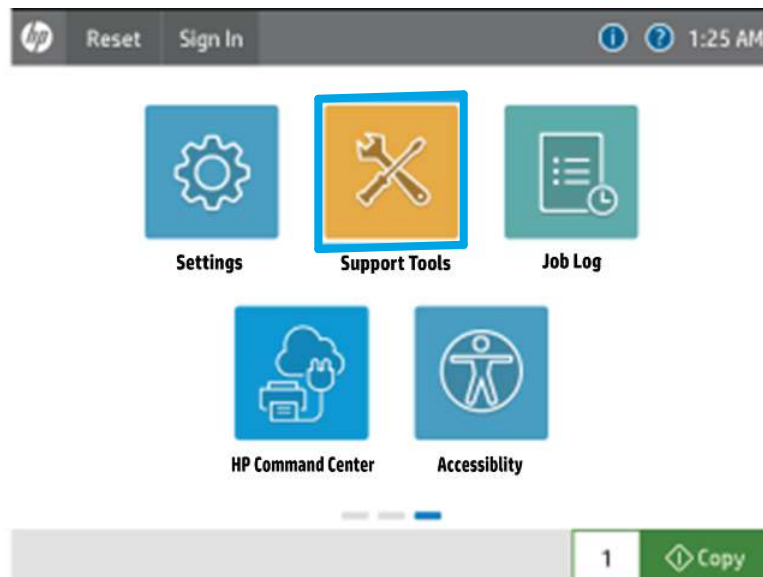


- b. Select **Troubleshooting**.

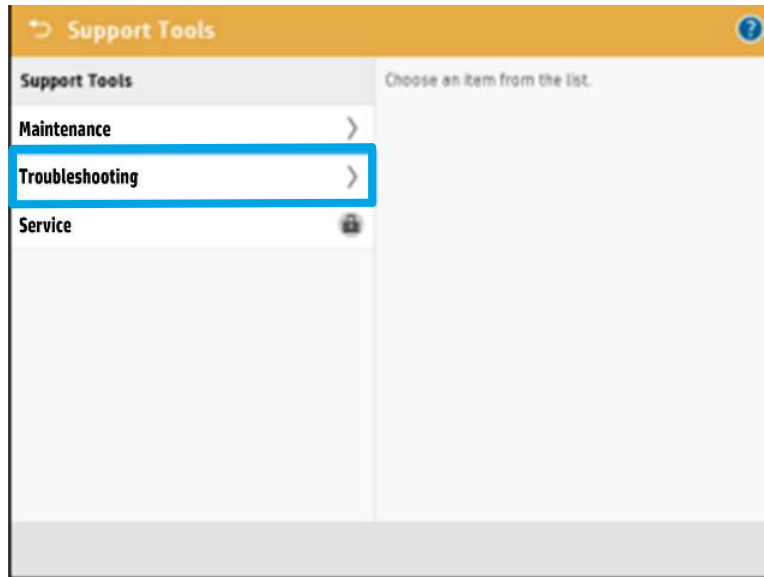


- c. Select **Diagnostic Tests**.

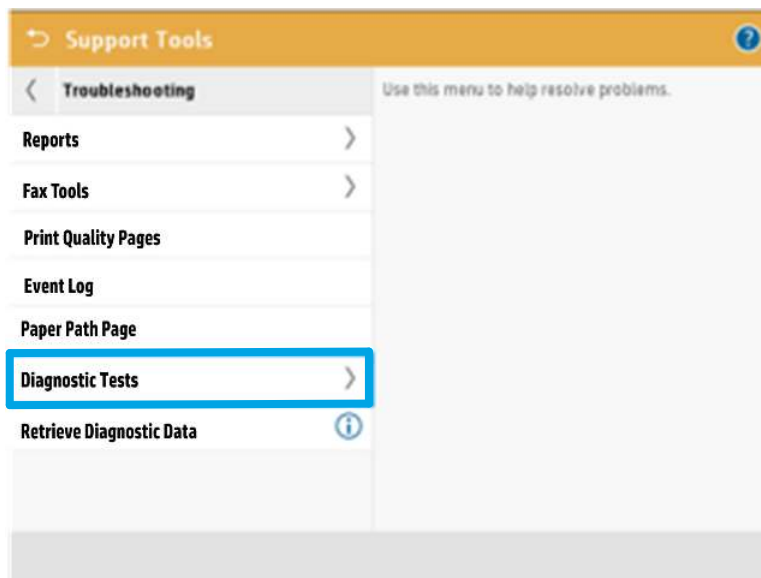


- d. Select **Continue**.

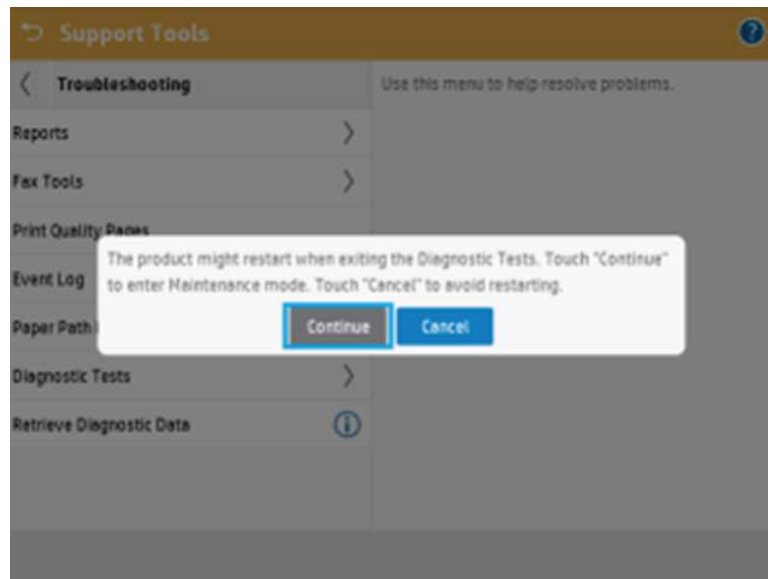

- e. Select **Manual Sensor Test**.

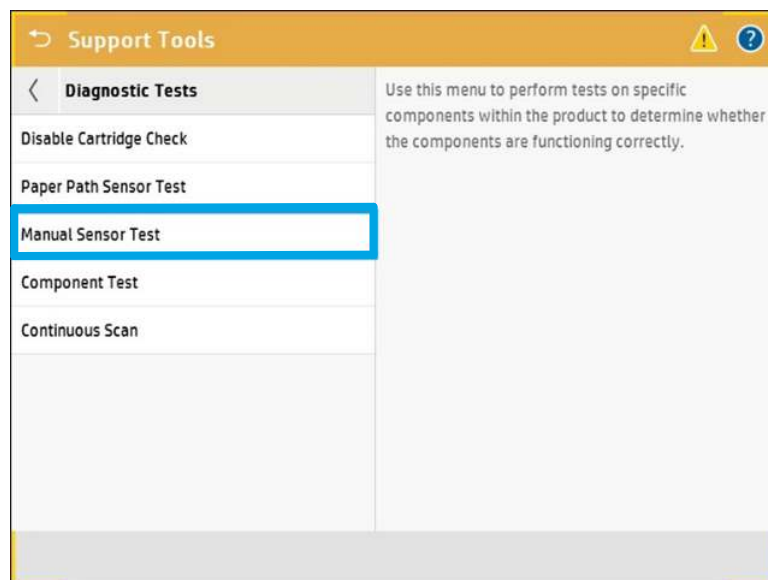

- f. Select **ADF Paper Path Deskew**.

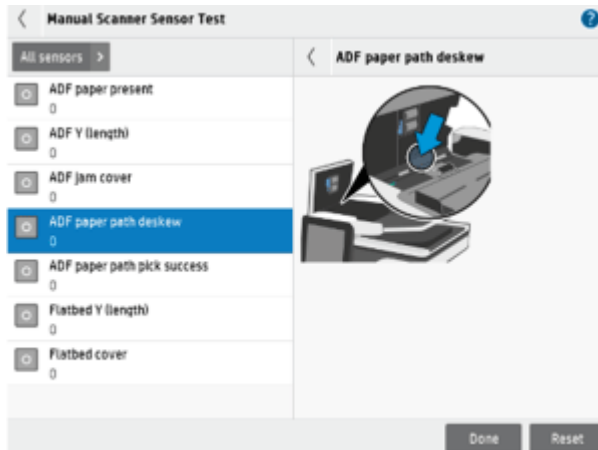


- g. Select **ADF Paper Path Pick Success**.

(Only in FLOW-MODELS)



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advancing.

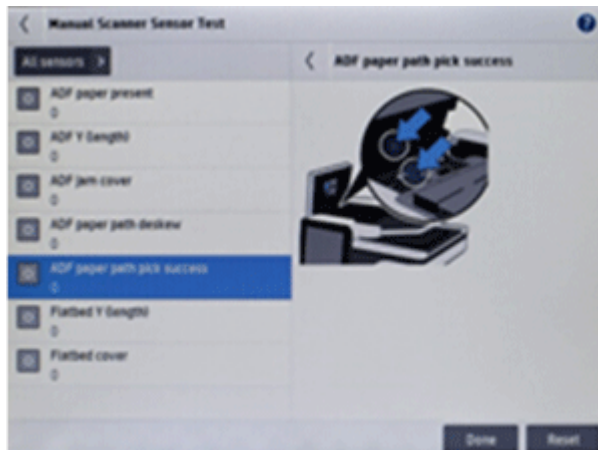

- h. Close the ADF cover and ensure that is secure and closed correctly.

13. Open and close the ADF cover to trigger the ADF Paper Path Pick Success sensor.



 **NOTE:** Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advanced.

14. If the ADF Paper Path Pick Success test fails to advance the count, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

Part number

- Flow models part number: B5L47-67907
- Non-Flow models part number: B5L47-67906

 **NOTE:** Note: Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder whole unit (ADF) part number:

- Flow models part number: B5L47-67909
- Non-Flow models part number: B5L47-67908

31.13.13

The document feeder jam access door is open.

Recommended action for customers

Follow these troubleshooting steps in the order presented.


1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Verify that the jam access cover is closed.

2. Verify that the flag is not broken off. Open and close the jam cover, and if the sensor status does not change then replace the ADF.

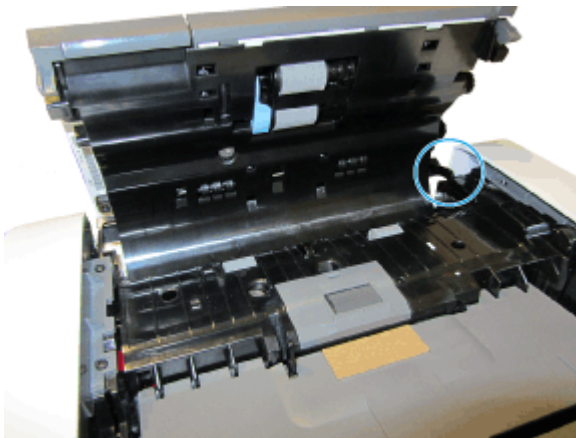

3. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Scanner Tests
4. Actuate the pick-success sensor. If the sensor does not show functionality when tested, verify the connector for the ultra-sonic sensor (connectors 9 and 11) on the scanner control board is connected. If the sensor still fails, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

Part number

- Document feeder (M527c/z) kit: B5L47-67907
- Document feeder (M527dn/f) kit: B5L47-67906

31.13.14

Document feeder job error: over current.


This is a feed jam in the document feeder, and the motor is not turning.

Recommended action for customer



Follow these troubleshooting steps in the order presented.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)

1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

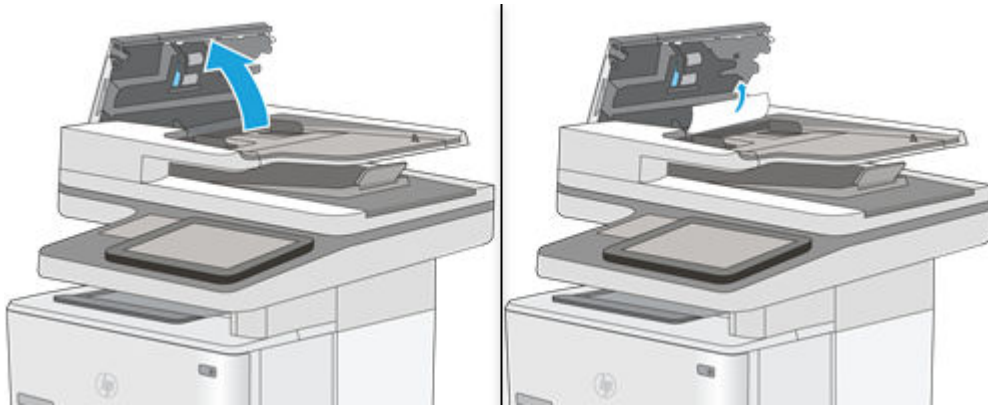

2. Lift the document-feeder input tray and remove any jammed paper.

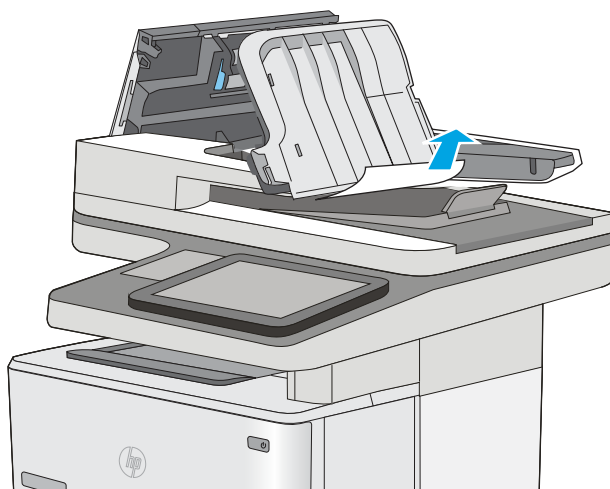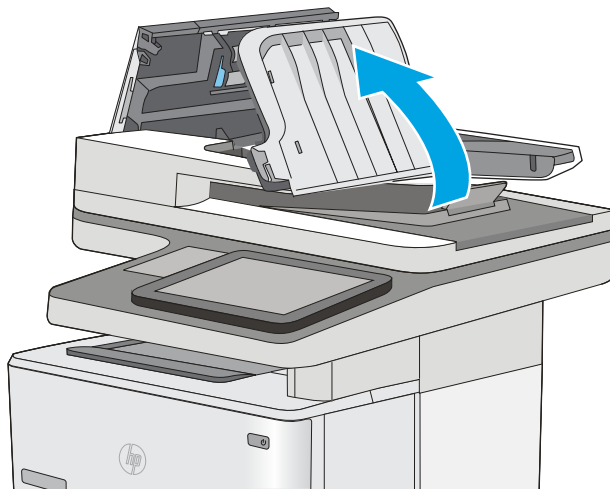

3. Lower the document-feeder input tray and then close the document feeder cover.

 **NOTE:** Verify that the latch on the top of the document-feeder cover is completely closed.


4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-76 Set the ADF guides

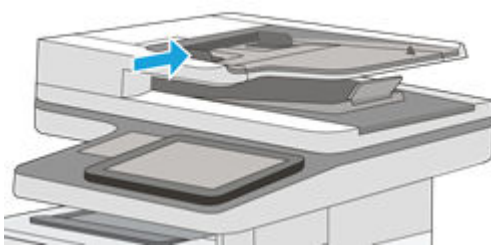


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

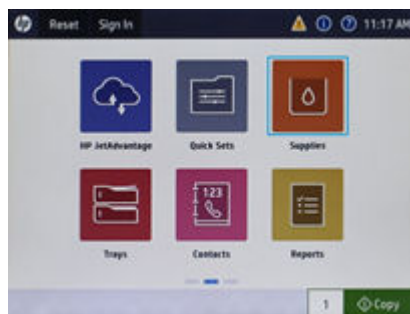

- b. Select **Document Feeder Kit**.

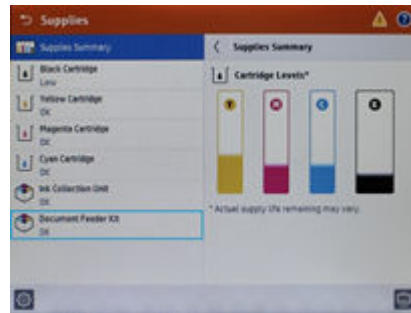

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

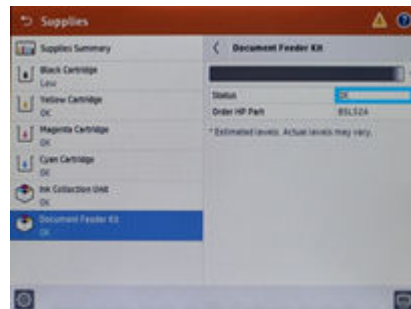


- d. Recommend that the customer replace the Document Feeder Kit if the status is **Low** or **Very Low**.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm

water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

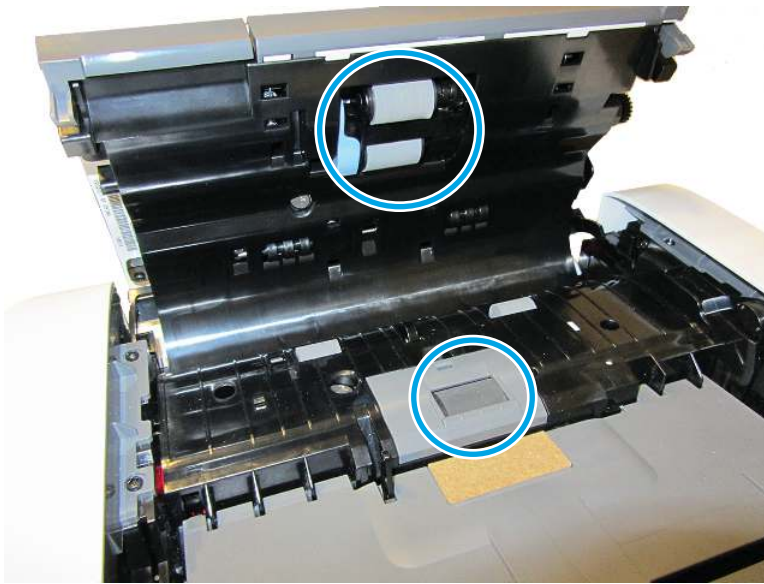

NOTE: Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23A/HP 200 ADF Roller Replacement Kit

To order parts, go to <https://store.hp.com>


9. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agent


Follow these troubleshooting steps in the order presented.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

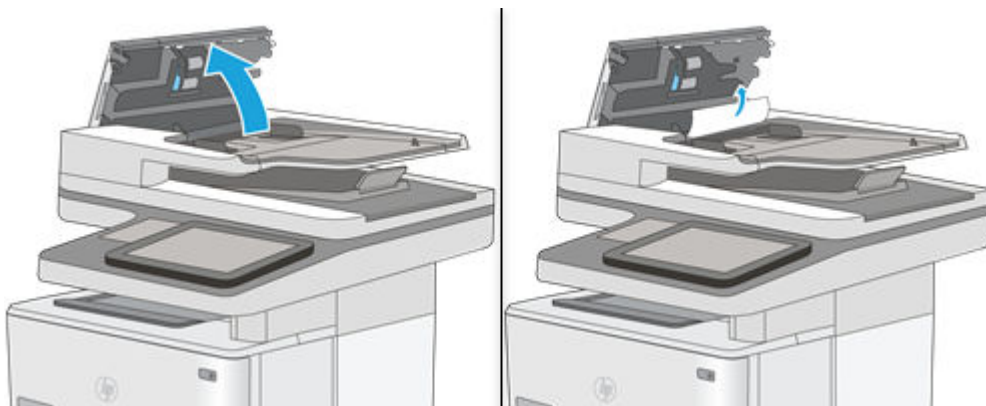

2. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

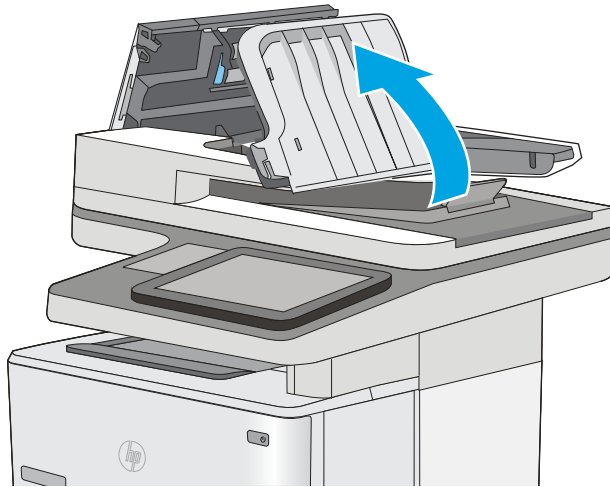

- b. Remove any paper found under the tray.

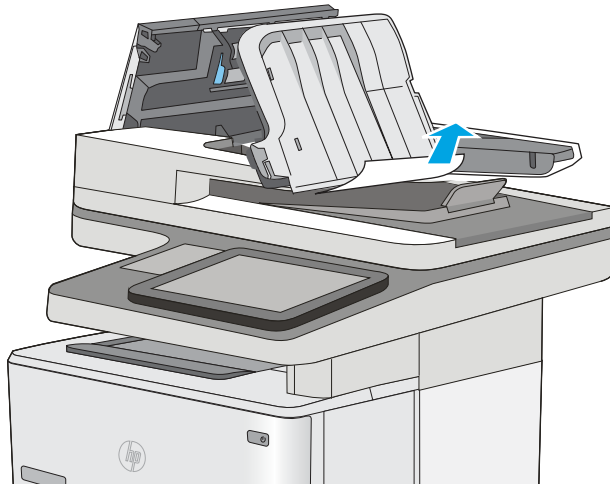


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

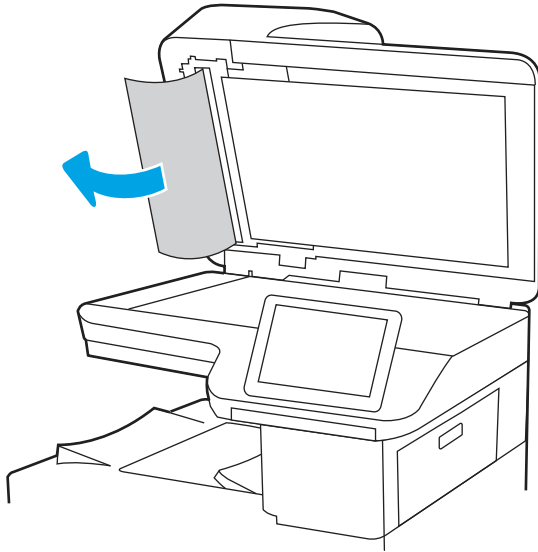

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

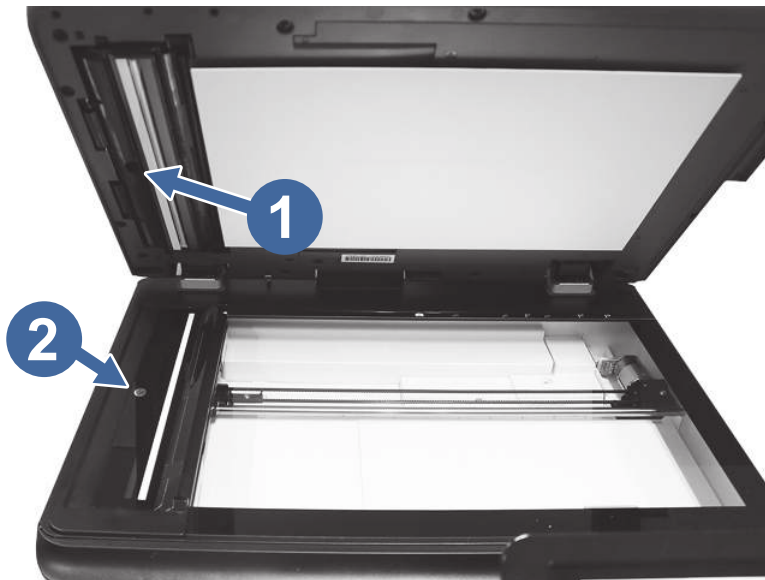

Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.


- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.

This document outlines the supported weights and sizes of the ADF including best practices:

Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):

5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size. Make sure that the paper stack is correctly aligned at the center of the input tray when paper is loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-77 Set the ADF guides

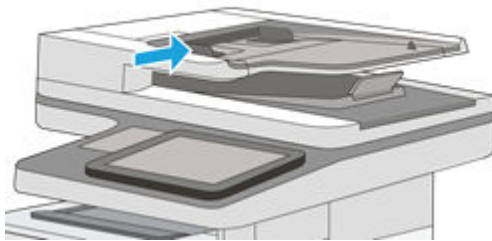


 **NOTE:** To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

 **NOTE:** Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

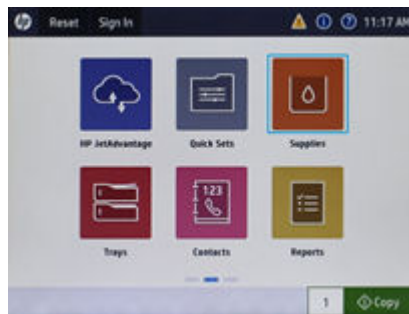

- b. Select **Document Feeder Kit**.

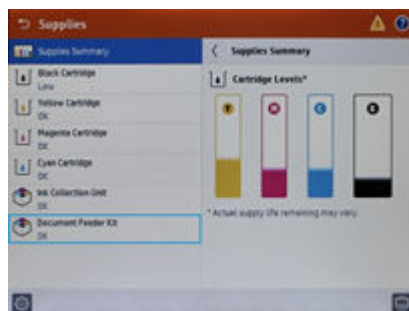

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

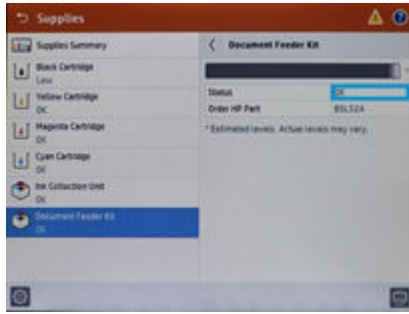

- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.


Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>



NOTE: Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

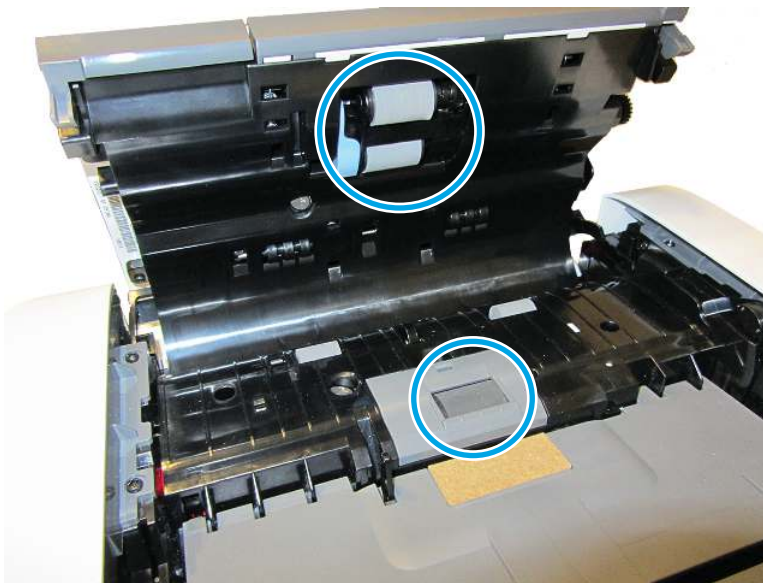

NOTE: Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23-67901 ADF maintenance replacement roller kit

 **NOTE:** Note: Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder whole unit (ADF) part number:


- Flow models part number: B5L47-67909
- Non-Flow models part number: B5L47-67908

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.

For further troubleshooting, please view this video: [Fixing 31.13.01/.02 ADF Jam Errors on HP PageWide MFP/LaserJet MFP M500 and M600 Printers](#)


1. Open the automatic document feeder cover, pull all the sheets back into the tray and then resume the job.

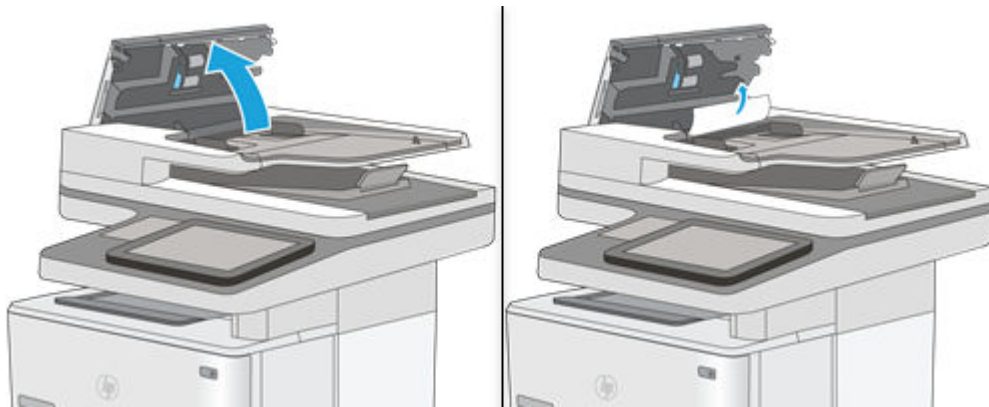

2. Lift the document-feeder input tray and remove any jammed paper.
 - a. Lift the document feeder input tray

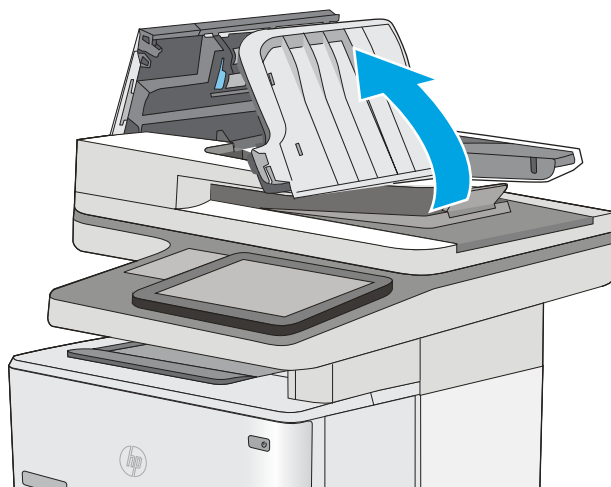

- b. Remove any paper found under the tray.

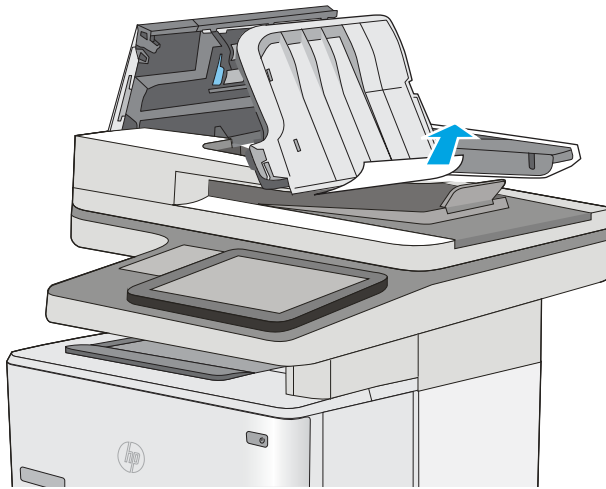


- c. Lower the document-feeder input tray and then close the document feeder cover.




NOTE: Verify that the latch on the top of the document-feeder cover is completely closed.

- 3. For 31.13.02, check for any paper jams or remnants under the document feeder (ADF) blocking in the paper path

- a. Open the ADF and remove any paper found.

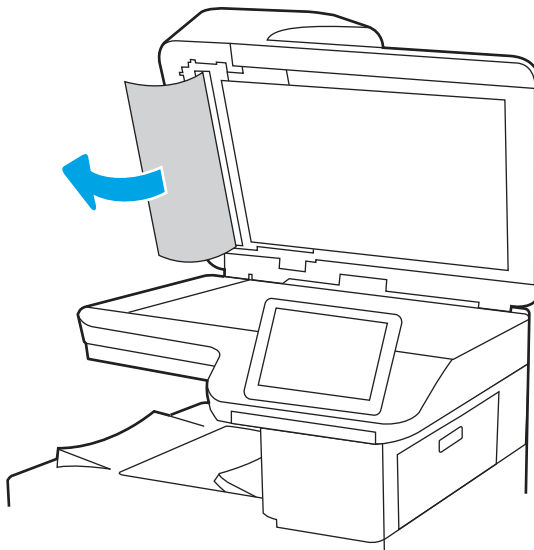

- b. Check for any paper remnants blocking the sensor as well as wiping any paper dust off the glass in the region shown below. If significant debris has accumulated over the circular mirror (used for paper edge sensing) this can cause a paper jam error.

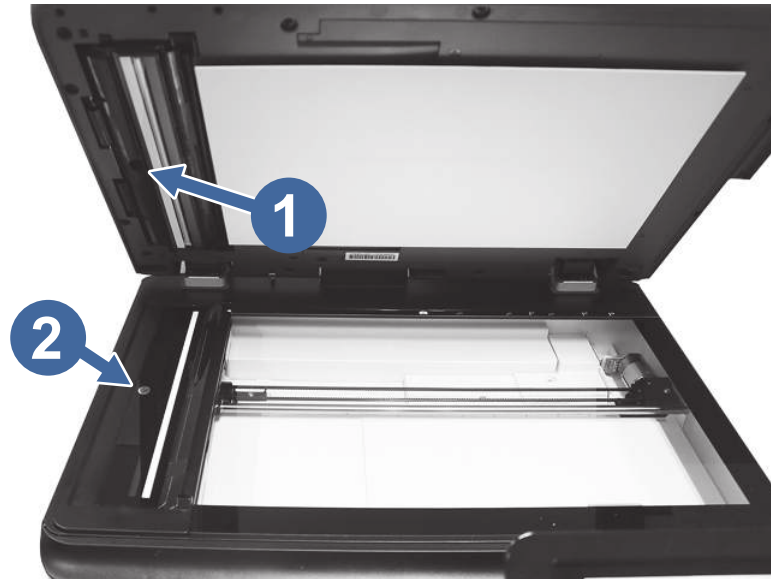


Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.

- c. Close the document feeder.
4. Ensure that the paper meets the document feeder (ADF) specifications for the printer.
This document outlines the supported weights and sizes of the ADF including best practices:
Go to or search for document: HP LaserJet and PageWide Array Enterprise and Managed 500 and 600 - Use the automatic document feeder (ADF):
 5. Ensure that the input tray is not overloaded and that the tray guides are set to the correct size.
Make sure that the paper stack is correctly aligned at the center of the input tray when paper is

loaded in the tray. The correct position of the loaded paper is parallel with the direction of travel into the document feeder paper path.


Figure 6-78 Set the ADF guides

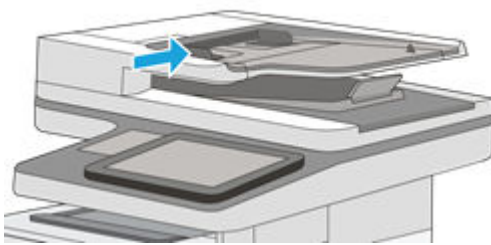


NOTE: To avoid jams, make sure the guides in the document-feeder input tray are adjusted against the document, without bending the document. To copy narrow documents, use the flatbed scanner. Remove all staples and paper clips from original documents.

NOTE: Original documents that are printed on heavy, glossy paper can jam more frequently than originals that are printed on plain paper.


6. Check the Document Feeder Kit consumable status.
 - a. Navigate to and select **Supplies** on the control panel.

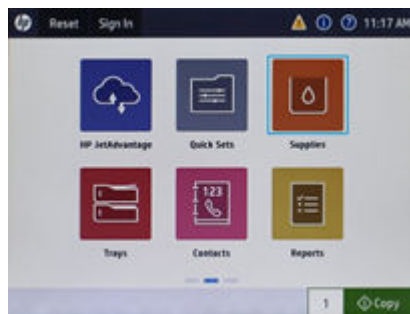

- b. Select **Document Feeder Kit**.

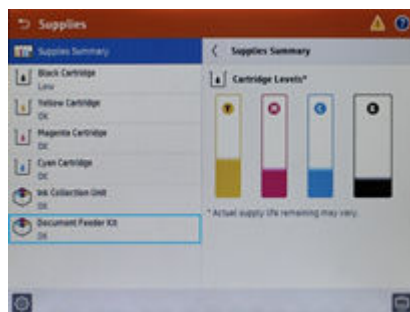

- c. See if the **Document Feeder Kit** status is **OK**, **Low**, or **Very Low**.

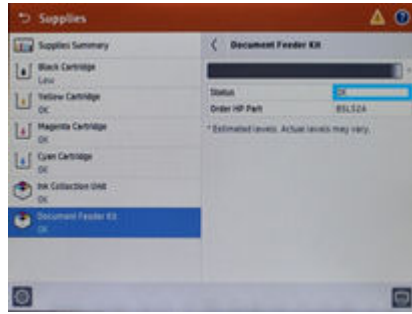


- d. If the status is **Low** or **Very Low**, recommend that the customer replace the Document Feeder Kit.

Part number: [W5U23A](#)/HP 200 ADF Roller Replacement Kit.

To order parts, go to <https://store.hp.com>

 **NOTE:** Above statement applies to Warranty customers; for Contractual customers, please parts predict or replace the (ADF maintenance replacement roller kit) - W5U23-67901

7. Check and clean the document feeder pickup rollers and separation rollers by removing any visible lint or dust from each of the rollers and using a clean lint-free cloth moistened with warm water. View the [How to Clean the Pick Rollers in HP LaserJet and PageWide Printers](#) for detailed instructions.

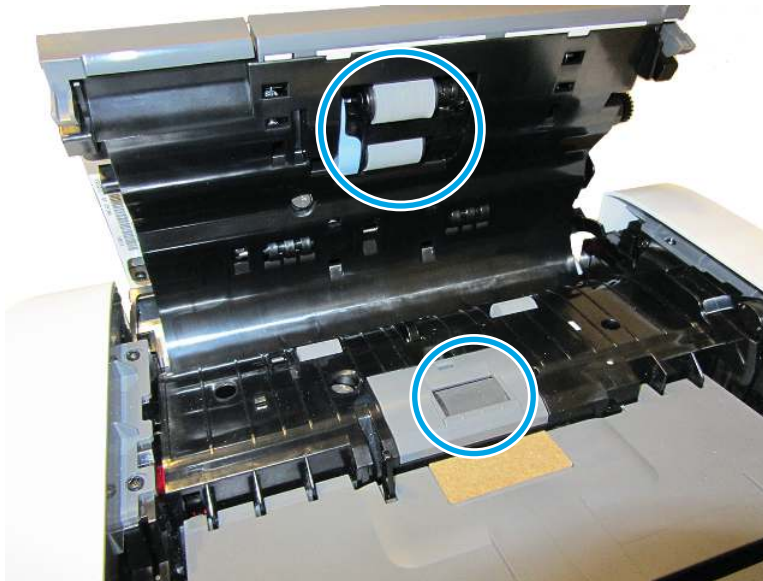


 **NOTE:** Lift up the roller assembly to access and clean the second roller

8. If necessary, replace the Document Feeder Kit rollers and separation pad.

Part number: W5U23-67901/(ADF maintenance replacement roller kit)


9. Inspect the ADF pick success sensor, cleaning both the REDI (paper pick success) sensor window and REDI (PAPER PICK SUCCESS) sensor reflector. If there is any dust or fiber remnants, clean by using a can of compressed air to blow out and clean.

Figure 6-79 ADF REDI sensor

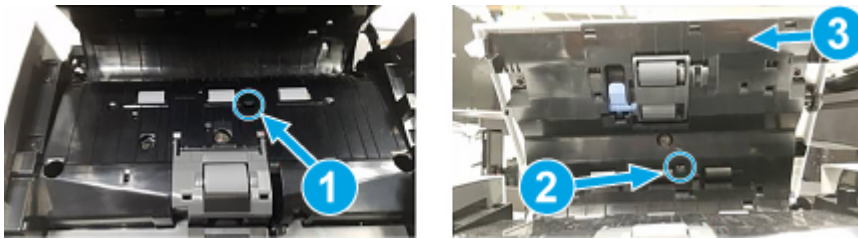

- 1 – REDI sensor window
2 – REDI sensor reflector
3 – ADF hatch

10. Check the REDI sensor reflector on flatbed. If there is any dust or fiber remnants, clean it by using a can of compressed air to blow out and clean. (related issue, ADF jam without paper inside)

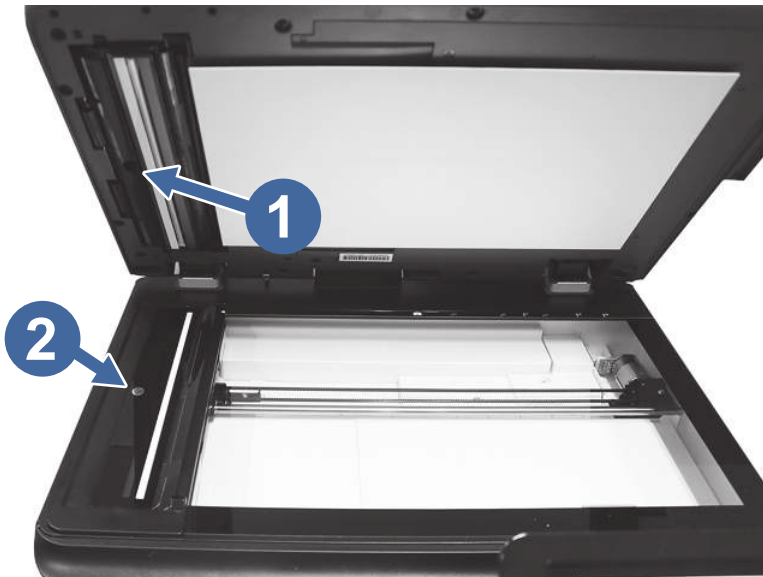


Callout 1: Check for paper blocking this area.

Callout 2: Clean this area with a damp lint free cloth.


11. Verify that the connections between the automatic document feeder and the SCB are correctly seated.

Figure 6-80 SCB connections

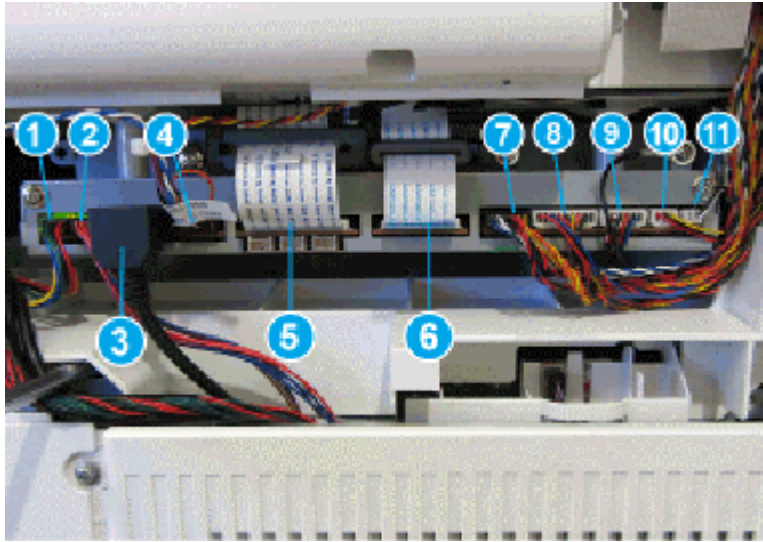


12. Using the Manual Scanner Sensor Test verify functionality of the ADF Paper Path Pick Success sensor.


- a. Navigate to and select **Support Tools**.

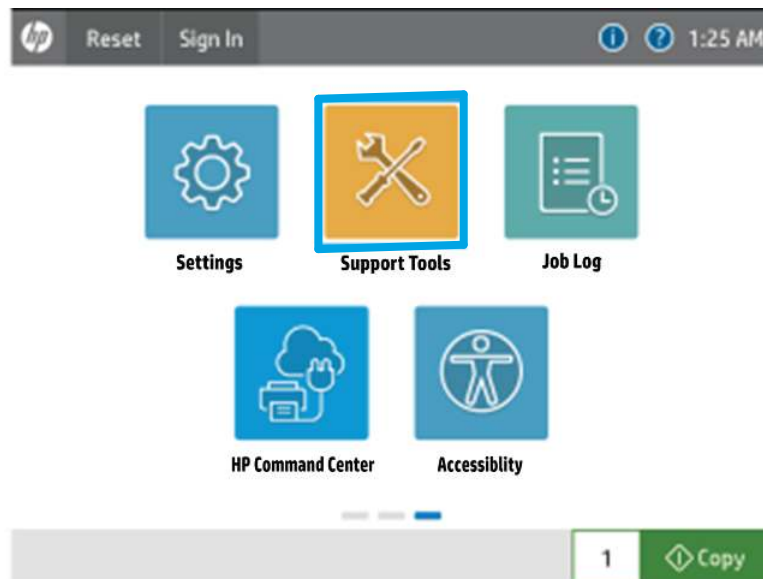


- b. Select **Troubleshooting**.

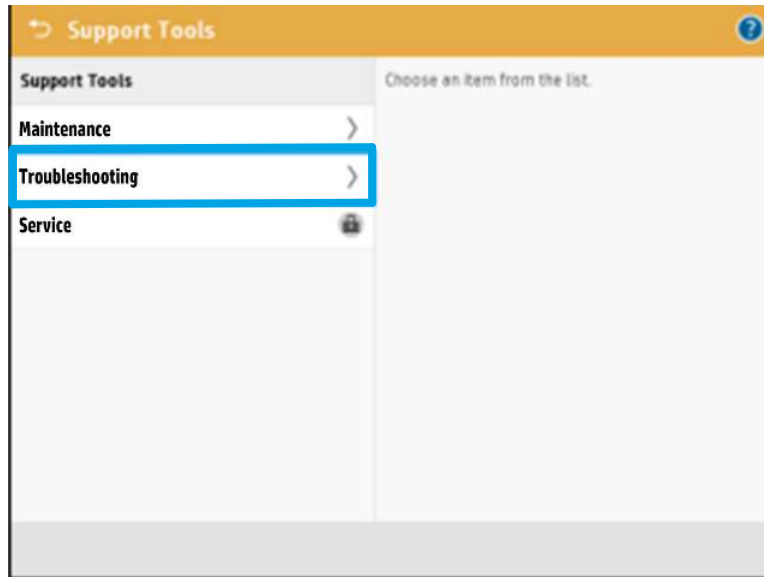


- c. Select **Diagnostic Tests**.

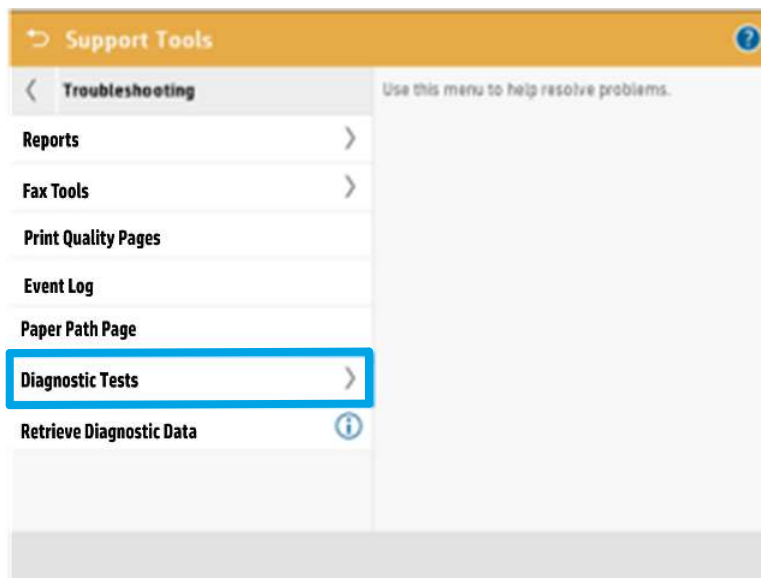


- d. Select **Continue**.

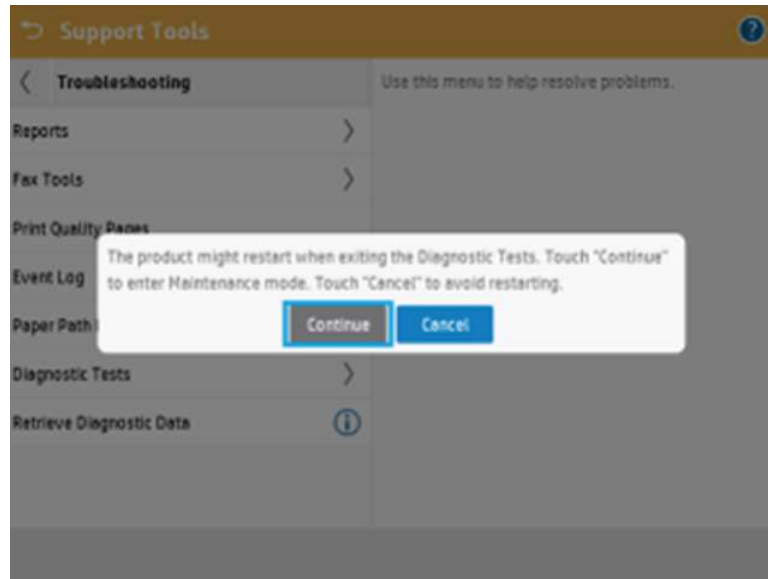

- e. Select **Manual Sensor Test**.

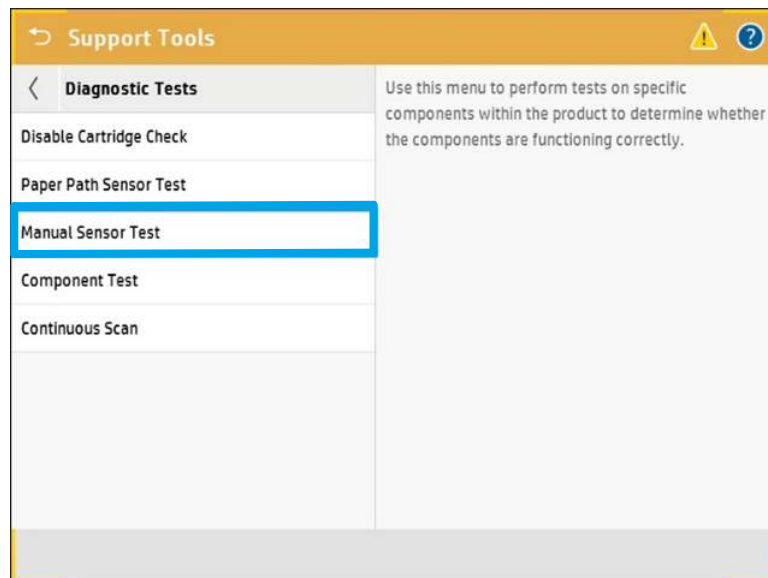

- f. Select **ADF Paper Path Deskew**.

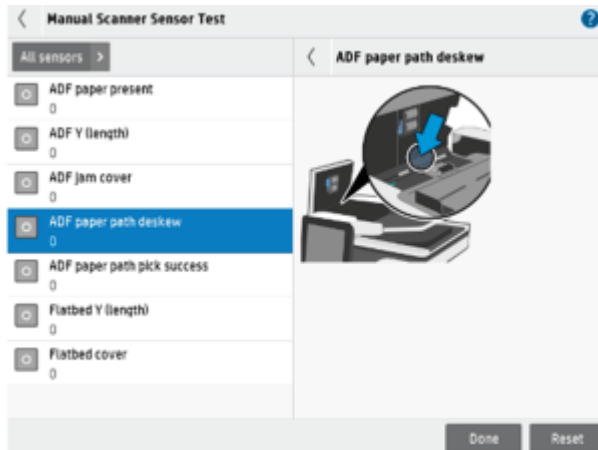


- g. Select **ADF Paper Path Pick Success**.

(Only in FLOW-MODELS)



NOTE: Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advancing.

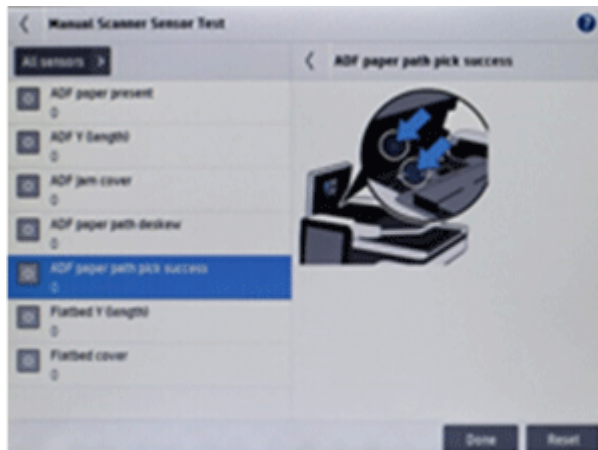

- h. Close the ADF cover and ensure that is secure and closed correctly.

13. Open and close the ADF cover to trigger the ADF Paper Path Pick Success sensor.



 **NOTE:** Pass is indicated if the working sensor advances the test count. Fail is indicated if the test count is not advanced.

14. If the ADF Paper Path Pick Success test fails to advance the count, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

Part number

- Flow models part number: B5L47-67907
- Non-Flow models part number: B5L47-67906

 **NOTE:** Note: Should a grinding noise be reported or heard in conjunction with the pick/feed of paper through the ADF, replace the document feeder (ADF) unit.

Document Feeder whole unit (ADF) part number:

- Flow models part number: B5L47-67909
- Non-Flow models part number: B5L47-67908

32.XX.YZ error messages

32.* errors

Errors in the 32.* family are related to either product start events or to backup and restore events.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Retry the job.

32.08.A1, 32.08.A2, 32.08.A3

An event related to starting the printer.

32.08.A1 (event code)

Shutdown event. Boot after abnormal shutdown.

32.08.A2 (event code)

Boot from normal shutdown event.

32.08.A3 (event code)

Regular boot event.

Recommended action

There is no action needed for this message.

- No action necessary.

32.1C.05

The restore job ticket was submitted with invalid credentials.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

32.1C.06 (event code)

The backup job ticket was submitted with invalid credentials.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

32.1C.07 (event code)

Backup restore permissions error.

There was an error during the creation, read, or write of the restore file.

Recommended action

Follow these troubleshooting steps in the order presented.

- Retry the job.

32.1C.08 (event code)

Not enough disk space to perform backup/restore, or a network share issue.

There was an error during the creation, read, or write of the backup file.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Retry the job.
2. Remove stored jobs and retry.
3. If the error persists, try using a larger capacity storage device for the share location and check the network share settings.
4. Check the network share or try setting up a new shared network drive or folder.

32.1C.09 (event code)

Tried to restore a backup file that was not valid for this printer.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

Recommended action

Follow these troubleshooting steps in the order presented.

- Use a valid backup file.

32.1C.0A (event code)

Backup file is invalid.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Use a valid backup file.
2. Reboot, and then observe the state of the printer.
3. If the error persists, perform a partition clean from the **Preboot** menu.

32.1C.0D (event code)

Backup/restore failed, auto-reboot failed, or the printer might be busy.

Recommended action

Follow these troubleshooting steps in the order presented.

- Reboot, and then retry the backup/restore.

32.1C.11 (event code)

Backup/restore time-out while communicating with the engine.

The backup operation was aborted because the printer is busy.

Recommended action

Follow these troubleshooting steps in the order presented.

- Wait until the printer is idle, and then try again.

32.1C.13, 32.1C.14

Not enough space exists to perform the backup.

The backup was aborted because the disk is at a critical level or full.

Scheduled backup failure.

Recommended action

Follow these troubleshooting steps in the order presented.

- Free up disk space, and then try again.

32.1C.15

The restore operation was aborted because the backup file was created by a previous version of firmware no longer supported by the feature.

Recommended action

Follow these troubleshooting steps in the order presented.

- Use the current backup file.

32.1C.2E

The restore operation was aborted because the printer is busy.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Wait until the printer is idle, and then retry.
2. Turn the printer off then on, and then retry.

32.1C.2F

Reset failure.

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn the printer off, and then on. Retry the job.

32.1C.40

The backup operation completed successfully (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.41

The backup operation encountered an error (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.42

The backup operation completed, but with a warning message (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.43

A component in the backup file is not supported by the current version of firmware and will not be restored (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.44

A component in the backup file is not transferable to another printer and will not be restored (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.45

Some data was not included in the backup file (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.46

An expected component could not be found and was thus not backed up. Because components should be known on backups, this code is a warning (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.47

Some data was not restored from the backup file (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.48

The backup job ticket was submitted using an invalid network path.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exists.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.

32.1C.49

The backup job ticket was submitted with a bad encryption.



NOTE: This would only apply to a web services call to perform a backup with a blank PIN

Recommended action

Follow these troubleshooting steps in the order presented.

- Verify that the encryption personal identification number (PIN) meets the restrictions for the printer.

32.1C.4A

An error occurred when creating the temporary directories used to store the backup files in transition to and from the compressed (ZIP) file.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Retry the job.
2. If this does not resolve the issue, turn the printer off then on again and retry the job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

32.1C.56

Reset aborted. Backup/restore in progress (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.57

Reset aborted (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.58

Unknown reset error (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.60

The restore operation completed successfully (informational).

Recommended action

See recommended action.

- No action necessary.

32.1C.61

The restore operation encountered an error.

Recommended action

Follow these troubleshooting steps in the order presented.

- Review the printer's event log to see specific details about the failure.

32.1C.62

The restore operation completed, but with a warning message.

Recommended action

Follow these troubleshooting steps in the order presented.

- Review the error log to see specific details about the failure.

32.1C.68

The restore job ticket was submitted using an invalid network path.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exist.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.
4. Check that the path includes the compressed .ZIP file name as part of the path.

32.1C.69

The restore job ticket was submitted with a bad encryption personal identification number (PIN).

Recommended action

Follow these troubleshooting steps in the order presented.

- Verify the encryption personal identification number (PIN) is the same PIN used to encrypt the backup file.

32.1C.6A

An error occurred when creating the temporary directories used to store the restore files in transition to and from the compressed (ZIP) file.

Recommended action

Follow these troubleshooting steps in the order presented.

- Retry the job.

32.1C.6D

An unusual error occurred when running the restore operation.

Recommended action

Follow these troubleshooting steps in the order presented.

- Retry the job.

33.XX.YZ error messages

33.* errors

Errors in the 33.* family are related to the printer's storage system or the formatter. The component might have been previously installed in another printer and is therefore locked to that other printer. Or, the component might be incorrect for this printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, investigate if the solid state drive (SSD) or hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original SSD/HDD and/or formatter, and then turn the printer on.
3. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer and contact your HP-authorized service or support provider, or contact customer support at <http://www.hp.com/go/contactHP>.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the issue persists, investigate if the solid state drive (SSD) or hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original SSD or HDD and/or formatter, and then turn the printer on.
3. If the formatter/SSD or HDD were recently replaced and the original is unavailable verify the correct formatter/SSD or HDD are installed by referencing the part numbers.
4. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer. Reference support content for the specific error and take the necessary action.
5. If the error cannot be cleared and you are unable to get the complete error code from the printer, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

6. If the error persists, download and from the **Preboot** menu install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

7. If the error persists, elevate the case using the Standard Support Process.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then turn on the printer.
2. If the issue persists, investigate if the solid state drive (SSD) or hard disk drive (HDD) or formatter are the original ones. If recently swapped or replaced, turn the printer off, install the original SSD or HDD and/or formatter, and then turn the printer on.
3. If the formatter/SSD or HDD were recently replaced and the original is unavailable verify the correct formatter/SSD or HDD are installed by referencing the part numbers.
4. If the issue persists, locate and notate the complete 33.WX.YZ error message as displayed on the control panel of the printer. Reference support content for the specific error and take the necessary action.
5. If the error cannot be cleared and you are unable to get the complete error code from the printer, perform a **Partial Clean** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

 **CAUTION:** A Partial Clean procedure automatically restores the firmware files from the repository, but all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system are completely lost.

6. If the error persists, download and from the **Preboot** menu install the latest version of printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

7. If the error persists, elevate the case using the Standard Support Process.

33.01.xx

A save or restore process has occurred.

- **33.01.01** (event code)

A restore process has occurred.

- **33.01.02** (event code)

A save process has occurred.

- **33.01.03** (event code)

Save recover functionality OK after previously being disabled.

Recommended action

See recommended action.

- No action necessary.

33.02.01 Used board/disk installed

Used board or disk installed.

An encrypted board or disk with existing data previously locked to a different printer has replaced the original. If you continue, data is permanently lost.



IMPORTANT: Do not install used formatter boards in HP LaserJet, HP PageWide Enterprise or Managed printers. Only replace the formatter when specifically directed to do so during troubleshooting using the Control Panel Message Document (CPMD). If you see the 33.02.01 event code, it means a used board has been installed, and the settings may be incorrect.

For more information go to, or search for: [HP LaserJet Enterprise, HP LaserJet Managed, HP PageWide Enterprise, HP PageWide Managed - 33.02.01 error or printer name and/or product number changes after replacing the formatter](#) (c06360930).

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. If the 33.02.01 event occurred after updating printer firmware reference support document entitled, "HP FutureSmart - '33.02.01 Used board/disk installed' error received after updating the firmware from HP FutureSmart 4.8.1 or 4.9 to a newer version" (c06488003)
2. If the 33.02.01 is unrelated to a firmware upgrade, perform the following.
 - a. Turn the printer off, and then on.
 - b. If the issue persists, turn the printer off, reinstall the original formatter board or hard disk drive.
 - c. If the issue persists, install a new formatter board or hard disk drive (HDD).

Table 6-63 HDD part numbers

Description	Part number
320 GB HDD	CF235-67901
320 GB HDD (government option)	CF235-67920

Table 6-64 Formatter part numbers

Description	Part number
Formatter assembly kit	CF235-67902
Formatter assembly kit (China)	CF235-67903

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. If this error appears after updating the firmware, go to WISE and search for the following document: HP FutureSmart - '33.02.01 Used board/disk installed' error received after updating the firmware from HP FutureSmart 4.8.1 or 4.9 to a newer version (c06488003).
2. If the 33.02.01 is unrelated to a firmware upgrade, perform the following.
 - a. Turn the printer off, and then on.
 - b. If the issue persists, turn the printer off, reinstall the original formatter board or hard disk drive.
 - c. If the issue persists, install a new formatter board or hard disk drive (HDD).

Table 6-65 HDD part numbers

Description	Part number
320 GB HDD	CF235-67901
320 GB HDD (government option)	CF235-67920

For instructions: See the Service Manual for this printer.

Table 6-66 Formatter part numbers

Description	Part number
Formatter assembly kit	CF235-67902
Formatter assembly kit (China)	CF235-67903

3. If the issue persists, elevate using your region's support process.

33.02.02

Save Recover Status Error

The save or recover is disabled, (one or both disabled) (**Event Log Only**)

Recommended action

There is no action needed for this message.

- No action necessary.

33.03.02

Data size mismatch. Unable to recover DCC NVRAM.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the scanner control board (SCB) and return the part to HP for evaluation.

Table 6-67 Scanner control board (SCB) part number

Part description	Part number
Scanner control PC board assembly	B5L47-67903

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, turn off the printer, and then disconnect and reconnect all the cables of the scanner control board (SCB).

Use the image below for SCB connections.

Figure 6-81 Scanner control board (SCB) connections

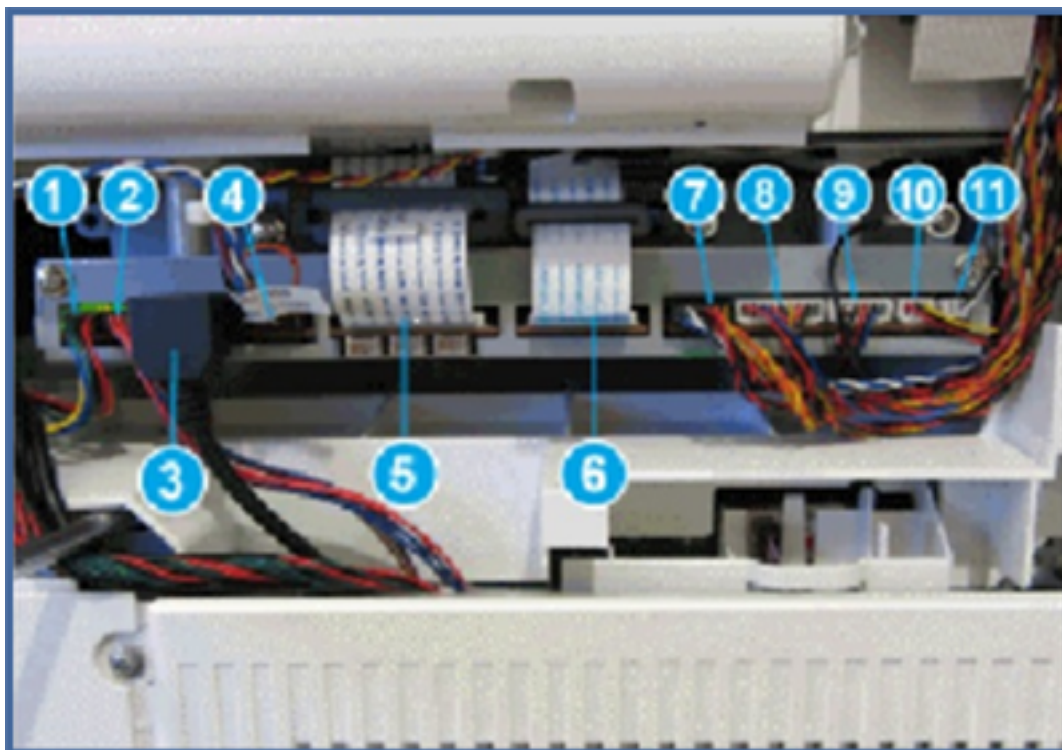


Table 6-68 Scanner control board (SCB) connections callout descriptions

Callout	Description
1	Staple power
2	SCB power (24v)
3	Cable, PAB to SCAM communication (HDMI)
4	Flatbed sensors (Document feeder open and flatbed paper length-and cave LED)
5	Flatbed (S1) flat flexible cable (scanner data and flatbed motor)
6	Document feeder (S2) flat flexible cable (Scanner data)
7	Document feeder motors (Feed and deskew)
8	Document feeder sensors (Prescan, Paper present receiver and top hatch)
9	Document feeder ultra sonic sensor receiver and deskew sensor
10	Letter/Legal (LTR/LGL) Input tray sensor
11	Ultra sonic sensor transmitter

3. Ensure that all the cables on the scanner control board (SCB) are connected and seated correctly before replacing any part.
4. If the error persists, replace the scanner control board (SCB).

Table 6-69 Scanner control board (SCB) part number

Part description	Part number
Scanner control PC board assembly	B5L47-67903

For instructions: See the Repair Service Manual for this product.

33.03.03 Incompatible formatter installed

This is an EFI BIOS event to prevent booting with the wrong formatter installed.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn the printer off, and then install the correct formatter in the printer.

For instructions: See the Repair Service Manual for this product.

Table 6-70 Part numbers

Description	Part number
Formatter PCA (M501dn)	J8H61-67901
Formatter PCA (M501dn; China)	J8H61-67902
Formatter PCA (M501n)	J8H60-67901
Formatter PCA (M501n; China)	J8H60-67902
Formatter PCA kit (M506n/dn)	F2A68-67915
Formatter PCA kit (M506x)	F2A68-67916
Formatter PCA kit (M527)	F2A76-67910

33.03.05 EFI Boot error

EFI BIOS event showing that a replacement formatter Recover attempt was unsuccessful.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

This issue is caused by an unsuccessful formatter recovery after a formatter has been replaced. Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, perform a [Partial Clean](#) using the Preboot menu or the Embedded Web Server (EWS).



NOTE: A Partial Clean erases all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system. It automatically reboots the printer and restores the firmware files from the repository.

3. If the error persists, update the printer firmware.

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware* (ish_4158468-4158516-16).
4. If the error persists after a firmware update, dispatch a service technician to replace the formatter.

Use the following table to order the correct part number for your printer.

Table 6-71 Formatter PCA part numbers

Product models	Part description	Part number
M501dn	Formatter PC board	J8H61-67901
M501dn (China)	Formatter PC board	J8H61-67902
M501n	Formatter PC board	J8H60-67901
M501n (China)	Formatter board assembly	J8H60-67902
M506n/ M506dn	Formatter PC board assembly	F2A68-67915
E50045n/ E50045dn		
M506x	Formatter PC board assembly	F2A68-67916
E50045x		
M507	Formatter PC board	1PV87-60001
E50145		
M527	Formatter PC board assembly	F2A76-67910
E52545		
M528	Formatter PC board	1PV64-60002
E52645		

Recommended action for onsite technicians

This issue is caused by an unsuccessful formatter recovery after a formatter has been replaced. Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, perform a [Partial Clean](#) using the Preboot menu or the Embedded Web Server (EWS).



NOTE: A Partial Clean erases all custom settings, PINs, passwords, third-party solutions, firmware files, and the operating system. It automatically reboots the printer and restores the firmware files from the repository.

3. If the error persists, update the printer firmware.

For instructions, go to *HP Enterprise, HP Managed - Update the printer firmware* (ish_4158468-4158516-16).

4. If the error persists, remove and reinstall the formatter board.
5. If the error persists, replace the formatter.

Use the following table to order the correct part number for your printer.

Table 6-72 Formatter PCA part numbers

Product models	Part description	Part number
M501dn	Formatter PC board	J8H61-67901
M501dn (China)	Formatter PC board	J8H61-67902

Table 6-72 Formatter PCA part numbers (continued)

Product models	Part description	Part number
M501n	Formatter PC board	J8H60-67901
M501n (China)	Formatter board assembly	J8H60-67902
M506n/ M506dn	Formatter PC board assembly	F2A68-67915
E50045n/ E50045dn		
M506x	Formatter PC board assembly	F2A68-67916
E50045x		
M507	Formatter PC board	1PV87-60001
E50145		
M527	Formatter PC board assembly	F2A76-67910
E52545		
M528	Formatter PC board	1PV64-60002
E52645		

For instructions: See the Repair Service Manual for this product.

6. If the error persists after replacing the formatter, elevate the case using the Standard Support Process.

33.03.06

The memory PCA was not detected on startup.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on again.
2. If the error persists, turn the printer off, disconnect the power cord, and remove the formatter cover. Press firmly on the memory PCA cable connection to the formatter.
3. If the error persists, replace the memory PCA assembly.

Table 6-73 Part numbers

Description	Part Number
Memory PCA (M506)	RM2-7955-000CN

Table 6-73 Part numbers (continued)

Description	Part Number
Memory PCA (M527)	RM2-7955-000CN

33.04.01 Missing TPM

A Trusted Platform Module is missing from a printer that previously had a TPM installed.

TPM accessory (optional): This system is using a TPM module installed as an accessory to protect data and it is not present. The original TPM must be returned or you can select the [Stop Using](#) option in the preboot TPM sub-menu. All data will be cryptographically erased and a reload of firmware from USB might be required.

TPM Standard (Standard on product): This system is using a TPM module installed at the factory to protect data and it is not present. Verify that the TPM is seated firmly on the formatter, in case of shifting during shipment. If the TPM has been removed for a formatter replacement, put the original TPM on the board. If the original TPM cannot be reinstalled or has become damaged, **DO NOT** replace any parts. Replace the printer.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Reinstall the missing TPM module into the printer.



NOTE: If the TPM accessory was installed, you can also go to the [Administration](#) menu and under TPM, select the [Stop Using](#) option if you no longer want to use the TPM accessory.

3. Restart the printer.

33.04.02 Missing TPM

The wrong TPM is installed on a printer that previously had a different TPM installed.

TPM Optional device: This system is using a TPM module to protect data and it is not present. The original TPM module must be returned or you may select the **Stop Using** option in the preboot TPM sub-menu.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Reinstall the original TPM module into the printer.
3. Restart the printer.
4. Go to the [Administration](#) menu and under TPM and select the [Enable and Use](#) option.



NOTE: To no longer use the TPM device, go to the [Administration](#) menu and under TPM and select the [Stop Using](#) option.

33 . 04 . 03 Unknown TPM

A used TPM has been installed on a printer that has not previously had a TPM installed.

TPM Optional device: This system is using a TPM module to protect data and it is not present. The TPM module currently installed is used to protect data in another device. The original TPM module must be returned or you can start using this TPM module by selecting the [Enable and Use](#) option in the preboot TPM sub-menu. You can also stop using a TPM altogether.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off and remove the TPM module. The printer will not be protected.
2. If choosing to protect the printer with the used TPM, refer to the "Install a new or re-enable an existing TPM after disabling a previous TPM" section of the <http://h10032.www1.hp.com/ctg/Manual/c04499622> (c04499622).

33 . 04 . 05

TPM (Trusted Platform Module) Security Error

This system contains a TPM module that is not supported on the device or belongs to another device.

TPM is unique for each device.

For units that shipped with a TPM on board standard (most newer models): If the original TPM installed in the factory is unavailable or damaged, DO NOT replace any parts. Follow the recommended action.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order they are listed.

The technician will need to re-establish the trusted platform module state in the printer.



NOTE: Never replace the TPM on a unit that shipped with one. The TPM that can be ordered is only available for adding a level of security on a device that never had a TPM paired from the factory. A new TPM cannot be installed for security reasons.

1. Do **not** replace the formatter or HDD. It will not solve this issue.
2. Perform a Format Disk procedure, select **Continue** in the Pre-boot menu, and then reboot the device.
 - If the unit boots to a 33 . 04 . 05 error, reseal the eMMC or HDD.
 - If the unit continues to boot to a 33 . 04 . 05 error, continue to the next step.

3. Perform a Format Disk procedure again, and then reboot the device.
 - If the unit boots to a 99 . 09 . 67 error, reboot the device, and then update the firmware. This should resolve the issue.
 - If the unit continues to boot to a 33 . 04 . 05 error, continue to the next steps.
4. Remove the TPM and eMMC or HDD, open **Startup Options**, and then perform a Cold Reset.

 **WARNING!** When removing the TPM, take extreme care as the connector on the TPM board can become dislodged and break. If this happens, a printer replacement will be required.

5. Reinstall the eMMC or HDD, open the Pre-boot menu, select **Manage Disk**, select **Boot Device**, and then select **Erase Unlock**.
 - If unit boots to a 99 . 09 . 67 error, reboot the device, and then update the firmware. This should resolve the issue.
 - If the unit continues to boot to a 33 . 04 . 05 error, continue to the next step.
6. Reseat the TPM and eMMC or HDD, perform a Format Disk, open Diagnostics, and then run diagnostics for all components.
 - If the Diagnostics fail, elevate the case to ATS and include all details.
 - If Diagnostics passes, continue to the next steps.
7. Remove the TPM and eMMC or HDD, open **Startup Options**, and then perform a Cold Reset.
8. Reinstall the eMMC or HDD, open the Pre-boot menu, select **Manage Disk**, select **Boot Device**, select **Erase Unlock**, and then reboot the device.
 - If the unit boots to a 99.09.67 error, reboot and then update the firmware. This should resolve the issue.
 - If the unit continues to boot to a 33 . 04 . 05 error, continue to the next step.
9. Include the following information in the CDAX case notes, and then elevate the case to ATS. No additional feedback is needed.

 **NOTE:** Ensure that all original printer parts are installed on the unit at the time of elevation.

- Printer serial number.
- Collect the Diagnostic log file (.jdp file).
- Information when the 33 . 04 . 05 error displayed on the printer control panel.
- Parts replaced prior to the error displaying on the printer control panel.

33 . 05 . 0x SureStart errors

The printer detected and recovered from a corrupted version of BIOS.

- **33.05.01** Boot code corrupt (Event code)
- **33.05.02** Boot code corrupt (Event code)
- **33.05.03** Boot code corrupt (Event code)

Recommended action

See recommended action.

- No action necessary.

33 . 05 . 0x SureStart errors

The newly downloaded firmware failed to cryptographically validate the BIOS code.

- **33.05.04** Security alert
- **33.05.04** Upgrade corrupt - (Event code)
- **33.05.05** Security alert
- **33.05.05** Boot code corrupt - (Event code)
- **33.05.06** Security alert
- **33.05.06** Upgrade corrupt - (Event code)
- **33.05.07** Security alert
- **33.05.07** Upgrade corrupt - (Event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- Download a firmware bundle to the device from the [Preboot](#) menu.

For more information on SureStart, go to HP LaserJet Enterprise, go to: See the Repair Service Manual for this product.

33 . 05 . 0z SureStart errors

A SureStart error has occurred.

The printer detected and recovered from a corrupted version of BIOS.

- **33.05.01** Boot code corrupt (event code)
- **33.05.02** Boot code corrupt (event code)
- **33.05.03** Boot code corrupt (event code)

The newly downloaded firmware failed to cryptographically validate the BIOS code.

- **33.05.04** Security alert
- **33.05.04** Upgrade corrupt (event code)
- **33.05.05** Security alert
- **33.05.05** Boot code corrupt (event code)
- **33.05.06** Security alert
- **33.05.06** Upgrade corrupt (event code)

- **33.05.07** Security alert
- **33.05.07** Upgrade corrupt (event code)
- **33.05.08** Invalid boot attempt (event code)
- **33.05.09** Downgrade attempted (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- **For 33.05.01, 33.05.02, and 33.05.03 errors:** No action is necessary.
- **For all other errors:** Download a firmware bundle to the printer from the Preboot menu.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)



NOTE: For more information on SureStart, search for: "SureStart Whitelisting and Intrusion Detection Troubleshooting Manual" (c04863614).

33.05.1x Whitelisting errors

An error occurred with a firmware file digital signature or an error with the certificate used to validate the firmware file certificate.

- **33.05.10** Security alert
- **33.05.10** Firmware verification Error: XX (Event code)
- **33.05.11** Security alert
- **33.05.11** Firmware verification Error: XX (Event code)
- **33.05.12** Security alert
- **33.05.12** Firmware verification Error: XX (Event code)

Recommended action

Follow these troubleshooting steps in the order presented.

1. Perform a [Format Disk](#) procedure.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16).

2. If the device does not reboot to [Ready](#), download a firmware bundle to the device from the Preboot menu.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)



NOTE: Performing a Format Disk procedure is required before downloading a firmware bundle.

For more information on SureStart, go to: (Doc ID: c04863614). [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#)

33.05.2x Intrusion detection errors

The intrusion detection system has encountered an error.

The intrusion detection memory process determined an unauthorized change in system memory.

- **33.05.21** Security alert
- **33.05.21** Potential intrusion (Event code)

The intrusion detection memory process heartbeat was not detected.

- **33.05.22** Security alert
- **33.05.22** Cannot scan for potential intrusions (Event code)

The intrusion detection memory process did not initialize.

- **33.05.23** Security alert
- **33.05.23** Intrusion detection not initialized (Event code)
- **33.05.24** Intrusion detection initialization error (Event code)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.



NOTE: Selecting [Continue](#) from the Preboot menu will not resolve the error. The printer must be turned off, and then on to clear the error allowing the printer to reboot to a [Ready](#) state.

Information on the Intrusion Detection error.

For more information on SureStart, go to: [HP SureStart - Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

33.05.5z Intrusion detection errors

The intrusion detection system has encountered an error.

The intrusion detection memory process determined an unauthorized change in system memory.

- **33.05.51** Security alert
- **33.05.51** Potential intrusion (Event code)

The intrusion detection memory process heartbeat was not detected.

- **33.05.52** Security alert
- **33.05.52** Cannot scan for potential intrusions (Event code)

The intrusion detection memory process did not initialize.

- **33.05.53** Security alert
- **33.05.53** Intrusion detection not initialized (Event code)
- **33.05.54** Intrusion detection initialization error (Event code)

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off then on.
2. Make sure that the printer is in a **Ready** state.



NOTE: Selecting **Continue** from the Preboot menu will not resolve the error. The printer must be turned off, and then on to clear the error allowing the printer to reboot to a **Ready** state.

Information on the Intrusion Detection error.

For more information on SureStart, go to: [HP SureStart - Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

33.06.01

The firmware is not able to detect the correct memory chip on the formatter.

This issue occurs because the wrong formatter was installed in the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Remove the formatter that was installed and reinstall the original or order the correct formatter for the printer.
3. Reinstall all the parts including HDD/eMMC, TPM and any additional accessories.
4. Reload firmware from a USB stick using the pre-boot menu if necessary.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

40.XX.YZ error messages

40.* errors

Errors in the 40.* family are related to input/output accessories, such as USB storage devices, Jetdirect cards, or EIO cards or on-board network functions.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the **OK** button to clear the error.
2. Remove and then reinstall the accessory.

40 . 00 . 01 USB I/O buffer overflow To continue, touch “OK”

The USB buffer has overflowed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to print the transferred data (some data might be lost).
2. Check the host configuration.

40 . 00 . 02 Embedded I/O buffer overflow To continue, touch “OK”

The product has experienced a JetDirect buffer overflow.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to print the transferred data (some data might be lost).
2. Check the host configuration.

40 . 00 . 03 EIO [x] buffer overflow To continue, touch “OK”

Too much data was sent to the EIO card in the specified slot (x). An incorrect communications protocol might be in use.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to print the transferred data (some data might be lost).

40 . 00 . 04 EIO [x] bad transmission To continue, touch “OK”

The connection between the product and the USB device has been broken.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to clear the error message and continue printing.
2. Remove, and then reinstall the USB device.

40 . 00 . 05 Embedded I/O bad transmission To continue, touch OK

The USB device has been removed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to clear the error message (data will be lost).
2. Install the USB device.

40 . 08 . 0x USB storage accessory removed

The USB storage accessory has been removed.

x = 0 or 1; information code.

Secure file erase is enabled.

Recommended action

See recommended action.

- No action necessary.

41.XX.YZ error messages

41.* errors

Errors in the 41.* family are related to printing problems, such as a mismatch between the paper that is in the printer and the paper the printer is configured to use.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Verify the tray is loaded with the correct paper type, and that the guides are adjusted correctly.
2. Verify the paper type and size settings on the control panel match the paper in the tray.
3. Verify the paper type and size settings in the print driver match the paper in the tray.
4. Use the Tray/Bin manual sensor test to verify the media switch in the cassette is working correctly.
5. Turn the printer off and then on.
6. If the issue persists, replace the DC controller.

41.01.YZ

An unknown misprint error occurred on the printer.

Event log error message: 41.01.YZ.

Y = Type, Z = Tray

- Y = 0: Photo Media (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light media 1, 2, or 3 mode
- Y = 4: Heavy media 1
- Y = 5: Heavy media 2
- Y = 6: Heavy media 3
- Y = 7: Glossy media 1
- Y = 8: Glossy media 2
- Y = 9: Glossy media 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = 0: From unknown tray

- Z = 1: From Tray 1
- Z = 2: From Tray 2
- Z = 3: From Tray 3
- Z = 4: From Tray 4
- Z = 5: From Tray 5
- Z = 6: From Tray 6
- Z = 7: From Tray 7
- Z = 8: From Tray 8
- Z = 9: From Tray 9
- Z = D: From duplex

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, attempt to remove and reinstall the toner cartridge.
Ensure that the printer is using genuine HP toner cartridges.
 - a. Make sure to turn the printer off, and then wait 30 seconds.
 - b. Press the top-cover-release button on the left side of the printer.
 - c. Open the front door (or toner-cartridge door).
 - d. Grasp the handle of the toner cartridge to remove the toner cartridge from the printer.
 - e. Check if a genuine HP toner cartridge is installed.

A genuine HP toner cartridge has the word “HP” on it, or has the HP logo on it. For more information on identifying HP cartridges go to <http://www.hp.com/go/learnaboutsupplies>.
 - f. Align the toner cartridge with the tracks inside the printer, and then install the toner cartridge until it is firmly seated.
 - g. Close the front door.
 - h. Use the power button to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the error is not cleared, turn off the printer, and then turn on the printer.

3. If the error persists, visually inspect the toner cartridge, and then reinstall the toner cartridge.
 - a. Open the front door to remove the toner cartridge.
 - b. Check the toner cartridge and ensure it is a genuine HP toner cartridge.
 - c. Swap out the toner cartridge to test it.
 - d. Install the toner cartridge until it is firmly seated, and then close the front door.
4. Ensure that the toner cartridges are HP original cartridges and that the cartridges are seated correctly before replacing any other parts.
5. If the error persists, replace the laser/scanner assembly.

Table 6-74 Laser scanner assembly part number

Part description	Part number
Assembly- Laser scanner	RM2-4860-000CN

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the error is not cleared, turn off the printer, and then turn on the printer.
3. If the error persists, visually inspect the toner cartridge, and then reinstall the toner cartridge.

Ensure that the toner cartridges are HP original cartridges and that the cartridges are seated correctly before replacing any other parts.

- a. Open the front door to remove the toner cartridge.
- b. Check the toner cartridge and ensure it is a genuine HP toner cartridge.
- c. Install the toner cartridge until it is firmly seated, and then close the front door.
4. If the error reoccurs, check the wire harness from the laser/scanner to the DC controller.
 - a. Make note of all the connectors on the laser/scanner assembly and DC controller.
 - b. Disconnect and reconnect the cables. Ensure that the connectors are correctly connected and seated before replacing any part.
5. If the error persists, replace the laser/scanner assembly.

Table 6-75 Laser scanner assembly part number

Part description	Part number
Assembly- Laser scanner	RM2-4860-000CN

For instructions: See the Repair Service Manual for this product.

6. If the error persists after replacing the laser/scanner assembly, replace the DC controller.

Table 6-76 DC Controller part numbers

Printer models	Part description	Part number
M501dn/ M501n	DC controller PCA	RM2-8711-030CN
M506 M527 E52545	For duplex models - DC controller PC board assembly (PCA)	RM2-8612-000CN
M506 E50045	For simplex models - DC controller PC board (PCA)	RM2-8614-000CN
M507 M528 E52645	For duplex models - DC controller PC board assembly (PCA)	RM3-7475-010CN
M507 E50145	For simplex models - DC controller PC board assembly (PCA)	RM3-7476-000CN

For instructions: See the Repair Service Manual for this product.

41.02.00 Error

A beam detected misprint error occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. To clear the error message, touch **OK**.
2. If the error persists, turn the printer off, and then on.
3. Verify that the toner cartridge is in good condition and the shutter works correctly. Swap the toner cartridge to test as needed.
4. If the error returns, check the wire harness from the laser/scanners to the DC controller.
5. If the error persists, replace the laser/scanner assembly and the laser/scanner cable.

For instructions: See the Repair Service Manual for this product.

Part number: RM2-5528-000CN

41.03.01, 41.03.A1, 41.03.B1, 41.03.C1

The printer detected a different paper size than expected.

Paper Size mismatch (O,A,B) or inter-page gap (C) error from Tray 1.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
4. Print internal pages from all trays to verify that this error only occurs when printing from the PC.
5. Set Tray 1 Size to ANY, and attempt to print again.
6. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
7. Verify that the toner cartridge and the transfer roller are seated correctly.
8. Check the tray 1 rollers and make sure they are not worn smooth, or coated with paper dust or other debris. If the rollers are causing the issue, replace the tray 1 roller kit.

Part number: Tray 1 Roller kit - F2A68-67914

9. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Set Tray 1 Size to ANY and attempt to print again.
4. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
5. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
6. Print internal pages from all trays to verify that this error only occurs when printing from the PC. If the error only occurs from the PC, check the print driver settings and ensure they are correct.
7. Verify that the toner cartridge and the transfer roller are seated correctly.
8. Check the rollers and make sure they are not worn smooth, or coated with paper dust or other debris. If the rollers are causing the issue, replace the roller kit.

Part number: Roller kit - F2A68-67914

9. Remove and reconnect the connectors for the paper path sensors, intermediate-transfer belt, and the DC controller PCA.
10. Test the registration assembly motor and clutch. If they do not function correctly replace the registration assembly.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

Part Number (M501/M506/E50045/M527/E52545): RM2-5671-000CN

Part Number (M507/E50145/M528/E52645): RM2-2577-000CN

11. Check the paper path sensors for correct operation and ensure that they do not stick at all. If the issue persists, elevate the issue using the Standard Support Process for a possible printer replacement.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

12. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

41.03.02, 41.03.A2, 41.03.B2, 41.03.C2 Error

The printer detected a different paper size than expected.

Paper Size mismatch (0,A,B) or inter-page gap (C) error from Tray 2.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Check if paper is loaded correctly in the paper tray.
Use paper that meets HP specifications for this printer.
3. Print a Configuration page to verify the size and type to which the trays are set.
Make sure that the selected paper size and type meets the HP specifications for the printer.
 - a. From the Home screen on the printer control panel, select **Administration** or the **Reports** button.



NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.

- b. Open the **Reports** menu, and then select **Configuration/Status Pages**.
 - c. Select **OK** or **Print** to print the page.
4. Make sure to load the tray with the correct paper size and the paper guides are adjusted to the correct size for the paper.



NOTE: Do not adjust the paper guides tightly against the paper stack. Adjust them to the indentations or markings in the tray.

5. Print internal pages from all trays to verify that this error only occurs when printing from the PC.
6. Verify that the error is not occurring as a result of an unexpected paper size trigger caused when multiple pages are picked up during paper feed.
7. Verify that the toner cartridge and the transfer roller are seated correctly.
8. Make sure that the rollers are installed correctly and show no damage or wear.
Check if the rollers are worn out or coated with paper dust or other debris.
 - If the rollers are not clean, use a damp, lint-free cloth to clean the rollers in the appropriate tray.
 - If the rollers are worn or damaged and causing the issue, replace the roller kit.

Table 6-77 Tray 2 roller kit part number

Part description	Part number
Kit-Trays 2X Roller	RM2-5752-000CN

9. If the error persists, contact HP customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. Print internal pages from all trays to verify that this error only occurs when printing from the PC. If the error only occurs from the PC, check the print driver settings and ensure they are correct.
6. Verify that the toner cartridge and the transfer roller are seated correctly.
7. Check the rollers and make sure they are not worn smooth, or coated with paper dust or other debris. If the rollers are causing the issue, replace the roller kit.

Part number: Roller kit - F2A68-67913

8. Use the Tray/Bin manual sensor test to verify that the cassette media switch is functioning correctly.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

9. Check the paper path sensors for correct operation and ensure that they do not stick at all. If the issue persists, elevate the issue using the Standard Support Process for a possible printer replacement.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

10. Remove and reconnect the connectors for the paper path sensors, intermediate-transfer belt, and the DC controller PCA.
11. Test the registration assembly motor and clutch. If they do not function correctly replace the registration assembly.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

Part Number (M501/M506/E50045/M527/E52545): RM2-5671-000CN
Part Number (M507/E50145/M528/E52645): RM2-2577-000CN
12. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

41.03.02 with slow printing

Some instances of slow printing and 41.03.02 have been seen caused by timing issues with the correct size paper loaded.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Check if paper is loaded correctly in the paper tray.

Use paper that meets HP specifications for this printer.
3. Print a Configuration page to verify the size and type to which the trays are set.

Make sure that the selected paper size and type meets the HP specifications for the printer.
 - a. From the Home screen on the printer control panel, select **Administration** or the **Reports** button.

 **NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.

 - b. Open the **Reports** menu, and then select **Configuration/Status Pages**.
 - c. Select **OK** or **Print** to print the page.
4. Make sure to load the tray with the correct paper size and the paper guides are adjusted to the correct size for the paper.

 **NOTE:** Do not adjust the paper guides tightly against the paper stack. Adjust them to the indentations or markings in the tray.

5. Print internal pages from all trays to verify that this error only occurs when printing from the PC.
6. Verify that the error is not occurring as a result of an unexpected paper size trigger caused when multiple pages are picked up during paper feed.
7. Verify that the toner cartridge and the transfer roller are seated correctly.

8. Make sure that the rollers are installed correctly and show no damage or wear.

Check if the rollers are worn out or coated with paper dust or other debris.

- If the rollers are not clean, use a damp, lint-free cloth to clean the rollers in the appropriate tray.
- If the rollers are worn or damaged and causing the issue, replace the roller kit.

Table 6-78 Tray 2 roller kit part number

Part description	Part number
Kit-Trays 2X Roller	RM2-5752-000CN

9. If the error persists, contact HP customer support.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print a Configuration page to verify the size and type to which the trays are set.
Make sure that the selected paper size and type meets the HP specifications for the printer.
3. Make sure that the tray is loaded with the correct paper size and the paper guides are adjusted to the correct size for the paper.



NOTE: Do not adjust the paper guides tightly against the paper stack. Adjust them to the indentations or markings in the tray.

4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. Print internal pages from all trays to verify that this error only occurs when printing from the PC.
6. Verify that the toner cartridge and the transfer roller are seated correctly.
7. Check the rollers and make sure they are not worn smooth, or coated with paper dust or other debris. If the rollers are causing the issue, send the customer a roller kit.

Table 6-79 Tray 2 roller kit part number

Part description	Part number
Kit-Trays 2X Roller	RM2-5752-000CN

8. Select the **Tray/Bin Manual Sensor Test** on the control panel to verify that the cassette paper switch is functioning correctly.

- a. From the Home screen on the printer control panel, scroll to and touch the **Administration** (FutureSmart 3), or **Support Tools** (FutureSmart 4).



NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.

- b. Open the following menus: **Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**.

- c. Activate the desired sensor, and then check the control panel display to verify the sensor is in a active or inactive state.
9. Run a [Paper Path Sensors](#) test using the control panel to view the status of each paper path sensor. Ensure that the sensors are functioning correctly.
 - a. From the Home screen on the printer control panel, scroll to and touch the [Administration](#) (FutureSmart 3), or [Support Tools](#) (FutureSmart 4).

 **NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.

 - b. Open the following menus: **Troubleshooting > Diagnostic Tests > Paper Path Sensors**.
 - c. Select [Start](#) to run the test.
10. If the error persists after performing the sensor tests, elevate the issue using the Standard Support Process for a possible printer replacement.
11. Test whether the registration assembly motor and clutch function correctly.
 - a. From the Home screen on the printer control panel, scroll to and touch the [Administration](#) (FutureSmart 3), or [Support Tools](#) (FutureSmart 4).

 **NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.

 - b. Open the following menus: **Troubleshooting > Diagnostic Tests > Component Test**.
 - c. Select the component and desired options.
12. If the registration assembly is not functioning correctly, replace the registration assembly.

Table 6-80 Registration roller assembly part number

Product model	Part description	Part number
M501	Registration roller assembly	RM2-5671-000CN
M506		
M527		
E50045		
E52545		
M507	Registration roller assembly	RM2-2577-000CN
M528		
E50145		
E52645		

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch [OK](#) to use another tray.

2. Print a Configuration page to verify the size and type to which the trays are set.
Make sure that the selected paper size and type meets the HP specifications for the printer.
3. Make sure that the tray is loaded with the correct paper size and the paper guides are adjusted to the correct size for the paper.



NOTE: Do not adjust the paper guides tightly against the paper stack. Adjust them to the indentations or markings in the tray.

4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. Print internal pages from all trays to verify that this error only occurs when printing from the PC.
6. Verify that the toner cartridge and the transfer roller are seated correctly.
7. Check the rollers and make sure they are not worn smooth, or coated with paper dust or other debris. If the rollers are causing the issue, send the customer a roller kit.

Table 6-81 Tray 2 roller kit part number

Part description	Part number
Kit-Trays 2X Roller	RM2-5752-000CN

8. Select the [Tray/Bin Manual Sensor Test](#) on the control panel to verify that the cassette paper switch is functioning correctly.
 - a. From the Home screen on the printer control panel, scroll to and touch the [Administration](#) (FutureSmart 3), or [Support Tools](#) (FutureSmart 4).
- NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.
- b. Open the following menus: **Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test.**
 - c. Activate the desired sensor, and then check the control panel display to verify the sensor is in a active or inactive state.
 9. Check the paper path sensors to ensure the sensors are functioning correctly.
 - a. From the Home screen on the printer control panel, scroll to and touch the [Administration](#) (FutureSmart 3), or [Support Tools](#) (FutureSmart 4).
- NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.
- b. Open the following menus: **Troubleshooting > Diagnostic Tests > Paper Path Sensors.**
 - c. Select [Start](#) to run the test.
 10. If the error persists after performing the sensor tests, elevate the issue using the Standard Support Process for a possible printer replacement.
 11. Test whether the registration assembly motor and clutch function correctly.

- a. From the Home screen on the printer control panel, scroll to and touch the [Administration](#) (FutureSmart 3), or [Support Tools](#) (FutureSmart 4).



NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.

- b. Open the following menus: **Troubleshooting > Diagnostic Tests > Component Test**.
- c. Select the component and desired options.

12. If the registration assembly is not functioning correctly, replace the registration assembly.

Table 6-82 Registration roller assembly part number

Product model	Part description	Part number
M501	Registration roller assembly	RM2-5671-000CN
M506		
M527		
E50045		
E52545		
M507	Registration roller assembly	RM2-2577-000CN
M528		
E50145		
E52645		

13. If the issue persists, perform an engine test with and without a formatter.

To perform an engine test, follow these steps:

- a. Load paper in Tray 2.




NOTE: The test page can only use Tray 2 as the paper source, so make sure that paper is loaded in Tray 2.

- b. Turn the printer on, and then use a small pointed object (like a paper clip) to depress the test-page switch located on the rear side of the printer (near the formatter).

The test page should have a series of lines that are parallel to the short end of the page.

Figure 6-82 Engine test-page switch

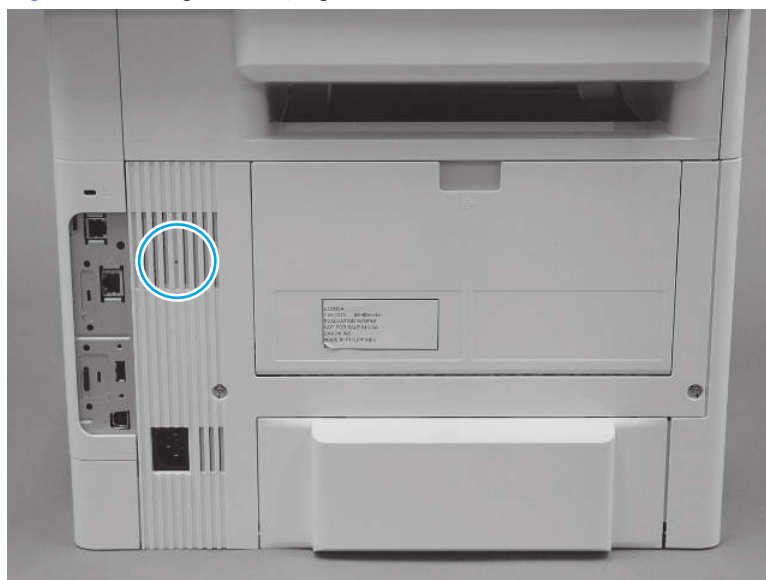

- c. Check if the engine test page prints or does not print.
 - If the engine-test page does not print, try removing the formatter, and then performing the engine test again.
 - If the engine test page prints without a formatter, the problem is with the formatter.
14. If the engine test page prints without a formatter, replace the formatter.

Use the following table to order the correct part number for your printer.

Table 6-83 Formatter PCA part numbers

Product models	Part description	Part number
M501dn	Formatter PC board	J8H61-67901
M501dn (China)	Formatter PC board	J8H61-67902
M501n	Formatter PC board	J8H60-67901
M501n (China)	Formatter board assembly	J8H60-67902
M506n/ M506dn	Formatter PC board assembly	F2A68-67915
E50045n/ E50045dn		
M506x	Formatter PC board assembly	F2A68-67916
E50045x		
M507	Formatter PC board	1PV87-60001
E50145		
M527	Formatter PC board assembly	F2A76-67910
E52545		
M528	Formatter PC board	1PV64-60002
E52645		

For instructions: See the Repair Service Manual for this product.

15. If replacing the formatter does not resolve the issue, replace the DC controller.

Use the following table to order the correct part number for your printer.

Table 6-84 DC Controller part numbers

Printer models	Part description	Part number
M501dn/ M501n	DC controller PCA	RM2-8711-030CN
M506 M527 E52545	For duplex models - DC controller PC board assembly (PCA)	RM2-8612-000CN
M506 E50045	For simplex models - DC controller PC board (PCA)	RM2-8614-000CN
M507 M528 E52645	For duplex models - DC controller PC board assembly (PCA)	RM3-7475-010CN
M507 E50145	For simplex models - DC controller PC board assembly (PCA)	RM3-7476-000CN

For instructions: See the Repair Service Manual for this product.

41.03.03, 41.03.A3, 41.03.B3, 41.03.C3 Error

The printer detected a different paper size than expected.

Paper Size mismatch (0,A,B) or inter-page gap (C) error from Tray 3.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Check if paper is loaded correctly in the paper tray.
Use paper that meets HP specifications for this printer.
3. Print a Configuration page to verify the size and type to which the trays are set.

Make sure that the selected paper size and type meets the HP specifications for the printer.

- a. From the Home screen on the printer control panel, select **Administration** or the **Reports** button.



NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.

- b. Open the **Reports** menu, and then select **Configuration/Status Pages**.

- c. Select **OK** or **Print** to print the page.
4. Make sure to load the tray with the correct paper size and the paper guides are adjusted to the correct size for the paper.



NOTE: Do not adjust the paper guides tightly against the paper stack. Adjust them to the indentations or markings in the tray.

5. Print internal pages from all trays to verify that this error only occurs when printing from the PC.
6. Verify that the error is not occurring as a result of an unexpected paper size trigger caused when multiple pages are picked up during paper feed.
7. Verify that the toner cartridge and the transfer roller are seated correctly.
8. Make sure that the rollers are installed correctly and show no damage or wear.

Check if the rollers are worn out or coated with paper dust or other debris.

- If the rollers are not clean, use a damp, lint-free cloth to clean the rollers in the appropriate tray.
- If the rollers are worn or damaged and causing the issue, replace the roller kit.

Table 6-85 Tray 2 roller kit part number

Part description	Part number
Kit-Trays 2X Roller	RM2-5752-000CN

9. If the error persists, contact HP customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. Print internal pages from all trays to verify that this error only occurs when printing from the PC. If the error only occurs from the PC, check the print driver settings and ensure they are correct.
6. Verify that the toner cartridge and the transfer roller are seated correctly.
7. Check the rollers and make sure they are not worn smooth, or coated with paper dust or other debris. If the rollers are causing the issue, replace the roller kit.

Part number: Roller kit - F2A68-67913

8. Use the Tray/Bin manual sensor test to verify that the cassette media switch is functioning correctly.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

9. Check the paper path sensors for correct operation and ensure that they do not stick at all. If the issue persists, elevate the issue using the Standard Support Process for a possible printer replacement.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

10. Remove and reconnect the connectors for the paper path sensors, intermediate-transfer belt, and the DC controller PCA.
11. Test the registration assembly motor and clutch. If they do not function correctly replace the registration assembly.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

Part Number (M501/M506/E50045/M527/E52545): RM2-5671-000CN

Part Number (M507/E50145/M528/E52645): RM2-2577-000CN

12. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

41.03.04, 41.03.A4, 41.03.B4, 41.03.C4

The printer detected a different paper size than expected.

Paper Size mismatch (0,A,B) or inter-page gap (C) error from Tray 4.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Check if paper is loaded correctly in the paper tray.
Use paper that meets HP specifications for this printer.
3. Print a Configuration page to verify the size and type to which the trays are set.
Make sure that the selected paper size and type meets the HP specifications for the printer.
 - a. From the Home screen on the printer control panel, select **Administration** or the **Reports** button.

 **NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.

 - b. Open the **Reports** menu, and then select **Configuration/Status Pages**.
 - c. Select **OK** or **Print** to print the page.
4. Make sure to load the tray with the correct paper size and the paper guides are adjusted to the correct size for the paper.

 **NOTE:** Do not adjust the paper guides tightly against the paper stack. Adjust them to the indentations or markings in the tray.

5. Print internal pages from all trays to verify that this error only occurs when printing from the PC.
6. Verify that the error is not occurring as a result of an unexpected paper size trigger caused when multiple pages are picked up during paper feed.
7. Verify that the toner cartridge and the transfer roller are seated correctly.
8. Make sure that the rollers are installed correctly and show no damage or wear.

Check if the rollers are worn out or coated with paper dust or other debris.

- If the rollers are not clean, use a damp, lint-free cloth to clean the rollers in the appropriate tray.
- If the rollers are worn or damaged and causing the issue, replace the roller kit.

Table 6-86 Tray 2 roller kit part number

Part description	Part number
Kit-Trays 2X Roller	RM2-5752-000CN

9. If the error persists, contact HP customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. Print internal pages from all trays to verify that this error only occurs when printing from the PC. If the error only occurs from the PC, check the print driver settings and ensure they are correct.
6. Verify that the toner cartridge and the transfer roller are seated correctly.
7. Check the rollers and make sure they are not worn smooth, or coated with paper dust or other debris. If the rollers are causing the issue, replace the roller kit.

Part number: Roller kit - F2A68-67913

8. Use the Tray/Bin manual sensor test to verify that the cassette media switch is functioning correctly.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

9. Check the paper path sensors for correct operation and ensure that they do not stick at all. If the issue persists, elevate the issue using the Standard Support Process for a possible printer replacement.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

10. Remove and reconnect the connectors for the paper path sensors, intermediate-transfer belt, and the DC controller PCA.
11. Test the registration assembly motor and clutch. If they do not function correctly replace the registration assembly.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

Part Number (M501/M506/E50045/M527/E52545): RM2-5671-000CN

Part Number (M507/E50145/M528/E52645): RM2-2577-000CN

12. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

41.03.05, 41.03.A5, 41.03.B5, 41.03.C5

The printer detected a different paper size than expected.

Paper Size mismatch (0,A,B) or inter-page gap (C) error from Tray 5.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Check if paper is loaded correctly in the paper tray.
Use paper that meets HP specifications for this printer.
3. Print a Configuration page to verify the size and type to which the trays are set.
Make sure that the selected paper size and type meets the HP specifications for the printer.
 - a. From the Home screen on the printer control panel, select **Administration** or the **Reports** button.



NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.

- b. Open the **Reports** menu, and then select **Configuration/Status Pages**.
 - c. Select **OK** or **Print** to print the page.
4. Make sure to load the tray with the correct paper size and the paper guides are adjusted to the correct size for the paper.



NOTE: Do not adjust the paper guides tightly against the paper stack. Adjust them to the indentations or markings in the tray.

5. Print internal pages from all trays to verify that this error only occurs when printing from the PC.
6. Verify that the error is not occurring as a result of an unexpected paper size trigger caused when multiple pages are picked up during paper feed.
7. Verify that the toner cartridge and the transfer roller are seated correctly.

8. Make sure that the rollers are installed correctly and show no damage or wear.

Check if the rollers are worn out or coated with paper dust or other debris.

- If the rollers are not clean, use a damp, lint-free cloth to clean the rollers in the appropriate tray.
- If the rollers are worn or damaged and causing the issue, replace the roller kit.

Table 6-87 Tray 2 roller kit part number

Part description	Part number
Kit-Trays 2X Roller	RM2-5752-000CN

9. If the error persists, contact HP customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. Print internal pages from all trays to verify that this error only occurs when printing from the PC. If the error only occurs from the PC, check the print driver settings and ensure they are correct.
6. Verify that the toner cartridge and the transfer roller are seated correctly.
7. Check the rollers and make sure they are not worn smooth, or coated with paper dust or other debris. If the rollers are causing the issue, replace the roller kit.

Part number: Roller kit - F2A68-67913

8. Use the Tray/Bin manual sensor test to verify that the cassette media switch is functioning correctly.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

9. Check the paper path sensors for correct operation and ensure that they do not stick at all. If the issue persists, elevate the issue using the Standard Support Process for a possible printer replacement.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

10. Remove and reconnect the connectors for the paper path sensors, intermediate-transfer belt, and the DC controller PCA.
11. Test the registration assembly motor and clutch. If they do not function correctly replace the registration assembly.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

Part Number (M501/M506/E50045/M527/E52545): RM2-5671-000CN

Part Number (M507/E50145/M528/E52645): RM2-2577-000CN

12. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

41.03.0D, 41.03.AD, 41.03.BD, 41.03.CD

The printer detected a different paper size than expected.

Paper Size mismatch (0,A,B) or inter-page gap (C) error from duplexer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
4. Print internal pages from all trays to verify that this error only occurs when printing from the PC.
5. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
6. Verify that the toner cartridge and the transfer roller are seated correctly.
7. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to use another tray.
2. Print the configuration page to verify the size and type to which the trays are set.
3. Make sure that the tray is loaded with the correct paper size and that the sliding paper guides are correctly adjusted to the correct paper size.
4. Verify that the error is not occurring as a result of an unexpected paper size trigger caused by a multi-page feed.
5. Print internal pages from all trays to verify that this error only occurs when printing from the PC. If the error only occurs from the PC, check the print driver settings and ensure they are correct.
6. Verify that the toner cartridge and the transfer roller are seated correctly.
7. Check the rollers and make sure they are not worn smooth, or coated with paper dust or other debris. If the rollers are causing the issue, replace the roller kit.

Part number: Roller kit - F2A68-67913

8. Use the Tray/Bin manual sensor test to verify that the cassette media switch is functioning correctly.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

9. Check the paper path sensors for correct operation and ensure that they do not stick at all. If the issue persists, elevate the issue using the Standard Support Process for a possible printer replacement.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

10. Remove and reconnect the connectors for the paper path sensors, intermediate-transfer belt, and the DC controller PCA.

11. Test the registration assembly motor and clutch. If they do not function correctly replace the registration assembly.

Open the following menus to test sensor: **Administration > Troubleshooting > Diagnostic Tests > Tray/Bin Manual Sensor Test**

Part Number (M501/M506/E50045/M527/E52545): RM2-5671-000CN

Part Number (M507/E50145/M528/E52645): RM2-2577-000CN

12. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

41 . 03 . FZ Unknown Misprint Error

This is a general misprint error.

Either the paper is loaded off-center with the side guides in the tray or a paper width sensor failure occurred from an unknown tray. The error will be one of the following:

- 41.03.F0
- 41.03.F1
- 41.03.F2
- 41.03.F3
- 41.03.F4
- 41.03.F5
- 41.03.FD

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Remove the paper from the tray and ensure that the paper tray size guides are set to the correct size for the paper loaded in the tray.
2. Try the print job again.

Watch the paper tray feed mechanism to see if it is functioning correctly. If the linkage is broken, replace the paper tray.

Table 6-88 Part numbers

Description	Part number
Tray 2 cassette only	RM2-5690-000CN
1x550 optional feeder cassette assembly	

3. If the error persists, print a Configuration Page and note the paper size for the tray in question.
 - If the size is not reported correctly, run the tray size sensor test in the **Diagnostic** menu.
 - If the tray size sensors test as **GOOD**, replace the paper tray.
 - If the tray size sensors test as **BAD**, check the cable connections between the tray size sensor and the DC Controller.

If the cable connections are plugged in correctly and the cables are not damaged, elevate the issue using the Standard Support Process.

41 . 04 . yz Printer Error

An unknown misprint error occurred on the printer.

Y = Type, Z = Tray

- Y = 0: Photo Media (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light media 1, 2, or 3 mode
- Y = 4: Heavy media 1
- Y = 5: Heavy media 2
- Y = 6: Heavy media 3
- Y = 7: Glossy media 1
- Y = 8: Glossy media 2
- Y = 9: Glossy media 3
- Y = A: Glossy film
- Y = B: OHT

- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = D Source is the duplexer.
- Z = 0 Source is the envelope feeder.
- Z = 1 Source is Tray 1.
- Z = 2 Source is Tray 2.
- Z = 3 Source is Tray 3.
- Z = 4 Source is Tray 4.
- Z = 5 Source is Tray 5.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the error does not clear, turn the printer off, and then on.
3. If the error persists, visually inspect the toner cartridge, and then reinstall the toner cartridge.



NOTE: Ensure that the toner cartridges are HP original cartridges and that the cartridges are seated correctly before replacing any other parts.

- a. Open the front door to remove the toner cartridge.
 - b. Check the toner cartridge and ensure it is a genuine HP toner cartridge.
 - c. Swap out the toner cartridge to test it.
 - d. Install the toner cartridge until it is firmly seated, and then close the front door.
4. Disconnect and re-seat the flat-flexible cable (FFC) connections on the laser scanner and on the DC controller.

Ensure that the cables are connected and seated correctly before replacing any part.

5. If the error persists, replace the laser/scanner assembly.

Table 6-89 Laser scanner assembly part number

Part description	Part number
Assembly- Laser scanner	RM2-4860-000CN

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite service technicians

Follow these troubleshooting steps in the order presented.

1. Touch **OK** to clear the error.
2. If the error does not clear, turn the printer off, and then on.
3. If the error persists, visually inspect the toner cartridge, and then reinstall the toner cartridge.



NOTE: Ensure that the toner cartridges are HP original cartridges and that the cartridges are seated correctly before replacing any other parts.

- a. Open the front door to remove the toner cartridge.
 - b. Check the toner cartridge and ensure it is a genuine HP toner cartridge.
 - c. Swap out the toner cartridge to test it.
 - d. Install the toner cartridge until it is firmly seated, and then close the front door.
4. Disconnect and re-seat the flat-flexible cable (FFC) connections on the laser scanner and on the DC controller.



NOTE: Ensure that the cables are connected and seated correctly before replacing any part.

5. If the error persists, replace the laser/scanner assembly.

Table 6-90 Laser scanner assembly part number

Part description	Part number
Assembly- Laser scanner	RM2-4860-000CN

For instructions: See the Repair Service Manual for this product.

6. If the error persists after replacing the laser/scanner assembly, replace the DC controller.

Table 6-91 DC Controller part numbers

Printer models	Part description	Part number
M501dn/ M501n	DC controller PCA	RM2-8711-030CN
M506	For duplex models - DC controller PC board assembly (PCA)	RM2-8612-000CN
M527		
E52545		

Table 6-91 DC Controller part numbers (continued)

Printer models	Part description	Part number
M506 E50045	For simplex models - DC controller PC board (PCA)	RM2-8614-000CN
M507 M528 E52645	For duplex models - DC controller PC board assembly (PCA)	RM3-7475-010CN
M507 E50145	For simplex models - DC controller PC board assembly (PCA)	RM3-7476-000CN

For instructions: See the Repair Service Manual for this product.

41 . 05 . yz Unexpected type in tray <X>

Tray X is loaded with a paper type (transparencies, envelopes, etc.) that is different than what the tray is configured to use.

The printer can detect the type of paper in the paper path, and it adjusts the print mode accordingly.

Y = Expected type, Z = Detected type

- Y = 0: Photo Media (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light media 1, 2, or 3 mode
- Y = 4: Heavy media 1
- Y = 5: Heavy media 2
- Y = 6: Heavy media 3
- Y = 7: Glossy media 1
- Y = 8: Glossy media 2
- Y = 9: Glossy media 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode

- Z = 0: Photo Media (1, 2, or 3)
- Z = 1: Auto Sense (Normal)
- Z = 2: Normal (typed not from Auto Sense)
- Z = 3: Light media 1, 2, or 3 mode
- Z = 4: Heavy media 1
- Z = 5: Heavy media 2
- Z = 6: Heavy media 3
- Z = 7: Glossy media 1
- Z = 8: Glossy media 2
- Z = 9: Glossy media 3
- Z = A: Glossy film
- Z = B: OHT
- Z = C: Label
- Z = D: Envelope 1, 2, or 3 mode
- Z = E: Rough
- Z = F: Other mode

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Load the tray with the size and type of paper indicated, or use another tray if available.
2. If this message displays and the tray is loaded with the correct paper type, check the print driver settings to make sure they match the tray type settings.
3. Check all application and printer settings to make sure that the **type** setting is correct.
4. Clean the paper path sensors.
5. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

41 . xx . yz Error To continue, touch “OK”

A printer error has occurred.

Use this information to resolve general 41.XX.YY error messages.

XX = error type

Y = fuser mode

Z = input tray

- XX = 02 Beam detect misprint
- XX = 09 Sub thermistor abnormally high
- XX = 10 Pickup failure.
- XX = 11 Illegal Duplex.
- XX = 18 Scan line inclination adjustment
- XX = 20 Image drum HV
- Y = 0: Photo Media (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light media 1, 2, or 3 mode
- Y = 4: Heavy media 1
- Y = 5: Heavy media 2
- Y = 6: Heavy media 3
- Y = 7: Glossy media 1
- Y = 8: Glossy media 2
- Y = 9: Glossy media 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode
- Z = 0 Envelope feeder
- Z = 1 Tray 1
- Z = 2 Tray 2
- Z = 3 Tray 3
- Z = 4 Tray 4

- Z = 5 Tray 5
- Z = 6 Tray 6
- D Duplexer

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. To clear the message, touch the **OK** button.
2. If the message displays again, turn the printer off, and then on.
3. If the error persists, replace the DC controller PCA.

DC controller (M527) part number: RM2-8612-000CN

DC controller simplex (M506) part number: RM2-8600-000CN

DC controller duplex (M506) part number: RM2-8612-000CN

DC controller simplex (M501) part number: RM2-8710-000CN

DC controller duplex (M506) part number: RM2-7950-000CN

For instructions: See the Repair Service Manual for this product.

42.XX.YZ error messages

42 . XX . YZ

Internal system failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on. Retry the job.
2. If the error persists, clear the firmware image from the active partition by using the **Partial Clean** item in the **Preboot** menu.

42.B0.01 or 42.B0.02

Missing string in firmware error.

42.B0.01: UI or EWS requests a string ID that does not exist in the localization database.

42.B0.02: UI requests an image ID or media file that does not exist.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on. Retry the job.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents, and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on. Retry the print job.
2. If the error persists, clear the firmware image from the active partition by using the [Partial Clean](#) item in the [Preboot](#) menu.



NOTE: The Partial Clean option erases all data from the partitions, except for the firmware repository where a backup copy of the firmware file is stored. This allows the disk drive to be reformatted without having to download a firmware upgrade file to return the printer to a bootable state. Characteristics of a Partial Clean

- Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted
- Rebooting the printer restores the firmware files from the Repository location, but does not restore any customer-defined settings.
- For previous HP products, a Hard Disk Initialization is similar to executing the Partial Clean function for this printer



CAUTION: HP recommends backing-up printer configuration data before executing a Partial Clean to retain customer-defined settings (if needed). See the Backup/Restore item in the Device Maintenance menu.

3. How to execute a Partial Clean from a touchscreen control panel.
 - a. Touch in the middle of the control panel display when you see the 1/8 under the HP logo.

Figure 6-83 Open the Pre-Boot menu



- b. Use the down arrow button to highlight the **+3:Administrator** item, and then touch the **OK** button.
- c. Use the down arrow button to highlight **Partial Clean** and then touch the **OK** button.
- d. Touch the **OK** button again.
- e. Touch the **Home** button to highlight Continue, and then touch the **OK** button.



NOTE: The printer initializes.

44.XX.XX error messages - M527 only

44.* errors

Errors in the 44.* family are related to the digital send functionality: fax, email, send to SharePoint, or save to folder.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. In many cases, the error will automatically clear, and you can try the job again.
2. Verify the digital send feature has been correctly configured at the control panel and with the HP Embedded Web Server (EWS).



NOTE: To access the EWS, open a Web browser, and in the address line, enter the printer IP address.

3. Turn the printer off, and then on. Retry the job.
4. For fax errors, verify the fax card is correctly installed on the formatter.
5. For SharePoint or save-to-folder errors, verify the permissions are set correctly for access to the SharePoint or network folder.
6. For email errors, verify connectivity to the network, and verify the SMTP gateway is configured correctly. Also verify if there is a size limit on email attachments.
7. If the error persists, reset the printer to factory settings, and then upgrade the firmware to the latest version.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](http://www.hp.com/go/firmware)

44 . 01 . xx Error Event log message

A digital send error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. No action necessary. This error message should automatically clear.
2. Try to send the job again.
3. If the error does not clear or it returns:
 - a. Use optimal resolution and image quality settings.
 - b. Wait until all the digital send jobs have been processed.
 - c. Turn the printer off, and then on. Retry the job.
 - d. Verify if there is an attachment limit on the email.
 - e. Verify network connectivity, SMTP gateways, access to folder share.

44 . 03 . xx Error Event log message

A digital send error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

- Try to send the job again.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Use optimal resolution and image quality settings.
2. Wait until all the digital send jobs have been processed.
3. Turn the printer off, and then on and retry the job.
4. Verify if there is an attachment limit on the email.
5. Verify network connectivity, SMTP gateways, access to folder share.

44 . 10 . xx Error Event log message (*Multifunction product only*)

A send to email error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the digital send configuration.

For more information, Go to: [Or click here: HP LaserJet Enterprise MFP - Set up Scan to Email.](#)

44 . 34 . xx Error Event log message

A fax error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the fax settings to make sure they are set to the proper settings for the environment.
3. If the issue persists, for additional fax troubleshooting information go to [HP LaserJet Enterprise MFP, HP PageWide Enterprise MFP - Checklist for solving fax problems](#).

44 . 34 . 03 Fax Modem Failure

Digital Send error. Fax result modem fail.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Verify the fax card is correctly installed on the formatter, be sure the fax card is aligned with slot on the formatter chassis and is firmly seated against the formatter board.
3. Turn the printer on.
4. If the issue persists, replace the fax PCA.

Part number: B5L53-67901

44 . 34 . E5 Fax Modem Failure

A fax error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Verify the fax card is correctly installed on the formatter, be sure the fax card is aligned with slot on the formatter chassis and is firmly seated against the formatter board.

3. If the issue persists, download and reinstall the firmware.
4. If the issue persists, perform a Partial Clean:
 - a. Turn the printer off, and then on.
 - b. The HP logo displays on the printer control panel. When a "1/8" with an underscore displays below the HP logo, touch the logo to open the [Pre-boot](#) menu.
 - c. Use the arrow buttons on the touchscreen to navigate the pre-boot menu.
 - d. Use the down arrow to highlight [Partial Clean](#), and then touch the [OK](#) button.
 - e. Touch the [OK](#) button again.
 - f. Touch the Back button to highlight [Continue](#), and then touch the [OK](#) button.

The printer will continue to boot to **Ready**.

5. If the issue persists, replace the fax PCA.

Part number: B5L53-67901

44 . 90 . xx, 44 . 91 . xx, 44 . 92 . xx Error Event log message

A fax error has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Try to send the job again.
2. Check the fax settings to make sure they are set to the proper settings for the environment.
3. If the issue persists, for additional fax troubleshooting information go to [HP LaserJet Enterprise MFP, HP PageWide Enterprise MFP - Checklist for solving fax problems](#).

47.XX.XX error messages

47.* errors

Errors in the 47.* family indicate an internal error has occurred.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.00.xx

Back channel internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.01.xx

Image transformer internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.02.xx

Job parser internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.03.xx

Print job internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.04.xx

Print spooler 9100 internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.05.xx

Print spooler framework internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a **Format Disk** procedure using the **Preboot** menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

47.06.xx

Print application internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

48.XX.YY error messages

48.* errors

Errors in the 48.* family indicate an internal error has occurred.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. In most cases, no action is necessary.
2. If the error persists, upgrade the printer firmware.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 48 error troubleshooting (whichever is appropriate) in document c03122817. Search for the following document on **WISE**: HP LaserJet FutureSmart Devices - 49 Error Troubleshooting (Persistent and Intermittent).



NOTE: 48.wx.yz errors are similar to 49.wx.yz errors and use the same troubleshooting steps and procedures.

49.XX.YY error messages

49 . xx . yy Error To continue turn off then on

A firmware error occurred.

Possible causes:

- Corrupted print jobs
- Software application issues
- Non-product specific print drivers
- Poor quality USB or network cables
- Bad network connections or incorrect configurations
- Invalid firmware operations
- Unsupported accessories

A 49 error might happen at any time for multiple reasons. Although some types of 49 errors can be caused by hardware failures, it is more common for 49 errors to be caused by printing a specific document or performing some task on the printer.

49 errors most often occur when a printer is asked to perform an action that the printer firmware is not capable of and might not have been designed to comply with, such as:

- Printing files with unsupported programming commands
- A unique combination of user environment and user interactions with the printer
- Interfacing with a third-party solution that was not designed to work with the printer
- Specific timing, network traffic, or concurrent processing of jobs

Recommended action for customers

Follow these troubleshooting steps in the order presented.



NOTE: LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
 - The error might be caused by a network connectivity problem, such as a bad USB or network interface cable, a bad USB port, or an invalid network configuration setting.
 - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
 - Upgrading the printer firmware might help resolve the error.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
 - The error might be caused by a network connectivity problem, such as a bad interface cable, a bad USB port, or an invalid network configuration setting.
 - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
 - Upgrading the printer firmware might help resolve the error.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 49 error troubleshooting (whichever is appropriate) in document c03122817. Search for the following document on **WISE**: HP LaserJet FutureSmart Devices - 49 Error Troubleshooting (Persistent and Intermittent).



NOTE: 48 errors are similar to 49 errors.

49.2F.D8

Native video pipeline error in managed RC.

This error has been seen after long idle periods.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Perform the following steps.

1. Turn the printer off, and then on to see if the error persists.
2. Ensure the printer is plugged into a stable power source.
3. If the error persists, replace the laser/scanner assembly.

Part number: RM2-5528-000CN

Recommended action for on-site technicians

Perform the following steps as outlined.

1. Turn the printer off, and then on to see if the error persists.
2. Ensure the printer is plugged into a stable power source.
3. If the error persists, replace the laser/scanner assembly.

Part number: RM2-5528-000CN

for instructions: See the Repair Service Manual for this product.

49.38.07

Generic error.

This issue is caused by a formatter replacement that has not had the correct parameters set at the factory. This issue is tied to the factory installed Trusted Platform Module (TPM).



NOTE: For additional information, go to WISE and search for this document: HP LaserJet Enterprise, HP LaserJet Managed - 49.38.07 error after replacing the formatter (Emerging Issue) (c06621339).

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ask the technician where the formatter came from and note the answer in the case notes.
2. Turn the printer off, and then on.
3. Confirm that the unit still boots to the same 49.38.07 error.
4. Elevate the case to ATS



NOTE: Never replace the TPM on a unit that shipped with one. The TPM that can be ordered is only available for adding a level of security on a device that never had a TPM paired from the factory. A new TPM cannot be installed for security reasons.

49.38.0C

Unhandled printer error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.
Go to [HP FutureSmart - Latest Firmware Versions](#).
For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the issue persists, replace the hard disk drive (HDD).



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-92 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the issue persists, replace the hard disk drive (HDD).



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-93 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above

For instructions: See the Service Manual for this printer.

50.WX.YZ error messages

50.* errors

Errors in the 50.* family indicate a problem with the fuser.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and remove the fuser. Check the fuser for damage or obstructions. Reinstall or replace the fuser as needed.



CAUTION: The fuser might be hot.

2. Check the connectors between the fuser and the DC controller and from the fuser to the printer.
3. Replace the fuser. If it has already been replaced, replace the fuser power supply.

50.1x.yz Fuser Error

Low fuser temperature.

Y = previous printer sleep state, Z = next printer sleep state

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.

Electrical Specifications

110v input voltage: 100 to 127 VAC, 50/60 Hz, 7.5 A (+/- 10%)

220v input voltage: 220 to 240 VAC, 50/60 Hz, 4 A (+/- 10%)

Table 6-94 Power consumption (avg. in watts)

Printing	Ready	Sleep	Auto-Off	Off
671 W	27.8 W	3.2 W	0.1 W	0.1 W

3. Turn the printer on. If the error returns, please contact your support provider.



NOTE: The fuser was not designed to be end-user replaceable and requires authorized service personnel to replace. Should the error persist please contact HP Customer Support or authorized repair personnel.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the fuser. Check the connector (J290–291) between the fuser and the printer. If it is damaged, replace the fuser.

Table 6-95 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

See the Repair Service Manual for this product.

3. Reconnect the connectors (J132 and J152) on the DC Controller PCA.

4. If the error persists, replace the fuser power supply assembly.

Table 6-96 Part numbers

Part Name	Part Number
Fixing (fuser) power supply (FPS) 110V-127V	RM2-7948-000CN
Fixing (fuser) power supply (FPS) 220V-240V	RM2-7949-000CN

For instructions: See the Repair Service Manual for this product.

5. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

50 . 2x . yz Fuser Error

Fuser warm up failure.

X = fuser mode, Y = previous printer sleep state, Z = next printer sleep state

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.

Electrical Specifications

110v input voltage: 100 to 127 VAC, 50/60 Hz, 7.5 A (+/- 10%)

220v input voltage: 220 to 240 VAC, 50/60 Hz, 4 A (+/- 10%)

Table 6-97 Power consumption (avg. in watts)

Printing	Ready	Sleep	Auto-Off	Off
671 W	27.8 W	3.2 W	0.1 W	0.1 W

3. Turn the printer on. If the error returns, please contact your support provider.



NOTE: The fuser was not designed to be end-user replaceable and requires authorized service personnel to replace. Should the error persist please contact HP Customer Support or authorized repair personnel.

Recommended action for call-center agents and onsite technician

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.
3. If error returns, turn the printer off.

4. Remove the fuser and check the fuser for damage or obstructions. Reinstall or replace the fuser as needed.

Table 6-98 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

See the Repair Service Manual for this product.

5. Check the connectors (J132 and J152) between the fuser and the DC controller PCA.
J291 (TP1 cable) is a 2-pin wire harness visible when the connector cover is removed.
If not connected and seated correctly, this can cause a 50.2x error.
6. If the error persists, replace the fuser and then replace the fuser power supply assembly if needed or if the fuser has already been replaced.

Table 6-99 Part numbers

Part Name	Part Number
Fixing (fuser) power supply (FPS) 110V-127V	RM2-7948-000CN
Fixing (fuser) power supply (FPS) 220V-240V	RM2-7949-000CN

For instructions: See the Repair Service Manual for this product.

7. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

50.2F.00 Fuser Error

Fuser warm up failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.

Electrical Specifications

110v input voltage: 100 to 127 VAC, 50/60 Hz, 7.5 A (+/- 10%)

220v input voltage: 220 to 240 VAC, 50/60 Hz, 4 A (+/- 10%)

Table 6-100 Power consumption (avg. in watts)

Printing	Ready	Sleep	Auto-Off	Off
671 W	27.8 W	3.2 W	0.1 W	0.1 W

3. Turn the printer on. If the error returns, please contact your support provider.



NOTE: The fuser was not designed to be end-user replaceable and requires authorized service personnel to replace. Should the error persist please contact HP Customer Support or authorized repair personnel.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.

Electrical Specifications

110v input voltage: 100 to 127 VAC, 50/60 Hz, 7.5 A (+/- 10%)

220v input voltage: 220 to 240 VAC, 50/60 Hz, 4 A (+/- 10%)

Table 6-101 Power consumption (avg. in watts)

Printing	Ready	Sleep	Auto-Off	Off
671 W	27.8 W	3.2 W	0.1 W	0.1 W

3. If error returns, turn the printer off.
4. If the error persists, replace the fuser as needed.



NOTE: The fuser was not designed to be end-user replaceable and requires authorized service personnel to replace. Should the error persist please contact HP Customer Support or authorized repair personnel.

Table 6-102 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

Recommended action for onsite technician

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.

Electrical Specifications

110v input voltage: 100 to 127 VAC, 50/60 Hz, 7.5 A (+/- 10%)

220v input voltage: 220 to 240 VAC, 50/60 Hz, 4 A (+/- 10%)

Table 6-103 Power consumption (avg. in watts)

Printing	Ready	Sleep	Auto-Off	Off
671 W	27.8 W	3.2 W	0.1 W	0.1 W

3. Check the fuser TP1 for continuity.



NOTE: TP1 (thermal switch) prevents an abnormal temperature rise in the fuser heater. TP1 continuity can be checked to identify if the switch is open. If the continuity measures open, the switch has been triggered and the fuser must be replaced.


- a. Turn the printer off.
- b. Disconnect the power cable.
- c. Remove the rear door assembly.

For instructions: See the Repair Service Manual for this product.



NOTE: An MFP printer is shown in this section. However, the procedure is correct for all printer models.

- d. Remove the fuser connector cover on the inner right side.

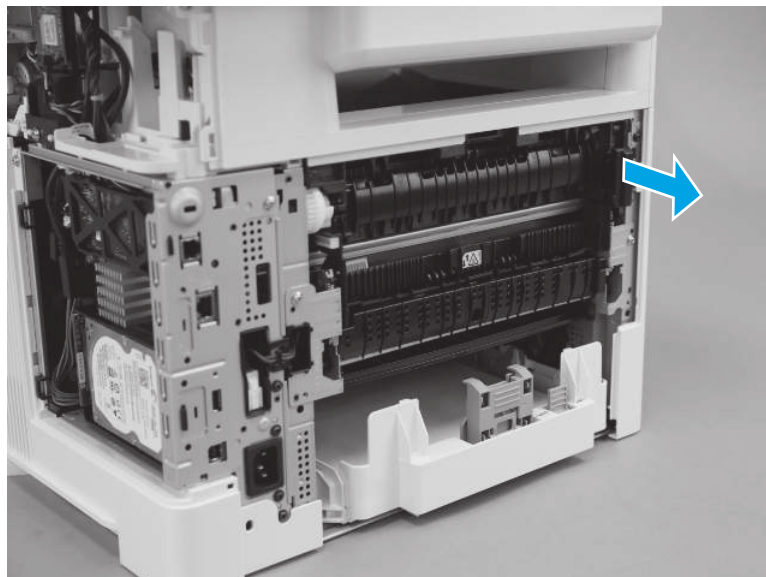

- e. Verify that the wire harness is fully seated and connected correctly with the Fuser Power Supply PCA.

J291 (TP1 cable) is a 2-pin wire harness visible when the connector cover is removed.

If not connected and seated correctly, this can cause a 50.2F.00 error.

- f. If the wiring harness is seated properly unplug J291 from the Fuser Power Supply PCA as pictured (2-pin wire harness)



- g. Using a multimeter check for TP1 continuity
- If the switch is OPEN, replace the fuser.
 - If the TP1 has continuity the switch is good.

Table 6-104 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

See the Repair Service Manual for this product.

4. If the error returns, turn the printer off and allow the fuser to cool for five minutes. Remove the fuser and check the fuser for visible damage. If damaged is identified, replace the fuser as needed.

Table 6-105 Part numbers


Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN

Table 6-105 Part numbers (continued)

Part Name	Part Number
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

See the Repair Service Manual for this product.

5. Check the connectors (J132 and J152) between the fuser and the DC controller PCA.

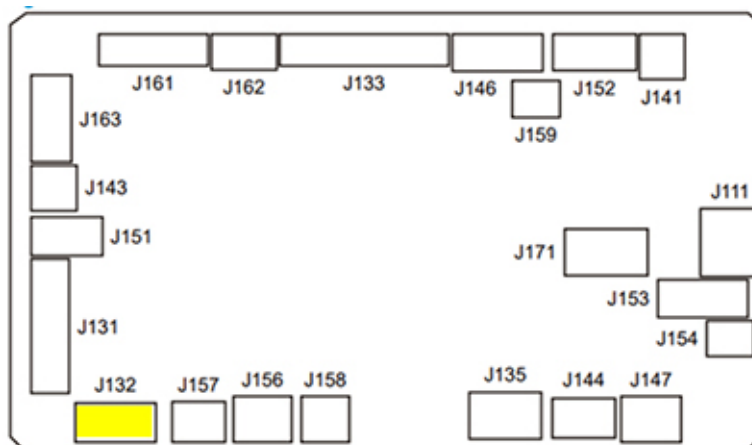

6. Check connector J216 at the Fuser power supply PCA, reseating as necessary. If after reseating the error continues, replace the fuser.

Table 6-106 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

See the Repair Service Manual for this product.

7. If the error persists, elevate the issue using the Standard Support Process.

50 . 3X . yZ Fuser Error

High fuser temperature.

X = fuser mode, Y = previous printer sleep state, Z = next printer sleep state

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the fuser and check the fuser for damage or obstructions. Reinstall or replace the fuser as needed.

Table 6-107 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

See the Repair Service Manual for this product.

3. Check the connector (J128) between the fuser and the printer. If it is damaged, replace the fuser.
4. Check the connectors (J132 and J152) on the DC controller PCA.
5. Replace the fuser.
6. If the error persists, replace the fuser power supply assembly.

Table 6-108 Part numbers

Part Name	Part Number
Fixing (fuser) power supply (FPS) 110V-127V	RM2-7948-000CN
Fixing (fuser) power supply (FPS) 220V-240V	RM2-7949-000CN

For instructions: See the Repair Service Manual for this product.

7. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

50 . 4x . yz Fuser Error

Drive circuit fault.

X = fuser mode, Y = previous printer sleep state, Z = next printer sleep state

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error returns, turn the printer off, unplug the device from any power-strips or uninterrupted power supplies, and plug printer directly in to a wall socket.

Electrical Specifications

110v input voltage: 100 to 127 VAC, 50/60 Hz, 7.5 A (+/- 10%)

220v input voltage: 220 to 240 VAC, 50/60 Hz, 4 A (+/- 10%)

Table 6-109 Power consumption (avg. in watts)

Printing	Ready	Sleep	Auto-Off	Off
671 W	27.8 W	3.2 W	0.1 W	0.1 W

3. Turn the printer on. If the error returns, please contact your support provider.



NOTE: The fuser was not designed to be end-user replaceable and requires authorized service personnel to replace. Should the error persist please contact HP Customer Support or authorized repair personnel.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Check the power source. Make sure the power source meets printer requirements.



NOTE: If the power source does not meet the power frequency requirement of 40 to 70Hz, the fuser temperature control does not work properly and causes this error.

2. Reconnect connectors (J132 and J152) on the DC controller PCA.
3. If the error persists, replace the fuser power supply assembly.

Table 6-110 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

See the Repair Service Manual for this product.

4. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

50 . 6x . yz Fuser Error

Fuser open error.

X = fuser mode, Y = previous printer sleep state, Z = next printer sleep state

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ensure the paper type and fuser mode are correctly set for the paper being used.
2. Turn the printer off.
3. Remove the fuser, and check the connector (J128) between the fuser and the printer. If it is damaged, replace the fuser.

Table 6-111 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

See the Repair Service Manual for this product.

4. Reinstall the fuser and turn the printer on.
5. Reconnect connectors (J132 and J152) on the DC controller PCA.
6. Replace the fuser.
7. If the error persists, replace the power supply unit.

Table 6-112 Part Numbers

Part Name	
Low-voltage power supply (LVPS) 110V-127V (M527/E52545/M528/E52645)	RM2-7951-000CN
Low-voltage power supply (LVPS) 220V-240V (M527/E52545/M528/E52645)	RM2-7952-000CN
Low-voltage power supply (LVPS) 110V-127V (M506/E50045/M507/E50145)	RM2-7941-000CN
Low-voltage power supply (LVPS) 220V-240V (M501/M506/E50045/M507/E50145)	RM2-7942-000CN

For instructions: See the Repair Service Manual for this product.

50 . 7X . YZ Fuser Error

Fuser pressure release failure.

X = fuser mode, Y = previous printer sleep state, Z = next printer sleep state

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Resend the job.
3. If error returns, turn the printer off.
4. Remove the fuser and check the fuser for damage or obstructions.

 **CAUTION:** Be careful: the fuser is HOT. Allow it cool if you need to before removing to check the assembly.

5. Reinstall the fuser and turn the printer on.
6. If the error persists, replace the fuser assembly.

Table 6-113 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

See the Repair Service Manual for this product.

50 . 9X . YZ Fuser Error

Low fuser temperature error.

X = fuser mode, Y = previous printer sleep state, Z = next printer sleep state

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the power cord of the printer is plugged directly into a wall outlet and the outlet voltage matches the voltage specifications on the printer.



NOTE: Unplug the power cord of the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Press the power button to turn on the printer.
4. Ensure the paper type and fuser mode are correct for the paper being used.
5. Open the **Trays** menu on the printer control panel. Verify that the tray is configured correctly for the paper type and size.
6. Ensure that the paper type set on the printer matches the paper type selection in the printer driver.
Use only paper that meets HP specifications for this printer.
7. Retest the printer.
8. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the power cord of the printer is plugged directly into a wall outlet and the outlet voltage matches the voltage specifications on the printer.



NOTE: Unplug the power cord of the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

3. Ensure the paper type and fuser mode are correctly set for the paper being used.
4. If the error reoccurs, turn off the printer, and then turn on the printer.
5. If the error persists, replace the fuser assembly.

Use the table below and ensure the correct voltage fuser is installed in the printer.



WARNING! The fuser is hot. Wait at least 30 minutes after turning the printer power off before removing the fuser.

Table 6-114 Fuser assembly (For 110V and 220V) Part numbers

Printer models	Part description	Part number
M501 M506 M507 M527 M528 E50045 E50145 E52545 E52645	Fuser assembly - For 110 VAC <i>Bonds toner to the paper with heat.</i>	RM2-2585-000CN
M501 M506 M507 M527 M528 E50045 E50145 E52545 E52645	Fuser assembly - For 220 VAC <i>Bonds toner to the paper with heat.</i>	RM2-2586-000CN

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Ensure the paper type and fuser mode are correctly set for the paper being used.
3. Ensure the power cord of the printer is plugged directly into a wall outlet and the outlet voltage matches the voltage specifications on the printer.



NOTE: Unplug the power cord of the printer from any power-strip or uninterrupted power supply, and plug it directly into a wall socket.

4. If the error returns, turn the printer off.
5. Remove the fuser and check the fuser for damage or obstructions.



CAUTION: The fuser is hot. Wait at least 30 minutes after turning the printer power off before removing the fuser assembly.

6. Reinstall the fuser, ensure it is seated correctly, and then turn the printer on.
7. If the error persists, replace the fuser assembly.

Table 6-115 Fuser assembly (For 110V and 220V) part numbers

Printer models	Part description	Part number
M501	Fuser assembly - For 110 VAC <i>Bonds toner to the paper with heat.</i>	RM2-2585-000CN
M506		
M507		
M527		
M528		
E50045		
E50145		
E52545		
E52645		
M501	Fuser assembly - For 220 VAC <i>Bonds toner to the paper with heat.</i>	RM2-2586-000CN
M506		
M507		
M527		
M528		
E50045		
E50145		
E52545		
E52645		

For instructions: See the Repair Service Manual for this product.

8. If error persists, replace the power supply unit.

Table 6-116 Low-voltage power supply (LVPS) part numbers

Printer models	Part description	Part number
M527	Low-voltage power supply (LVPS) - For 110-127 VAC	RM2-7951-000CN
M528		
E52545		
E52645		

Table 6-116 Low-voltage power supply (LVPS) part numbers (continued)

Printer models	Part description	Part number
M527	Low-voltage power supply (LVPS) - For 220-240 VAC	RM2-7952-000CN
M528		
E52545		
E52645		
M506	Low-voltage power supply (LVPS) - For 110-127 VAC	RM2-7941-000CN
M507		
E50045		
E50145		
M501	Low-voltage power supply (LVPS) - For 220-240 VAC	RM2-7942-000CN
M506		
M507		
E50045		
E50145		

For instructions: See the Repair Service Manual for this product.

9. If the error persists, replace the DC controller PCA.

Table 6-117 DC Controller part numbers

Printer models	Part description	Part number
M501dn/ M501n	DC controller PCA	RM2-8711-030CN
M506	For duplex models - DC controller PC board assembly (PCA)	RM2-8612-000CN
M527		
E52545		
M506	For simplex models - DC controller PC board (PCA)	RM2-8614-000CN
E50045		
M507	For duplex models - DC controller PC board assembly (PCA)	RM3-7475-010CN
M528		
E52645		
M507	For simplex models - DC controller PC board assembly (PCA)	RM3-7476-000CN
E50145		

For instructions: See the Repair Service Manual for this product.

51.XX.YZ, 52.XX.YZ error messages

51.* errors

Errors in the 51.* family are related to the laser scanner.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Ensure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Check all connections on the laser/scanner and from the laser/scanner to the DC controller, and reseal them if necessary.
3. If the error persists, replace the laser scanner.

51.00.10

Laser/scanner error.

Laser/scanner beam detect error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Reconnect connector (J811/J851) on the laser/scanner.
2. Reconnect connectors (J161) on the DC controller.

3. If the error persists, replace the laser/scanner.

For instructions: See the Repair Service Manual for this product.

Part number: RM2-5528-000CN

52.* errors

Errors in the 52.* family are related to the laser scanner.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Ensure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Check all connections on the laser/scanner and from the laser/scanner to the DC controller, and reseal them if necessary.
3. If the error persists, replace the laser scanner.

52.XX.00

Laser/scanner error.

- XX = 00

laser/scanner motor startup error.

- XX = 20

Laser/scanner rotation error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Upgrade the firmware.

For the latest firmware versions, go to [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Reconnect connector (J802) on the laser/scanner.
2. Reconnect connectors (J162) on the DC controller.
3. Use the scanner motor (M3) drive test in the [Component Tests](#) to verify that the scanner motor is functioning correctly. If it is not, replace the laser/scanner.



NOTE: Listen for a high pitched whine from the motor.

4. If the error persists, replace the laser/scanner.

For instructions: See the Repair Service Manual for this product.

Part number: RM2-5528-000CN

53.WX.YZ Error Messages

53.B0.0z

Tray "Z" feed roller nearing end of life.

Prepare to replace tray pick rollers



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B0.01:** Tray 1 feed roller nearing end of life.
- **53.B0.02:** Tray 2 feed roller nearing end of life.
- **53.B0.03:** Tray 3 feed roller nearing end of life.
- **53.B0.04:** Tray 4 feed roller nearing end of life.
- **53.B0.05:** Tray 5 feed roller nearing end of life.
- **53.B0.06:** Tray 6 feed roller nearing end of life.

Recommended action

Follow these troubleshooting steps in the order presented.

- The paper tray rollers will need to be replaced soon. Be prepared to replace the tray rollers for the specified tray.

 **NOTE:** Check the event log for the following messages to determine which tray rollers need to be changed.

- **53.B0.01:** Tray 1 feed roller nearing end of life.
- **53.B0.02:** Tray 2 feed roller nearing end of life.
- **53.B0.03:** Tray 3 feed roller nearing end of life.
- **53.B0.04:** Tray 4 feed roller nearing end of life.
- **53.B0.05:** Tray 5 feed roller nearing end of life.
- **53.B0.06:** Tray 6 feed roller nearing end of life.

53.B1.0z

Tray "Z" feed roller at end of life.

 **NOTE:** This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B1.01:** Tray 1 feed roller at end of life.
- **53.B1.02:** Tray 2 feed roller at end of life.
- **53.B1.03:** Tray 3 feed roller at end of life.
- **53.B1.04:** Tray 4 feed roller at end of life.
- **53.B1.05:** Tray 5 feed roller at end of life.
- **53.B1.06:** Tray 6 feed roller at end of life.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

- Replace the feed and separation rollers for the specified tray.

53.B2.0z

Tray "Z" feed roller brand new.

 **NOTE:** This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B2.01:** Tray 1 feed roller brand new.
- **53.B2.02:** Tray 2 feed roller brand new.
- **53.B2.03:** Tray 3 feed roller brand new.
- **53.B2.04:** Tray 4 feed roller brand new.
- **53.B2.05:** Tray 5 feed roller brand new.
- **53.B2.06:** Tray 6 feed roller brand new.

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.B3.0z

Tray "Z" pick roller brand new (engine detected).

The engine detected that new tray feed rollers have been installed.



NOTE: This is an event log only message, it will not show on the control panel.

"Z" = Tray number.

- **53.B3.01:** Tray 1 feed roller brand new (engine detected).
- **53.B3.02:** Tray 2 feed roller brand new (engine detected).
- **53.B3.03:** Tray 3 feed roller brand new (engine detected).
- **53.B3.04:** Tray 4 feed roller brand new (engine detected).
- **53.B3.05:** Tray 5 feed roller brand new (engine detected).
- **53.B3.06:** Tray 6 feed roller brand new (engine detected).

Recommended action

No Action necessary.

- This is an informational message; no action is necessary.

53.C1.0z Tray "Z" size mismatch.

The specified tray contains a size that does not match the configured size.

Complete screen message:

The specified tray contains a size that does not match the configured size.

The tray is configured to support the only size indicated

Confirm guides are in correct position.

This issue occurs when the managed print provider has locked the paper tray to either letter or A4 and the tray has a different size paper loaded.



NOTE: This can occur if the tray was swapped out or the physical trays locks in the tray were removed and the guides changed.

- **53.C1.02:** Tray 2 size mismatch.
- **53.C1.03:** Tray 3 size mismatch.
- **53.C1.04:** Tray 4 size mismatch.
- **53.C1.05:** Tray 5 size mismatch.
- **53.C1.06:** Tray 6 size mismatch.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Ensure that the paper size in the tray matches the tray size in the [Trays](#) menu.
2. Contact your managed print provider if you need to change the paper size from the one selected.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Ask the customer to check the media size loaded in the tray to see if it matches the size listed in the [Trays](#) menu or on the Configuration Page.
2. Instruct the customer to contact the managed print provider if the paper size needs to be changed from the one selected.

54.XX.YZ error messages

54.* errors

Errors in the 54.* family are related to the image-formation system.

- For HP LaserJet printers, they can indicate a problem with the toner cartridges or the transfer unit (color printers only), or they can indicate a problem with a sensor, such as with the laser/scanner.
- For HP PageWide printers, they can indicate a problem with the calibration process.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Check the supplies status page using the [Supplies](#) menu on the control panel to verify that toner cartridges, toner collection unit (TCU), or the transfer belt kit are not past their useful life. Replace the supplies and maintenance parts as necessary.

To print a Supplies Status Page:

- a. From the Home screen on the printer control panel, select [Administration](#).
- b. Open the following menus:
 - i. [Reports](#)
 - ii. [Configuration/Status Pages](#)
- c. Scroll to and select [Supplies Status Page](#).
- d. Select [Print](#) to print the page.

To order parts, go to <https://www.hp.com/buy/parts>.

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check the supplies status page to verify that the toner cartridges, TCU, or the transfer belt kit are not past their useful life. Replace the supplies and maintenance parts as necessary.
3. For color printers, inspect the transfer belt for damage. Replace the transfer belt if necessary or instruct the customer to replace it.
4. For color printers, if the error persists, replace the registration assembly.
5. Check the connections between the laser/scanner and the DC controller, and from the laser/scanner to the printer. Reseat them if necessary. If the error persists, replace the laser scanner.

54.06.21 error

A sensor error has occurred.

Primary laser/scanner beam detect abnormality.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the printer has had parts removed or replaced, check the connectors (J161 and J162) on the DC controller PCA.
3. If the error persists, replace the laser/scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: RM2-5528-000CN

55.XX.YZ, 56.XX.YZ error messages

55.* errors

Errors in the 55.* family often indicate a problem with the DC controller.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Reset the printer:
 - a. Turn the printer off using the power switch, and then wait at least 30 seconds.
 - b. Turn the printer on and wait for it to initialize.
2. Make sure the printer is running the most current version of firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, replace the DC controller.

55.00.yy To continue turn off then on

DC controller PCA error.

- **55.00.01** (event code)

DC controller memory error.

- **55.00.03** (event code)

DC controller no engine response.

- **55.00.04** (event code

DC controller communications time-out.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Reset the printer.
 - a. Press the power button to turn off the printer, and then wait at least 30 seconds.
 - b. Press the power button to turn on the printer, and then wait for the printer to initialize.
2. If you are using a surge protector, turn off the printer, and then unplug the power cord from the surge protector.
3. Plug the power cord of the printer directly into the wall outlet, and then turn on the printer.
4. If the error persists, test the power source with another power cord or a working power outlet.
 - If the error persists, try a different power cord, if available. Plug the power cord to the printer and to the wall outlet.



NOTE: Use a power cord with the same connector and power specifications as your printer power cord.

- If the error persists, try to plug the power cord to a working wall outlet.
5. If the issue persists, print an engine test page to verify the printer engine is functioning.
 - a. Load paper in Tray 2.




NOTE: The test page can only use Tray 2 as the paper source, so make sure that paper is loaded in Tray 2.

- b. Turn the printer on, and then use a small pointed object (like a paper clip) to depress the test-page switch located on the rear side of the printer (near the formatter).

The test page should have a series of lines that are parallel to the short end of the page.

Figure 6-84 Engine test-page switch

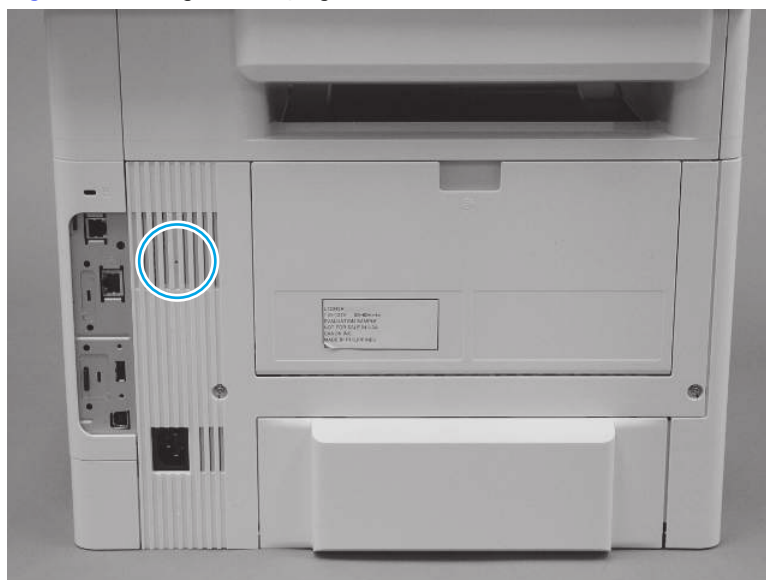

For more information and instructions to perform an engine test, go to WISE and search for the following document: HP LaserJet Pro M501, M506, MFP M527, HP LaserJet Managed E50045, E52545 - Tools for troubleshooting: Engine diagnostics (c04794694).

6. If the engine test page does not print, replace the DC controller PCA.

 **NOTE:** Make sure to have a service technician check the connections at the DC controller PCA.

Table 6-118 DC Controller part numbers

Printer models	Part description	Part number
M501dn/ M501n	DC controller PCA	RM2-8711-030CN
M506	For duplex models - DC controller PC board assembly (PCA)	RM2-8612-000CN
M527		
E52545		
M506	For simplex models - DC controller PC board (PCA)	RM2-8614-000CN
E50045		
M507	For duplex models - DC controller PC board assembly (PCA)	RM3-7475-010CN
M528		
E52645		
M507	For simplex models - DC controller PC board assembly (PCA)	RM3-7476-000CN
E50145		

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Reset the printer.
 - a. Press the power button to turn off the printer, and then wait at least 30 seconds.
 - b. Press the power button to turn on the printer, and then wait for the printer to initialize.
2. If you are using a surge protector, turn off the printer, and then unplug the power cord from the surge protector.
3. Plug the power cord of the printer directly into the wall outlet, and then turn on the printer.
4. If the error persists, test the power source with another power cord or a working power outlet.
 - If the error persists, try a different power cord, if available. Plug the power cord to the printer and to the wall outlet.



NOTE: Use a power cord with the same connector and power specifications as your printer power cord.

- If the error persists, try to plug the power cord to a working wall outlet.
5. If the issue persists, print an engine test page to verify the printer engine is functioning.
 - a. Load paper in Tray 2.




NOTE: The test page can only use Tray 2 as the paper source, so make sure that paper is loaded in Tray 2.

- b. Turn the printer on, and then use a small pointed object (like a paper clip) to depress the test-page switch located on the rear side of the printer (near the formatter).

The test page should have a series of lines that are parallel to the short end of the page.

Figure 6-85 Engine test-page switch

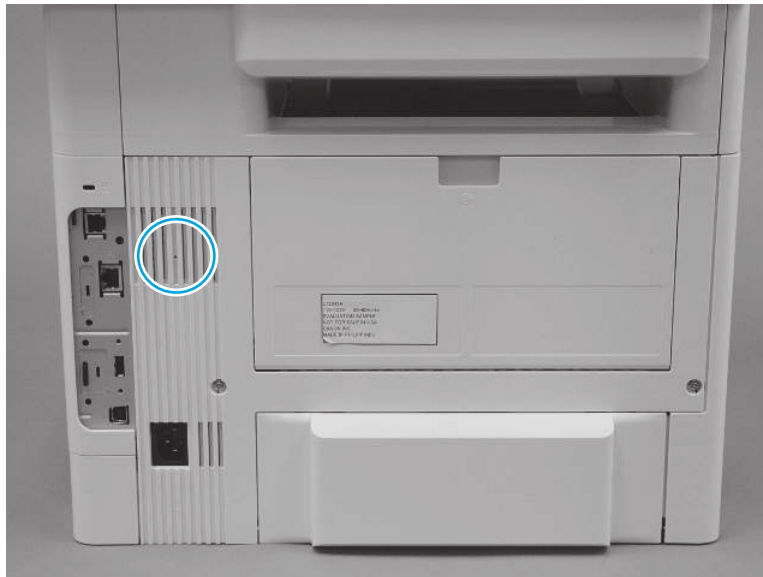

For more information and instructions to perform an engine test, go to WISE and search for the following document: HP LaserJet Pro M501, M506, MFP M527, HP LaserJet Managed E50045, E52545 - Tools for troubleshooting: Engine diagnostics (c04794694).

6. Check and reseal the connections in the DC Controller.



IMPORTANT: Ensure all cable connections on the DC controller are securely and attached correctly before replacing any part.

7. If the engine test page does not print, replace the DC controller PCA.

Table 6-119 DC Controller part numbers

Printer models	Part description	Part number
M501dn/ M501n	DC controller PCA	RM2-8711-030CN
M506 M527 E52545	For duplex models - DC controller PC board assembly (PCA)	RM2-8612-000CN
M506 E50045	For simplex models - DC controller PC board (PCA)	RM2-8614-000CN
M507 M528 E52645	For duplex models - DC controller PC board assembly (PCA)	RM3-7475-010CN
M507 E50145	For simplex models - DC controller PC board assembly (PCA)	RM3-7476-000CN

View the following video on how to replace the DCC controller for HP LaserJet Enterprise MFP M527, M528, Flow MFP M528, and Managed MFP E52645



[How to replace the DCC controller for HP LaserJet Enterprise MFP M527, M528, Flow MFP M528, and Managed MFP E52645](#)

For instructions: See the Repair Service Manual for this product.

55.0x.yy to.continue.off.on

DC controller PCA error.

- **55.01.06** (event code)
NVRAM memory data error warning.
- **55.02.06** (event code)
NVRAM memory access error warning.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Reset the printer.
 - a. Turn off the power by using the power switch, and then wait at least 30 seconds.
 - b. Turn on the power and wait for the product to initialize.
2. If you are using a surge protector:
 - a. Turn the printer power off.
 - b. Remove the surge protector.
 - c. Plug the printer directly into the wall socket and turn the printer power on.
3. If the error persists, try a different power cord if one is available.
4. If the error persists, try a different wall outlet.
5. If the error persists, replace the DC controller PCA.

DC controller (M527) part number: RM2-8612-000CN

DC controller simplex (M506) part number: RM2-8600-000CN

DC controller duplex (M506) part number: RM2-8612-000CN

DC controller simplex (M501) part number: RM2-8710-000CN

DC controller duplex (M506) part number: RM2-7950-000CN

For instructions: See the Repair Service Manual for this product.

56.* errors

Errors in the 56.* family indicate a communication problem with an optional paper tray or other external accessory.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. If any third-party hardware is installed, remove it and try printing again.
3. If an optional paper tray is installed, remove it. Check the connectors on the tray for damage. If the connector is damaged, replace the tray.
4. Reinstall the tray, and make sure it is correctly seated.

56.00.yy to.continue.off.on

Optional paper trays communication error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, disconnect the power cable from the printer and wait 1-minute before reconnecting power and turning the printer on.
2. If the error persists, dispatch an Onsite CE to replace the 1x550-sheet paper feeder cassette assembly:

Part Number: F2A72-67901

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, disconnect the power cable from the printer and wait 1-minute before reconnecting power and turning the printer on.
2. If the error persists, remove the optional paper trays (1x550-sheet paper feeder cassette assembly) and check the input connectors for damage. If the connector is damaged on the optional paper feeder tray, replace the optional paper feeder.

Part Number: F2A72-67901

For instructions: Removal and replacement: Lifter drive assembly See the Repair Service Manual for this product.

3. If the connector is damaged on the printer side, replace the fuser power supply assembly (contains the connector to the paper tray assembly).


Part numbers:

Fixing (fuser) power supply (FPS) 110V-127V - RM2-7948-000CN

Fixing (fuser) power supply (FPS) 220V-240V - RM2-7949-000CN

For instructions: See the Repair Service Manual for this product.

4. If the error persists, check, and RESEAT connector J622 on the 1x550-sheet paper feeder controller PC board assembly prior to replacing any parts.

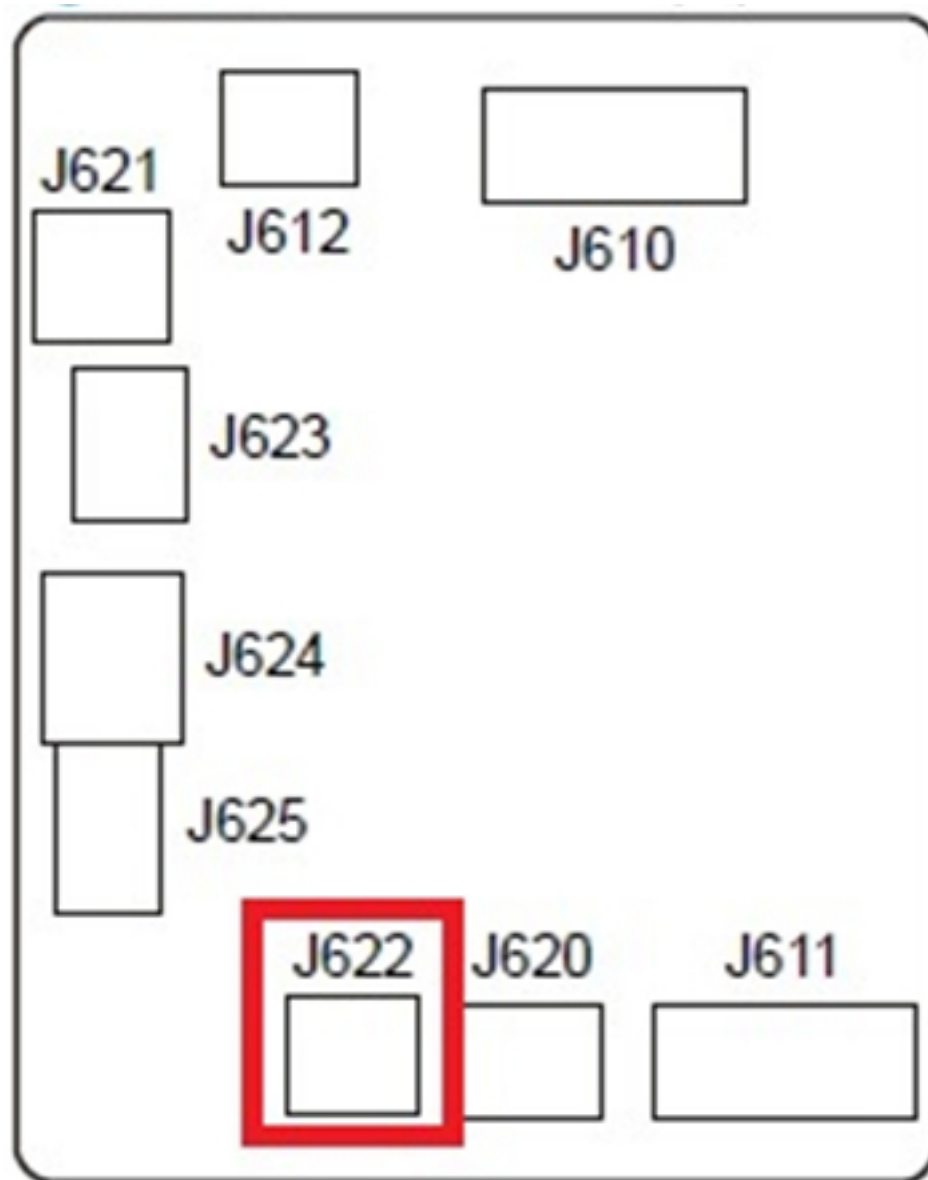

Part Number: F2A72A

For instructions: Removal and replacement: Lifter drive assembly See the Repair Service Manual for this product.

5. If the issue persists after replacing the part, elevate the case using your Region's Elevation Process.

57.XX.YZ error messages

57.* errors

Errors in the 57.* family indicate a problem with a fan.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the Power button on the front of the printer to turn it off, and then wait 10 seconds.
2. Press the Power button again to turn on the printer.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the printer troubleshooting manual to identify the locations of each fan. Turn the printer off and then on, and listen for noise coming from the area of each fan. Replace any fan that is not making noise.
2. Update the firmware to the latest version. If the latest version firmware is already installed, reinstall it now.

For more information, see:

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Remove enough parts to access the DC controller or the power supply PCA. Check the connections from each fan to the DC controller or power supply PCA. Reseat them if necessary.
4. With the DC controller or power supply PCA exposed, turn the printer on. Immediately measure the voltage between the connectors for each fan and the DC controller. If the voltage changes from 0V to approximately 24V during the power-on cycle, replace the affected fan. If the voltage remains at 0V, replace the DC controller.

57.00.01 to.continue.off.on

Main fan (FM1) failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on. Listen for fan noise on the right side of the printer. If no noise is heard, replace the main fan (FM1).

Part number: RK2-8068-000CN
2. If the fan has been removed or replaced, check the connectors (J372 and J341) on the high voltage PCA and (J133) on the DC controller PCA.
3. If the error persists, replace the printer.

57.00.02 to.continue.off.on

Sub fan (FM2) failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then back on. Listen for fan noise coming from the left side of the printer. The fan should turn on approximately 1.5 minutes after power on.
2. If no noise is heard, replace fan FM2.

Part number: RK2-8068-000CN
3. If the fan has been removed or replaced, check connector J661 on the sub fan and J147 on the DC controller.
4. If the error persists, replace the high voltage power supply (HVPS).

Table 6-120 Parts

Part number	Description
RM2-7945-000CN	Power supply, high-voltage (HVPS) (M501/M506/E50045/M527/E52545)
RM3-7424-000CN	Power supply, high-voltage (HVPS) (M507/E50145/M528/E52645)

For instructions: See the Repair Service Manual for this product.

58.XX.YZ error messages

58.* errors

Errors in the 58.* family indicate an electrical problem inside the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. Check all connections on the DC Controller and the power supply. Trace the connections from the DC Controller and power supply to the sensors and other components and reseal them if necessary.

58.00.03 Error

DC controller CPU failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Check and reseal all the connectors on the DC controller PCA.



IMPORTANT: Ensure that all the cable connections on the DC controller are secure and connected correctly before replacing any part.

3. If you are using a surge protector, turn off the printer, and then unplug the power cord from the surge protector.
4. Plug the power cord of the printer directly into the wall outlet, and then turn on the printer.

5. If the error persists, test the power source with another power cord or a working power outlet.

- If the error persists, try a different power cord, if available. Plug the power cord to the printer and to the wall outlet.

 **NOTE:** Use a power cord with the same connector and power specifications as your printer power cord.

- If the error persists, try to plug the power cord to a working wall outlet.

6. If the issue persists, run an engine test on the printer. Print an engine test page to verify the printer engine is functioning.


- a. Load paper in Tray 2.

 **NOTE:** The test page can only use Tray 2 as the paper source, so make sure that paper is loaded in Tray 2.

- b. Turn the printer on, and then use a small pointed object (like a paper clip) to depress the test-page switch located on the rear side of the printer (near the formatter).

The test page should have a series of lines that are parallel to the short end of the page.

Figure 6-86 Engine test-page switch

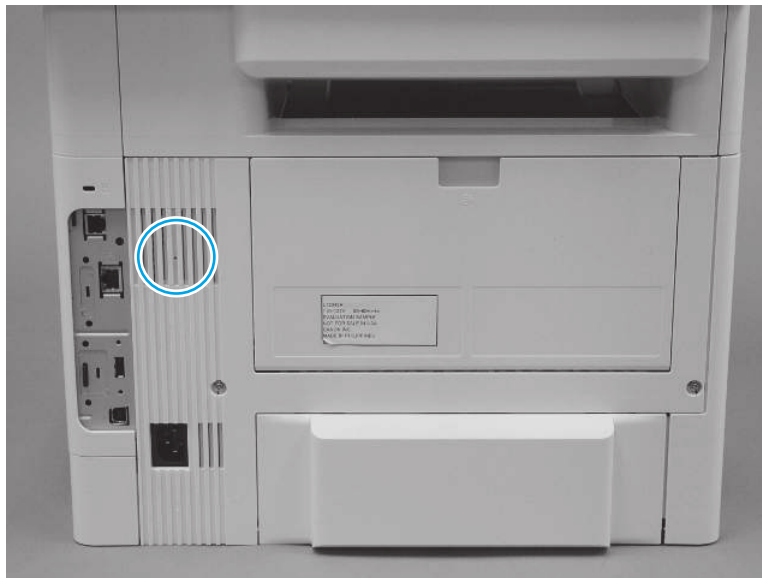

For more information and instructions to perform an engine test, go to WISE and search for the following document: HP LaserJet Pro M501, M506, MFP M527, HP LaserJet Managed E50045, E52545 - Tools for troubleshooting: Engine diagnostics (c04794694).

7. If the engine test page does not print, replace the DC controller PCA.

 **NOTE:** Make sure to have a service technician check the connections at the DC controller PCA.

Table 6-121 DC Controller part numbers

Printer models	Part description	Part number
M501dn/ M501n	DC controller PCA	RM2-8711-030CN

Table 6-121 DC Controller part numbers (continued)

Printer models	Part description	Part number
M506 M527 E52545	For duplex models - DC controller PC board assembly (PCA)	RM2-8612-000CN
M506 E50045	For simplex models - DC controller PC board (PCA)	RM2-8614-000CN
M507 M528 E52645	For duplex models - DC controller PC board assembly (PCA)	RM3-7475-010CN
M507 E50145	For simplex models - DC controller PC board assembly (PCA)	RM3-7476-000CN

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Reset the printer.
 - a. Press the power button to turn off the printer, and then wait at least 30 seconds.
 - b. Press the power button to turn on the printer, and then wait for the printer to initialize.
2. If you are using a surge protector, turn off the printer, and then unplug the power cord from the surge protector.
3. Plug the power cord of the printer directly into the wall outlet, and then turn on the printer.
4. If the error persists, test the power source with another power cord or a working power outlet.
 - If the error persists, try a different power cord, if available. Plug the power cord to the printer and to the wall outlet.
5. If the issue persists, run an engine test on the printer. Print an engine test page to verify the printer engine is functioning.
 - a. Load paper in Tray 2.



NOTE: Use a power cord with the same connector and power specifications as your printer power cord.



• If the error persists, try to plug the power cord to a working wall outlet.




NOTE: The test page can only use Tray 2 as the paper source, so make sure that paper is loaded in Tray 2.

- b. Turn the printer on, and then use a small pointed object (like a paper clip) to depress the test-page switch located on the rear side of the printer (near the formatter).

The test page should have a series of lines that are parallel to the short end of the page.

Figure 6-87 Engine test-page switch

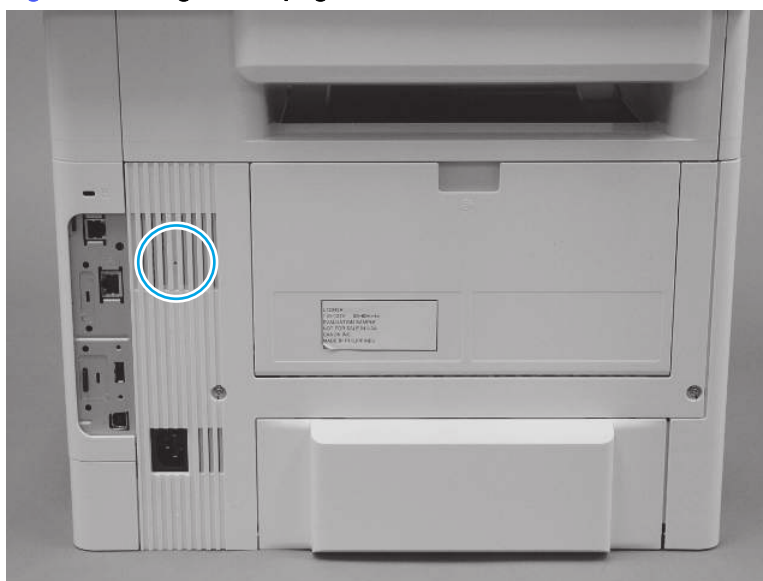

For more information and instructions to perform an engine test, go to WISE and search for the following document: HP LaserJet Pro M501, M506, MFP M527, HP LaserJet Managed E50045, E52545 - Tools for troubleshooting: Engine diagnostics (c04794694).

6. Check and reseal all of the connectors on the DC controller PCA.



IMPORTANT: Ensure all cable connections on the DC controller are securely and connected correctly before replacing any part.

7. If the engine test page does not print, replace the DC controller PCA.

Table 6-122 DC Controller part numbers

Printer models	Part description	Part number
M501dn/ M501n	DC controller PCA	RM2-8711-030CN
M506	For duplex models - DC controller PC board assembly (PCA)	RM2-8612-000CN
M527		
E52545		
M506	For simplex models - DC controller PC board (PCA)	RM2-8614-000CN
E50045		
M507	For duplex models - DC controller PC board assembly (PCA)	RM3-7475-010CN
M528		
E52645		
M507	For simplex models - DC controller PC board assembly (PCA)	RM3-7476-000CN
E50145		

View the following video on how to replace the DCC controller for HP LaserJet Enterprise MFP M527, M528, Flow MFP M528, and Managed MFP E52645



[How to replace the DCC controller for HP LaserJet Enterprise MFP M527, M528, Flow MFP M528, and Managed MFP E52645](#)

For instructions: See the Repair Service Manual for this product.

58.00.04 Error

The printer experienced a low voltage power supply unit malfunction.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. Ensure the printer is connected to a dedicated power outlet.
3. If the error persists, replace the power supply unit.

For instructions: See the Repair Service Manual for this product.

Table 6-123 Parts

Description	
Low-voltage power supply (LVPS) 110V-127V (M527)	RM2-7951-000CN
Low-voltage power supply (LVPS) 220V-240V (M527)	RM2-7952-000CN
Low-voltage power supply (LVPS) 110V-127V (M501/M506)	RM2-7941-000CN
Low-voltage power supply (LVPS) 220V-240V (M501/M506)	RM2-7942-000CN

58.01.04 Error

During regular printing operation the 24V power supply experienced an error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. Ensure the printer is connected to a dedicated power outlet.
3. If the error persists, replace the power supply unit.

For instructions: See the Repair Service Manual for this product.

Table 6-124 Parts

Description	
Low-voltage power supply (LVPS) 110V-127V (M527)	RM2-7951-000CN
Low-voltage power supply (LVPS) 220V-240V (M527)	RM2-7952-000CN
Low-voltage power supply (LVPS) 110V-127V (M501/M506)	RM2-7941-000CN
Low-voltage power supply (LVPS) 220V-240V (M501/M506)	RM2-7942-000CN

58.02.04 Error

During printer power on or when waking from sleep mode, the printer experienced an error with the 24V power supply.



NOTE: Check the voltage of the unit on the regulatory sticker. This event is directly related to a 220V printer being plugged into a 110V outlet. Ensure that the voltage of the outlet matches the voltage of the printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.



NOTE: This error might be caused by source power related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. Ensure the printer is connected to a dedicated power outlet.
3. If the error persists, replace the power supply unit.

For instructions: See the Repair Service Manual for this product.

Table 6-125 Parts

Description	
Low-voltage power supply (LVPS) 110V-127V (M527)	RM2-7951-000CN
Low-voltage power supply (LVPS) 220V-240V (M527)	RM2-7952-000CN
Low-voltage power supply (LVPS) 110V-127V (M501/M506)	RM2-7941-000CN
Low-voltage power supply (LVPS) 220V-240V (M501/M506)	RM2-7942-000CN

59.XX.YZ error messages

59.* errors

Errors in the 59.* family indicate a problem with one of the motors or with the lifter drive assembly for one of the trays.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check all connections on the main control board of the printer, (DC controller, Engine control board ECB), the driver PCA, each motor, and to the paper feeder drive PCA (for an optional paper feeder). Reseat them if necessary.

59.A2.02

Tray 2 lifter drive assembly failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Use the Tray/Bin manual sensor test to verify that the Tray 2 paper surface sensors are functioning correctly.
2. If any parts have been removed or replaced, check the connector (J144) on the on the DC controller PCA.
3. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

59.A2.0X

Tray 3 to 5 lifter drive assembly motor failure.



NOTE: You can determine the tray number from the last digit in the error number.

X = Tray number

59.A2.03 – Tray 3


59.A2.04 – Tray 4

59.A2.05 – Tray 5

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the failing tray and remove all paper from the tray.
2. Ensure that when reloading the paper the top of the stack is below the tray full indicator.

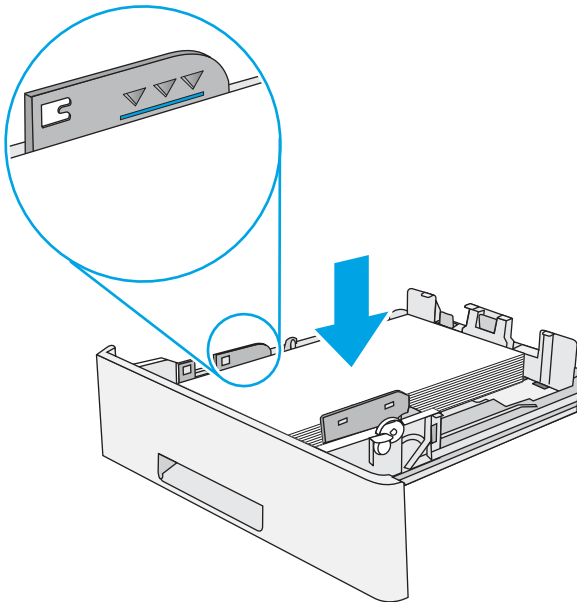


3. If Tray has paper loaded ABOVE the tray full indicator, remove enough paper to get stack BELOW the line. Close tray and test.

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Open the failing tray and remove all paper from the tray.
2. Ensure that when reloading the paper the top of the stack is below the tray full indicator.

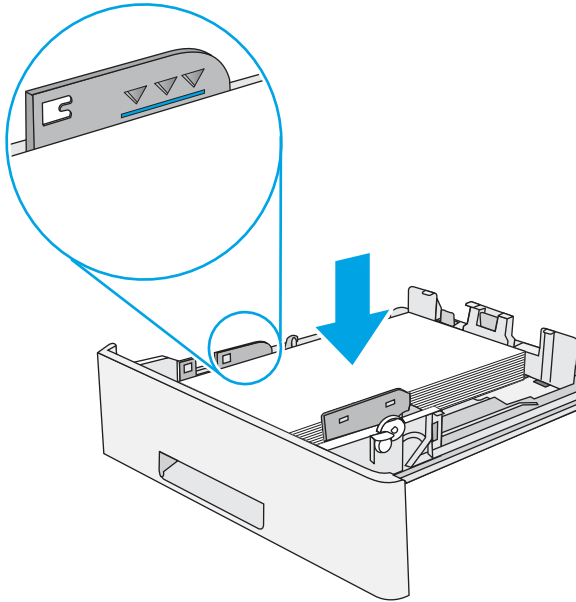

3. If the issue persists when the paper tray is properly loaded, swap the tray cassette with another from the printer that is the same size and check if the error follows the cassette.
4. If the error persists, dispatch an Onsite CE with a new Cassette Tray.


Tray 2-6 Cassette Part Number: RM2-5758-000CN

Recommended action for onsite technicians


Follow these troubleshooting steps in the order presented.

1. Open the failing tray and remove all paper from the tray.

2. Ensure that when reloading the paper the top of the stack is below the tray full indicator.

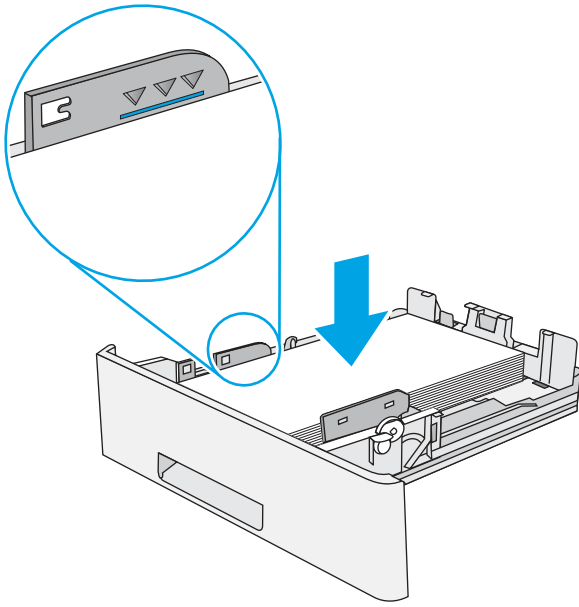

3. If the error persists, check, and RESEAT connector J622 on the 1x550-sheet paper feeder controller PC board assembly prior to replacing any parts.

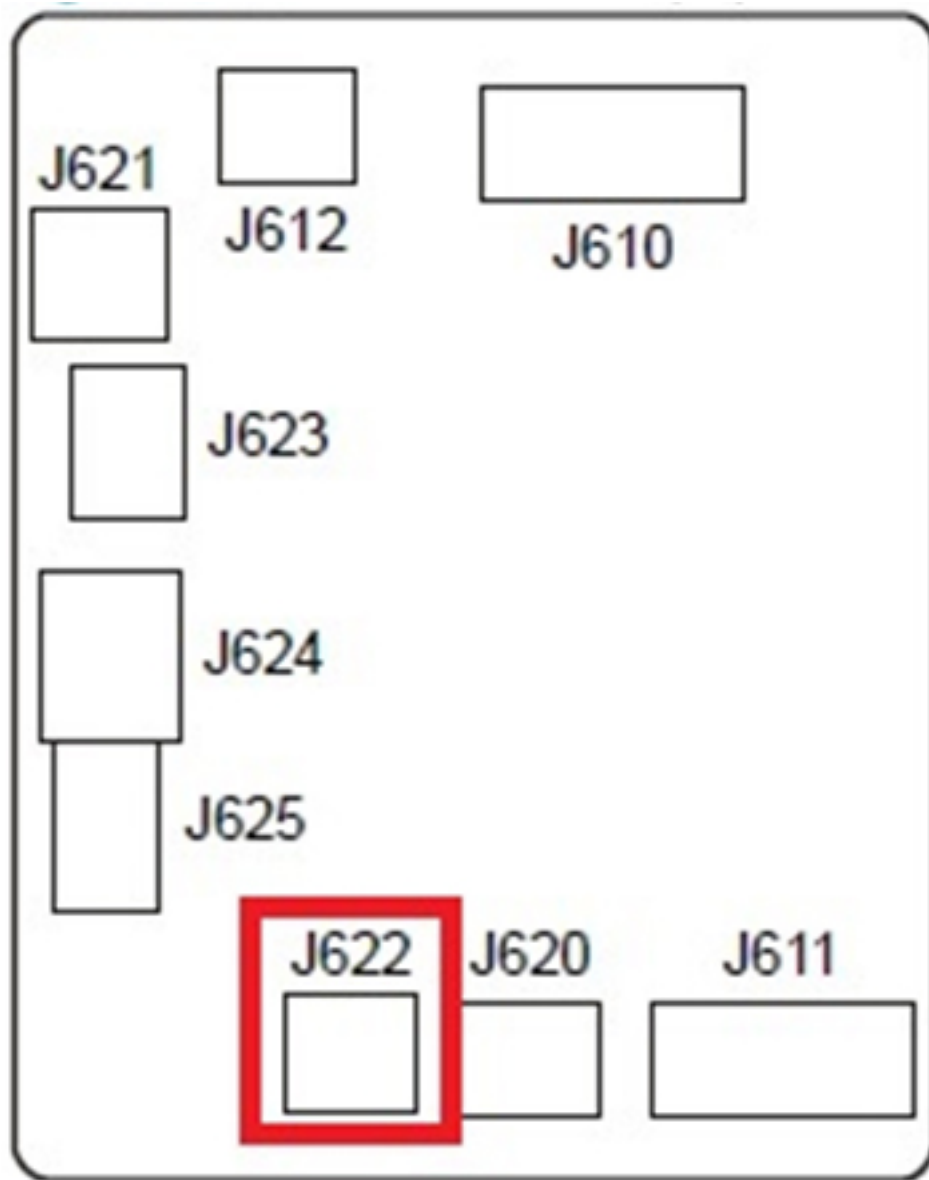

4. If the error goes away, swap the tray from another in the printer. If issue follows the cassette, replace the Tray Cassette:

Part Number: RM2-5758-000CN

For instructions: Removal and replacement: Cassette Tray See the Repair Service Manual for this product.

5. If the issue persists after swapping/replacing the Cassette Tray, replace the 1x550-sheet paper feeder cassette assembly:

Part Number: F2A72-67901

For instructions: Removal and replacement: Cassette Tray See the Repair Service Manual for this product.

6. If the issue persists after replacing the Tray Cassette, or the 1x550 Sheet Feeder Assembly, replace the 1x550-sheet paper feeder controller PC board assembly.

Part Number: RM2-7944-000CN

For instructions: Removal and replacement: Cassette Tray See the Repair Service Manual for this product.

7. If the issue persists after replacing the part, elevate the case using your Region's Elevation Process.

59.00.20 Error – To.continue.off.on

Feed motor (M2) failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Reconnect the connector (J711) on the feed motor and the connector (J171) on the DC controller PCA.
2. Use the feed motor (M2) drive test in the Component test to verify that the motor is functioning correctly.
3. If the feed motor is not functioning or the issue persists, replace the feed motor M2.

59.00.30 – To.continue.off.on

Fuser motor (M1) failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the fuser motor (M1) drive test in the Component test to verify that the motor is functioning correctly. If test fails, replace the fuser.

Table 6-126 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

See the Repair Service Manual for this product.

2. If the motor has been removed or replaced, check connector J712 on the fuser motor M1 and connector J146 on the DC controller.
3. If the error persists, replace the fuser motor M1.

Part number: RM2-8684-000CN

For instructions: See the Repair Service Manual for this product.

59.00.40 – To.continue.off.on

Fuser motor (M1) failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Use the fuser motor (M1) drive test in the Component test to verify that the motor is functioning correctly. If test fails, replace the fuser.

Table 6-127 Part numbers

Part Name	Part Number
Fuser assembly 110V-127V (M501/M506/E50045/M527/E52545)	RM2-5679-000CN
Fuser assembly 110V-127V (M507/E50145/M528/E52645)	RM2-2585-000CN
Fuser assembly 220-240V (M501/M506/E50045/M527/E52545)	RM2-5692-000CN
Fuser assembly 220-240V (M507/E50145/M528/E52645)	RM2-2586-000CN

See the Repair Service Manual for this product.

2. If the motor has been removed or replaced, check connector J712 on the fuser motor M1 and connector J146 on the DC controller.
3. If the error persists, replace the fuser motor M1.

Part number: RM2-8684-000CN

For instructions: See the Repair Service Manual for this product.

60.00.0Y, 62.00.00 error messages

60 . 00 . 0x Tray X lifting error

A tray lifting error has occurred.

60.00.02: Tray 2

60.00.03: Tray 3

60.00.04: Tray 4

60.00.05: Tray 5



NOTE: You can determine the tray number from the last digit in the error number.

For example:


- 60.00.02 or 60.01.02 = Tray 2
 - 60.00.03 or 60.01.03 = Tray 3
-

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the failing tray and remove all paper from the tray.

2. Ensure that when reloading the paper the top of the stack is below the tray full indicator.

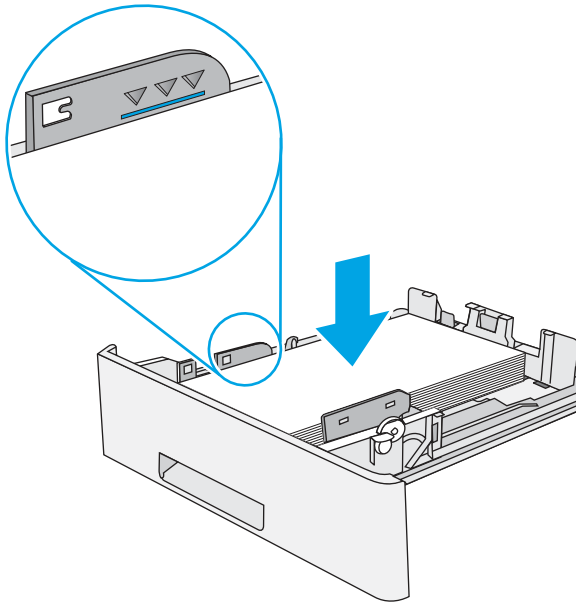


3. If Tray has paper loaded ABOVE the tray full indicator, remove enough paper to get stack BELOW the line. Close tray and test.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Open the failing tray and remove all paper from the tray.
2. Ensure that when reloading the paper the top of the stack is below the tray full indicator.

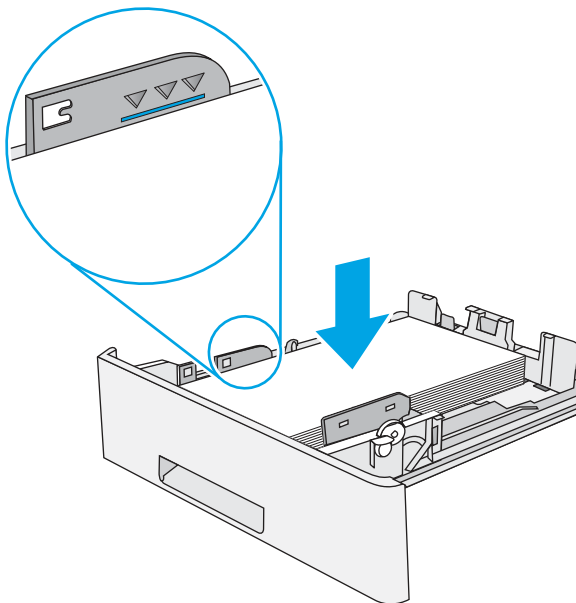


3. If the issue persists when the paper tray is properly loaded, swap the tray cassette with another from the printer that is the same size and check if the error follows the cassette.
4. If the error persists, dispatch an Onsite CE with a new Cassette Tray.

Tray 2-6 Cassette Part Number: RM2-5758-000CN


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the failing tray and remove all paper from the tray.
2. Ensure that when reloading the paper the top of the stack is below the tray full indicator.

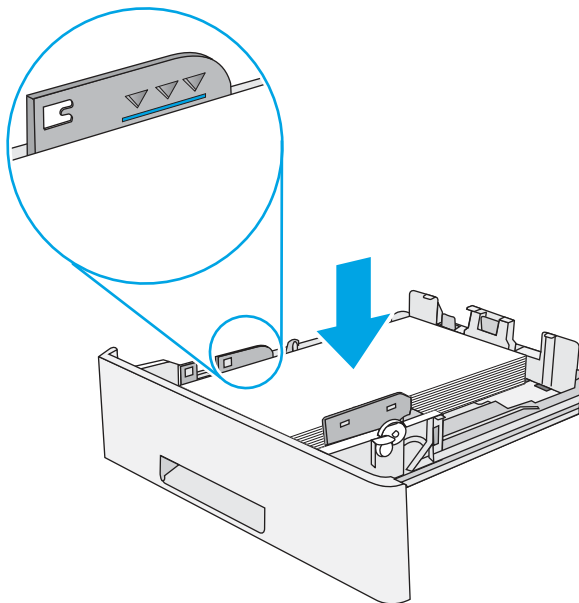

3. If the error persists, check, and RESEAT connector J622 on the 1x550-sheet paper feeder controller PC board assembly prior to replacing any parts.

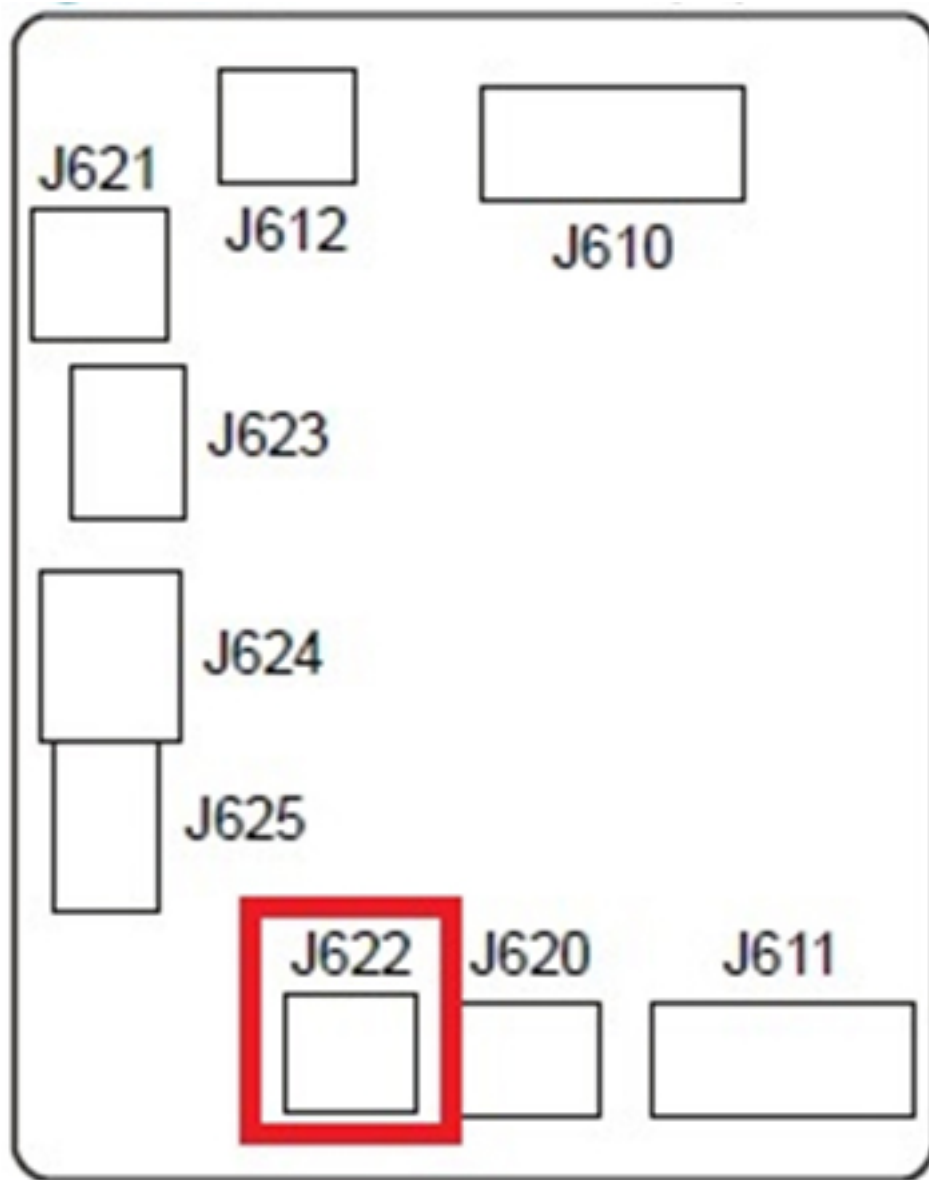

4. If the error goes away, swap the tray from another in the printer. If issue follows the cassette, replace the Tray Cassette:
Part Number: RM2-5758-000CN
For instructions: Removal and replacement: Cassette Tray See the Repair Service Manual for this product.
5. If the issue persists after swapping/replacing the Cassette Tray, replace the lifter drive assembly:
Part Number: RM2-5715-000CN
For instructions: Removal and replacement: See the Repair Service Manual for this product.

6. If the issue is occurring on an Accessory Tray (Trays 3-6) and the Cassette Tray has been ruled out, replace the 1x550-sheet paper feeder cassette assembly -

Part Number:F2A72-67901

For instructions: Removal and replacement: Cassette Tray See the Repair Service Manual for this product.

7. If the persists after replacing the Lifter Drive Assembly, Tray Cassette, or the 1x550 Sheet Feeder Assembly, 1x550 Sheet Feeder Assembly, replace the 1x550-sheet paper feeder controller PC board assembly.

Part Number: RM2-7944-000CN

For instructions: Removal and replacement: See the Repair Service Manual for this product.

8. If the issue persists after replacing the part, elevate the case using your Region's Elevation Process.

60 . 01 . 0x Tray X lifting error

A tray lifting error has occurred.

60.01.02: Tray 2

60.01.03: Tray 3

60.01.04: Tray 4

60.01.05: Tray 5



NOTE: You can determine the tray number from the last digit in the error number.

For example:


- 60.00.02 or 60.01.02 = Tray 2
 - 60.00.03 or 60.01.03 = Tray 3
-

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Open the failing tray and remove all paper from the tray.

2. Ensure that when reloading the paper the top of the stack is below the tray full indicator.

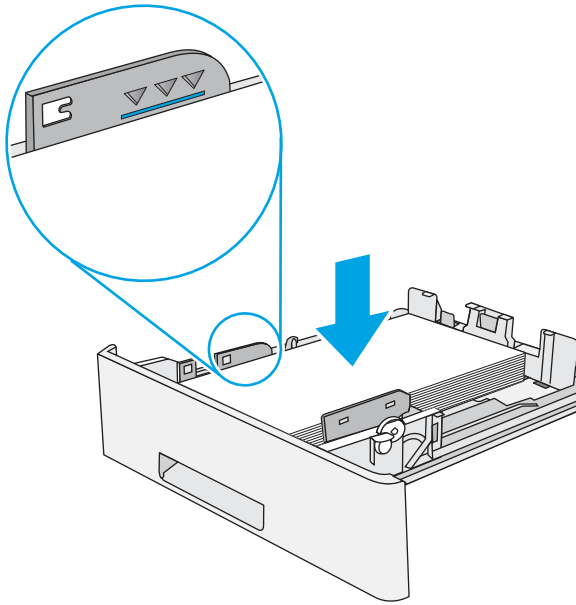


3. If Tray has paper loaded ABOVE the tray full indicator, remove enough paper to get stack BELOW the line. Close tray and test.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Open the failing tray and remove all paper from the tray.
2. Ensure that when reloading the paper the top of the stack is below the tray full indicator.

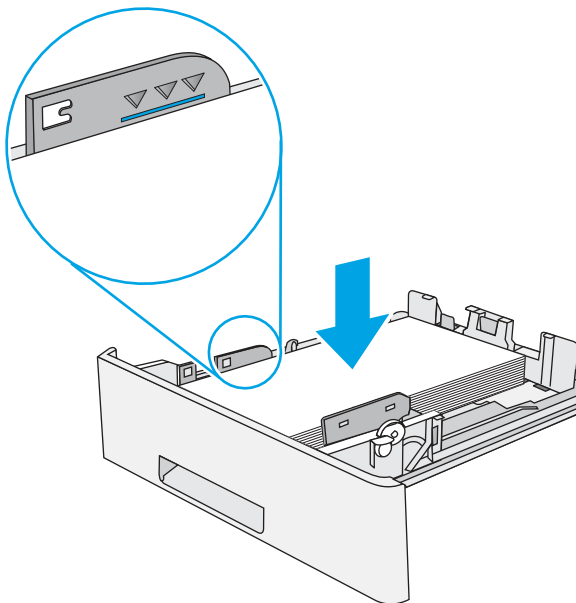


3. If the issue persists when the paper tray is properly loaded, swap the tray cassette with another from the printer that is the same size and check if the error follows the cassette.
4. If the error persists, dispatch an Onsite CE with a new Cassette Tray.

Tray 2-6 Cassette Part Number: RM2-5758-000CN


Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Open the failing tray and remove all paper from the tray.
2. Ensure that when reloading the paper the top of the stack is below the tray full indicator.

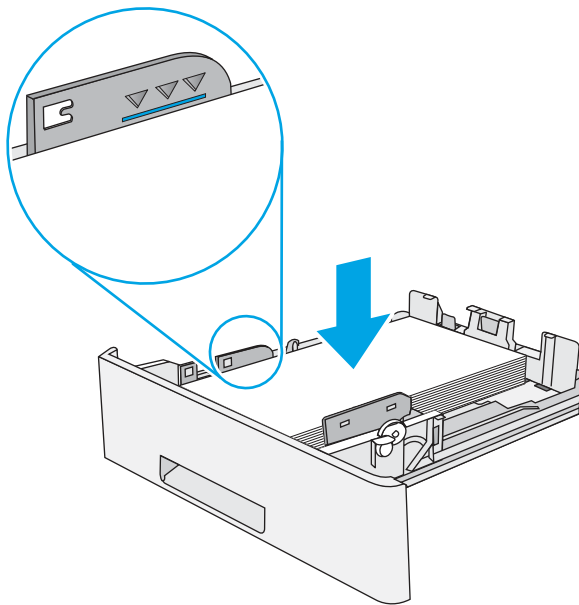

3. If the error persists, check, and RESEAT connector J622 on the 1x550-sheet paper feeder controller PC board assembly prior to replacing any parts.

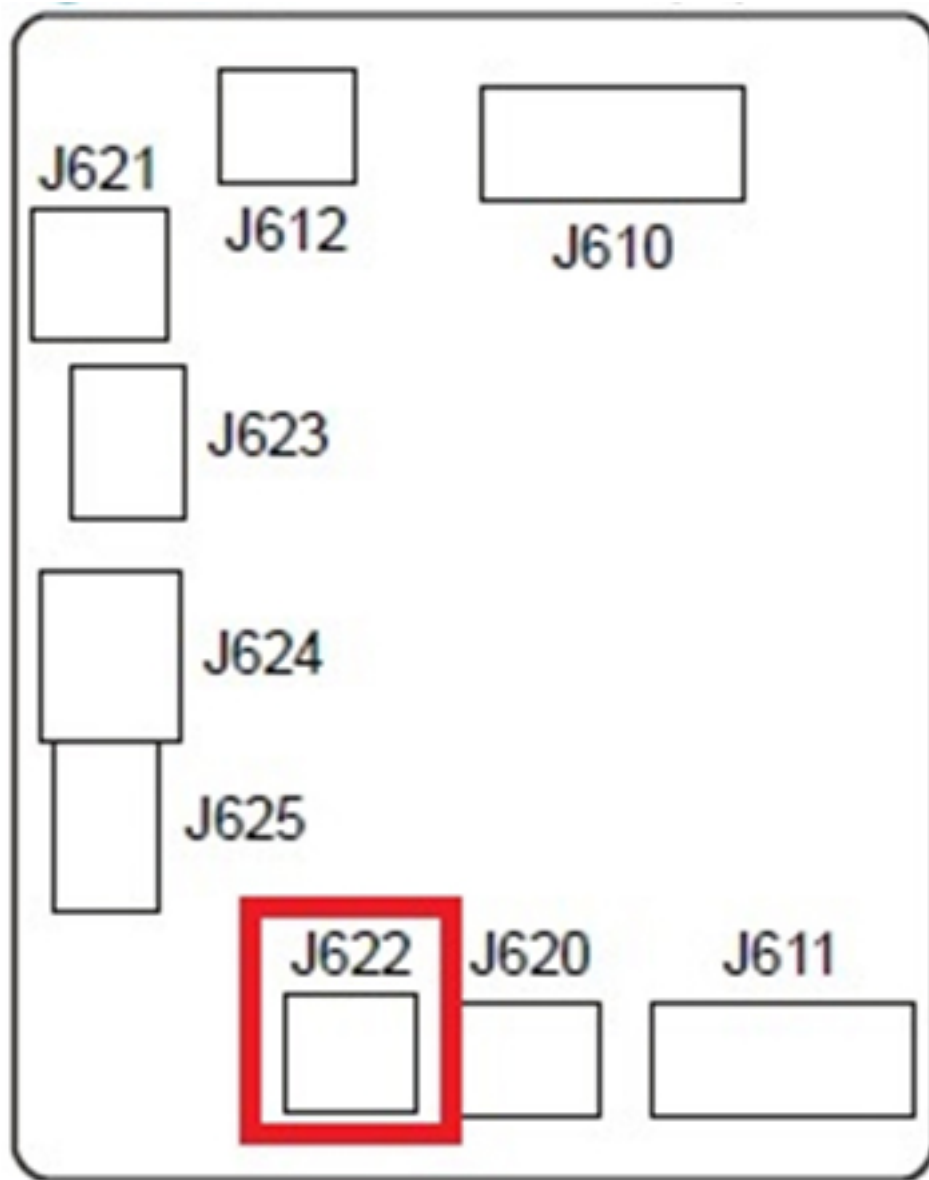

4. If the error goes away, swap the tray from another in the printer. If issue follows the cassette, replace the Tray Cassette:
Part Number: RM2-5758-000CN
For instructions: Removal and replacement: Cassette Tray See the Repair Service Manual for this product.
5. If the issue persists after swapping/replacing the Cassette Tray, replace the lifter drive assembly:
Part Number: RM2-5715-000CN
For instructions: Removal and replacement: See the Repair Service Manual for this product.

6. If the issue is occurring on an Accessory Tray (Trays 3-6) and the Cassette Tray has been ruled out, replace the 1x550-sheet paper feeder cassette assembly -

Part Number:F2A72-67901

For instructions: Removal and replacement: Cassette Tray See the Repair Service Manual for this product.

7. If the persists after replacing the Lifter Drive Assembly, Tray Cassette, or the 1x550 Sheet Feeder Assembly, 1x550 Sheet Feeder Assembly, replace the 1x550-sheet paper feeder controller PC board assembly.

Part Number: RM2-7944-000CN

For instructions: Removal and replacement: See the Repair Service Manual for this product.

8. If the issue persists after replacing the part, elevate the case using your Region's Elevation Process.

62 . 00 . 00 To continue turn off then on.

Internal system failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, reload the firmware. If the error still persists, perform a firmware upgrade.
3. If the firmware upgrade does not resolve the problem, replace the hard disk.



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-128 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above

For instructions: See the Repair Service Manual for this product..

65.X0.AZ error messages

65.* errors

Errors in the 65.* family are related to output accessories.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Verify the output accessory is correctly connected to the printer.
3. If the error persists, replace the output accessory.

65 . 80 . A0, 65 . 80 . A1: Output accessory Failure

Output accessory disconnected.

An external paper handling accessory connection has been interrupted.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Make sure that the communication cable from the finisher to the engine is installed correctly.
3. Make sure that all packing materials have been removed from the paper handling accessory.
4. Check the paper path for obstructions, or jammed paper.
5. Turn the printer on. If the error persists, replace the stapler/stacker assembly.

Part Number: B5L46-60102

66.WX.YZ error messages

66.* errors

Errors in the 66.* family are related to output accessories.

Recommended action

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Verify the output accessory is correctly connected to the printer.
3. If the error persists, replace the output accessory.

66.00.20

This message is related to an output device failure.

Over current error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Make sure that the finisher is connected correctly.
3. If the error persists, replace the stapler/stacker assembly.

Part Number: B5L46-60102

66.00.40

This is a finisher control board NVRAM error.

The checksum for the finisher stacker controller PCA has an error when the power is turned on.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Make sure that the finisher is connected correctly.
3. If the error persists, replace the stapler/stacker assembly.

Part Number: B5L46-60102

66.00.50

This is a CAN-CPU sequence error.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Make sure that the finisher is connected correctly.
3. If the error persists, replace the stapler/stacker assembly.

Part Number: B5L46-60102

66.00.77

This is a device communication error.

The communication between the print engine and the finisher has been interrupted or lost.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Make sure that the finisher is connected correctly.
3. If the error persists, replace the stapler/stacker assembly.

Part Number: B5L46-60102

66.00.79

This is a JetLink communication error.

The printer has lost JetLink communication with the output device.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then disconnect the finisher.
2. Inspect and reconnect the JetLink cable (power and communication cable) from the finisher to the printer.
3. Reconnect the finisher to the printer.
4. Turn the printer on.
5. If the error persists, replace the stacker controller PCA or the stapler/stacker assembly.

Stapler/stacker part number: B5L46-60102

66.80.yy Stapler/Stacker failure

An external paper handling accessory error has occurred.

- **66.80.01** (event code)
Y-align malfunction
- **66.80.02** (event code)
Jogger malfunction
- **66.80.03** (event code)
Stapler malfunction
- **66.80.21** (event code)
Lift up malfunction

- **66.80.22** (event code)
Lift down malfunction
- **66.80.23** (event code)
Lift sensor malfunction
- **66.80.33** (event code)
Output roller malfunction
- **66.80.35** (event code)
Self priming malfunction
- **66.80.51** (event code)
System error (FW error)
- **66.80.55** (event code)
System error 5 (FW error)
- **66.80.56** (event code)
System error 6 (FW error)
- **66.80.57** (event code)
System error 7 (FW error)
- **66.80.58** (event code)
System error 8 (FW error)
- **66.80.59** (event code)
System error 9 (FW error)
- **66.80.60** (event code)
System error 10 (FW error)
- **66.80.61** (event code)
System error 11 (FW error)
- **66.80.62** (event code)
System error 12 (FW error)
- **66.80.63** (event code)
System error 13 (FW error)
- **66.80.64** (event code)
System error 14 (FW error)
- **66.80.65** (event code)

System error 15 (FW error)

- **66.80.70** (event code)
Page-info in flush
- **66.80.71** (event code)
Flush request in PDLV
- **66.80.72** (event code)
Delivery notice error
- **66.80.73** (event code)
Flush request in checking paper path
- **66.80.74** (event code)
Checking paper path start in PDLV
- **66.80.75** (event code)
Flush request in flush
- **66.80.76** (event code)
Non-flush complete

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn off the printer, and then disconnect the finisher.
2. Inspect and reconnect the JetLink cable (power and communication cable) from the finisher to the printer.
3. Inspect the finisher for paper jams.
4. Reconnect the finisher to the printer.
5. Turn the printer on.
6. If the error persists, replace the stapler/stacker assembly.

Part Number: B5L46-60102

70.XX.YY error messages

70.* errors

Messages in the 70.* family indicate a problem with the DC controller or Formatter (ECB) depending on your printer.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Replace the DC controller or the Formatter as needed.

70 . 00 . 00 Error To continue turn off then on

DC controller failure.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, replace the DC controller.

Table 6-129 DC Controller part numbers

Printer models	Part description	Part number
M501dn/ M501n	DC controller PCA	RM2-8711-030CN
M506	For duplex models - DC controller PC board assembly (PCA)	RM2-8612-000CN
M527		
E52545		

Table 6-129 DC Controller part numbers (continued)

Printer models	Part description	Part number
M506 E50045	For simplex models - DC controller PC board (PCA)	RM2-8614-000CN
M507 M528 E52645	For duplex models - DC controller PC board assembly (PCA)	RM3-7475-010CN
M507 E50145	For simplex models - DC controller PC board assembly (PCA)	RM3-7476-000CN

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Print an engine test page to verify the printer engine is functioning.
 - a. Load paper in Tray 2.




NOTE: The test page can only use Tray 2 as the paper source, so make sure that paper is loaded in Tray 2.

- b. Turn on the printer, and then use a small pointed object (like a paper clip) to depress the test-page switch located on the rear side of the printer (near the formatter).

The test page should have a series of lines that are parallel to the short end of the page.

Figure 6-88 Engine test-page switch

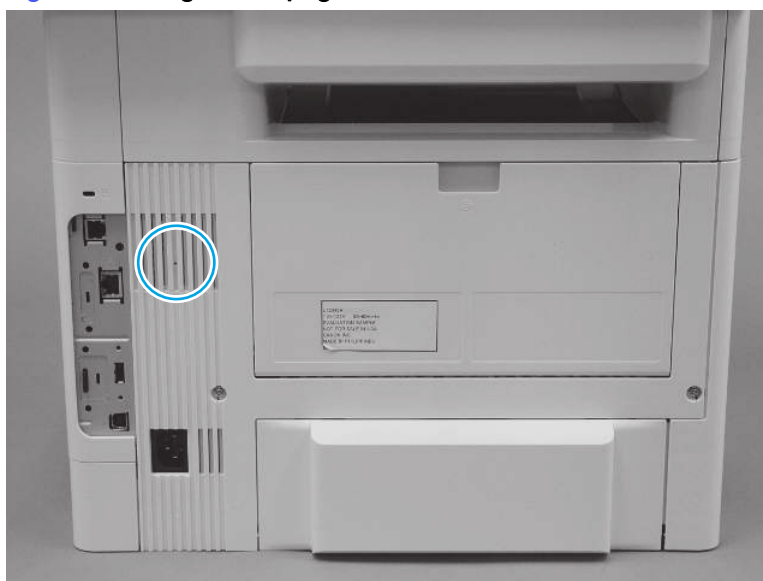

3. If the engine test page prints or does not print, verify that all the connections on the DCC are seated correctly.



NOTE: Ensure all cable connections on the DC controller are secure and connected correctly before replacing any part.

4. If the error persists, replace the DC controller.

Table 6-130 DC Controller part numbers

Printer models	Part description	Part number
M501dn/ M501n	DC controller PCA	RM2-8711-030CN
M506 M527 E52545	For duplex models - DC controller PC board assembly (PCA)	RM2-8612-000CN
M506 E50045	For simplex models - DC controller PC board (PCA)	RM2-8614-000CN
M507 M528 E52645	For duplex models - DC controller PC board assembly (PCA)	RM3-7475-010CN
M507 E50145	For simplex models - DC controller PC board assembly (PCA)	RM3-7476-000CN

For instructions: See the Repair Service Manual for this product.

5. If the error persists after replacing the DC controller, elevate the case using the Standard Support Process.

80.XX.YY, 81.XX.YY, 82.XX.YY error messages

80.* errors

Errors in the 80.* family indicate a problem with an external I/O device, such as a Jetdirect card, an EIO card, or an external hard disk.

- **80.00.00 error:** Managed device lost connection to service provider. The product is under a service contract and has lost network connectivity for license validation.
- **80.01.01 error:** HP Accessibility Assistant connection error. Managed device is unable to establish a connection with the HP Accessibility Assistant.
- **80.01.02 error:** Managed Device Unknown HP Accessibility Assistant error.
- **80.01.03 error:** HP Accessibility Assistant connection lost. The product lost communication with the HP Accessibility Assistant.
- **80.01.04 error:** HP Accessibility Assistant disconnected. The HP Accessibility Assistant was disconnected from the product.

- **80.01.05 error:** HP Accessibility Assistant detected. Restart required. The HP Accessibility Assistant was connected to the product after turn on. The HP Accessibility Assistant is not a plug-and-play device.

Recommended action for customers

Customer actions for 80.* errors.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. Reload the printer firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agents

Call center agent actions for 80.* errors.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
 - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.

- b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
 - g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.
5. If the error persists, dispatch an onsite technician (no replacement parts required).

Recommended action for call center agents

Call center agent actions for 80.* errors.

- 1. Turn the printer off, reconnect the network cable, and then turn the printer on.
- 2. Try another network cable.
- 3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
 - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
- c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
- d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.

- e. Press the **OK** button again.
- f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
- g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.

80 . 0x . yy Embedded Jetdirect Error

An Embedded HP JetDirect print server critical error has occurred.

- **80.01.80:** (event log) No heartbeat
- **80.01.81:** (event log) Reclaim timeout
- **80.01.82:** (event log) Invalid data length
- **80.01.8B:** (event log) Invalid max outstanding packet header field
- **80.01.8C:** (event log) Invalid channel mapping response
- **80.03.01:** (event log) No PGP buffers
- **80.03.02:** (event log) Channel table full
- **80.03.03:** (event log) Producer index not reset
- **80.03.04:** (event log) Consumer index not reset
- **80.03.05:** (event log) Queue position size too small
- **80.03.06:** (event log) Transport overflow
- **80.03.07:** (event log) No overflow packets
- **80.03.08:** (event log) Invalid identify response
- **80.03.09:** (event log) Invalid channel map return status
- **80.03.10:** (event log) Invalid reclaim return status
- **80.03.12:** (event log) Datagram invalid buffer
- **80.03.13:** (event log) Max stream channels
- **80.03.14:** (event log) Max datagram channels
- **80.03.15:** (event log) Card reset failed
- **80.03.16:** (event log) Self-test failure
- **80.03.17:** (event log) Unknown PGP packet
- **80.03.18:** (event log) Duplicate I/O channel

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Press the power button to turn on the printer, and then press the power button to turn off the printer.
2. Disconnect the Ethernet cable from the Ethernet port on the printer and router.
3. If the error persists, turn off the printer, and then turn on the printer.
4. Reconnect the Ethernet cable to the Ethernet port on the printer and a port on the router.
5. If the error persists, try using a new Ethernet cable or a different Ethernet/LAN port on the router.
Check the lights on the printer's Ethernet port to make sure the connection is successful. The green light should be steady and lit.
6. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Turn off the printer, and then turn on the printer.
3. Disconnect the Ethernet (RJ-45) cable from the Ethernet port on the printer and router.
4. If the error persists, turn off the printer, and then turn on the printer.
5. Reconnect the Ethernet (RJ-45) cable to the Ethernet port on the printer and a port on the router.
6. If the error persists, try using a new Ethernet (RJ-45) cable or a different Ethernet or LAN port on the router.

Check the lights on the printer's Ethernet port to make sure the connection is successful.

7. If the error persists, update the firmware.

For instructions, go to *Update the printer firmware* (ish_4158468-4158516-16).

8. If the error persists, dispatch a service technician to replace the formatter.

Use the following table to order the correct part number for your printer.

Table 6-131 Formatter PCA part numbers

Product models	Part description	Part number
M501dn	Formatter PC board	J8H61-67901
M501dn (China)	Formatter PC board	J8H61-67902
M501n	Formatter PC board	J8H60-67901
M501n (China)	Formatter board assembly	J8H60-67902
M506n/ M506dn	Formatter PC board assembly	F2A68-67915
E50045n/ E50045dn		
M506x	Formatter PC board assembly	F2A68-67916
E50045x		

Table 6-131 Formatter PCA part numbers (continued)

Product models	Part description	Part number
M507	Formatter PC board	1PV87-60001
E50145		
M527	Formatter PC board assembly	F2A76-67910
E52545		
M528	Formatter PC board	1PV64-60002
E52645		

For instructions: See the Repair Service Manual for this product.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Turn off the printer, and then turn on the printer.
3. Disconnect the Ethernet (RJ-45) cable from the Ethernet port on the printer and router.
4. If the error persists, turn off the printer, and then turn on the printer.
5. Reconnect the Ethernet (RJ-45) cable to the Ethernet port on the printer and a port on the router.
6. If the error persists, try using a new Ethernet (RJ-45) cable or a different Ethernet or LAN port on the router.

Check the lights on the printer's Ethernet port to make sure the connection is successful.

7. If the error persists, update the firmware.

For instructions, go to *Update the printer firmware* (ish_4158468-4158516-16).

8. If the error persists, replace the formatter.

Use the following table to order the correct part number for your printer.

Table 6-132 Formatter PCA part numbers

Product models	Part description	Part number
M501dn	Formatter PC board	J8H61-67901
M501dn (China)	Formatter PC board	J8H61-67902
M501n	Formatter PC board	J8H60-67901
M501n (China)	Formatter board assembly	J8H60-67902
M506n/ M506dn	Formatter PC board assembly	F2A68-67915
E50045n/ E50045dn		
M506x	Formatter PC board assembly	F2A68-67916
E50045x		

Table 6-132 Formatter PCA part numbers (continued)

Product models	Part description	Part number
M507 E50145	Formatter PC board	1PV87-60001
M527 E52545	Formatter PC board assembly	F2A76-67910
M528 E52645	Formatter PC board	1PV64-60002

For instructions: See the Repair Service Manual for this product.

81.09.00 Error

Internal Jetdirect Inside Networking event.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technician

Follow these troubleshooting steps in the order presented.

1. Verify that the issue occurs with the latest version of firmware.
 - a. Obtain the latest public firmware version for the device from hp.com.
 - b. Update the device firmware.
 - c. The device will reboot during the firmware update process.
 - d. If available (from HP Advance Technical Support), obtain the latest interim version of firmware to perform the same update test.
 - e. If the issue persists, continue with the next troubleshooting step.
2. Verify that the issue occurs when the device has the latest firmware and is not connected to the network.
 - a. Disconnect the network cable from the network I/O port on the device.
 - b. Turn the printer off, and then on.
 - c. If the error persists, continue with the next troubleshooting step.
3. Verify that the issue occurs when disconnected from the network and with default configuration.

- a. Run a partial clean.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- b. If the error persists, continue with the next troubleshooting step.

- 4. **Call center agents:** Dispatch an onsite technician to re-establish the trusted platform module state in the printer.



IMPORTANT: Never replace the TPM on a unit that shipped with one. The TPM that can be ordered is only available for adding a level of security on a device that never had a TPM paired from the factory. A new TPM cannot be installed for security reasons.

82.* errors

Errors in the 82.* family indicate a problem with an external I/O device, such as a Jetdirect card, an EIO card, or an external hard disk.

- **82.00.00 error:** Memory Error.
- **82.73.45 error:** Memory Error. Disk successfully cleaned. Event log only.
- **82.73.46 error:** Memory Error. A hard disk or compact flash disk cleaning failed. Usually caused by a failure of the disk hardware. Event log only.
- **82.73.47 error:** Memory Error. Some of sanitized disk did not correctly verify. Event log only.

Recommended action for customers

Customer actions for 80.* errors.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. Reload the printer firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call center agents

Call center agent actions for 80.* errors.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.

3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the [1/8](#) under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
 - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the [1/8](#) under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
 - g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.
5. If the error persists, dispatch an onsite technician (no replacement parts required).

Recommended action for call center agents

Call center agent actions for 80.* errors.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. If the error persists, perform a [Partial Clean](#) procedure using the [Preboot](#) menu.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
 - b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
 - c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
 - d. Press the down arrow button to highlight [Partial Clean](#), and then press the [OK](#) button.
 - e. Press the [OK](#) button again.
 - f. Press the back button once to highlight [Continue](#), and then press the [OK](#) button.
 - g. The printer automatically initializes and then returns to a Ready state.
4. If the error persists, perform a [Format Disk](#) procedure using the [Preboot](#) menu, and then upgrade the firmware to the latest version.



NOTE: For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

- a. Turn the printer on.
- b. Press the HP logo that displays in the middle of the screen when you see the 1/8 under the logo.
- c. Press the down arrow button to highlight [Administrator](#), and then press the [OK](#) button.
- d. Press the down arrow button to highlight [Format Disk](#), and then press the [OK](#) button.
- e. Press the [OK](#) button again.
- f. Wait for the printer to automatically initialize. The message **99.09.67** appears on the control panel.
- g. Reload the firmware using a USB flash drive. See [99.09.67 error](#) for more information.

82 . 73 . 46, 82 . 73 . 47

A hard disk drive (HDD), solid state drive (SDD), or compact flash disk cleaning failed.

This error is usually caused by a failure of the disk hardware.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the product off, and then on.
2. Reload the printer firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

3. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

98.0X.0Y error messages

98.* errors

Errors in the 98.* family are related to data corruption in the firmware.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Download and install the most current version of the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

98.00.0C

Data corruption, fail to mount partition.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, download and install the latest printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Use the [Format Disk](#) item in the Preboot menu.

 **CAUTION:** Selecting Format Disk removes all data. The system is not bootable after this action and 99.09.67 displays on the control panel. A firmware download must be performed to return the system to a bootable state. Should any installed workflow solutions be present they will be deleted and require reloading and setup by the customer.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. Use the printer's Preboot menu and USB thumb drive, update the printer firmware:

For more information, go to: [HP LaserJet Enterprise, HP LaserJet Managed - Update the printer firmware | HP® Customer Support](#)

5. If the issue persists, replace the hard disk drive (HDD).

 **IMPORTANT:** **WARNING:** Do not replace the printer formatter, it will not resolve this issue.

 **NOTE:** Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-133 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011

Table 6-133 HDD part numbers (continued)

Description	Part number
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, download and install the latest printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Use the [Format Disk](#) item in the Preboot menu.

 **CAUTION:** Selecting Format Disk removes all data. The system is not bootable after this action and 99.09.67 displays on the control panel. A firmware download must be performed to return the system to a bootable state. Should any installed workflow solutions be present they will be deleted and require reloading and setup by the customer.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. Use the printer's Preboot menu and USB thumb drive, update the printer firmware:

For more information, go to: [HP LaserJet Enterprise, HP LaserJet Managed - Update the printer firmware | HP® Customer Support](#)

5. If the issue persists, replace the hard disk drive (HDD).

 **IMPORTANT:** **WARNING:** Do not replace the printer formatter, it will not resolve this issue.

 **NOTE:** Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-134 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above

For instructions: See the Repair Service Manual for this product.

98.00.00

An internal firmware error has occurred (corrupt data found in the Partition Manager).

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, download and install the latest printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Use the [Format Disk](#) item in the Preboot menu.

 **CAUTION:** Selecting Format Disk removes all data. The system is not bootable after this action and 99.09.67 displays on the control panel. A firmware download must be performed to return the system to a bootable state. Should any installed workflow solutions be present they will be deleted and require reloading and setup by the customer.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. Use the printer's Preboot menu and USB thumb drive, update the printer firmware:

For more information, go to: [HP LaserJet Enterprise, HP LaserJet Managed - Update the printer firmware | HP® Customer Support](#)

5. If the issue persists, replace the hard disk drive (HDD).

 **IMPORTANT:** **WARNING:** Do not replace the printer formatter, it will not resolve this issue.

 **NOTE:** Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-135 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, download and install the latest printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Use the [Format Disk](#) item in the Preboot menu.

 **CAUTION:** Selecting Format Disk removes all data. The system is not bootable after this action and 99.09.67 displays on the control panel. A firmware download must be performed to return the system to a bootable state. Should any installed workflow solutions be present they will be deleted and require reloading and setup by the customer.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. Use the printer's Preboot menu and USB thumb drive, update the printer firmware:

For more information, go to: [HP LaserJet Enterprise, HP LaserJet Managed - Update the printer firmware | HP® Customer Support](#)

5. If the issue persists, replace the hard disk drive (HDD).

 **IMPORTANT:** **WARNING:** Do not replace the printer formatter, it will not resolve this issue.

 **NOTE:** Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-136 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above

For instructions: See the Repair Service Manual for this product.

98.00.00, 98.00.01, or 98.01.00 Corrupt data in firmware volume

Data corruption has occurred in the firmware volume.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

3. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

98.00.02 Corrupt data in the solutions volume

Data corruption has occurred in the solutions volume.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. If the error persists, download and install the latest printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Use the **Format Disk** item in the Preboot menu.

 **CAUTION:** Selecting Format Disk removes all data. The system is not bootable after this action and 99.09.67 displays on the control panel. A firmware download must be performed to return the system to a bootable state. Should any installed workflow solutions be present they will be deleted and require reloading and setup by the customer.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. Use the printer's Preboot menu and USB thumb drive, update the printer firmware:

For more information, go to: [HP LaserJet Enterprise, HP LaserJet Managed - Update the printer firmware | HP® Customer Support](#)

5. If the issue persists, replace the hard disk drive (HDD).

 **IMPORTANT:** **WARNING:** Do not replace the printer formatter, it will not resolve this issue.

 **NOTE:** Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-137 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, download and install the latest printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Use the **Format Disk** item in the Preboot menu.

 **CAUTION:** Selecting Format Disk removes all data. The system is not bootable after this action and 99.09.67 displays on the control panel. A firmware download must be performed to return the

system to a bootable state. Should any installed workflow solutions be present they will be deleted and require reloading and setup by the customer.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. Use the printer's Preboot menu and USB thumb drive, update the printer firmware:

For more information, go to: [HP LaserJet Enterprise, HP LaserJet Managed - Update the printer firmware | HP® Customer Support](#)

5. If the issue persists, replace the hard disk drive (HDD).

 **IMPORTANT: WARNING:** Do not replace the printer formatter, it will not resolve this issue.

 **NOTE:** Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-138 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above

For instructions: See the Repair Service Manual for this product.

98.00.03 Corrupt data in the configuration volume

Data corruption has occurred in the configuration volume.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.

2. Download the firmware again, and then attempt the upgrade again.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Use the [Format Disk](#) item in the Preboot menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

98 . 00 . 04 Corrupt data in the job data volume

Data corruption has occurred in the job data volume.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Make sure the printer is running the most current version of firmware.
For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
3. Rerun the file erase function.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

99.XX.YY error messages

99.* errors

Errors in the 99.* family are related to the firmware upgrade process.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure the connection to the network is good, and then try the firmware upgrade again.
2. If the error persists, try using the USB upgrade method.
For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Follow these troubleshooting steps in the order presented.

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Make sure the connection to the network is good, and then try the upgrade again.
2. Try using the USB upgrade method.
3. If the error persists, run the [Format Disk](#) process from the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. If the issue persists, replace the hard disk drive (HDD).



NOTE: Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive. Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-139 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41616-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
See NOTE above.	See NOTE above.

99 . 00 . 01 Upgrade not performed file is corrupt

A remote firmware upgrade (RFU) was not performed.

This is a CRC error in the firmware image (bad image).

Recommended action

Follow these troubleshooting steps in the order presented.

- Download the firmware upgrade file, and then attempt the upgrade again.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

99 . 00 . 02 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header number and size. It indicates a problem with the network environment, not the product.

Recommended action

Follow these troubleshooting steps in the order presented.

The most common cause is an issue with the network environment.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99 . 00 . 03 Upgrade not performed error writing to disk

A remote firmware upgrade (RFU) was not performed.

This is a disk error. It might indicate a problem or a hard disk failure. It might be necessary to check the connection to the hard disk or replace the hard disk.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the RFU file, and then attempt the upgrade again.
2. If the error persists, run the **Clean Disk** process from the **Preboot** menu.

You will need to download the firmware from the **Preboot** menu.

3. If the error persists, replace the hard disk drive.



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-140 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011

Table 6-140 HDD part numbers (continued)

Description	Part number
Federal Information Processing Standards Drive, FIPS (HDD) *See NOTE above	L42243-021 *See NOTE above

For instructions: See the Repair Service Manual for this product..

99 . 00 . 04 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header.

The most common cause is an issue with the network environment.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

99 . 00 . 05 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading image data.

The most common cause is an issue with the network environment.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.



NOTE: If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware.](#)

99 . 00 . 06 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

The issue is an unexpected read error when reading the header number and size.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the RFU file, and then attempt the upgrade again.
2. If the error persists, replace the hard disk drive.



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-141 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above

For instructions: See the Repair Service Manual for this product..

99 . 00 . 07 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

The issue is an unexpected read error when reading the rest of the header.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.
Go to [HP FutureSmart - Latest Firmware Versions](#).
For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the RFU file, and then attempt the upgrade again.
2. If the error persists, replace the hard disk drive.



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-142 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above

For instructions: See the Repair Service Manual for this product..

99 . 00 . 08 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

The issue is an unexpected read error when reading image data.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. If the error persists, Upgrade the firmware.
Go to [HP FutureSmart - Latest Firmware Versions](#).
For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the RFU file, and then attempt the upgrade again.
2. If the error persists, replace the hard disk drive.



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-143 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above

For instructions: See the Repair Service Manual for this product..

99 . 00 . 09 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled.

Recommended action

Follow these troubleshooting steps in the order presented.

- Resend the remote firmware upgrade (RFU).

99 . 00 . 10 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the header number and size.

Recommended action

Follow these troubleshooting steps in the order presented.

- Resend the remote firmware upgrade (RFU).

99 . 00 . 11 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the rest of the header, after reading the header number and size.

Recommended action

Follow these troubleshooting steps in the order presented.

- Resend the remote firmware upgrade (RFU).

99 . 00 . 12 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 1, but the header size does not match version 1 size.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the remote firmware upgrade (RFU) file again.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Resend the RFU.

99 . 00 . 13 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 2, but the header size does not match version 2 size.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the remote firmware upgrade (RFU) file again.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Resend the RFU.

99 . 00 . 14 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The file is invalid.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download the remote firmware upgrade (RFU) file again.

Make sure that you download the file for the correct printer model.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Resend the RFU.

99.00.2x

There is a compatibility issue with the firmware.

The specific message varies depending on the cause, but the solution for each message is the same.

- 99.00.20 (event log)

The bundle is not for this product.

- 99.00.21 (event log)

The bundle is not signed with the correct signature, or the signature is invalid.

- 99.00.22 (event log)

The bundle header version is not supported by this firmware.

- 99.00.23 (event log)

The package header version is not supported by this firmware.

- 99.00.24 (event log)

The format of the bundle is invalid.

- 99.00.25 (event log)

The format of the package is invalid.

- 99.00.26 (event log)

A CRC32 check did not pass.

- 99.00.27 (event log)

An I/O error occurred while downloading the bundle.

Recommended action

Follow these troubleshooting steps in the order presented.

1. **99.00.27 only:** Turn the product off, and then on.

2. Download the correct firmware file, and then resend the firmware upgrade.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#) For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, try installing the upgrade by another method (USB or Embedded Web Server).

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99.01.xx

A firmware install error has occurred.

The specific message varies depending on the cause, but the solution for each message is the same.

- 99.01.00

- 99.01.10
- 99.01.20
- 99.01.21

Recommended action

Follow these troubleshooting steps in the order presented.

- Reload the firmware.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)
Firmware update steps,

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

99.02.01

Firmware installation was successful.

Recommended action

See recommended action.

- No action necessary.

99.02.09

Firmware upgrade cancelled by user.

Recommended action

See recommended action.

- No action necessary.

99.07.22 Firmware install error

This error indicates that the firmware installation failed. It displays on the printer control panel when the fax modem installer fails to download the installed firmware to the modem.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure that the network connection is stable and good, and then attempt to update the firmware again.
2. If the error persists, try to update the firmware at the control panel using a USB flash drive.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure that the network connection is stable and good, and then attempt to update the firmware again.

2. If the error persists, try to update the firmware at the control panel using a USB flash drive.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Use the **Format Disk** item in the Preboot menu.

 **CAUTION:** Selecting Format Disk removes all data. The system is not bootable after this action and 99.09.67 displays on the control panel. A firmware download must be performed to return the system to a bootable state. Should any installed workflow solutions be present they will be deleted and require reloading and setup by the customer.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. If the issue persists, identify which storage solution is utilized, a hard disk drive (HDD) or embedded multi-media card (eMMC).

- a. Print or view the device configuration page.
- b. Reference section **Installed Personalities and Options**.
- c. Reference **Internal Disk: Hard Disk: Enabled**
- d. Reference **Hard Disk Encryption Status**, "Disk cannot be encrypted" denotes an eMMC storage device.

5. Depending on the storage solution installed, replace either the hard disk drive (HDD) or embedded multi-media card (eMMC).

 **IMPORTANT:** **WARNING:** Do not replace the printer formatter, it will not resolve this issue.

 **NOTE:** Device is unusable until a new boot device is installed.

 **NOTE:** Most customers have the self-encrypting drive (SED) and should not have a Federal Information Processing Standards (FIPS) drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-144 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above
Module 16GB embedded Multimedia Card (eMMC) kit	5851-6587

Recommended action for onsite technicians

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure that the network connection is stable and good, and then attempt to update the firmware again.
2. If the error persists, try to update the firmware at the control panel using a USB flash drive.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

3. Use the [Format Disk](#) item in the Preboot menu.

 **CAUTION:** Selecting Format Disk removes all data. The system is not bootable after this action and 99.09.67 displays on the control panel. A firmware download must be performed to return the system to a bootable state. Should any installed workflow solutions be present they will be deleted and require reloading and setup by the customer.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

4. If the issue persists, identify which storage solution is utilized, a hard disk drive (HDD) or embedded multi-media card (eMMC).
 - a. Print or view the device configuration page.
 - b. Reference section **Installed Personalities and Options**.
 - c. Reference **Internal Disk: Hard Disk: Enabled**
 - d. Reference **Hard Disk Encryption Status**, "Disk cannot be encrypted" denotes an eMMC storage device.
5. Depending on the storage solution installed, replace either the hard disk drive (HDD) or embedded multi-media card (eMMC).

 **IMPORTANT:** **WARNING:** Do not replace the printer formatter, it will not resolve this issue.

 **NOTE:** Device is unusable until a new boot device is installed.

 **NOTE:** Most customers have the self-encrypting drive (SED), and should not have a Federal Information Processing Standards (FIPS) drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-145 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above
Module 16GB embedded Multimedia Card (eMMC) kit	5851-6587

6. If the issue persists, elevate using your region's support process.

99.09.60 Unsupported disk

The hard disk currently installed is not recognized or supported by the product.

This is a [Preboot](#) menu error.

Recommended action

Follow these troubleshooting steps in the order presented.

- Install the correct hard disk drive for this printer.

99.09.61 Unsupported disk

The HDD or SSD installed is not support in this printer.

The hard disk drive (HDD) or solid state drive (SSD) is not encrypted and the printer is configured for an encrypted HDD/SSD.

Recommended action

Follow these troubleshooting steps in the order presented.



NOTE: Do NOT replace the formatter board, it will not resolve this error.

- Access the [Preboot](#) menu, and then select [Lock Disk](#) to lock the disk.
 - a. Access the [Preboot](#) menu
 - b. Turn the product on.
 - c. Touch the HP logo that displays in the center of the touchscreen until the [Preboot](#) menu item opens.
 - d. Use the arrow buttons on the touchscreen to navigate the [Preboot](#) menu.
 - e. Touch the [OK](#) button to select a menu item.

99.09.62 Unknown disk

This error indicates that there is an encryption mismatch between the HDD or SSD and the formatter.

This typically happens because an HDD or SSD was swapped into a device from another device.

Recommended action for customers

Follow these troubleshooting steps in the order presented.




NOTE: You will need a USB drive containing the printer firmware to complete this process. Get the latest printer firmware from support.hp.com

Use the [Preboot](#) menu to unlock the disk.

1. Access the [Preboot](#) menu.
 - a. Turn the product on.

- c. Use the **OK** button to select **Download**.

Figure 6-90 Navigate to Download

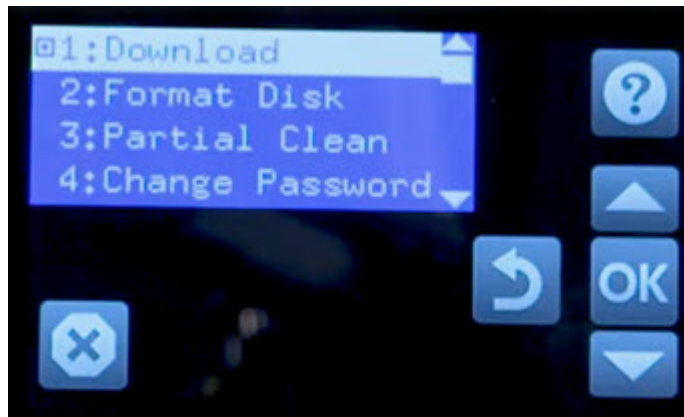


- d. Insert the USB drive containing the printer firmware into the front/side USB port on the device.
- e. Use the down arrow to navigate to **USB Thumbdrive**.

Figure 6-91 Navigate to USB Thumbdrive




- f. Use the **OK** button to select **USB Thumbdrive**.
- g. Use the arrow buttons and the **OK** button to navigate to and select the BDL file stored on the USB drive.

Figure 6-92 Navigate to the BDL file

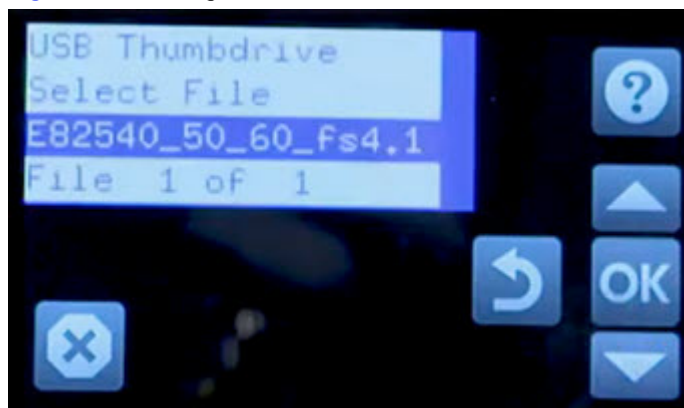

- h. After selecting **OK**, the printer will begin copying the BDL firmware file to the device. This can take up to 10 minutes.

Figure 6-93 Copying the BDL file

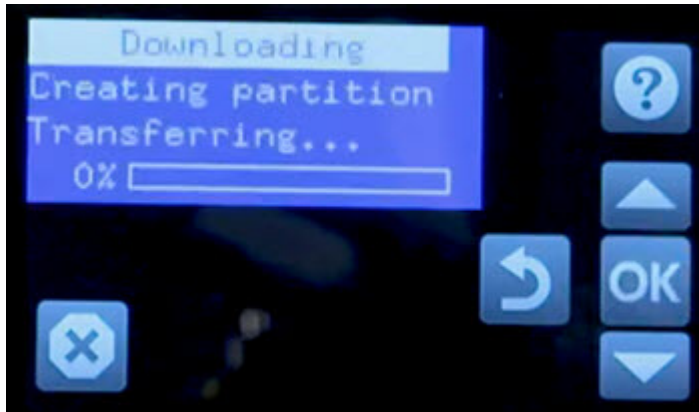

- i. When the firmware copy is complete, turn the printer off and then on again. The printer will continue with the firmware installation.
4. If the previous steps did not resolve the issue, replace the hard disk drive.

Part Number:
5851-6712

Recommended action for call-center agents


Follow these troubleshooting steps in the order presented.

 **NOTE:** Do NOT replace the formatter board, it will not resolve this error.

Use the **Preboot** menu to unlock the disk.

1. Access the **Preboot** menu.
 - a. Turn the product on.
 - b. Touch the HP logo that displays in the center of the touchscreen until the **Preboot** menu item opens.


Figure 6-94 The Preboot menu

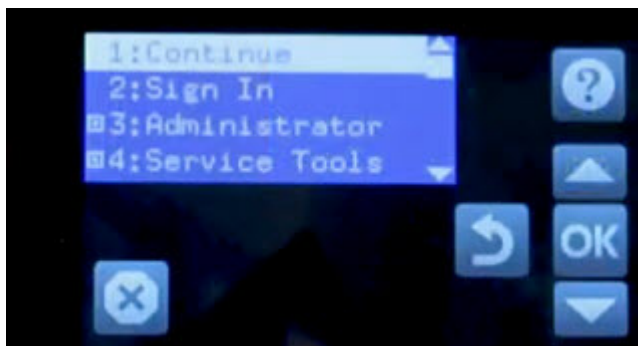

2. Erase/unlock the disk.

- a. While still in the Preboot menu, use the arrow buttons on the touchscreen to scroll down to **Administrator** menu.
 - b. Touch the **OK** button to select **Administrator**.
 - c. Use the arrow buttons on the touchscreen to scroll down to **Manage Disks** menu.
 - d. Touch the **OK** button to select **Manage Disks**.
 - e. Use the arrow buttons on the touchscreen to scroll down to **Boot Device** menu.
 - f. Touch the **OK** button to select **Boot Device**.
 - g. Use the arrow buttons on the touchscreen to scroll down to **Erase / Unlock** menu.
 - h. Touch the **OK** button to select **Erase / Unlock**. This will completely erase the disk removing the firmware (printer operating system). You will need to reinstall the printer firmware after performing the Erase/Unlock procedure.
3. Reinstall printer firmware using a USB thumb drive. View this video for more information: [How to Load Firmware on HP PageWide and LaserJet Enterprise Printers When a 99.09.63 or 99.09.67 Error Displays](#).
 - a. Use the **Back** button on the control panel to navigate back to **Administrator** in the Preboot menu.
 - b. Use the **OK** button to select **Administrator**.
 - c. Use the **OK** button to select **Download**.


Figure 6-95 Navigate to Download

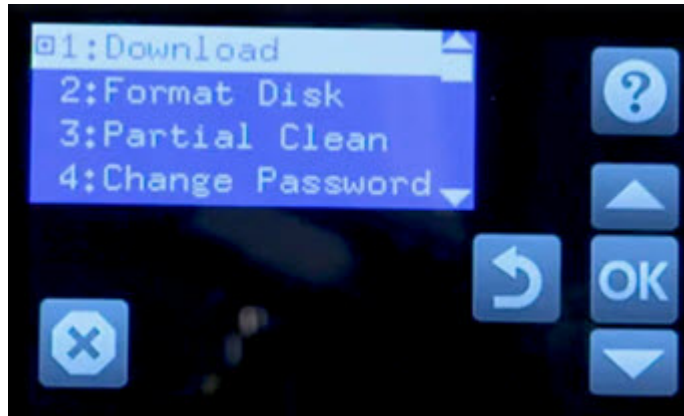

- d. Insert the USB drive containing the printer firmware into the front/side USB port on the device.


- e. Use the down arrow to navigate to **USB Thumbdrive**.

Figure 6-96 Navigate to USB Thumbdrive

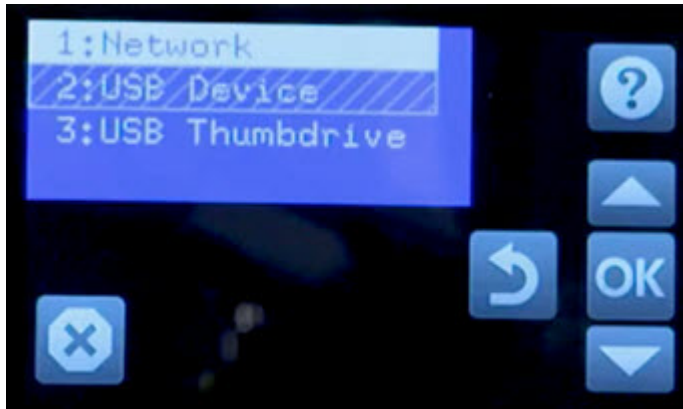


- f. Use the **OK** button to select **USB Thumbdrive**.
- g. Use the arrow buttons and the **OK** button to navigate to and select the BDL file stored on the USB drive.

Figure 6-97 Navigate to the BDL file

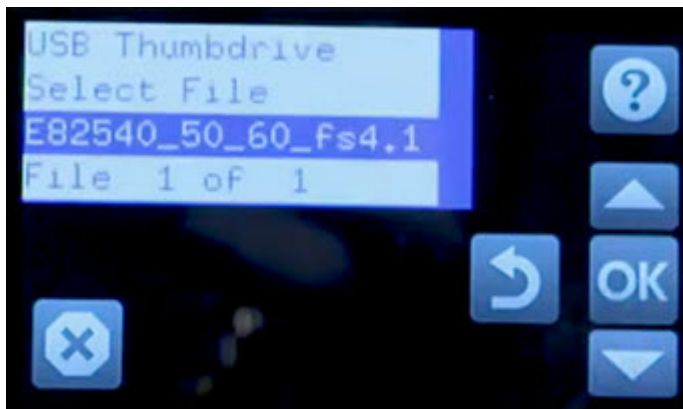

- h. After selecting **OK**, the printer will begin copying the BDL firmware file to the device. This can take up to 10 minutes.

Figure 6-98 Copying the BDL file

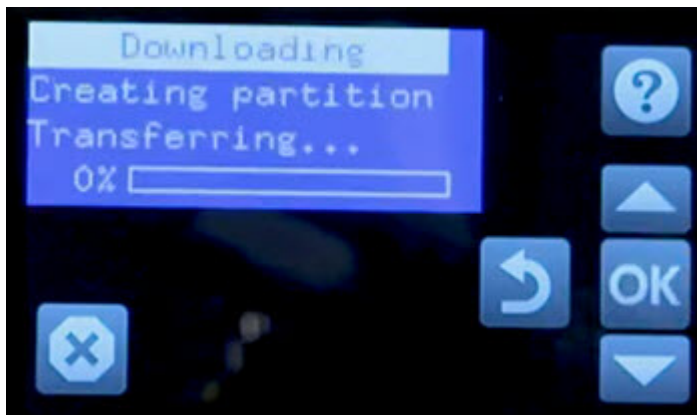

- i. When the firmware copy is complete, turn the printer off and then on again. The printer will continue with the firmware installation.
4. If the previous steps did not resolve the issue, replace the hard disk drive.



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-146 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.



NOTE: Do NOT replace the formatter board, it will not resolve this error.

1. Access the [Preboot](#) menu to unlock the disk.
2. Select [Administrator](#) menu.
3. Select [Manage Disks](#) menu.
4. Select [Boot Device](#) menu.
5. Select [Erase / Unlock](#). This will completely erase the disk removing the firmware (printer operating system). You will need to reinstall the printer firmware after performing the Erase/Unlock procedure.
6. Reinstall printer firmware using a USB thumb drive. View this video for more information: [How to Load Firmware on HP PageWide and LaserJet Enterprise Printers When a 99.09.63 or 99.09.67 Error Displays](#).
 - a. While still in the Preboot menu, use the [Back](#) button on the control panel to navigate back to [Administrator](#).
 - b. Use the [OK](#) button to select [Administrator](#).
 - c. Use the [OK](#) button to select [Download](#).
 - d. Insert the USB drive containing the printer firmware into the front/side USB port on the device.
 - e. Use the down arrow to navigate to [USB Thumbdrive](#).
 - f. Use the [OK](#) button to select [USB Thumbdrive](#).
 - g. Use the arrow buttons and the [OK](#) button to navigate to and select the BDL file stored on the USB drive.

- h. After selecting **OK**, the printer will begin copying the BDL firmware file to the device. This can take up to 10 minutes.
 - i. When the firmware copy is complete, turn the printer off and then on again. The printer will continue with the firmware installation.
7. If the previous steps did not resolve the issue, replace the hard disk drive.



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-147 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above

99.09.63 Incorrect disk

This error indicates that the expected encrypted HDD is not present.

This is expected behavior when installing a new HDD in a device where the previous HDD was encrypted.

Recommended action for Customers

Use the following general troubleshooting steps to try to resolve the problem.

1. If installing a new hard disk drive (HDD), follow the instructions which came with the replacement drive or reference the following support document, [Removal and replacement: Hard-disk drive \(HDD\)](#).
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for onsite technicians

Use the following general troubleshooting steps to try to resolve the problem.

1. If installing a new hard disk drive (HDD), follow the instructions which came with the replacement drive or reference the following support document, [Removal and replacement: Hard-disk drive \(HDD\)](#).
2. If the error persists, try to update the firmware at the control panel using a USB flash drive.
For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).
3. Turn the printer off and then on to access the printer's Preboot menu to erase / unlock the new HDD, reference support document, HP LaserJet Managed MFP - Preboot menu options.
 - a. From the Preboot menu, select **Administrator**.
 - b. Select **Manage Disk**.

- c. Select **Boot Device**.
- d. Select **Erase / Unlock**.
- e. Select **OK**.
- f. Turn the printer off, and then on.

Printer will display a 99.09.67 error message.

- 4. Insert the USB thumb drive with the previously extracted firmware file into the walkup USB port.
- 5. Use the printer's Preboot menu to update the printer firmware

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).



IMPORTANT: For the more information, go to: HP Enterprise, HP Managed - Update the printer firmware.

Recommended action for onsite technicians

Use the following general troubleshooting steps to try to resolve the problem.

- 1. If installing a new hard disk drive (HDD), follow the instructions which came with the replacement drive or reference the following support document, [Removal and replacement: Hard-disk drive \(HDD\)](#).

- 2. If the error persists, try to update the firmware at the control panel using a USB flash drive.

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).

- 3. Turn the printer off and then on to access the printer's Preboot menu to erase / unlock the new HDD, reference support document, HP LaserJet Managed MFP - Preboot menu options.

- a. From the Preboot menu, select **Administrator**.
- b. Select **Manage Disk**.
- c. Select **Boot Device**.
- d. Select **Erase / Unlock**.
- e. Select **OK**.
- f. Turn the printer off, and then on.

Printer will display a 99.09.67 error message.

- 4. Insert the USB thumb drive with the previously extracted firmware file into the walkup USB port.
- 5. Use the printer's Preboot menu to update the printer firmware

For the more information, go to: [HP Enterprise, HP Managed - Update the printer firmware](#).



IMPORTANT: For the more information, go to: HP Enterprise, HP Managed - Update the printer firmware.

- 6. If the issue persists, elevate the case using your regions process.

99 . 09 . 64 Disk malfunction

A fatal hard disk failure has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Determine if the hard disk drive needs to be replaced.
2. Ask if the customer is using eMMC as a temporary mass storage solution (eMMC must be present).
3. Instruct the customer to enable eMMC from the preboot menus.
4. Turn the printer off.
5. Inform the customer that the broken hard disk drive must be removed to continue.
6. Turn the printer on. The boot sequence is expected to stop at 99.39.67 eMMC Not Bootable.
7. Provide instructions to download firmware (This will automatically download to eMMC).
8. During the download to eMMC, the firmware will clear the data migration bit.
9. Ship a new hard disk drive.

Do NOT replace the formatter board, it will not resolve this.

99 . 09 . 65 Disk data error

Disk data corruption has occurred.

Recommended action

Follow these troubleshooting steps in the order presented.



NOTE: Do NOT replace the formatter board, it will not resolve this error.

- Use the [Format Disk](#) procedure from the [Preboot](#) menu, and then resend the remote firmware upgrade (RFU).

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

99 . 09 . 66 No boot device.

A hard disk drive is not installed in the printer.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Determine the customer's intended boot device (hard disk drive or eMMC).
2. Install a compatible hard disk drive or eMMC.
3. If a compatible hard disk drive or eMMC is installed, reseal the hard disk drive or eMMC to make sure that it is connected correctly. Additionally reseal all cables on the formatter, except the Flat Flexible cable (FFC).

4. If the error persists, replace the hard disk drive or eMMC.

 **NOTE:** Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 6-148 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above

For instructions: See the Repair Service Manual for this product..

 **NOTE:** Do NOT replace the formatter board, it will not resolve this.

 **NOTE:** Device is unusable until a new boot device is installed.

99 . 09 . 67 Disk is not bootable please download firmware

This is an error indicating that there is no firmware installed on the disk.

This is usually the result of installing a new disk or performing a [Clean Disk](#) operation from the [Preboot](#) menu.

 **NOTE:** When installing a new hard drive or eMMC, the disk should be formatted through the Preboot menu, BEFORE loading firmware.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Press any button to continue to the main **Preboot** menu.
2. Press the Help button to see the help text for the error.
3. Select the **Administration** menu.

 **NOTE:** If there is a password assigned to the Administrator, a prompt to enter the printer displays. Enter the password to proceed.

4. Select the [Format disk](#) option, select **OK**.
5. Select the **Download** item, and then download the latest firmware.
The user can now download a new firmware bundle to the printer.
6. If the download fails to the hard disk drive, complete the following:

- a. Determine if the hard disk drive needs to be replaced.

- b. Ask if the customer is using eMMC as a temporary mass storage solution (eMMC must be present).
- c. Instruct the customer to enable eMMC from the preboot menus.
- d. Turn the printer off.
- e. Inform the customer that the broken hard disk drive must be removed to continue.
- f. Turn the printer on. The boot sequence is expected to stop at 99.39.67 eMMC Not Bootable.
- g. Provide instructions to download firmware (This will automatically download to eMMC).
- h. During the download to eMMC, the firmware will clear the data migration bit.
- i. Ship a new hard disk drive.

Do NOT replace the formatter board, it will not resolve this.

99 . 39 . 64 eMMC Nonfunctional

The eMMC is not functioning.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the eMMC.

Table 6-149 Part numbers

Description	Part number
Kit-eMMC Replacement 16gb (M527)	5851-6587
Module 16B embedded MultiMedia Card (eMMC) kit	5851-6436



NOTE: The device is unusable until a new eMMC is installed.

99 . 39 . 67 eMMC Not Bootable

Data on the eMMC cannot be secured or encrypted.

When the hard disk drive is installed all data on the eMMC is automatically migrated to the hard disk drive and erased from the eMMC. As long as the hard disk drive is installed the eMMC is non-functional.

The customer passed the data migration and put the eMMC back in.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Download firmware to the eMMC.

2. If the download fails to eMMC, Replace the eMMC.

Table 6-150 Part numbers

Description	Part number
Kit-eMMC Replacement 16gb (M527)	5851-6587
Module 16B embedded MultiMedia Card (eMMC) kit	5851-6436



NOTE: The device is unusable until a new eMMC is installed.

99.XX.YY

A message of this form indicates a firmware installation error.

Recommended action

Follow these troubleshooting steps in the order presented.

- Reload the firmware.

7 Alphabetical control panel messages

Use the following alphabetical message to see further information on the message.

Alphabetical messages

Accept bad signature

The product is performing a remote firmware upgrade and the code signature is invalid.

Recommended action

Follow these troubleshooting steps in the order presented.

- Download the correct firmware upgrade file for the product, and then reinstall the upgrade.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

Bad optional tray connection

The optional tray is not connected, not connected correctly, or a connection is not working correctly.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove and then reinstall the optional tray.
3. Reconnect the connectors for the tray.
4. If the problem continues, replace the connector for the tray.

<binname> full Remove all paper from bin

The specified output bin is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Empty the bin to continue printing.

Canceling

The printer is canceling the current job.

Recommended action

See recommended action.

- No action necessary.

Canceling...<jobname>

The printer is canceling the current job <jobname>.

Recommended action

See recommended action.

- No action necessary.

Cartridge Low

This message appears even though the toner cartridge is new.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Remove, and then reinstall the toner cartridge.
2. Make sure a genuine HP supply is used.
3. If the error persists, replace the toner cartridge.

Cartridge memory abnormal

This message appears even though the toner cartridge is new.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Remove, and then reinstall the toner cartridge.
2. Make sure a genuine HP supply is being used.
3. Reconnect connector (J376) on the high voltage power supply PCA.
4. If the error persists, replace the toner cartridge.

Cartridge out

This message appears even though the toner cartridge is new.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Remove, and then reinstall the toner cartridge.
2. Make sure a genuine HP supply is being used.
3. If the error persists, replace the toner cartridge.

Checking engine

The printer is conducting an internal test.

Recommended action

See recommended action.

- No action necessary.

Checking paper path

The printer is checking for possible paper jams.

Recommended action

See recommended action.

- No action necessary.

Chosen personality not available To continue touch “OK”

A print job requested a printer language (personality) that is not available for this printer. The job will not print and will be cleared from memory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Print the job by using a print driver for a different printer language, or add the requested language to the printer (if possible). To see a list of available personalities, print a configuration page.
 - a. From the Home screen on the printer control panel, go to the following menus: **Reports > Configuration/Status Pages**
 - b. Select [Configuration Page](#), then select the [Print](#) button to print the pages.

Cleaning

The printer is performing an automatic cleaning cycle. Printing will continue after the cleaning is complete.

Recommended action

See recommended action.

- No action necessary.

Cleaning do not grab paper

The printer is performing an automatic cleaning cycle. Printing will continue after the cleaning is complete.

Recommended action

See recommended action.

- No action necessary.

Clearing event log

This message is displayed while the event log is cleared. The printer exits the menus when the event log has been cleared.

Recommended action

See recommended action.

- No action necessary.

Clearing paper path

The printer is attempting to eject jammed paper.

Recommended action

Follow these troubleshooting steps in the order presented.

- Check the progress at the bottom of the display.

Close top cover

This message appears even though the top cover is closed.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Verify that the switch (SW2) is functioning correctly (open and close the top cover). If the switch fails the test, replace the switch.
2. Make sure that the switch flag at the right-side of the top cover assembly, behind the control-panel display is not damaged or missing. If the flag is damaged or missing, replace the top cover assembly.

Table 7-1 Part numbers

Description	Part number
Top cover assembly (duplex MF models only)	RM2-5686-000CN
Top cover assembly (simplex models only)	RM2-5687-010CN

3. If the problem persists, replace the top cover switch.

Cooling device

The printer is cooling.

Recommended action

See recommended action.

- No action necessary.

Creating cleaning page...

A cleaning page is being generated.

Recommended action

See recommended action.

- No action necessary.

Data received To print last page press “OK”

The printer is waiting for the command to print the last page.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the “OK” button on the control panel to print the last page of the job.

Event log is empty

No printer events are in the log.

Recommended action

See recommended action.

- No action necessary.

Expected drive missing

The printer cannot find the encrypted hard drive.

Recommended action

Follow these troubleshooting steps in the order presented.

- Install the encrypted hard disk drive.

External device initializing

An external device is initializing.

Recommended action

See recommended action.

- No action necessary.

Face Down Tray Full


This message is displaying even though the tray is not full.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Make sure that the output bin sensor flag is not damaged and can move freely. Try to manually lift the output bin actuator up and see if the actuator goes down (or is lowered).

Figure 7-1 Lift up the output bin full actuator

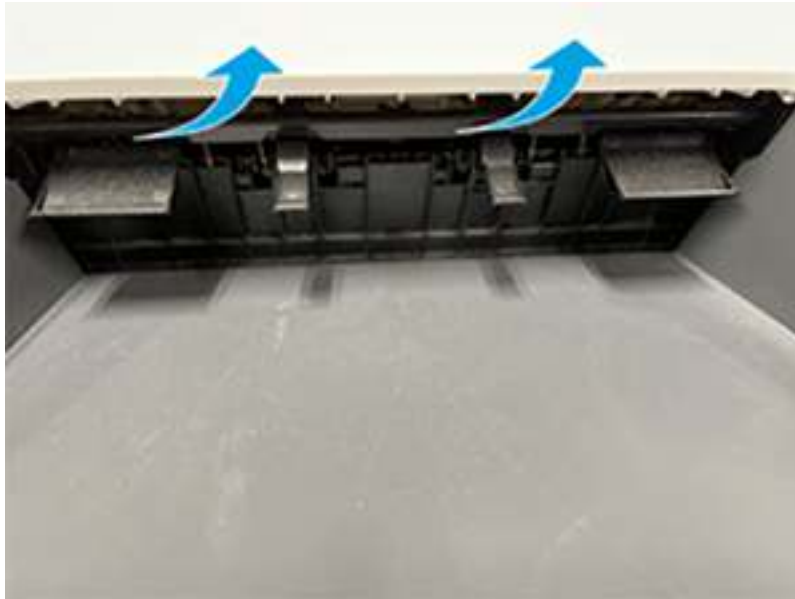

2. If the output bin sensor flag is damaged, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents (Remote support)

Follow these troubleshooting steps in the order presented.

Use the following procedure to access the [Manual Sensor Test](#) from the printer control panel to verify the output bin sensor flag is functioning correctly.

1. From the Home screen on the printer control panel, scroll to and touch the [Administration](#) (FutureSmart 3), or [Support Tools](#) (FutureSmart 4).



NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.

2. Open the following menus: **Troubleshooting > Diagnostic Tests > Manual Sensor Test**.


3. Select the [SR4 Output Bin Full Sensor](#).

Figure 7-2 SR4 Output Bin Full Sensor



4. Lift the output bin full actuator up and verify the toggle counter under the sensor name is incremented from "0" to "1" on the control panel.
 - If the toggle counter under the sensor name toggles from "0" to "1", the output sensor flag is functioning correctly and the diagnostic test is successful.
 - If the toggle counter under the sensor name does not toggle, the output sensor flag is not functioning correctly and the diagnostic test fails.

Figure 7-3 Lift up the output bin full actuator

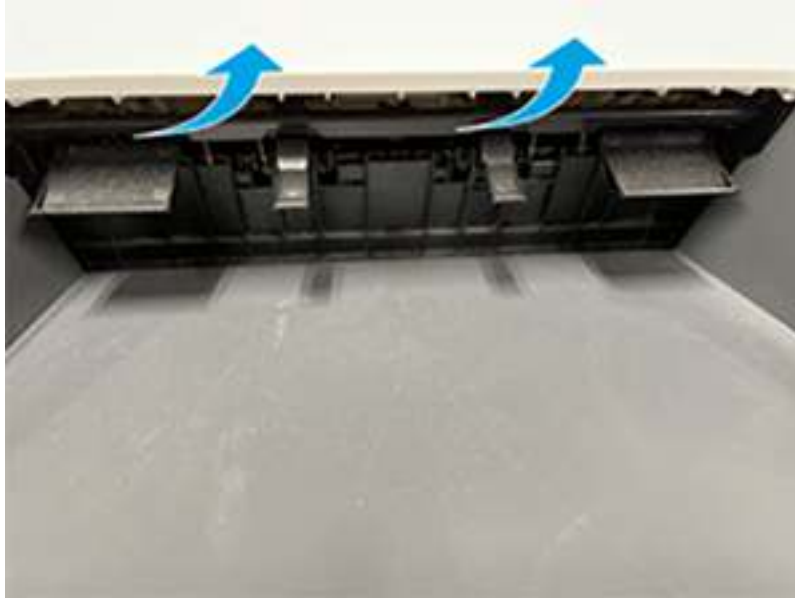

5. If the diagnostic test fails and the sensor does not toggle, the printer needs to be replaced.
6. If the diagnostic test is successful and the issue persists, send a service technician to diagnose the issue.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Make sure that the output bin sensor flag is not damaged and can move freely.
2. Access the [Manual Sensor Test](#) from the printer control panel to verify the output bin sensor flag is functioning correctly.
 - a. From the Home screen on the printer control panel, scroll to and touch the [Administration](#) (FutureSmart 3), or [Support Tools](#) (FutureSmart 4).



NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.

- b. Open the following menus: **Troubleshooting > Diagnostic Tests > Manual Sensor Test.**


- c. Select the [SR4 Output Bin Full Sensor](#).

Figure 7-4 SR4 Output Bin Full Sensor




- d. Lift the output bin full actuator up and verify the toggle counter under the sensor name is incremented from "0" to "1" on the control panel.
- If the toggle counter under the sensor name toggles from "0" to "1", the output sensor flag is functioning correctly and the diagnostic test is successful.
 - If the toggle counter under the sensor name does not toggle, the output sensor flag is not functioning correctly and the diagnostic test fails.

Figure 7-5 Lift up the output bin full actuator

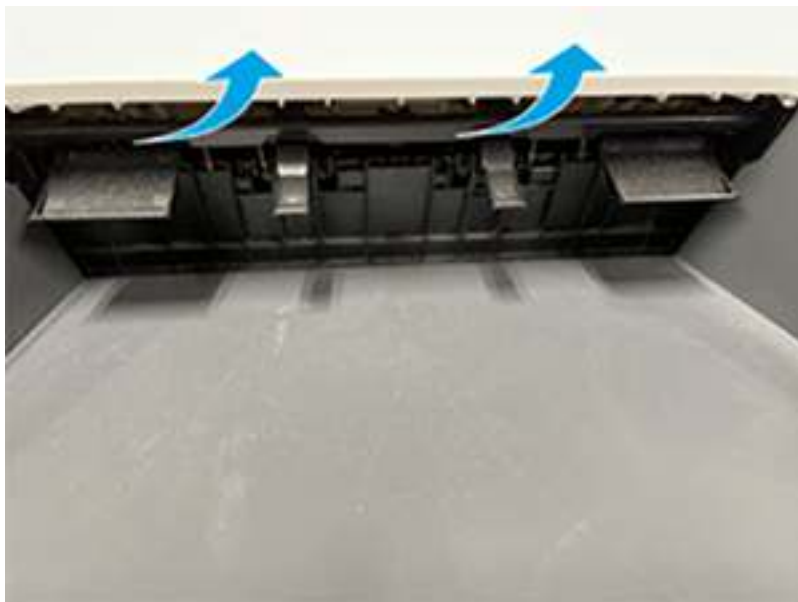

3. If the diagnostic test fails and the sensor does not toggle, the printer needs to be replaced.
 4. If the diagnostic test is successful and the issue persists, check if the fuser output sensor flag is functioning correctly.
 - a. From the Home screen on the printer control panel, scroll to and touch the [Administration](#) (FutureSmart 3), or [Support Tools](#) (FutureSmart 4).
-
-  **NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.
-
- b. Open the following menus: **Troubleshooting > Diagnostic Tests > Manual Sensor Test.**
 - c. Select the [SR13 Fuser Output Sensor](#).

Figure 7-6 SR13 Fuser Output Sensor

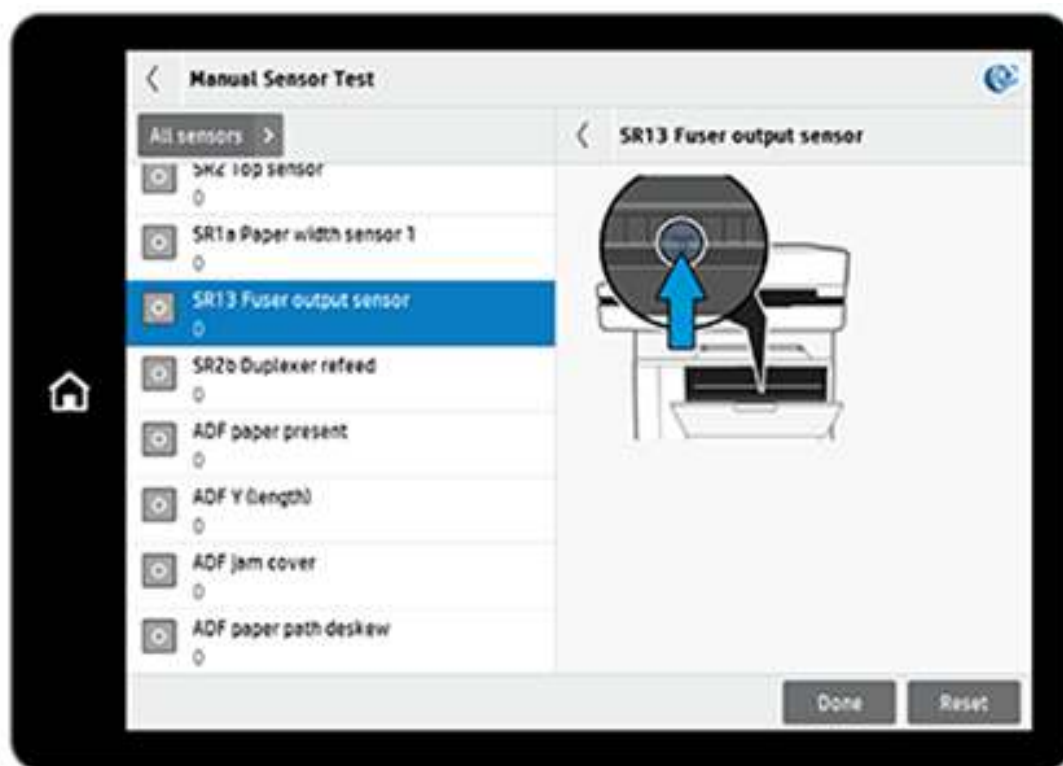

- d. Manually toggle the sensor and verify that the toggle counter under the sensor name increments accordingly.
5. If the sensor does not toggle and the sensor flag fails to function correctly, replace the fuser assembly.

Table 7-2 Fuser assembly (For 110V and 220V) part numbers

Part description	Part number
Fuser assembly - For 110 VAC <i>Bonds toner to the paper with heat.</i>	RM2-2585-000CN
Fuser assembly - For 220 VAC <i>Bonds toner to the paper with heat.</i>	RM2-2586-000CN

For instructions: See the Repair Service Manual for this product.

6. If the error persists, replace the DC controller.

Table 7-3 DC Controller part numbers

Printer models	Part description	Part number
M501dn/ M501n	DC controller PCA	RM2-8711-030CN
M506	For duplex models - DC controller PC board assembly (PCA)	RM2-8612-000CN
M527		
E52545		

Table 7-3 DC Controller part numbers (continued)

Printer models	Part description	Part number
M506 E50045	For simplex models - DC controller PC board (PCA)	RM2-8614-000CN
M507 M528 E52645	For duplex models - DC controller PC board assembly (PCA)	RM3-7475-010CN
M507 E50145	For simplex models - DC controller PC board assembly (PCA)	RM3-7476-000CN

For instructions: See the Repair Service Manual for this product.

7. If issue persists, elevate the issue using the Standard Support Process for a possible printer replacement.

FIM Load Error Send full FIM on <X> port

The printer displays this message before the firmware is loaded at startup if an error has occurred during a firmware upgrade.

Recommended action

Follow these troubleshooting steps in the order presented.

- Re-send the firmware upgrade.

Fuser Kit low

The printer indicates when a supply is low.

10.23.60 (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the fuser.

For instructions: See the Repair Service Manual for this product.

Fuser assembly 110V-127V: RM2-5679-000CN

Fuser assembly 220-240V: RM2-5692-000CN

Fuser Kit very low To continue, touch "OK"

The printer indicates when a supply is very low.

10.23.70 (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- If print quality is no longer acceptable, the customer must order and pay for a replacement fuser assembly (fuser kit).

For instructions: See the Repair Service Manual for this product.

Fuser assembly 110V-127V: RM2-5679-000CN

Fuser assembly 220-240V: RM2-5692-000CN

Genuine HP cartridge installed

A new genuine HP toner cartridge has been installed. The message appears for about 6 seconds before the printer returns to the READY state.

Recommended action

See recommended action.

- No action necessary.

Genuine HP supply installed

A new genuine HP supply has been installed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the [Hide](#) button to remove this message.

HP Secure hard drive disabled

The hard disk drive has been encrypted for another printer.

Recommended action

Follow these troubleshooting steps in the order presented.

- Remove the hard disk drive or use the Embedded Web Server for more information.

Incompatible <supply>

The indicated supply <supply> is not compatible with this printer.

- **10.00.35** (event code)
Black toner cartridge
- Fuser kit
10.23.35 (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the supply with one that is designed for this printer.

Incompatible supplies

The toner cartridge or other supply items are installed that were not designed for this printer. The printer cannot print with these supplies installed.

Event codes are supply specific.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to identify the incompatible supplies.
2. Replace the supplies with those that are designed for this printer.

Initializing...

The printer is starting.

Recommended action

See recommended action.

- No action necessary.

Install Black Cartridge

A supply item is either not installed or installed incorrectly.

- Black cartridge
10.00.15 (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

- Install the supply item or make sure that the installed supply item is correctly installed and fully seated.

Install Fuser

The fuser has been removed or installed incorrectly.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then wait for the fuser to cool.
2. Remove the output bin or stapler/stacker.
3. Remove the fuser entrance guide.
4. Remove the fuser.

 **CAUTION:** Be careful: the fuser is HOT. Allow it cool if you need to before removing to check the assembly.

5. Reinstall the fuser correctly.
6. If issue persists, replace the fuser.

For instructions: See the Repair Service Manual for this product.

Fuser assembly 110V-127V: RM2-5679-000CN

Fuser assembly 220-240V: RM2-5692-000CN

Install supplies

More than one supply is missing or is installed incorrectly.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to identify the supplies that need to be replaced.
2. Touch the **OK** button a second time for more information about the specific supply.
3. Install the supply or make sure it is correctly installed and fully seated.

Internal disk device failure To clear touch “OK”

The internal disk failed.

82 . 0X . YY (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to clear the error.
2. If the error persists, turn off the product, and then remove and reinstall the hard drive.
3. Turn on the product.
4. If the error persists, replace the internal hard drive.

Internal disk file operation failed

A PjL system command attempted to perform an illogical operation, such as downloading a file to a nonexistent directory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

Internal disk file system is full

A PjL system command attempted to write data to the internal hard disk drive but was unsuccessful because the hard disk drive is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

Internal disk is write protected

The internal hard disk drive is write protected and no new files can be written to it.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

Internal disk not found

The internal hard disk drive was not found at start up.

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn the printer off, and then on.

Internal disk not functional

The internal hard disk drive is not functioning correctly.

82.0X.YY (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, remove and then reinstall the hard disk drive.
2. If the error persists, replace the internal hard disk drive.



NOTE: Most customers have the Self-Encrypting Drive, SED, and should not have a Federal Information Processing Standards, FIPS Drive.

Only send the FIPS drive for federal government printers, customers that require FIPS per HP agreement, or customers that have bought the FIPS drive as an accessory.

Table 7-4 HDD part numbers

Description	Part number
Self-Encrypting Drive, SED (HDD)	L41606-011
Federal Information Processing Standards Drive, FIPS (HDD)	L42243-021
*See NOTE above	*See NOTE above

For instructions: See the Repair Service Manual for this product..

Internal disk not initialized

The internal hard disk drive file system must be initialized before it can be used.

Recommended action

Follow these troubleshooting steps in the order presented.

- Initialize the internal hard disk drive file system.

For information on performing various actions on the hard disk drive, go to:

[HP LaserJet, OfficeJet, PageWide, ScanJet - HP FutureSmart Firmware Device Hard Disk, SSD, and eMMC Security \(white paper\)](#)

Internal disk spinning up

The internal hard disk drive device is spinning up its platter. Jobs that require hard disk drive access must wait.

Recommended action

See recommended action.

- No action necessary.

Job not stapled due to mixed sizes

This message is displayed when the job to be stapled has more than one paper size (paper width).

Recommended action

Follow these troubleshooting steps in the order presented.

- Paper with different widths cannot be stapled. Use the same width paper for the entire print job.

Load Tray <X>: [Type], [Size]

Load paper in Tray X as specified.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

- Load paper in specified tray.

If this message appears even though there is paper loaded in the tray, perform the following.

Follow these troubleshooting steps in the order presented.

1. Use the sensor tests to verify that the tray sensors are functioning correctly.
2. Make sure that the sensor flag on the paper presence sensor is not damaged and moves freely.
3. Reconnect the corresponding connector for the paper tray having the issue.

Load Tray <X>: [Type], [Size] To use another tray, press “OK”

This message appears when the indicated tray is selected but is not loaded, and other paper trays are available for use. It also appears when the tray is configured for a different paper type or size than the print job requires.

Recommended action

Use the following steps to resolve the error.

1. Load the correct paper in the tray.
2. If prompted, confirm the size and type of the paper loaded.
3. Otherwise, press the [OK](#) button to select another tray.

Loading program <XX> Do not power off

Programs and fonts can be stored on the printer's file system and are loaded into RAM when the printer is turned on. The number <XX> specifies a sequence number indicating the current program being loaded.

Recommended action

See recommended action.

- No action necessary.

Manually feed: <Type><Size>

This message appears when manual feed is selected, Tray 1 is not loaded, and other trays are empty.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Load the tray with requested paper.
2. If the paper is already in the tray, press the [Help](#) button to exit the message and then press the [OK](#) button to print.
3. To use another tray, clear paper from Tray 1, press the [Help](#) button to exit the message and then press the [OK](#) button.

Manually feed: <Type><Size> To use another tray, press “OK”

This message appears when manual feed is selected, Tray 1 is loaded, and other trays are available.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Load the tray with requested paper.
2. If the paper is already in the tray, press the [Help](#) button to exit the message and then press the [OK](#) button to print.
3. To use another tray, clear paper from Tray 1, press the [Help](#) button to exit the message and then press the [OK](#) button.

Manually feed output stack Then touch "OK" to print second side

The printer has printed the first side of a manual duplex job and is waiting for you (or the applicable user) to insert the output stack to print the second side.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Maintaining the same orientation, remove the pages from the output bin.
2. Flip the document printed side up.
3. Load the document in Tray 1.
4. Touch the **OK** button to print the second side of the job.

Moving solenoid

The solenoid is moving as part of a component test.

Recommended action

Follow these troubleshooting steps in the order presented.

- To exit press **X**.

Moving solenoid and motor

The solenoid and a motor are moving as part of a component test.

Recommended action

Follow these troubleshooting steps in the order presented.

- To exit press **X**.

No job to cancel

You have pressed the stop button but the printer is not actively processing any jobs.

Recommended action

See recommended action.

- No action necessary.

NON HP Supply Installed

This message is displayed for about 6 seconds when a new non-HP supply is installed.

10.99.31 (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

1. Use a genuine HP supply for the printer.
2. If you believe a genuine HP supply is being used, go to www.hp.com/go/anticounterfeit.

Output Bin Full


This message appears even though the output bin is not full.

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Make sure that the output bin sensor flag is not damaged and can move freely. Try to manually lift the output bin actuator up and see if the actuator goes down (or is lowered).

Figure 7-7 Lift up the output bin full actuator

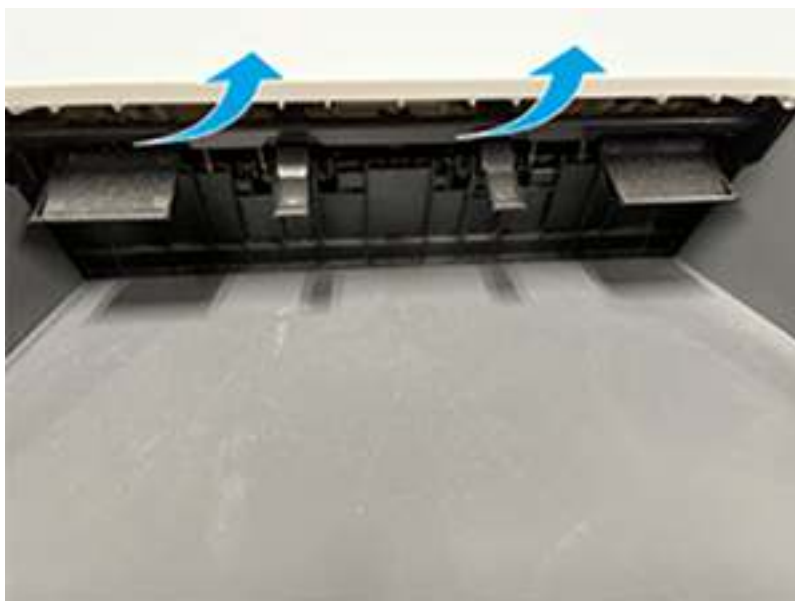

2. If the output bin sensor flag is damaged, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents (Remote support)

Follow these troubleshooting steps in the order presented.

Use the following procedure to access the [Manual Sensor Test](#) from the printer control panel to verify the output bin sensor flag is functioning correctly.

1. From the Home screen on the printer control panel, scroll to and touch the [Administration](#) (FutureSmart 3), or [Support Tools](#) (FutureSmart 4).

 **NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.

2. Open the following menus: **Troubleshooting > Diagnostic Tests > Manual Sensor Test**.


3. Select the [SR4 Output Bin Full Sensor](#).

Figure 7-8 SR4 Output Bin Full Sensor



4. Lift the output bin full actuator up and verify the toggle counter under the sensor name is incremented from "0" to "1" on the control panel.
 - If the toggle counter under the sensor name toggles from "0" to "1", the output sensor flag is functioning correctly and the diagnostic test is successful.
 - If the toggle counter under the sensor name does not toggle, the output sensor flag is not functioning correctly and the diagnostic test fails.

Figure 7-9 Lift up the output bin full actuator

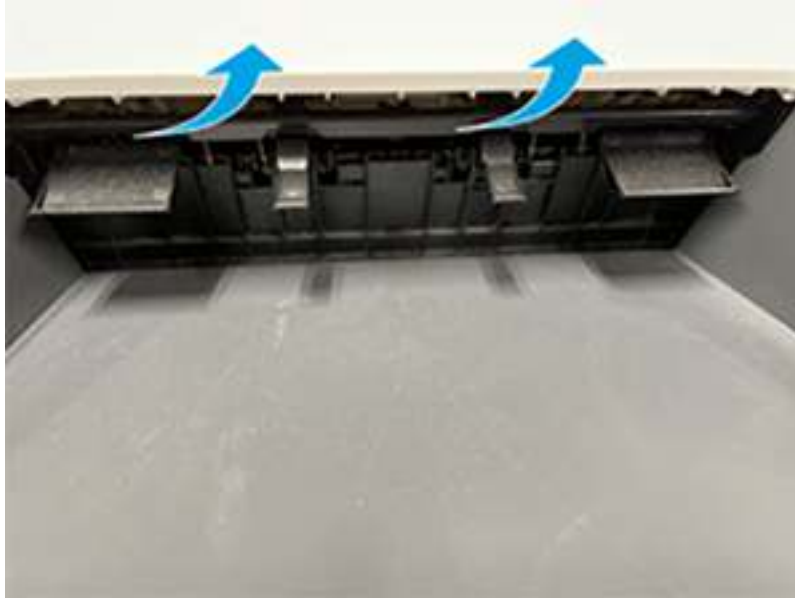

5. If the diagnostic test fails and the sensor does not toggle, the printer needs to be replaced.
6. If the diagnostic test is successful and the issue persists, send a service technician to diagnose the issue.

Recommended action for onsite technicians

Follow these troubleshooting steps in the order presented.

1. Make sure that the output bin sensor flag is not damaged and can move freely.
2. Access the [Manual Sensor Test](#) from the printer control panel to verify the output bin sensor flag is functioning correctly.
 - a. From the Home screen on the printer control panel, scroll to and touch the [Administration](#) (FutureSmart 3), or [Support Tools](#) (FutureSmart 4).



NOTE: The control panel menu options might vary depending on the printer model and firmware version installed.

- b. Open the following menus: **Troubleshooting > Diagnostic Tests > Manual Sensor Test.**


- c. Select the [SR4 Output Bin Full Sensor](#).

Figure 7-10 SR4 Output Bin Full Sensor




- d. Lift the output bin full actuator up and verify the toggle counter under the sensor name is incremented from "0" to "1" on the control panel.
- If the toggle counter under the sensor name toggles from "0" to "1", the output sensor flag is functioning correctly and the diagnostic test is successful.
 - If the toggle counter under the sensor name does not toggle, the output sensor flag is not functioning correctly and the diagnostic test fails.

Figure 7-11 Lift up the output bin full actuator

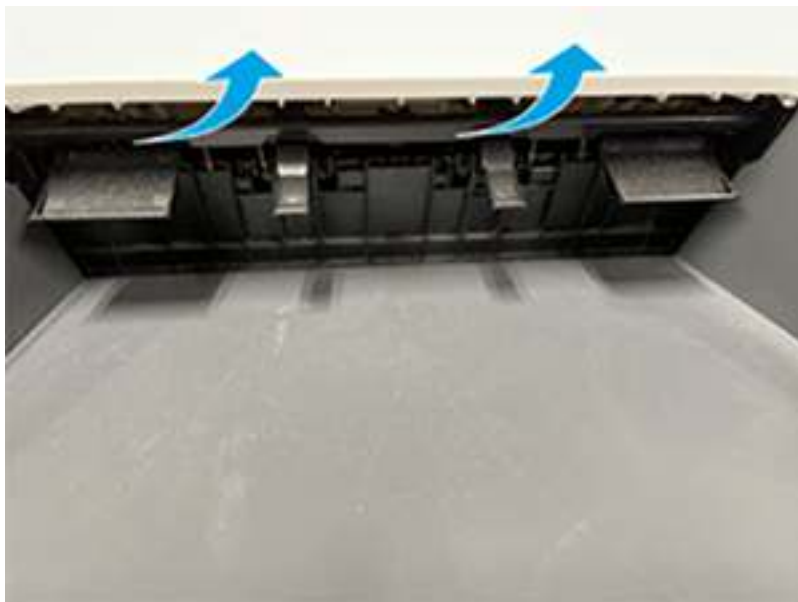

3. If the diagnostic test fails and the sensor does not toggle, the printer needs to be replaced.
 4. If the diagnostic test is successful and the issue persists, check if the fuser output sensor flag is functioning correctly.
 - a. From the Home screen on the printer control panel, scroll to and touch the [Administration](#) (FutureSmart 3), or [Support Tools](#) (FutureSmart 4).
-
-  **NOTE:** The control panel menu options might vary depending on the printer model and firmware version installed.
-
- b. Open the following menus: **Troubleshooting > Diagnostic Tests > Manual Sensor Test.**
 - c. Select the [SR13 Fuser Output Sensor](#).

Figure 7-12 SR13 Fuser Output Sensor

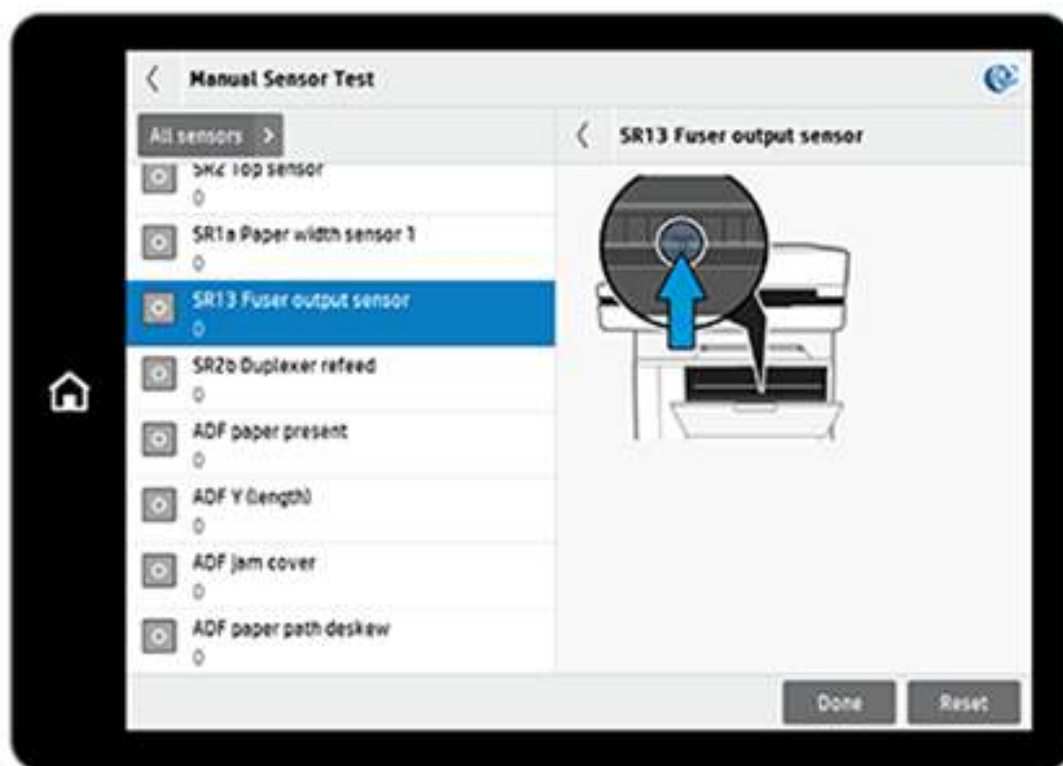

- d. Manually toggle the sensor and verify that the toggle counter under the sensor name increments accordingly.
5. If the sensor does not toggle and the sensor flag fails to function correctly, replace the fuser assembly.

Table 7-5 Fuser assembly (For 110V and 220V) part numbers

Part description	Part number
Fuser assembly - For 110 VAC <i>Bonds toner to the paper with heat.</i>	RM2-2585-000CN
Fuser assembly - For 220 VAC <i>Bonds toner to the paper with heat.</i>	RM2-2586-000CN

For instructions: See the Repair Service Manual for this product.

6. If the error persists, replace the DC controller.

Table 7-6 DC Controller part numbers

Printer models	Part description	Part number
M501dn/ M501n	DC controller PCA	RM2-8711-030CN
M506	For duplex models - DC controller PC board assembly (PCA)	RM2-8612-000CN
M527		
E52545		

Table 7-6 DC Controller part numbers (continued)

Printer models	Part description	Part number
M506 E50045	For simplex models - DC controller PC board (PCA)	RM2-8614-000CN
M507 M528 E52645	For duplex models - DC controller PC board assembly (PCA)	RM3-7475-010CN
M507 E50145	For simplex models - DC controller PC board assembly (PCA)	RM3-7476-000CN

For instructions: See the Repair Service Manual for this product.

7. If issue persists, elevate the issue using the Standard Support Process for a possible printer replacement.

Paused...

The printer is paused, and there are no error messages pending at the display. The I/O continues receiving data until the memory is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Press the [Stop](#) button.

Performing Paper Path Test

A paper path test is being performed.

Recommended action

See recommended action.

- No action necessary.

Please Wait...

The printer is in the process of clearing data.

Recommended action

See recommended action.

- No action necessary.

Printing Cleaning Page...

The printer is printing the cleaning page.

Recommended action

See recommended action.

- No action necessary.

Printing Configuration...

The printer is printing the Configuration page.

Recommended action

See recommended action.

- No action necessary.

Printing engine test...

The printer is printing an engine test page.

Recommended action

See recommended action.

- No action necessary.

Printing Event Log...

The printer is printing the Event Log page.

Recommended action

See recommended action.

- No action necessary.

Printing File Directory...

The printer is printing the File Directory pages.

Recommended action

See recommended action.

- No action necessary.

Printing Font List...

The printer is printing the Font List pages.

Recommended action

See recommended action.

- No action necessary.

Printing Help Page...

The printer is printing the Help page.

Recommended action

See recommended action.

- No action necessary.

Printing Menu Map...

The printer is printing the Menu Map pages.

Recommended action

See recommended action.

- No action necessary.

Printing Registration Page

The printer is printing the Registration pages.

Recommended action

See recommended action.

- No action necessary.

Printing stopped...

Time has expired on the Print/Stop test.

Recommended action

See recommended action.

- No action necessary.

Printing Supplies Status Page...

The printer is printing the Supplies Status page.

Recommended action

See recommended action.

- No action necessary.

Printing Usage Page...

The printer is printing the Usage page.

Recommended action

See recommended action.

- No action necessary.

Processing...

The printer is currently processing a job but is not yet picking pages. When paper motion begins, this message is replaced by a message that indicates the tray the job is using.

Recommended action

See recommended action.

- No action necessary.

Processing... copy <x> of <y>

The printer is currently processing or printing collated copies. The message indicates that copy number <x> of total copies <y> is currently being processed.

Recommended action

See recommended action.

- No action necessary.

Processing duplex job Do not grab paper until job completes

Paper temporarily comes into the output bin while printing a duplex job.

Recommended action

See recommended action.

- No action necessary.

Processing job from tray <x>... Do not grab paper until job completes

The printer is actively processing a job from the designated tray.

Recommended action

See recommended action.

- No action necessary.

Ready

The printer is online and ready for data. No status or printer attendance messages are pending at the display.

Recommended action

See recommended action.

- No action necessary.

RAM disk device failure To clear press "OK"

The specified device failed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

RAM disk file operation failed To clear press “OK”

A PjL command was received that attempted to perform an illegal operation, such as downloading a file to a nonexistent directory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

RAM disk file system is full To clear press “OK”

The RAM disk is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

RAM disk is write protected To clear press “OK”

The device is protected and no new files can be written to it.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

RAM disk not initialized

The RAM disk file system must be initialized before it can be used.

Recommended action

Follow these troubleshooting steps in the order presented.

- Initialize the RAM disk file system.

Ready <IP Address>

The printer is online and ready for data. No status or printer attendance messages are pending at the display. The printer IP address displays.

Recommended action

See recommended action.

- No action necessary.

Receiving Upgrade

The printer is receiving a firmware upgrade.

Recommended action

Follow these troubleshooting steps in the order presented.

- Do not turn the printer off until it reaches the [Ready](#) state.

Remove USB accessory

This message displays when an unsupported USB device is inserted into a host USB port on the printer.

Recommended action

Follow these troubleshooting steps in the order presented.

- Remove the unsupported USB device.

Replace <supply>

This alert appears only if the printer is configured to stop when a supply reaches the very low threshold. The printer indicates when a supply level is at its estimated end of life. The actual life remaining might be different than estimated.

The supply does not need to be replaced now unless the print quality is no longer acceptable.



NOTE: HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

The printer can be configured to stop when the supply level is very low. The supply might still be able to produce acceptable print quality.

- **10.00.70** (event code)

Black toner cartridge

- **10.23.70** (event code)

Fuser Kit

Recommended action

Follow these troubleshooting steps in the order presented.

1. Replace the specified supply.
2. Or, configure the printer to continue printing by using the [Manage Supplies](#) menu.

Replace supplies

This alert appears only if the printer is configured to stop when a supply reaches the very low threshold. The printer indicates when a supply level is at its estimated end of life. The actual life remaining might be different than estimated.

The supply does not need to be replaced now unless the print quality is no longer acceptable.

HP recommends that the customer have a replacement supply available to install when print quality is no longer acceptable.

Recorded event codes depend on which supplies are at the end of life.

- **10.00.70** (event code)
Black toner cartridge
- **10.23.70** (event code)
Fuser Kit

Recommended action

Follow these troubleshooting steps in the order presented.

1. Touch the **OK** button to find out which supplies need to be replaced.
2. Or, configure the printer to continue printing by using the **Manage Supplies** menu.

Resend external accessory firmware

An external accessory requires a firmware upgrade. Printing can continue, but jams might occur if the job uses the external accessory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Perform a firmware upgrade.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

Resend Upgrade

A firmware upgrade did not complete successfully.

Recommended action

Follow these troubleshooting steps in the order presented.

- Upgrade the firmware again.

For the latest firmware versions, go to: [HP FutureSmart - Latest Firmware Versions](#)

Restore Factory Settings

The printer is restoring factory settings.

Recommended action

See recommended action.

- No action necessary.

ROM disk device failed To clear press “OK”

The specified device failed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

ROM disk file operation failed To clear press “OK”

A PjL command was received that attempted to perform an illegal operation, such as downloading a file to a nonexistent directory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

ROM disk file system is full To clear press “OK”

The specified device is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

ROM disk is write protected To clear press “OK”

The device is protected and no new files can be written to it.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

ROM disk not initialized To clear press “OK”

The ROM disk file system must be initialized before it can be used.

Recommended action

Follow these troubleshooting steps in the order presented.

- Initialize the ROM disk file system.

Rotating Motor

The printer is executing a component test and the component selected is a motor.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Press the **STOP** button when ready to stop this test.
2. To exit, press **X**.

Size Mismatch

This message appears even though the correct size paper is loaded in the correct paper tray.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Use the Tray 2 size switch test in the Tray/Bin manual sensor test to test the switch.
2. If sensor test does not respond, reconnect the connector on the Tray 2 paper size switch, and then reconnect connector on the DC controller.
3. If the error persists, elevate the issue using the Standard Support Process for a possible printer replacement.

Size mismatch in Tray <x>

The paper in the listed tray does not match the size specified for that tray.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Load the correct paper.
2. Make sure that the paper is positioned correctly.
3. Close the tray, and then make sure that the control panel lists the correct size and type for the specified tray.
4. If necessary, use the control panel menus to reconfigure the size and type settings for the specified tray.
5. If error persists, use the tray/bin manual sensor test to test the switch.

Sleep mode on

The printer is in sleep mode. Pressing a control-panel button, receiving a print job, or occurrence of an error condition clears this message.

Recommended action

See recommended action.

- No action necessary.

Supplies low

Multiple supplies on the printer have reached the low threshold.

Recommended action

Follow these troubleshooting steps in the order presented.

- Replace the supply when print quality is no longer acceptable.

Supply memory warning

The printer cannot read or write to the e-label or the e-label is missing.

Recommended action

See recommended action.

- No action necessary.

Supply low

The printer indicates when a supply level, or more than one supply, is low. Actual toner cartridge life might vary. You do not need to replace the toner cartridge at this time unless print quality is no longer acceptable.

When multiple supplies are low, more than one event code is recorded.

- **10.00.60** (event code)
Black toner cartridge
- **10.23.60** (event code)
Fuser Kit

Recommended action

Follow these troubleshooting steps in the order presented.

- If print quality is no longer acceptable, replace the supply.

HP recommends that the customer have a replacement supply available to install when print quality is no longer acceptable.



NOTE: When an HP supply has reached its approximated end of life, the HP Premium Protection Warranty ends.

Supply very low OR Supplies very low

The printer indicates when a supply level, or more than one supply, is very low. Actual toner cartridge life might vary. You do not need to replace the toner cartridge at this time unless print quality is no longer acceptable.

When multiple supplies are low, more than one event code is recorded.

- **10.00.70** (event code)
Black toner cartridge
- **10.23.70** (event code)
Fuser Kit

Recommended action

Follow these troubleshooting steps in the order presented.

- If print quality is no longer acceptable, the customer must purchase and replace the supply.

HP recommends that the customer have a replacement supply available to install when print quality is no longer acceptable.



NOTE: When an HP supply has reached its approximated end of life, the HP Premium Protection Warranty ends.

The unit has corrupt data

Data corruption has occurred in the firmware volume.

- 98 . 00 . 01 : Corrupt data in the firmware volume
- 98 . 00 . 02 : Corrupt data in the solutions volume
- 98 . 00 . 03 : Corrupt data in the configuration volume
- 98 . 00 . 04 : Corrupt data in the job data volume

Recommended action for 98.00.01, 98.00.02, and 98.00.03

Follow these troubleshooting steps in the order presented.

For 98 . 00 . 01 , 98 . 00 . 02 , and 98 . 00 . 03 , perform the following steps:

1. Turn the printer off, and then on.
2. Use the [Format Disk](#) item in the [Preboot](#) menu.

For the steps to perform a Clean or Format Disk procedure, search for "HP LaserJet Enterprise, HP LaserJet Managed - Various methods to clean the hard disk drives or solid-state drives" (ish_4502973-4502949-16) - .

3. Reload the firmware.

Recommended action for 98.00.04

Follow these troubleshooting steps in the order presented.

For 98 . 00 . 04 , perform the following steps:

1. Turn the printer off, and then on.
2. Run the file erase function.

For the steps to perform this procedure, go to WISE and search for the following document: HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure (c03398779).

Tray <X> empty: [Type], [Size]

The specified tray is empty and the current job does not need this tray to print.

- X = 1
Tray 1
- X = 2

Tray 2

- X = 3

Tray 3

- X = 4

Tray 4

- X = 5

Tray 5

Recommended action for customers

Follow these troubleshooting steps in the order presented.

1. Refill the tray at a convenient time.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents

Follow these troubleshooting steps in the order presented.

1. Identify which Tray the error is occurring on. This will help focus subsequent troubleshooting.
2. Once the Tray has been identified, refill the tray at a convenient time.
3. If the message continues when the paper tray is properly loaded, swap the tray cassette with another from the printer that is the same size and check if the error follows the cassette. Replace the cassette tray as needed.



NOTE: NOTE: If the error is occurring with the Multipurpose Tray (also known as the MP Tray or Tray 1), the ability to swap cassette trays is not applicable. Continue to next Troubleshooting steps of testing the appropriate Tray Paper Presence sensor.

Try actuating the tray paper present sensor flag (See the Troubleshooting manual - pg. 164) and check for any damage of the part. If it is damaged, replace the listed part for the targeted Tray.

- The Tray 1 media-out sensor (PS205) detects whether paper is present in Tray 1.

If Tray 1 media-out sensor (PS205) is damaged, dispatch an Onsite Technician with the Cartridge door assembly:

PS205 Tray 1 paper sensor Part Number: F2A68-67914

- The Tray 2 media-out sensor (PS3) detects the presence of paper in Tray 2.

If Tray 2 media-out sensor (PS3) is damaged, dispatch an Onsite Technician with the Paper Cassette Tray:

Paper cassette tray (cassette tray only, no feeder) - Part Number: RM2-5758-000CN

- The accessory Trays (3-6) media-out sensor (PS451) detects the presence of paper in accessory Trays

If accessory Tray media-out sensor (PS451) is damaged, dispatch an Onsite Technician with 1x550 Sheet Feeder Assembly:

Part Number: F2A72-67901

Recommended action for onsite technician

Follow these troubleshooting steps in the order presented.

1. Identify which Tray the error is occurring on. This will help focus subsequent troubleshooting.
2. Once the Tray has been identified, refill the tray at a convenient time.
3. If the message continues when the paper tray is properly loaded, swap the tray cassette with another from the printer that is the same size and check if the error follows the cassette. Replace the cassette tray as needed.



NOTE: NOTE: If the error is occurring with the Multipurpose Tray (also known as the MP Tray or Tray 1), the ability to swap cassette trays is not applicable. Continue to next Troubleshooting steps of testing the appropriate Tray Paper Presence sensor.

Try actuating the tray paper present sensor flag (See the Troubleshooting manual - pg. 164) and check for any damage of the part. If it is damaged, replace the listed part for the targeted Tray.

- The Tray 1 media-out sensor (PS205) detects whether paper is present in Tray 1.

If Tray 1 media-out sensor (PS205) is damaged, dispatch an Onsite Technician with the Cartridge door assembly:

PS205 Tray 1 paper sensor Part Number: F2A68-67914

For instructions: Removal and replacement: Cassette Tray See the Repair Service Manual for this product.

- The Tray 2 media-out sensor (PS3) detects the presence of paper in Tray 2.

If Tray 2 media-out sensor (PS3) is damaged, dispatch an Onsite Technician with the Paper Cassette Tray:

Paper cassette tray (cassette tray only, no feeder) - Part Number: RM2-5758-000CN

For instructions: Removal and replacement: Cassette Tray See the Repair Service Manual for this product.



NOTE: The paper presence (media-out) Sensor for Tray 2 is not an orderable part. If the cassette does not resolve the issue, elevate the case using your Region's Elevation Process.

- The accessory Trays (3-6) media-out sensor (PS451) detects the presence of paper in accessory Trays

If accessory Tray media-out sensor (PS451) is damaged, dispatch an Onsite Technician with 1x550 Sheet Feeder Assembly:

Part Number: F2A72-67901

For instructions: Removal and replacement: Cassette Tray See the Repair Service Manual for this product.

4. If the issue persists after replacing the part, elevate the case using your Region's Elevation Process.

Tray <X> lifting

The printer is in the process of lifting paper in the indicated tray.

- X = 2
Tray 2
- X = 3
Tray 3
- X = 4
Tray 4
- X = 5
Tray 5

Recommended action

See recommended action.

- No action necessary.

Tray <X> open

The specified tray is open or not closed completely.

- X = 2
Tray 2
- X = 3
Tray 3
- X = 4
Tray 4
- X = 5
Tray 5

Recommended action

Follow these troubleshooting steps in the order presented.

- Close the tray.

 **NOTE:** If this message appears after the lifter drive assembly was removed or replaced, make sure that the connector on the assembly is correctly connected and fully seated.

If the error persists, use the paper size switches test in the Tray/Bin manual sensor test to test the switches. If they do not respond, replace the associated lifter drive assembly.

Tray <X> overfilled

The tray is filled above the stack-height mark.

- X = 2
Tray 2
- X = 3
Tray 3
- X = 4
Tray 4
- X = 5
Tray 5

Recommended action

Follow these troubleshooting steps in the order presented.

- Remove enough paper so that the paper stack does not exceed the limit for the tray.

 **NOTE:** If this message appears after the lifter drive assembly was removed or replaced, make sure that the connector on the assembly is correctly connected and fully seated.

Type mismatch Tray <x>

The specified tray contains a paper type that does not match the configured type.

Recommended action

Follow these troubleshooting steps in the order presented.

The specified tray will not be used until this condition is addressed. Printing can continue from other trays.

1. Load the correct paper in the specified tray.
2. On the printer control panel, make sure the paper type loaded in the tray matches the specified setting for the tray.

Unsupported drive installed To continue, touch “OK”

A non-supported hard disk drive has been installed. The hard disk drive is unusable by this printer.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the hard drive.
3. Turn the printer on.

Unsupported supply in use OR Unsupported supply installed To continue, touch “OK”

A non-supported supply has been installed, or the toner cartridge is for a different HP printer.

- XX = 00

Black toner cartridge

Recommended action

Follow these troubleshooting steps in the order presented.

- Install the correct supplies for this printer. See the parts chapter in the service manual for supply part numbers.

Unsupported tray configuration

The printer has too many optional trays installed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn the printer off, remove the unsupported trays, and then turn the printer on.

Unsupported USB accessory detected Remove USB accessory

A non-supported USB accessory has been installed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Turn the printer off, remove the USB accessory, and then turn the printer on.

Upgrade Error

Scanner Control Board (SCB) upgrade error.

30.01.36 (event code)

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, and then on.
2. Re-send the upgrade.
3. If the error persists, replace the SCB.

For instructions: See the Repair Service Manual for this product.

Part number: B5L47-67903

USB accessory not functional

A parameter in the USB accessory is not correctly functioning.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off.
2. Remove the USB accessory.
3. Insert a replacement USB accessory.
4. Turn the printer on.

USB hubs are not fully supported Some operations may not work properly

Some USB hubs require more power than the printer has available.

Recommended action

Follow these troubleshooting steps in the order presented.

- Remove the USB hub.

USB is write protected To clear press "OK"

The device is protected and no new files can be written to it.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

USB needs too much power Remove USB and then turn off and on

A USB accessory is drawing too much electrical current. Printing cannot continue.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Turn the printer off, remove the USB accessory, and then turn the printer on.
2. Use a USB accessory that uses less power or that contains its own power supply.

USB not initialized

The USB device file system must be initialized before it can be used.

Recommended action

Follow these troubleshooting steps in the order presented.

1. Enable the USB port using the following steps:
 - **FutureSmart 3:**
 - a. From the Home screen on the printer control panel, open the following menus:
 - i. **Administration**

- ii. **General Settings**
 - b. Select **Enable Device USB**.
 - c. Select **Enabled**, and then select **Save**.
 - d. Touch the Back button  to return to the **General Settings** menu.
 - **FutureSmart 4:**
 - a. From the Home screen on the printer control panel, select **Settings**.
 - b. Select **Copy/Print**.
 - c. Select **Enable Device USB**, and then select **Enabled**.
 - d. Touch the Back button  to return to the **Settings** menu.
- 2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

USB storage accessory removed Clearing any associated data

This message displays for about 6 seconds after a USB device is removed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to remove this message.

USB storage device failure To clear press “OK”

The specified device failed.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

USB storage file operation failed To clear press “OK”

A PjL file system command was received that attempted to perform an illegal operation, such as downloading a file to a nonexistent directory.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

USB storage file system is full To clear press “OK”

The file system on the installed USB device is full.

Recommended action

Follow these troubleshooting steps in the order presented.

- Touch the **OK** button to clear the error.

Used supply installed To continue, touch “OK” OR Used supply in use

The toner cartridge has been previously used.

- XX = 00

Black toner cartridge

Recommended action

Follow these troubleshooting steps in the order presented.

- If you believe a genuine HP supply is being used, go to www.hp.com/go/anticounterfeit.

Waiting for tray <x> to lift

The specified tray is in the process of lifting paper to the top of the tray (so it can correctly feed).

Recommended action

See recommended action.

- No action necessary.

Windows Login Required to Use this Feature

Windows login required.

Recommended action

Follow these troubleshooting steps in the order presented.

- Enter your windows login.

Index

Symbols/Numerics

76.00.24 5

B

backup error
 32.WX.YZ error 4
 reset error 4
 restore error 4

C

connector error
 65.WX.YZ error 5

D

DC controller communication error
 55.WX.YZ error 4
DC controller firmware error
 70.WX.YZ error 5
digital sending error (firmware)
 44.WX.YZ error 4
document feeder error
 31.WX.YZ error 4
Drive partition error
 98.WX.YZ error 5
duplexer error
 69.WX.YZ error 5

E

Embedded Jetdirect error
 80.WX.YZ error 5
engine error (LaserJet)
 46.WX.YZ error 4
 63.WX.YZ error 5
engine error (PageWide)
 61.WX.YZ error 4
event log error (firmware)
 42.WX.YZ error 4

F

fan error
 58.WX.YZ error 4
firmware communication error
 49.WX.YZ error 4
firmware install error
 99.WX.YZ error 5
 Drive error 5

remote firmware upgrade
 error 5
fuser error
 41.WX.YZ error 4
 laser scanner error 4
 paper path error 4
fuser error (LaserJet)
 50.WX.YZ error 4

I

input accessory error
 67.WX.YZ error 5
input/output error
 40.WX.YZ error 4
internal diagnostics error
 90.WX.YZ error 5
video display error 5

J

jam error (LaserJet)
 13.WX.YZ error 3
jam error (PageWide)
 13.WX.YZ error 4
job accounting error (firmware)
 48.WX.YZ error 4
job management error
 (firmware) 4
job pipeline error (firmware) 4
job parser error (firmware)
 47.WX.YZ error 4
printer calibration error 4

L

laser scanner error (LaserJet)
 51.WX.YZ error 4
 52.WX.YZ error 4
last update 1

M

memory error
 82.WX.YZ error 5
 Drive error 5
 EMMC error 5
 SSD error 5
motor error (LaserJet)
 59.WX.YZ error 4

N

Near Field Communication error
 81.WX.YZ error 5
Bluetooth error 5
external I/O card error 5
internal EIO error 5
wireless error 5

O

output accessory error
 66.WX.YZ error 5
OXPD/Web kit error
 45.WX.YZ error 4

P

page error
 21.WX.YZ error 4
paper handling error (LaserJet)
 56.WX.YZ error 4
print bar error (PageWide)
 62.WX.YZ error 5
printer memory error
 20.WX.YZ error 4

R

real-time clock error
 11.WX.YZ error 3

S

scanner error
 30.WX.YZ error 4
security error
 33.WX.YZ error 4
sensor error
 54.WX.YZ error 4
 58.WX.YZ error 4
supplies error (LaserJet)
 10.WX.YZ error 3
supplies error (PageWide)
 17.WX.YZ error 4
system error (LaserJet)
 62.WX.YZ error 5

T

tray motor error (LaserJet)
 60.WX.YZ error 4