



Recommended splicing method 2 - Solder (For 14 AWG/1.9mm and Smaller Diameter Wire Only)

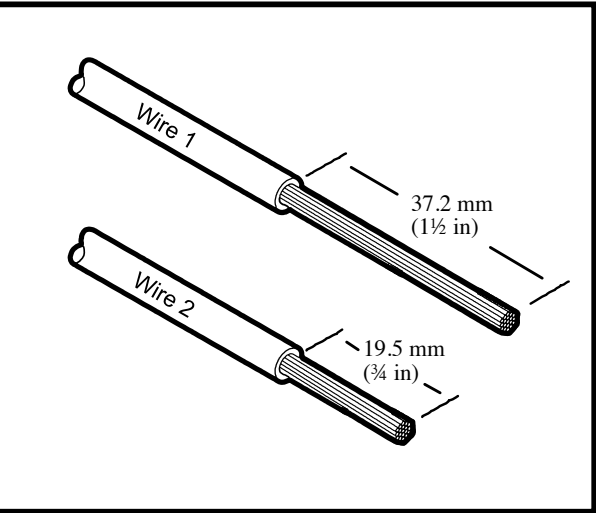


- 1. Disconnect battery ground cable.
- 2. Strip wires to appropriate length.

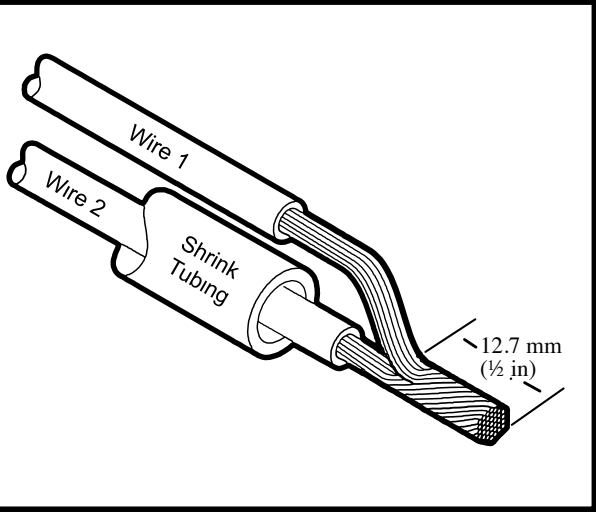


- 3. Install heat shrink tubing.
- 4. Twist wires together.
- 5. Solder wires together.

NOTE: Use rosin core mildly-activated (RMA) solder. Do not use acid core solder.


NOTE: Use Motorcraft heat shrinkable tubes:
Part # WT-56815 for 14-16 AWG
Part # WT-56814 for 18-22 AWG

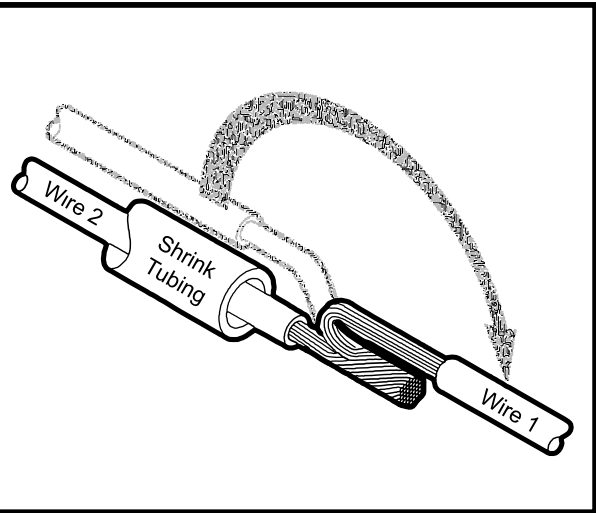

- 6. Bend wire 1 back in a straight line.
- NOTE:** Wait for solder to cool before moving wires.

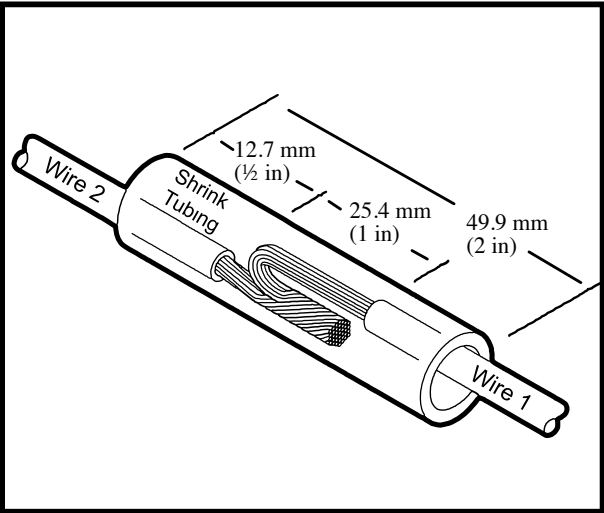

- 7. Evenly position heat shrink tubing over wire repair.
- NOTE:** Overlap tubing on both wires.

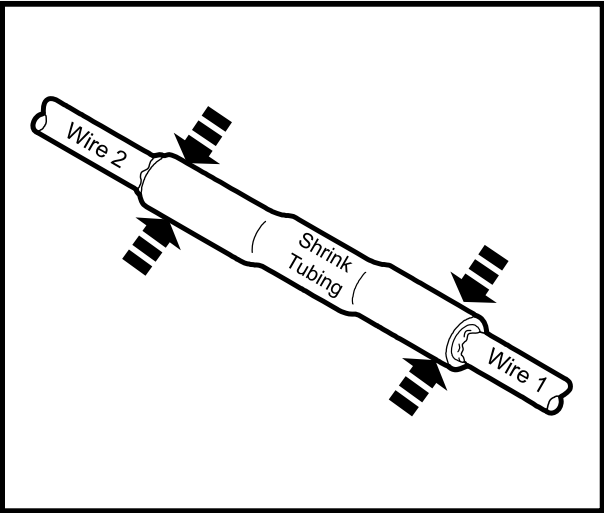

- 8. Use shielded heat gun to heat the repaired area until adhesive flows out of both ends of heat shrink tubing.
- NOTE:** On smaller wires, use pliers to gently squeeze the ends of the heat shrink sleeve (while heat shrink is still warm) to ensure a tight fit and close any air gaps
- 9. Reconnect battery ground cable.

