
CONCEPT A

Can-flipping robot · assembly manual · MF 2331/I

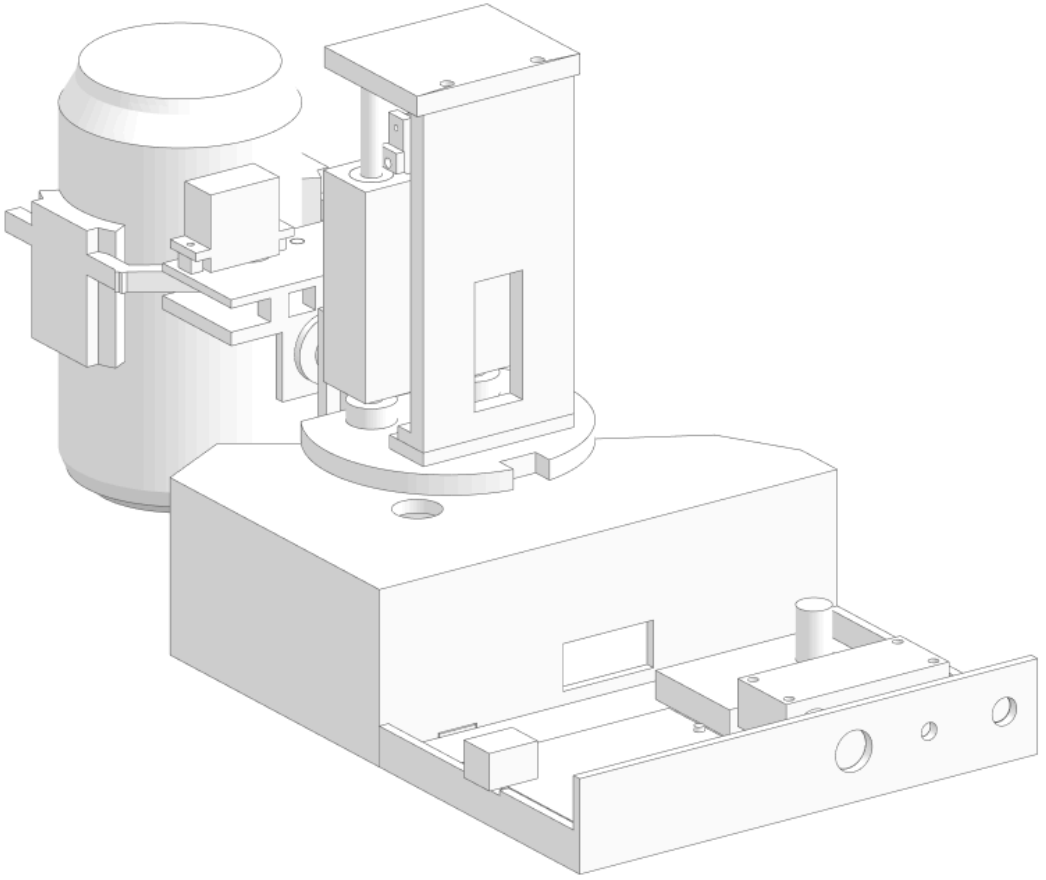

1 person · ~3 h after printing · read each page, then build. **Servo angles:** load `firmware/servo_setup` and type the command in the round badge (Serial Monitor, 9600).


You need

Tool
Phillips screwdrivers #1 and #2
Multimeter
Hot-glue gun
Superglue
Wire stripper
Small flat screwdriver (buck pot)
Hacksaw (6 mm rod) + file
Vise or clamp (bearing press)
12 mm drill bit, turned by hand


Hardware	Qty
 #6-32 × ½″	8
 #8-32 × ½″	4
 servo-bag screws	~14
6807-2RS bearing	1
LM6UU linear bearing	4
6 mm rod, cut 2 × 112 mm	2
Servos: MG996R / MG90S / SG90	1 / 2 / 1

! Before building: bench-test the electronics (docs/13_electronics_bench_test.md) and set the buck to **5.8 V**.


Printed parts

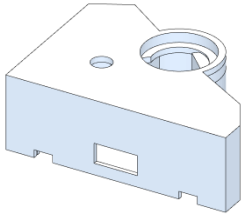


CA-101
Base

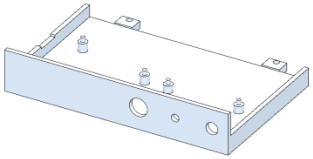


CA-102
Tray

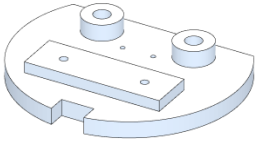


CA-201
Turret plate




CA-202
Spine

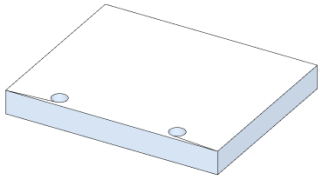


CA-203
Top cap




CA-301
Carriage arm




CA-302
Lift link

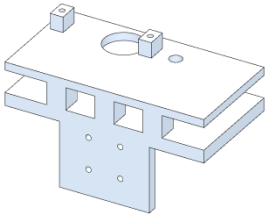

CA-401
Gripper frame

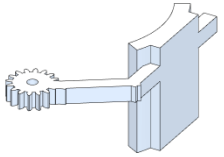


CA-402
Finger R



CA-403
Finger L


PART E

Electronics first: wire it flat on the table and test it while the parts print

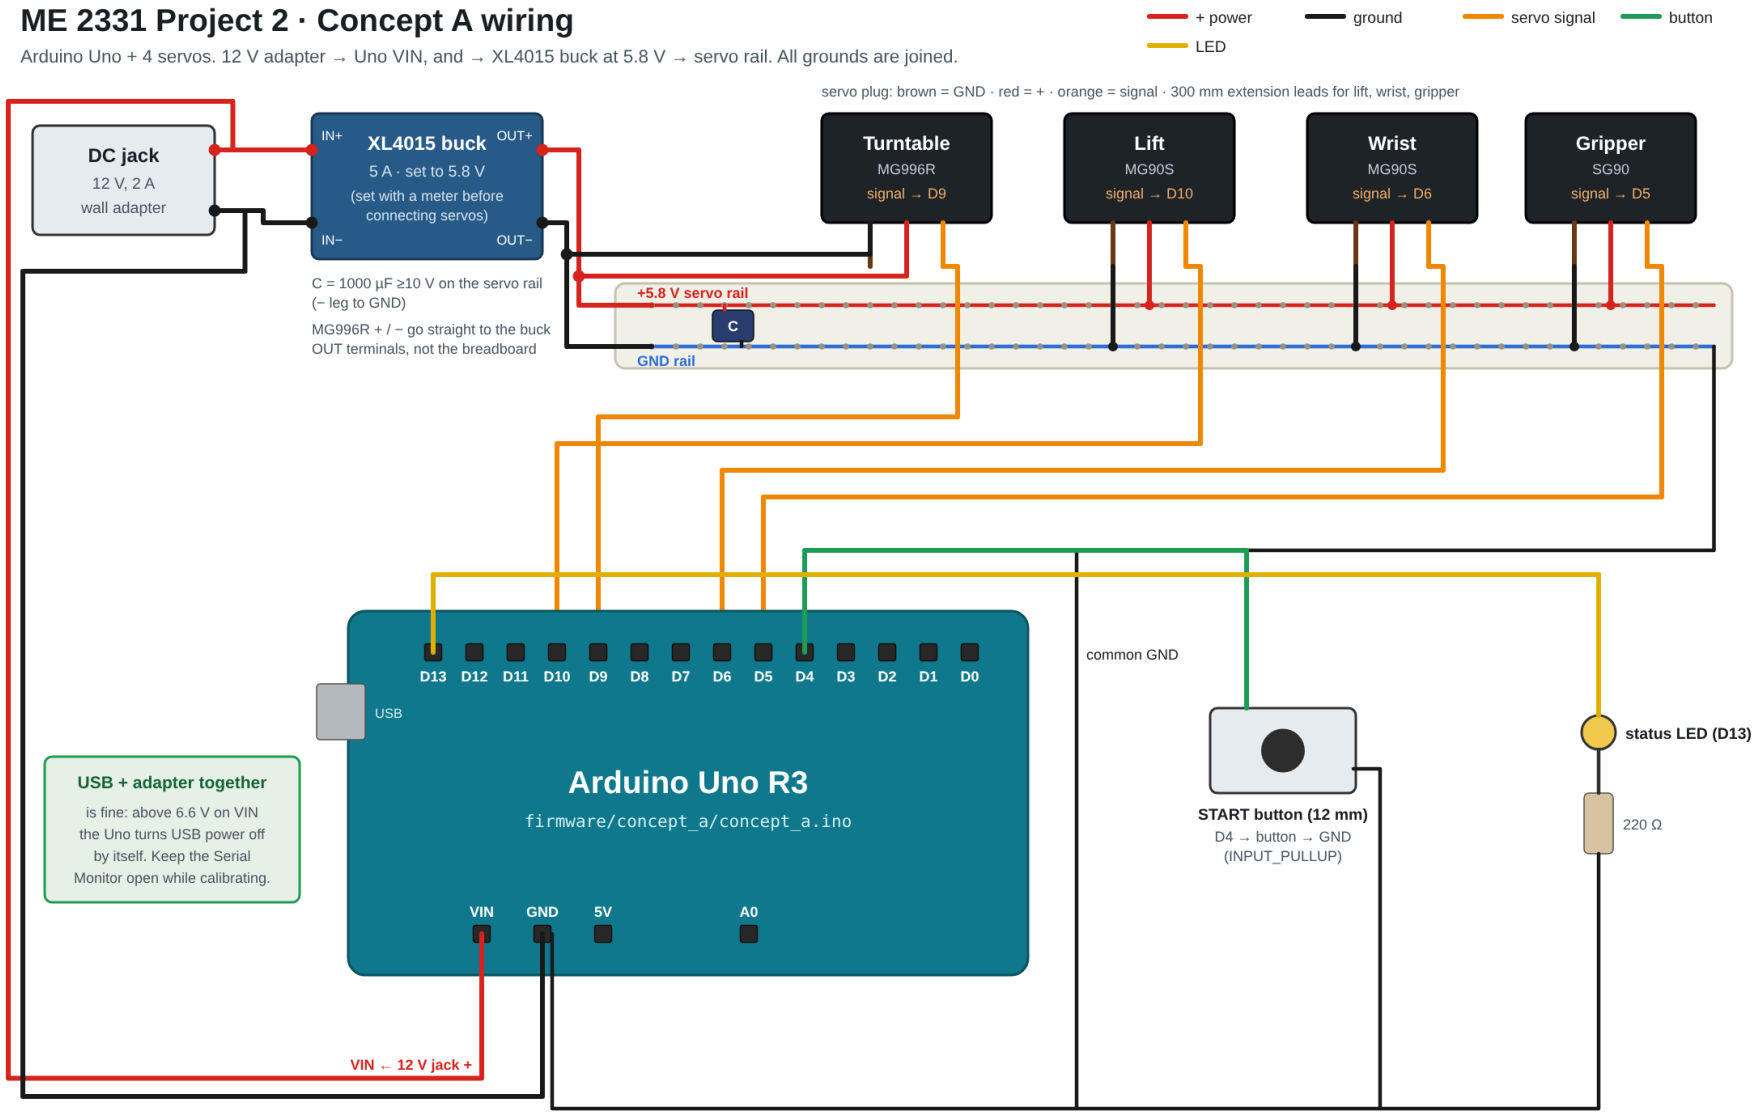

E1

Circuit: every connection

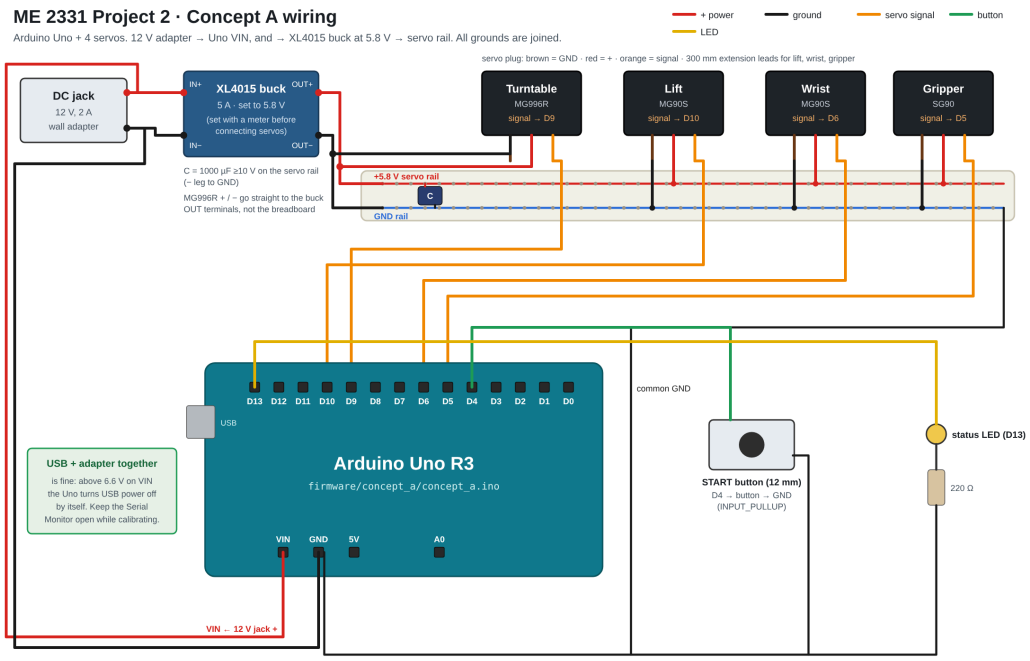

	From	To	Wire	Notes
☐	Jack +	XL4015 IN+ and Uno **VIN**	red	12 V. "Jack" = the DC panel jack or the LIZVOR terminal-block tip
☐	Jack −	XL4015 IN− and Uno **GND**	black	
☐	XL4015 OUT+ / OUT−	servo rail + / GND, and the MG996R's red / brown	red / black	5.8 V. MG996R power on the terminals, not the breadboard
☐	GND rail	Uno GND	black	common ground (servo signals need it)
☐	Turntable servo MG996R	signal → **D9** (+ / − at the buck terminals)	orange	One extension lead is cut to split its power from its signal
☐	Lift servo MG90S	signal → **D10**	orange	300 mm extension lead
☐	Wrist servo MG90S	signal → **D6**	orange	300 mm lead. Code widens its pulse range to 500–2500 µs to reach 180°
☐	Gripper servo SG90	signal → **D5**	orange	500 mm extension lead (or a taped jumper chain, see 11_bom)
☐	START button (12 mm)	**D4** → button → GND	green / black	`INPUT_PULLUP`, debounced in code
☐	Status LED	**D13** → 220 Ω → LED → GND	yellow / black	off = idle, blinking = moving, on = done

Never connect the 5.8 V rail to the Uno's 5V pin: the Uno gets 12 V on VIN only. Servo plug: brown = GND, red = +, orange = signal.

E2

Bench test 1: power, no servos yet

	#	Do	Check	Expected
☐	1	LIZVOR adapter, nothing connected, plain 5.5 × 2.1 mm tip	Display + meter on the tip (centre = +)	**12.0 V**, centre positive. Tape the knob
☐	2	Adapter → terminal-block tip → buck **IN+ / IN−**	Buck display / meter on **OUT+ / OUT−**	Turn the buck pot (many turns) to **5.8 V**. Dot of nail polish on the pot
☐	3	Buck OUT → breadboard **+ / −** rails. 1000 µF capacitor across the rails	Stripe on the capacitor = **−** rail	Rail reads 5.8 V
☐	4	Unplug. Uno on **USB only**, upload `bench_test`	Uno LED	Blinks 3×
☐	5	Adapter **+** → **Uno VIN**, **−** → **Uno GND**. Uno GND → rail **−** (common ground)	Unplug USB, plug the adapter	LED blinks 3× again (running on 12 V)
☐	6	START button: D4 ↔ GND. LED: D13 → 220 Ω → LED → GND	Press START	LED lights while pressed

Never connect the rail (5.8 V) to the Uno's 5V pin. The Uno gets 12 V on VIN only.

E3

Bench test 2: one servo at a time (firmware/bench_test)

Plug only the servo for the next test. Brown = GND (rail −), red = + (rail +), orange = signal (pin). The MG996R's + / − go to the **buck OUT terminals** (cut extension), its signal to D9.

	Test	Servo	Plug signal to	Press START, expect
☐	1	SG90 gripper	D5	Goes to 20°, wiggles ±10°, back
☐	2	MG90S wrist	D6	0°, wiggle to 20°, then **a full half-turn 0 → 180 → 0**: mark the horn and check it really reaches 180°
☐	3	MG90S lift	D10	30°, wiggles ±10°
☐	4	MG996R turntable	D9 (+/− on the buck)	135°, wiggles ±10°
☐	5	All four plugged in	—	All at HOME for 5 s. **Meter on the rail: stays above 5.5 V**

Each test: smooth, no buzzing, the Uno doesn't reset (no 3× blink in the middle).

E4

If something is wrong

	Symptom	Likely cause	Fix
☐	Uno resets (blinks 3×) when a servo moves	Rail sags or no common ground	Check Uno GND ↔ rail −, the 1000 µF capacitor, the MG996R on the buck terminals (not the breadboard)
☐	Servo buzzes / jitters	Signal without ground, loose jumper	Re-seat; shorter jumpers; ground first
☐	Servo doesn't move at all	Signal on the wrong pin, dead servo	Swap the plug to a known-good test; try the spare
☐	Wrist stops short of 180°	That MG90S's range	`servo_setup`: try `WRIST_MIN_US` / `WRIST_MAX_US` 450 / 2550; else swap MG90S (buy a spare)
☐	Rail below 5.5 V in test 5	Weak adapter / long thin wires	Shorter rail wires; check the adapter is at 12.0 V under load
☐	Buck gets hot	Pot set too high, short	Unplug, re-check OUT = 5.8 V with nothing connected

E5

Wiring dry run (decides what to return)

With the servos still loose, build the **jumper chains** (prototype v1 BOM): 2 jumpers per wire for the gripper, 1 for the wrist and lift, tape every joint. Re-run tests 1–5 through the chains.

• All pass, joints stay put when you tug and bend them → **return the extension leads**.

• A joint drops out or a servo resets → keep the extension leads.

Record the results (angles that looked right, rail voltage in test 5) in the build log: they go in the report's test section.


Then: PART M, the mechanics

Print plates 0–3 (cad/print/plates), then follow steps 1–23. Keep the bench-test wiring: it moves into the tray in step 21.

1

Bearing into the base

PART M

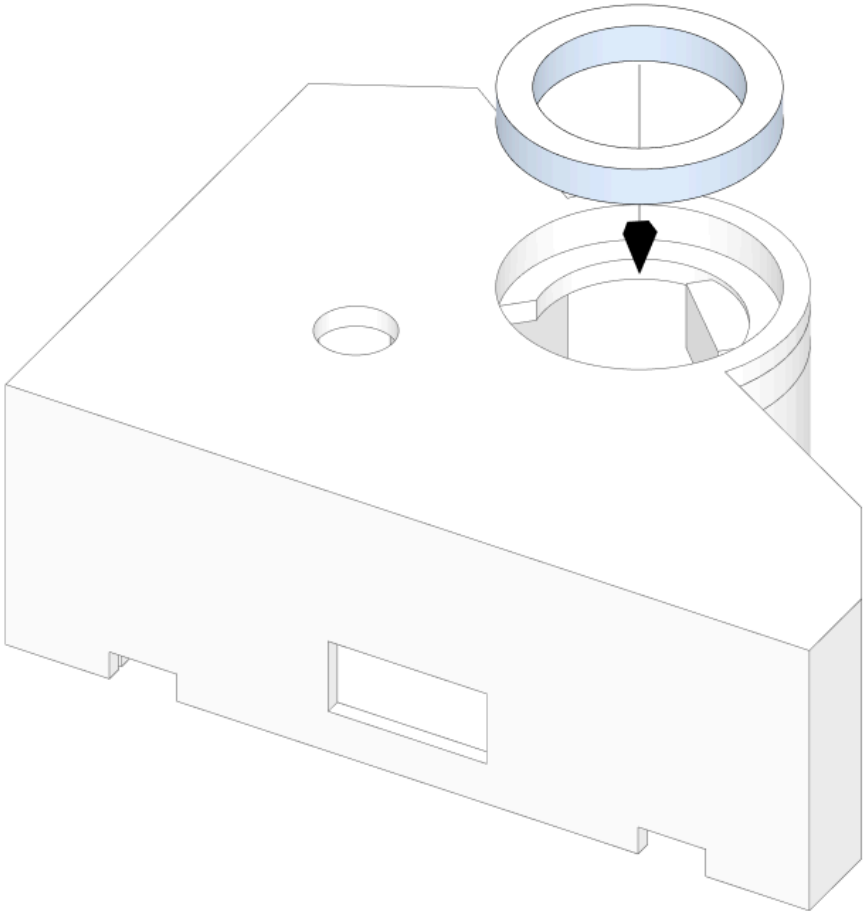


Press on the outer ring only, evenly (flat block + vise)

2

Turntable servo


4× #8-32 × ½″

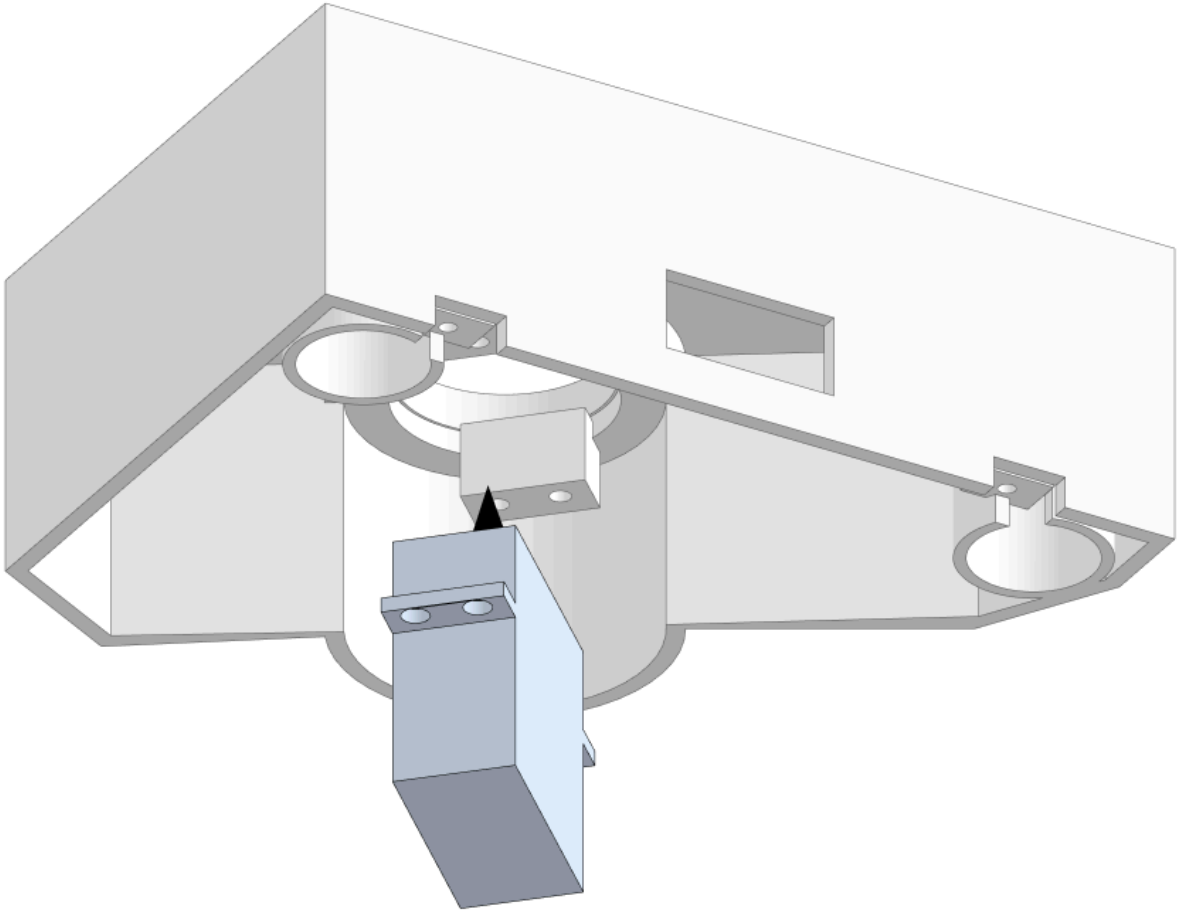

From underneath; body points away from the arm side

3

Weight + feet

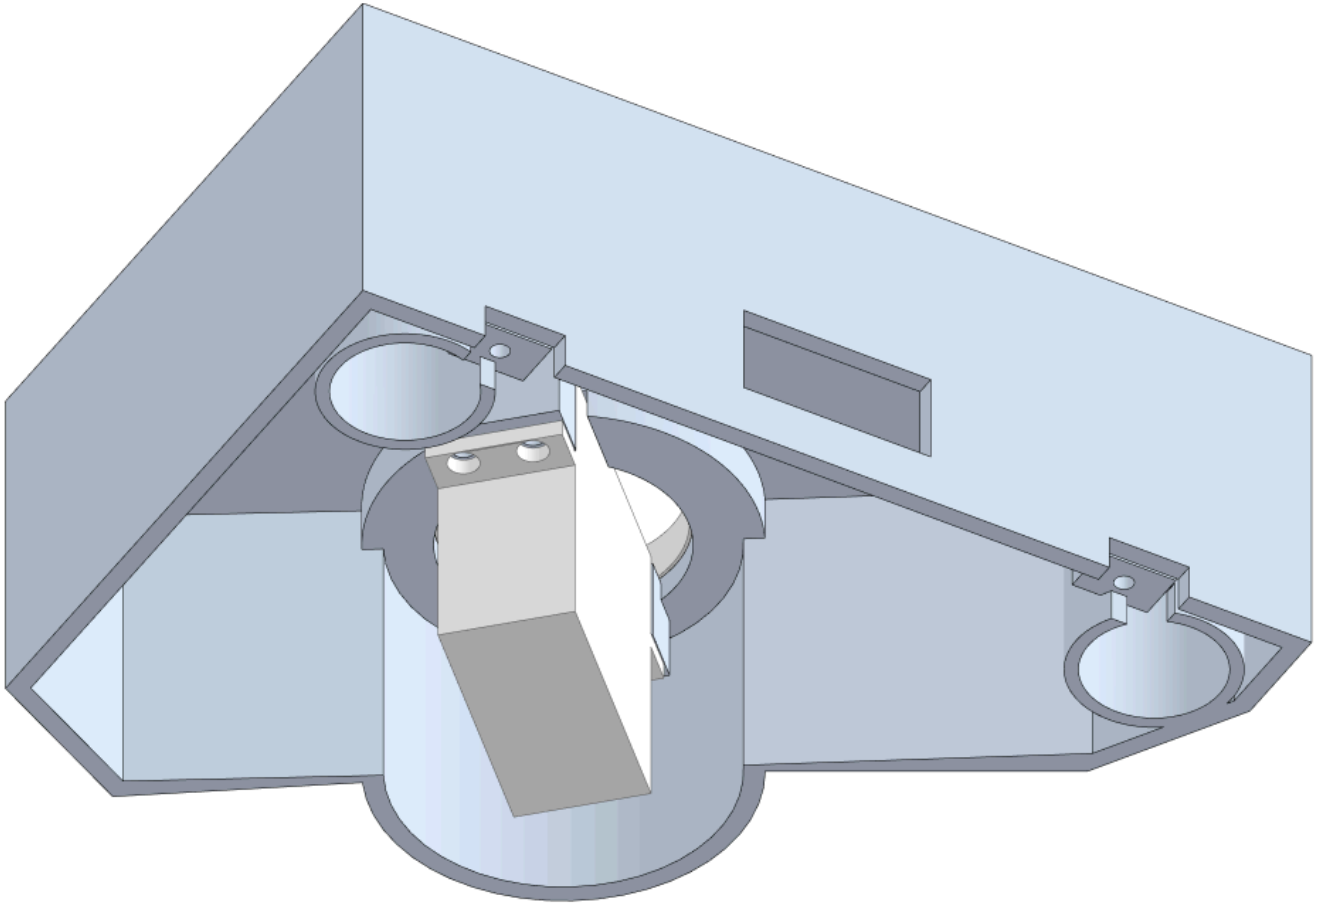


(!) ~100 g in the 2 back pockets (washers, pennies, rocks): GLUE or TAPE it in. 4 feet or hot-glue dots

4

Servo horn

1× servo-bag

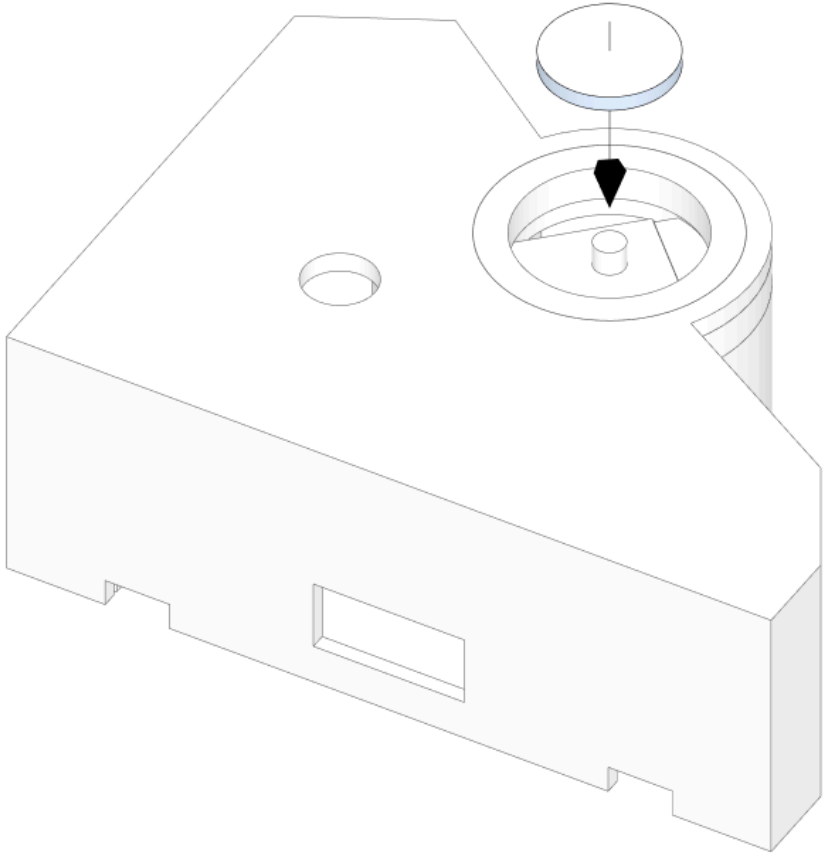

MG996R

135°


`t 135`

(!) Set the servo to 135° first (servo_setup: t 135)

5

Turret plate


4×  servo-bag

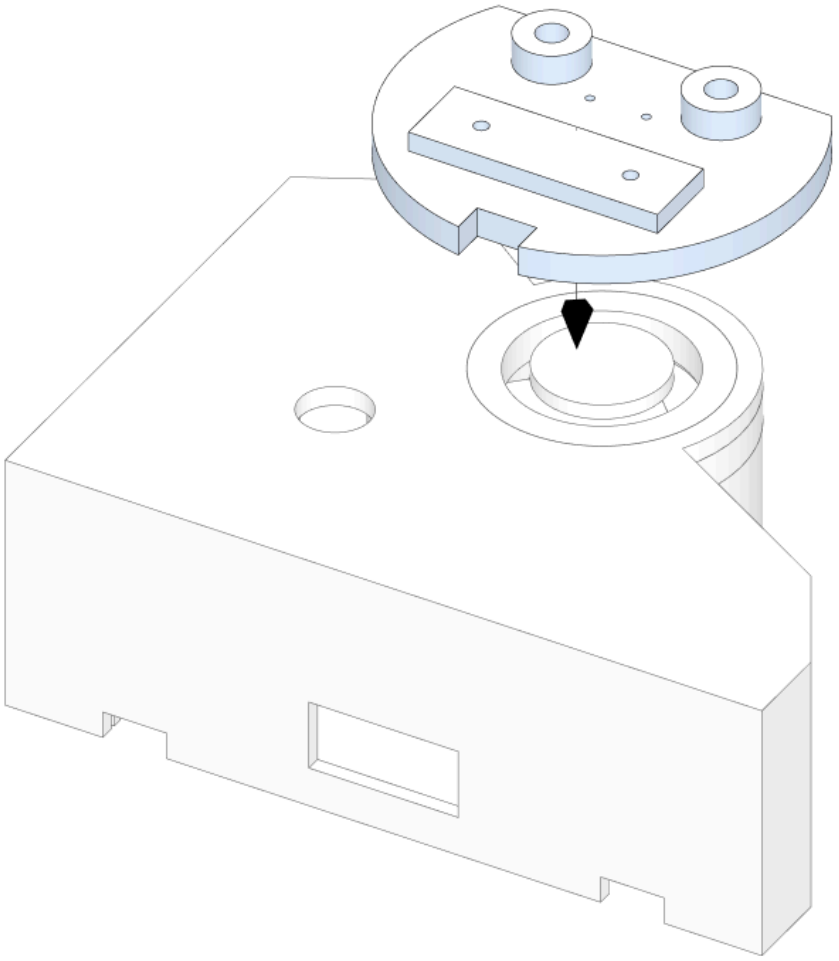

Hub into the bearing; rod bosses point at the START can. Turns 90° freely

6


Linear bearings into the carriage

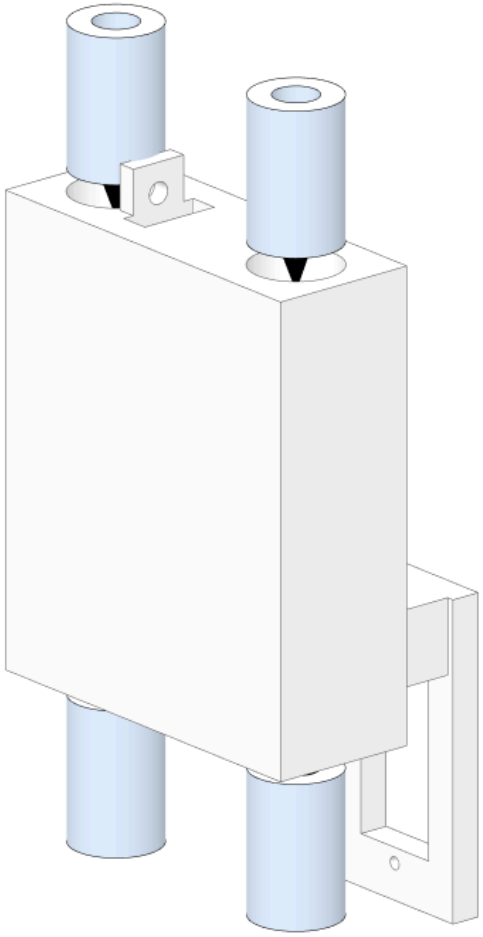

2 from below, 2 from above, flush with the faces

7


Rods

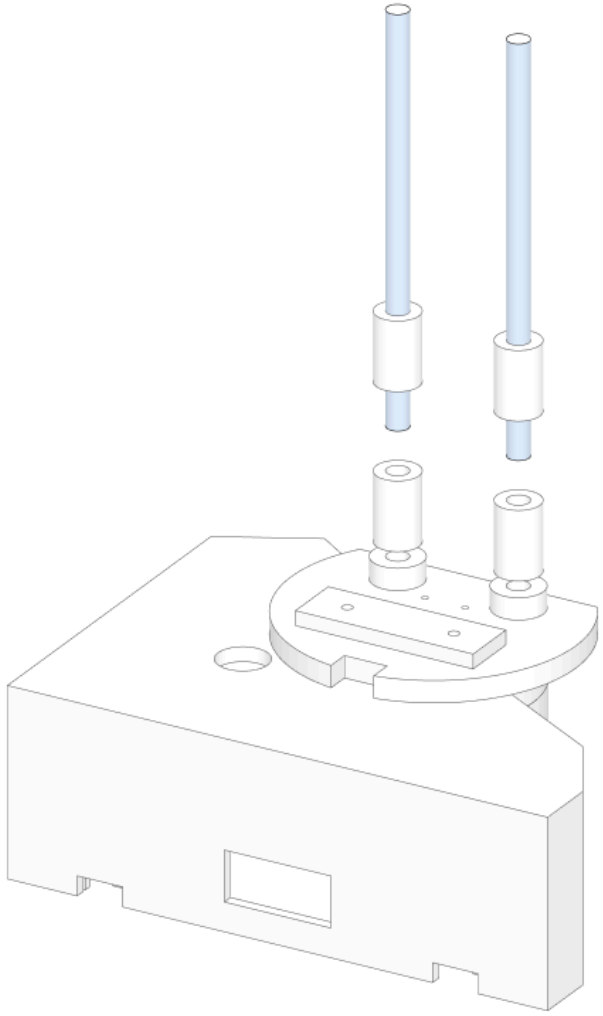

Press into the blind holes of the turret plate

8

Carriage onto the rods

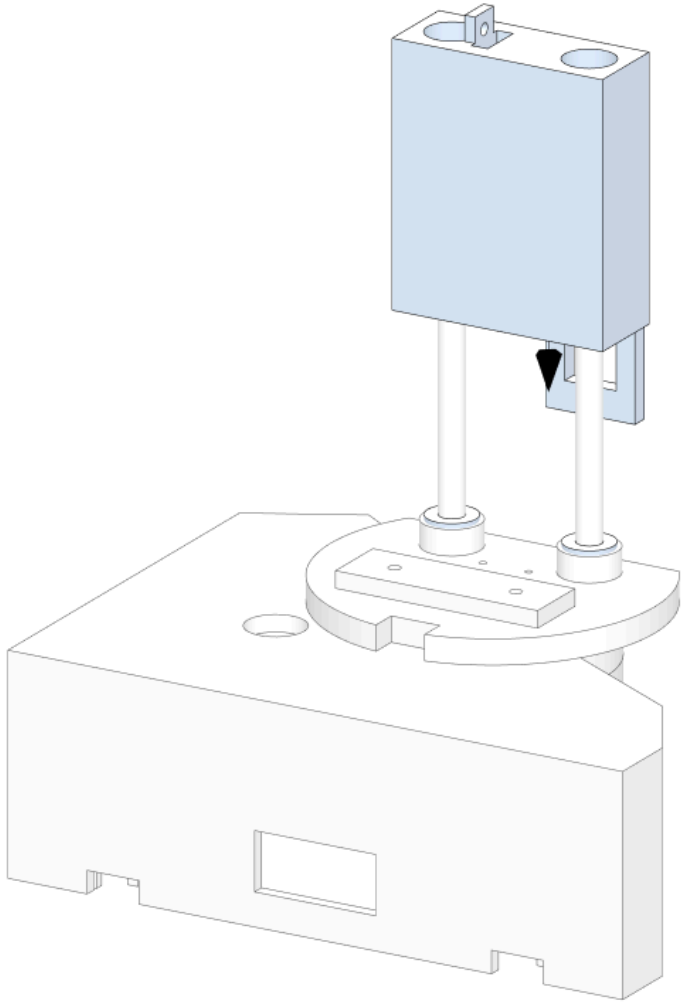


(!) It must slide down under its own weight

9

Spine

2× #6-32 × ½″

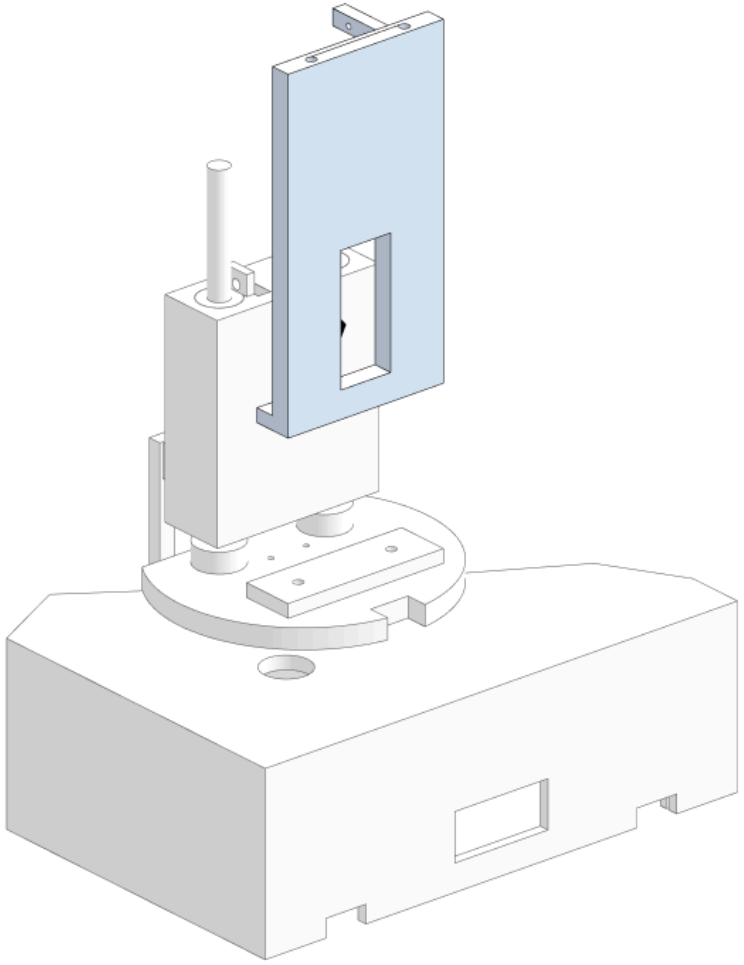


Onto the turret plate behind the rods, screws from above

10

Top cap

2× #6-32 × ½″

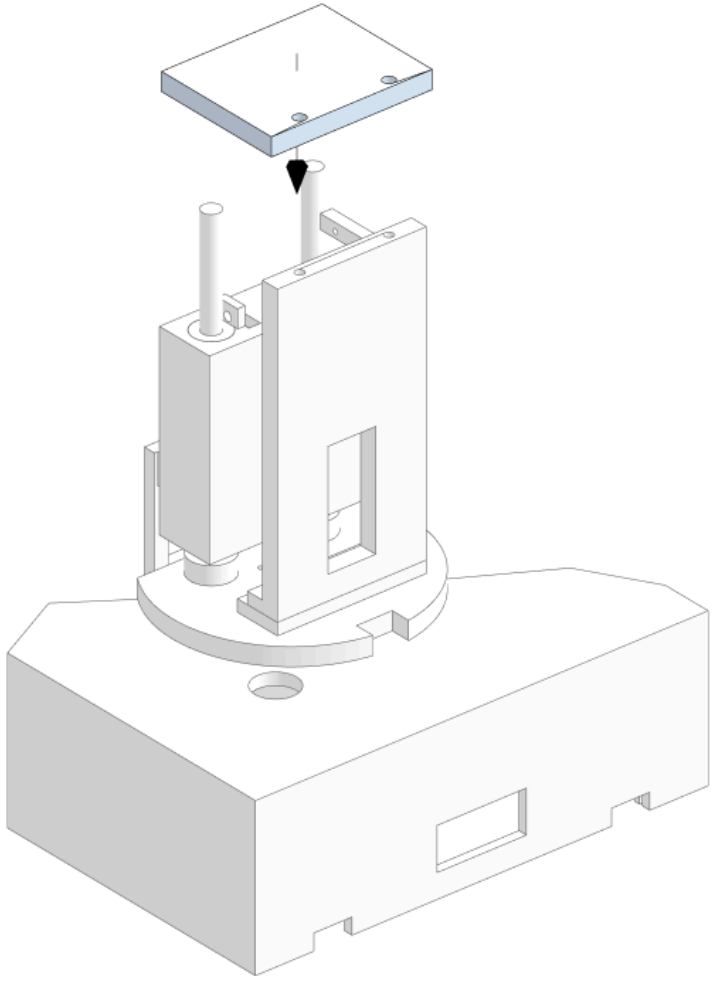

Over the rod tops onto the spine. Carriage still slides freely?

11


Lift servo

2× servo-bag

MG90S lift

30°

`l 30`

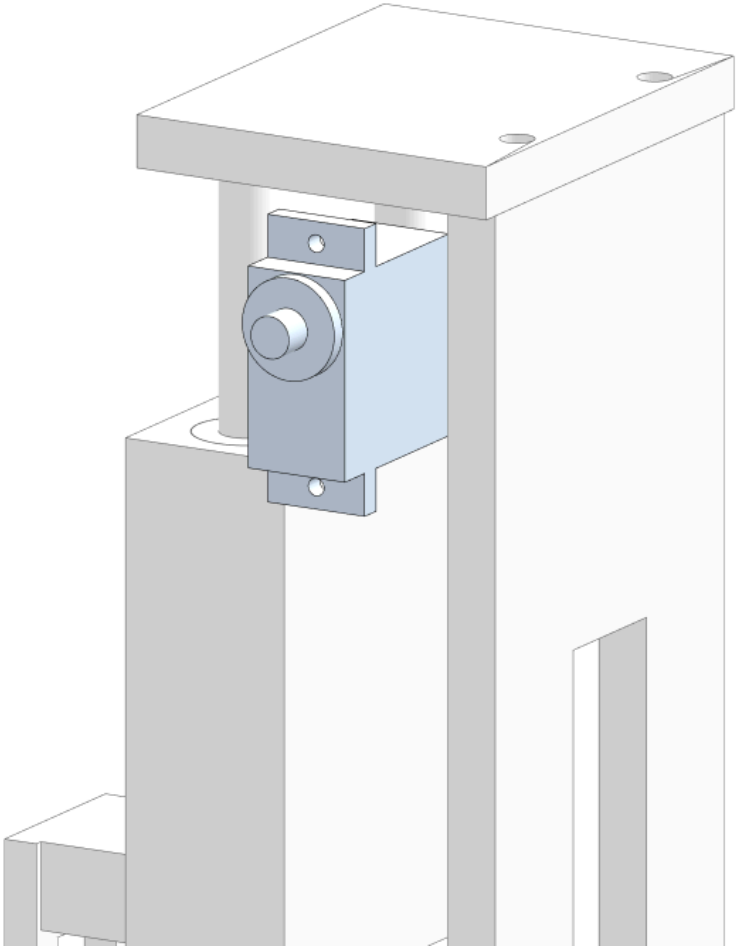


Body through the spine bracket from the left

12

Lift link

1× #6-32 × ½″

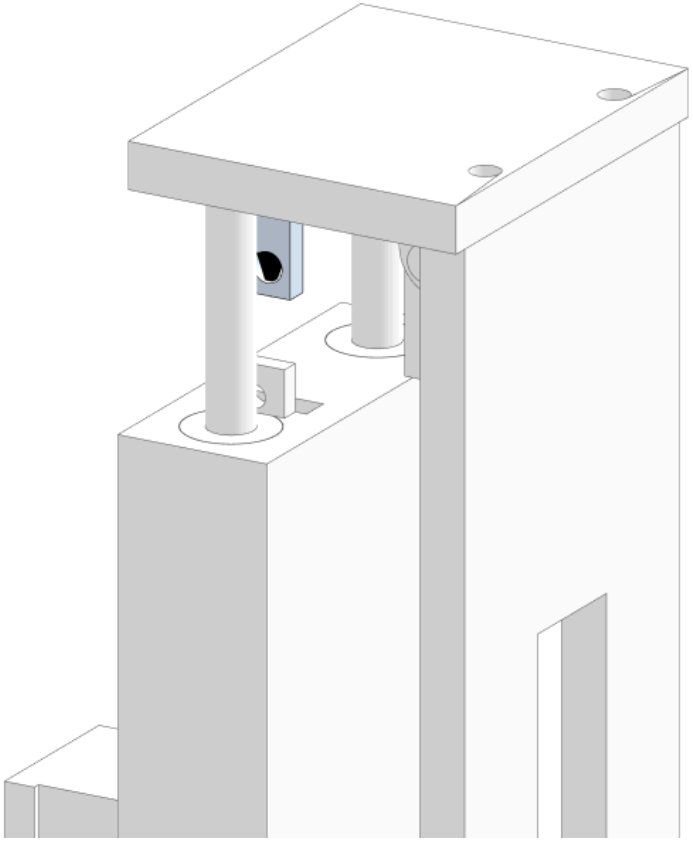

! Carriage end: #6-32 as the pivot, don't over-tighten: it must turn


13 Crank

2× servo-bag

MG90S lift

30°

`l 30`

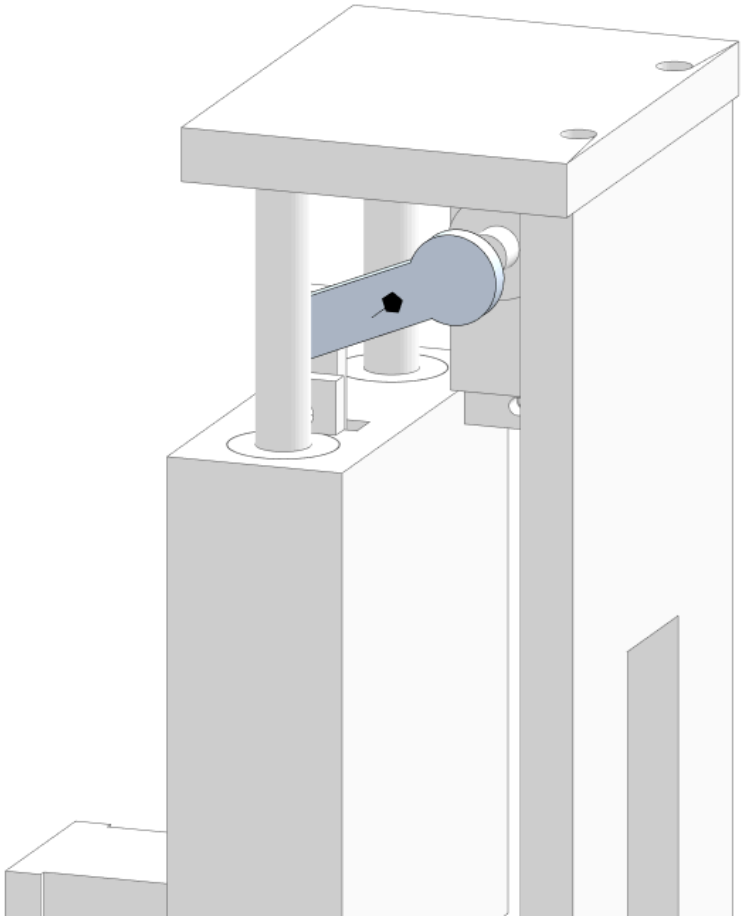

Single-arm horn trimmed to 20 mm, on the spline at 30°; pin screw into the link

14


Wrist servo

2×  servo-bag

MG90S wrist

0°

`w 0`

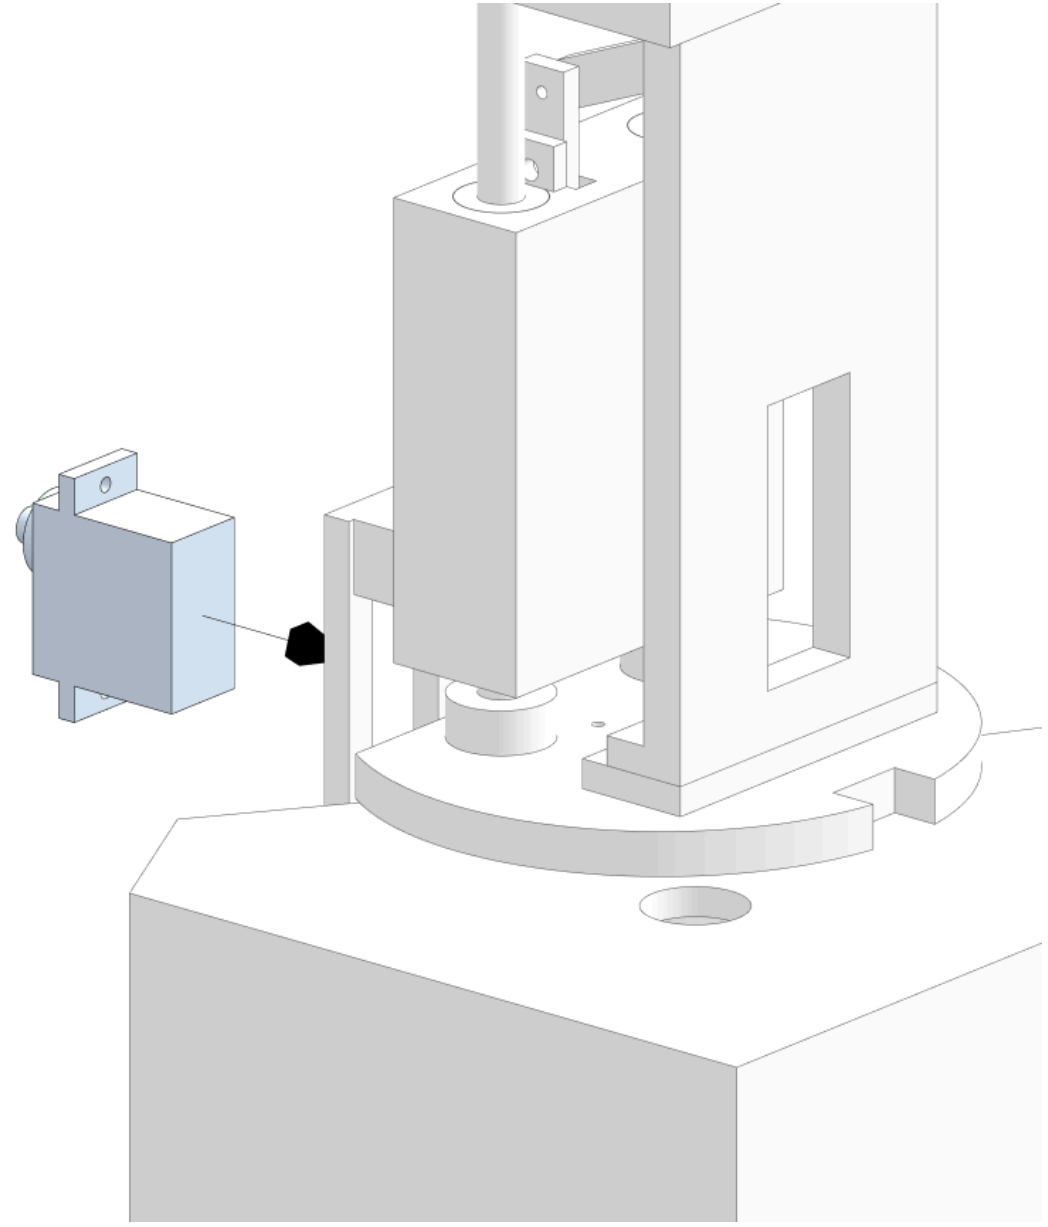

Body through the bracket from the front

15


Wrist horn

1×  servo-bag

MG90S wrist


0°

`w 0`

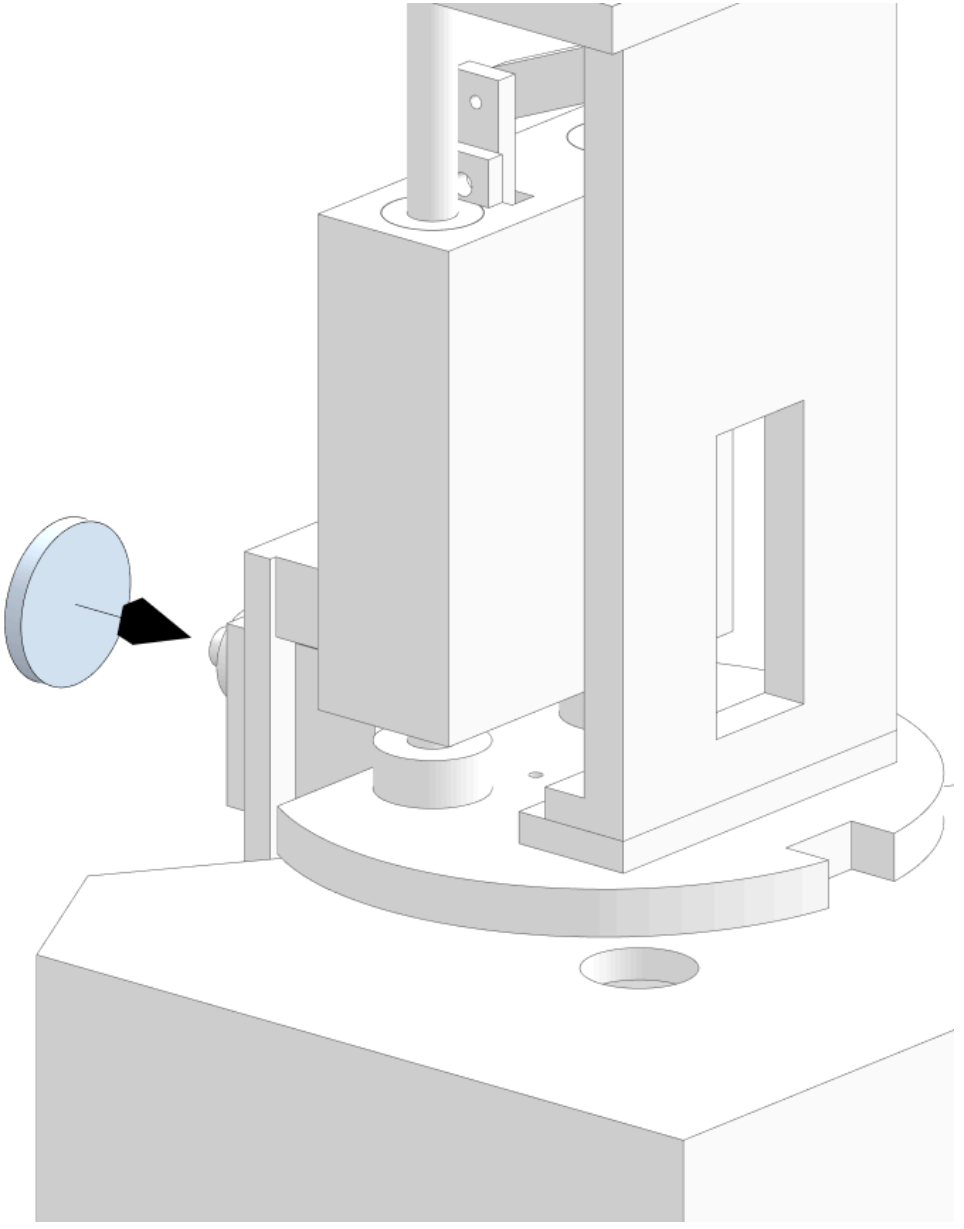

16 Gripper frame


4× servo-bag

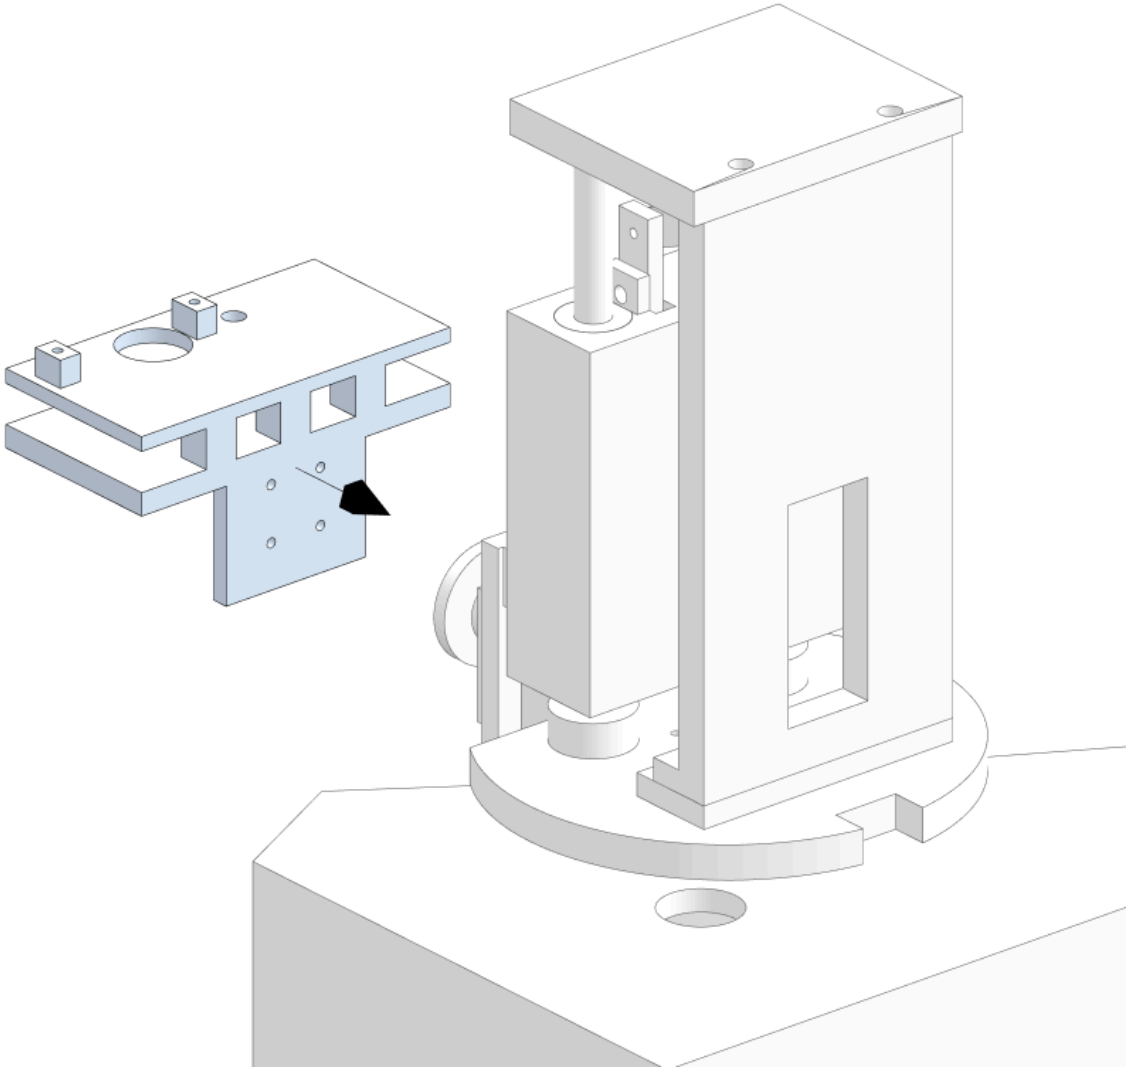

Upright: plates level, opening facing out

17

Both fingers, gears meshed

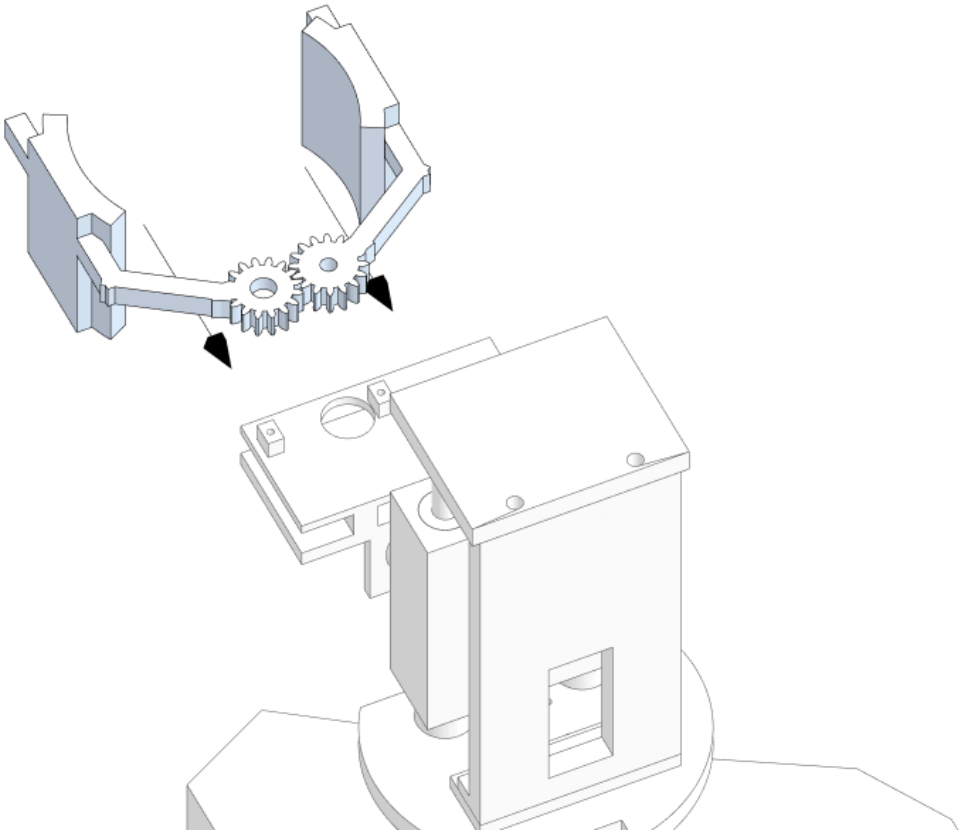


Slide them in together between the plates, open by the same angle

18

Right finger axle

1× #6-32 × ½″

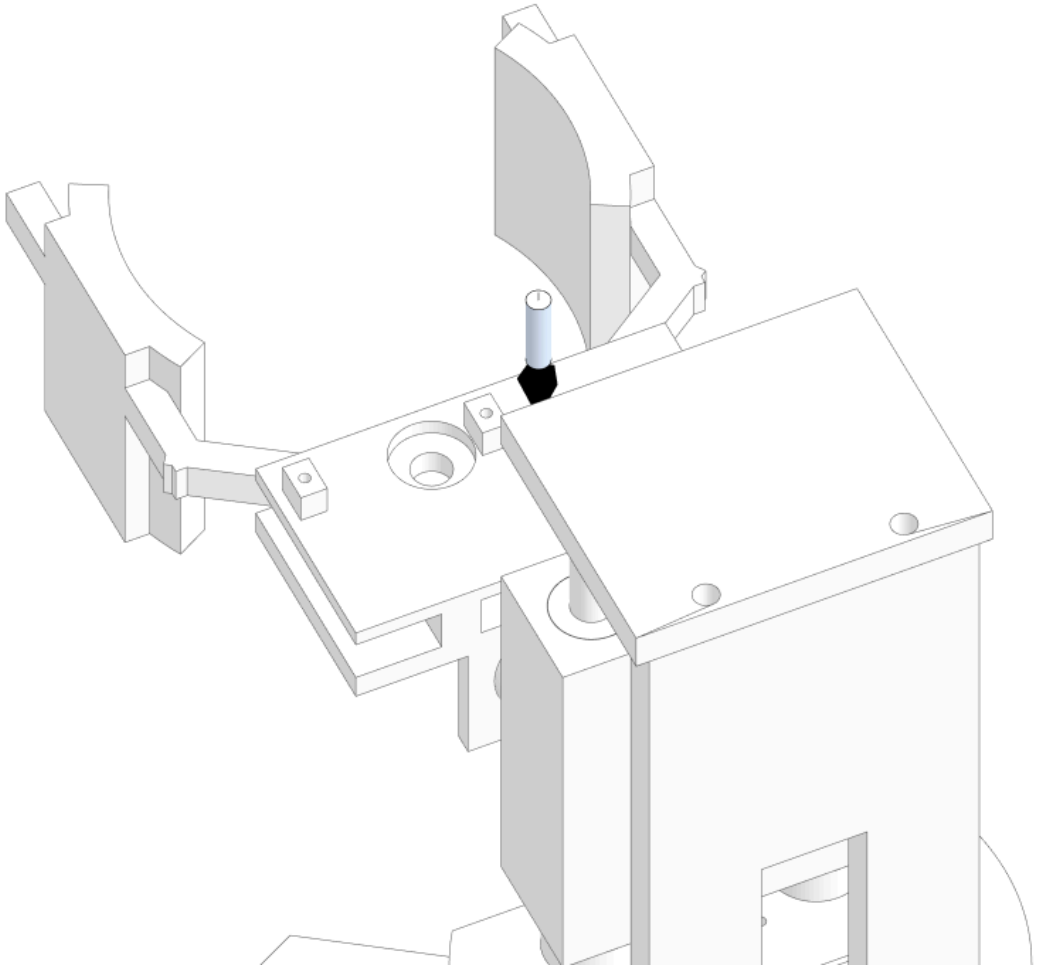

! From the top through the right finger; it must swing freely

19


Gripper servo

3× servo-bag

SG90

20°


g 20

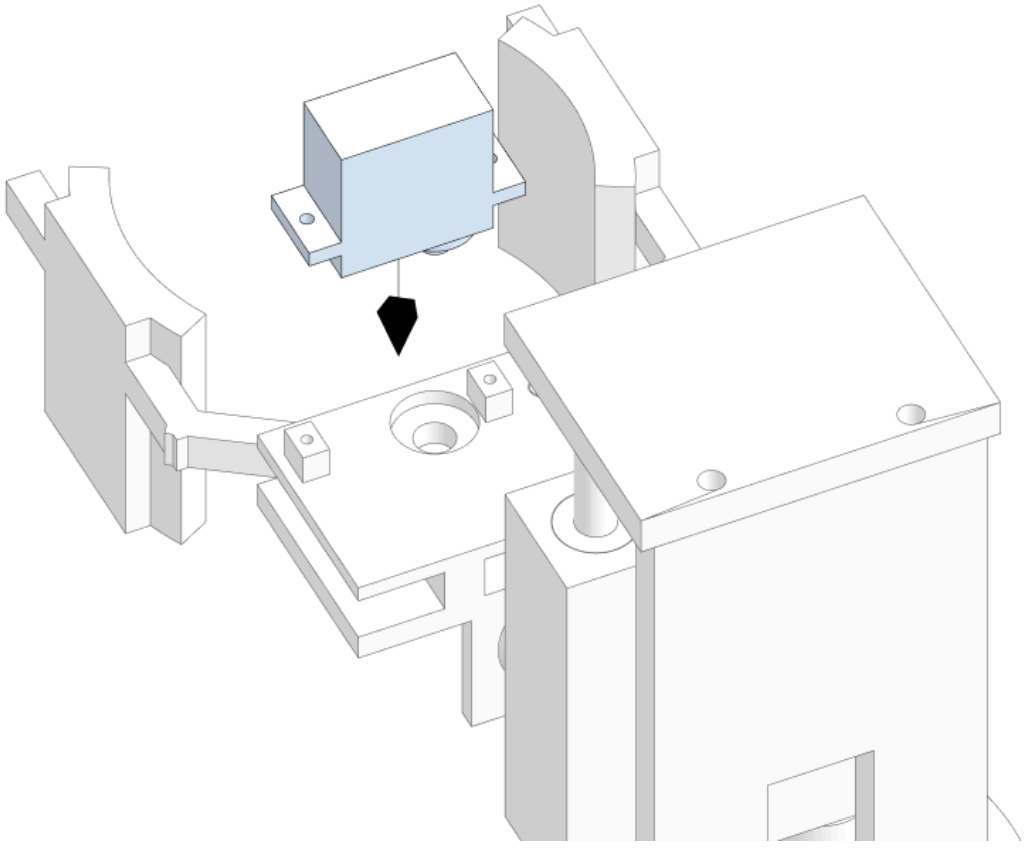

Spline down into the left finger's socket (it is the horn)

20


Can bumper

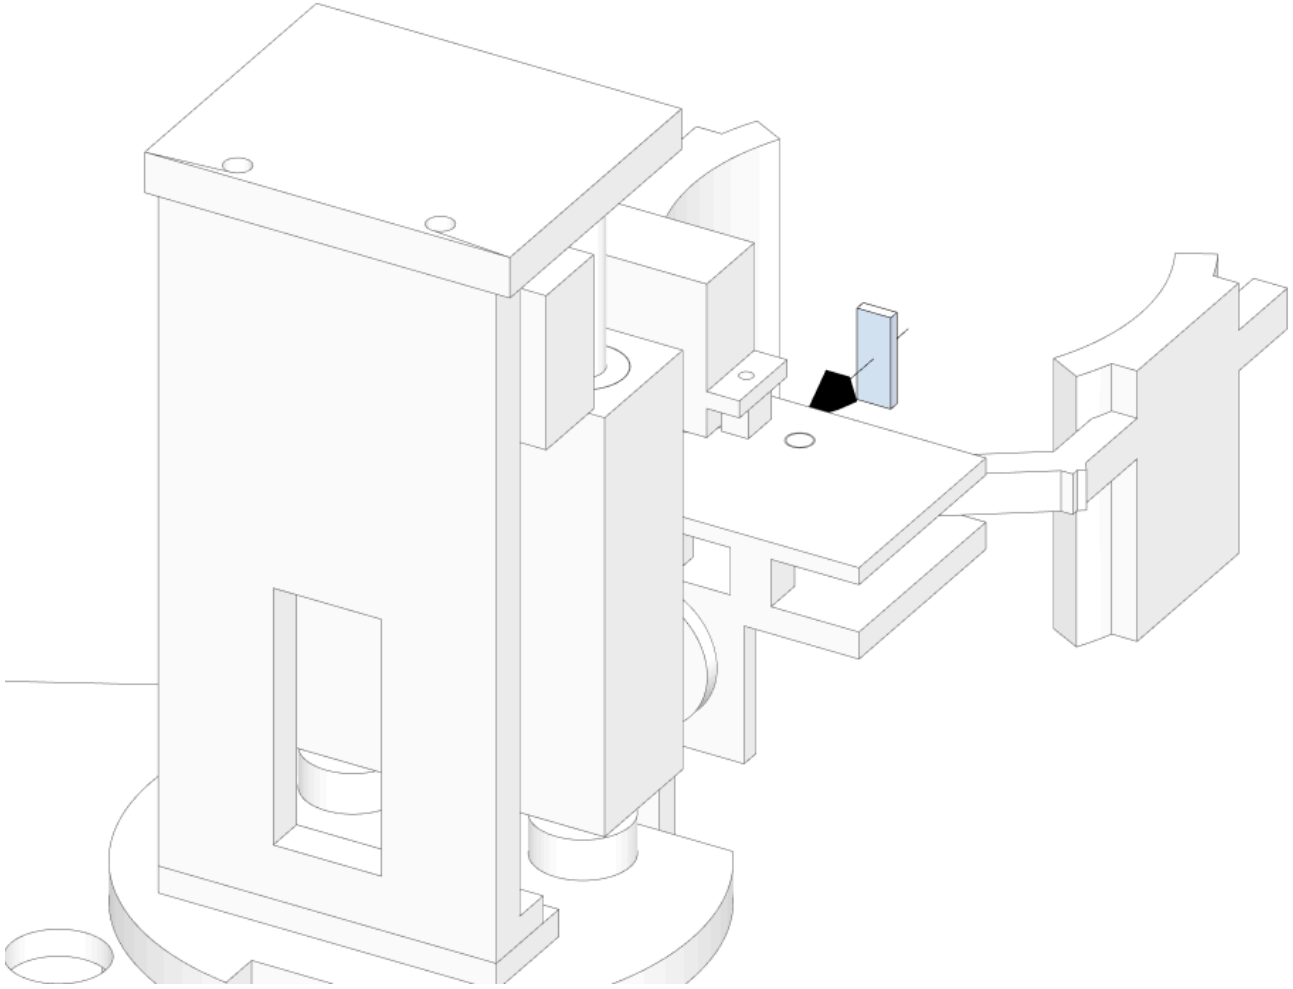

Silicone or rubber, 9 × 13.5 mm, superglue to the frame

21


Electronics on the tray

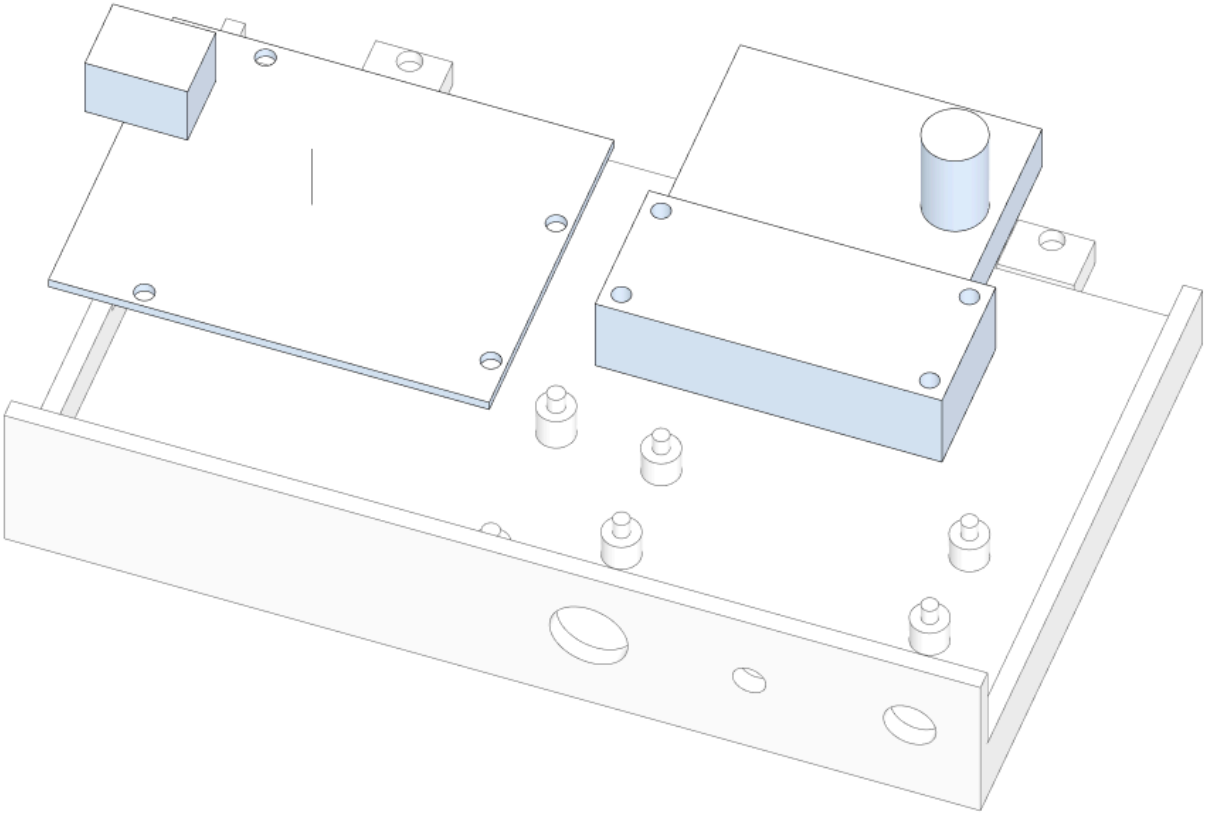

! Pegs + a dab of hot glue; breadboard is self-adhesive. Buck already set to 5.8 V

22

Panel: button, LED, power

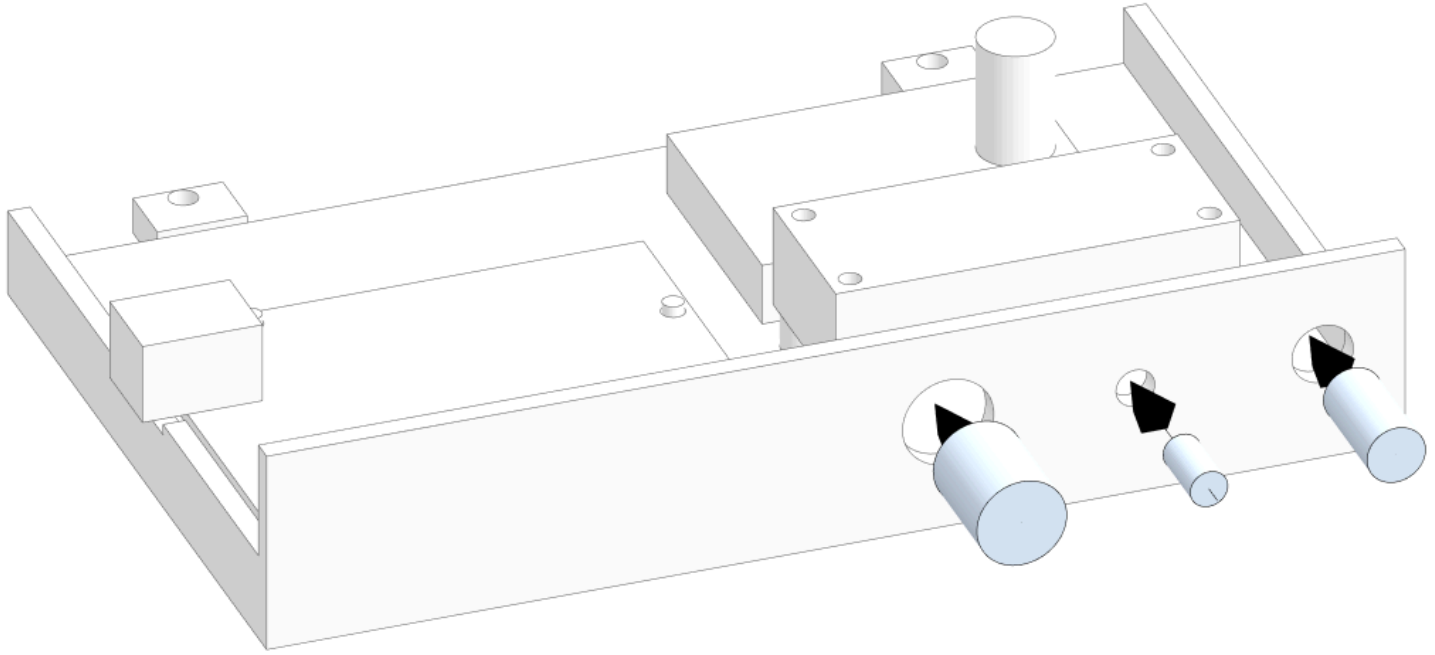


Through the panel holes from the front, nuts inside. Power: DC jack, or the LIZVOR terminal-block tip

23


Tray onto the base

2× #6-32 × ½″

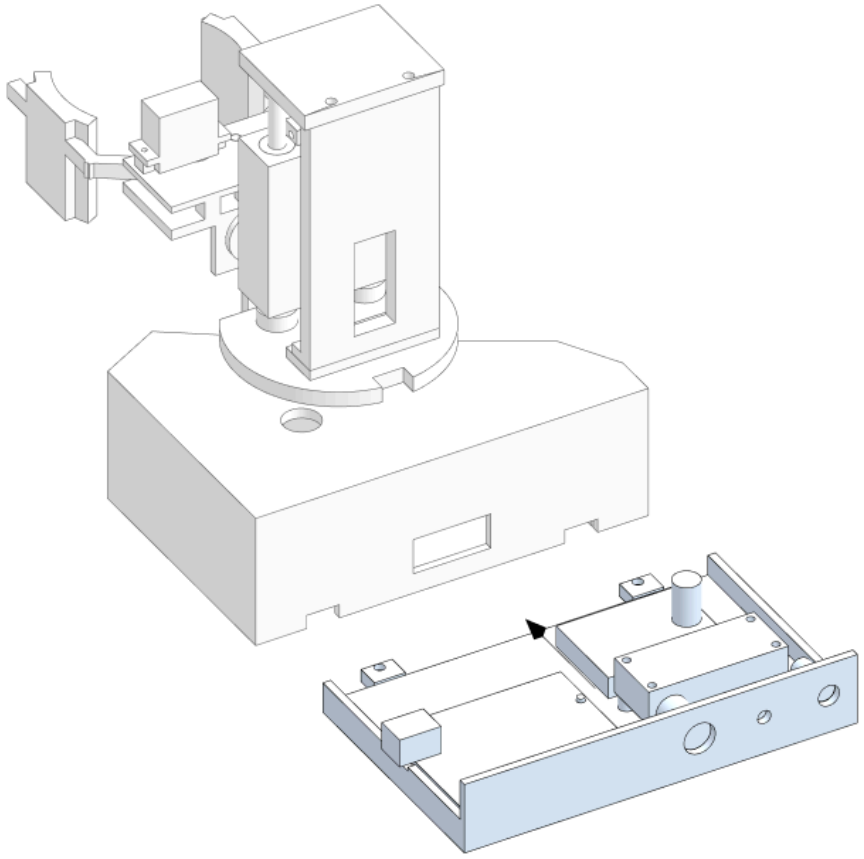

Tabs slide under the base wall, screws from below

24 Wiring

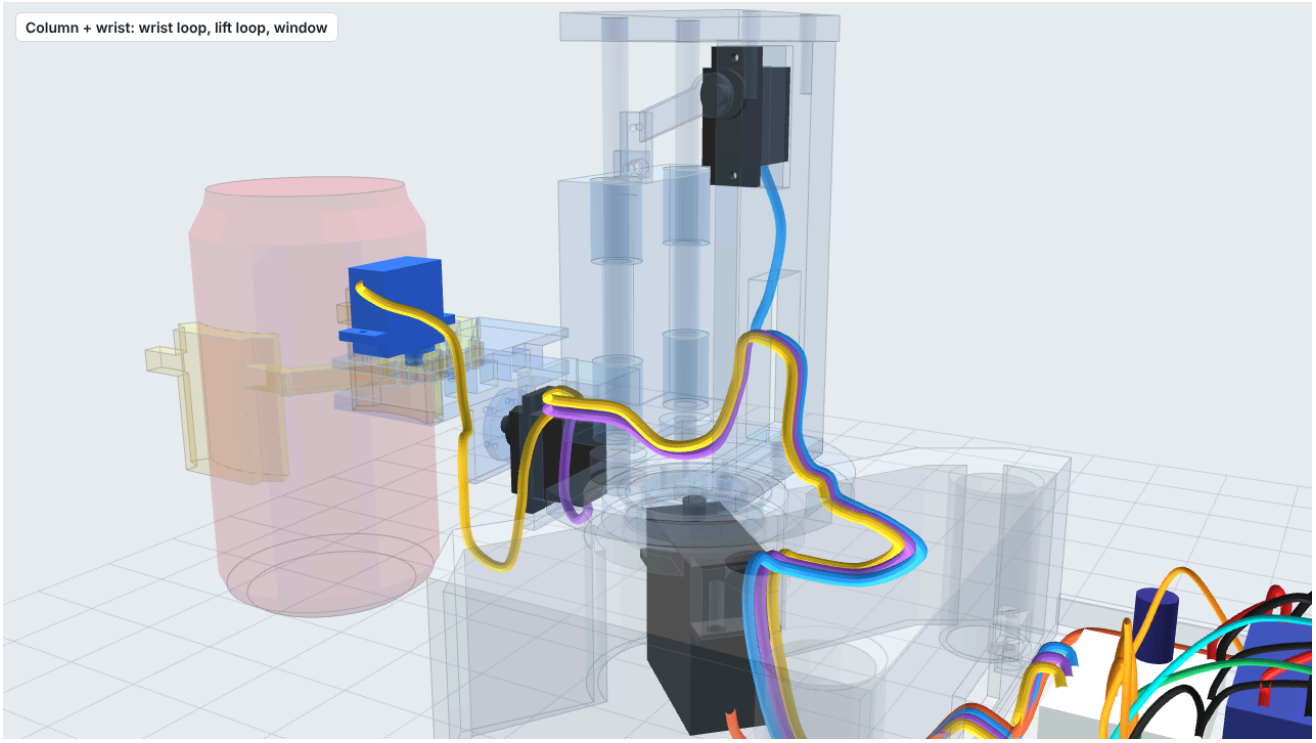

Servo lead	Pin
MG996R turntable	D9 (+/− on the buck)
MG90S lift	D10
MG90S wrist	D6
SG90 gripper	D5
START button	D4 + GND
LED + 220 Ω	D13 + GND

Route: claw → wrist loop → along the arm → lift loop → spine window → down the back → turret notch → turn loop → base hole → tray. **Tie at the tie points, leave the 3 loops free.** Wrist loop ≥ 70 mm of cable.

3D view: viewer/wiring_360.html · moves: viewer/wiring_motion.html

! Power off while wiring. Servo plugs: brown = GND, red = +5.8 V, orange = signal.


25

Test

1. Upload

`firmware/concept_a`

2. Can on START, 5 in out
3. Press START
4. Can lands upside down at TARGET

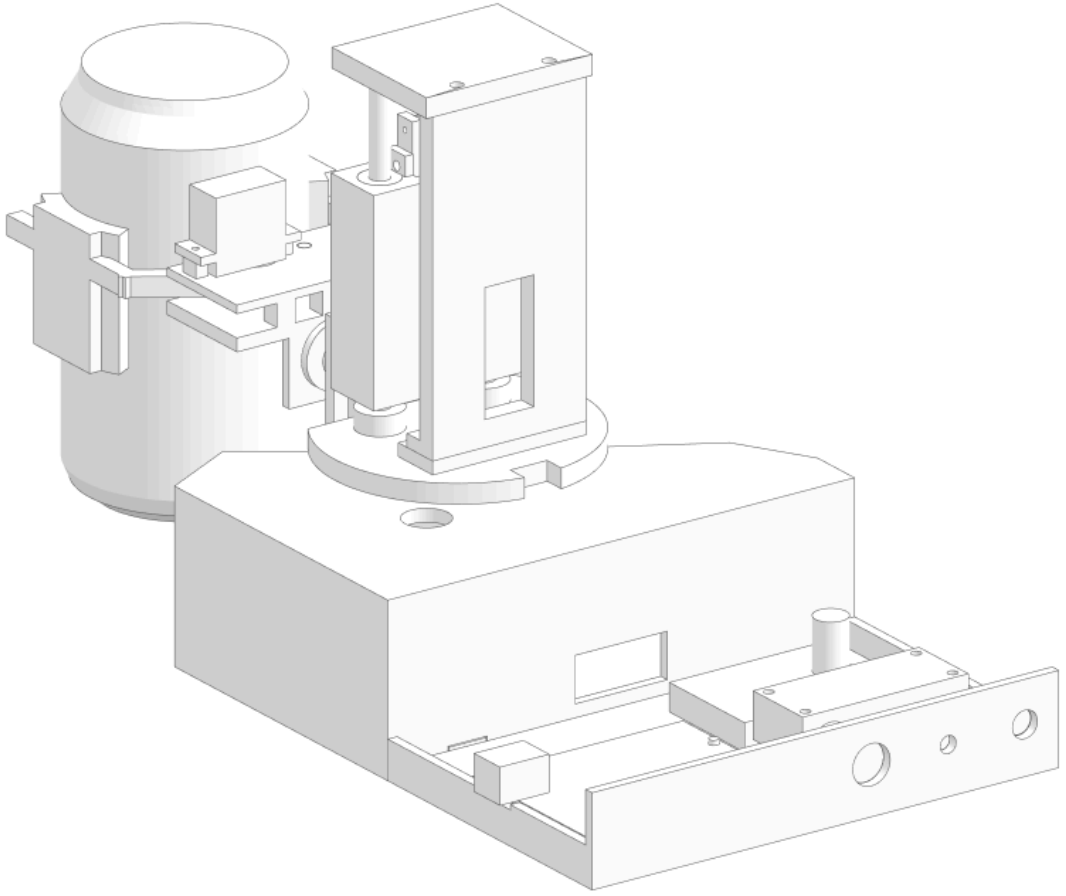

If a move is off: re-set its angle with servo_setup, then edit the constant at the top of concept_a.ino.