



RUN-1 the rover rotated instead of approaching

wrong-way guard fired at 348 ms; heading reached 95 deg; no contact

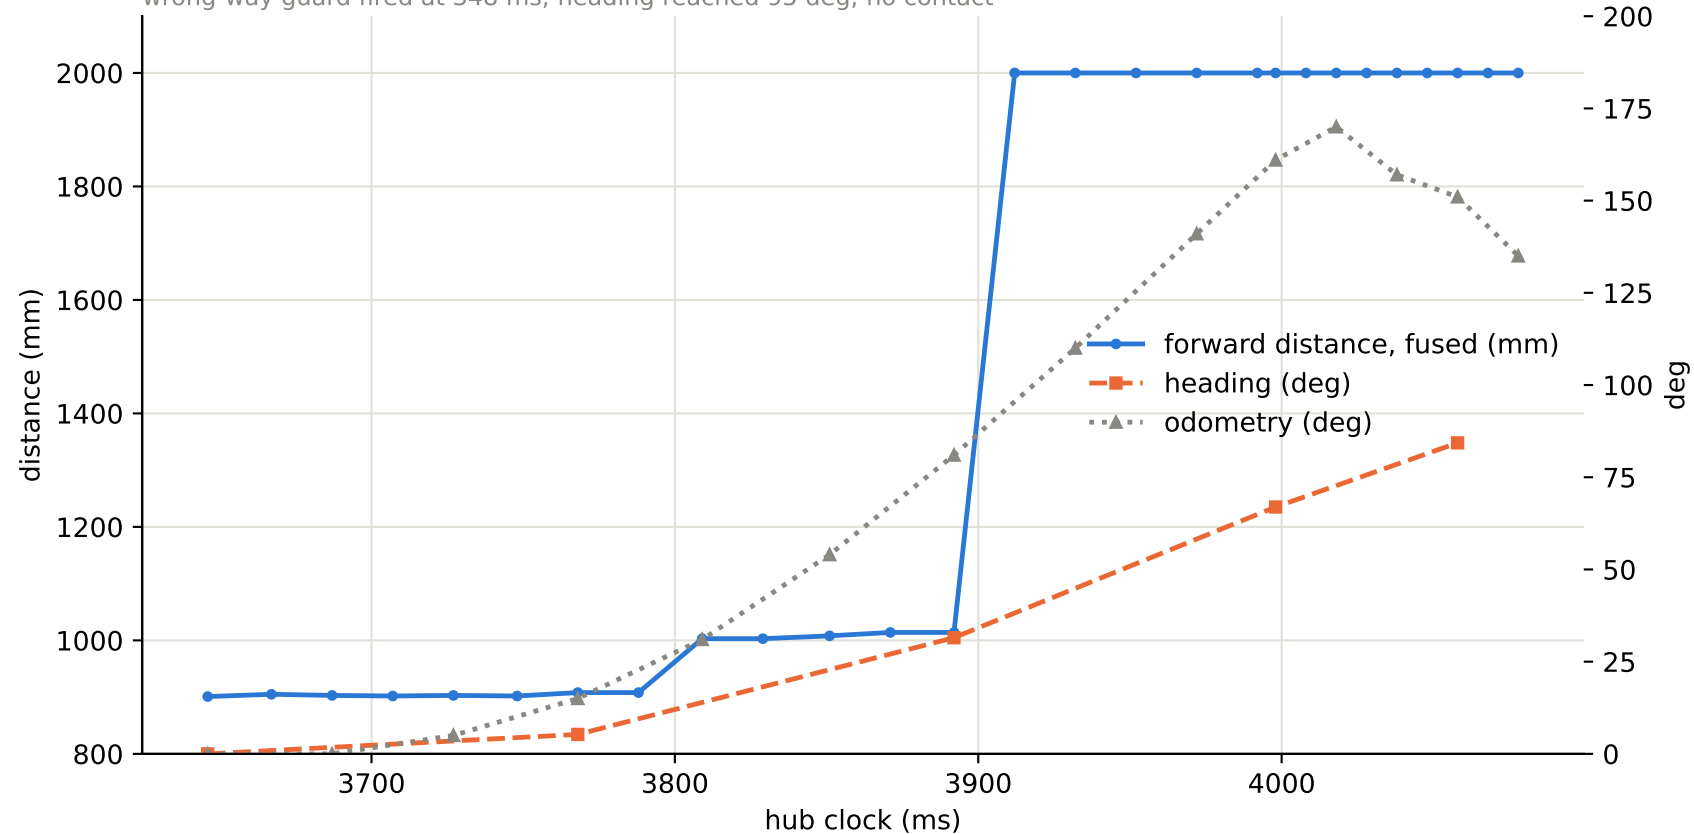


RUN-2 one good forward channel and one bad one

A rises 92 mm while closing on a wall; the 107 mm split was never a mounting constant

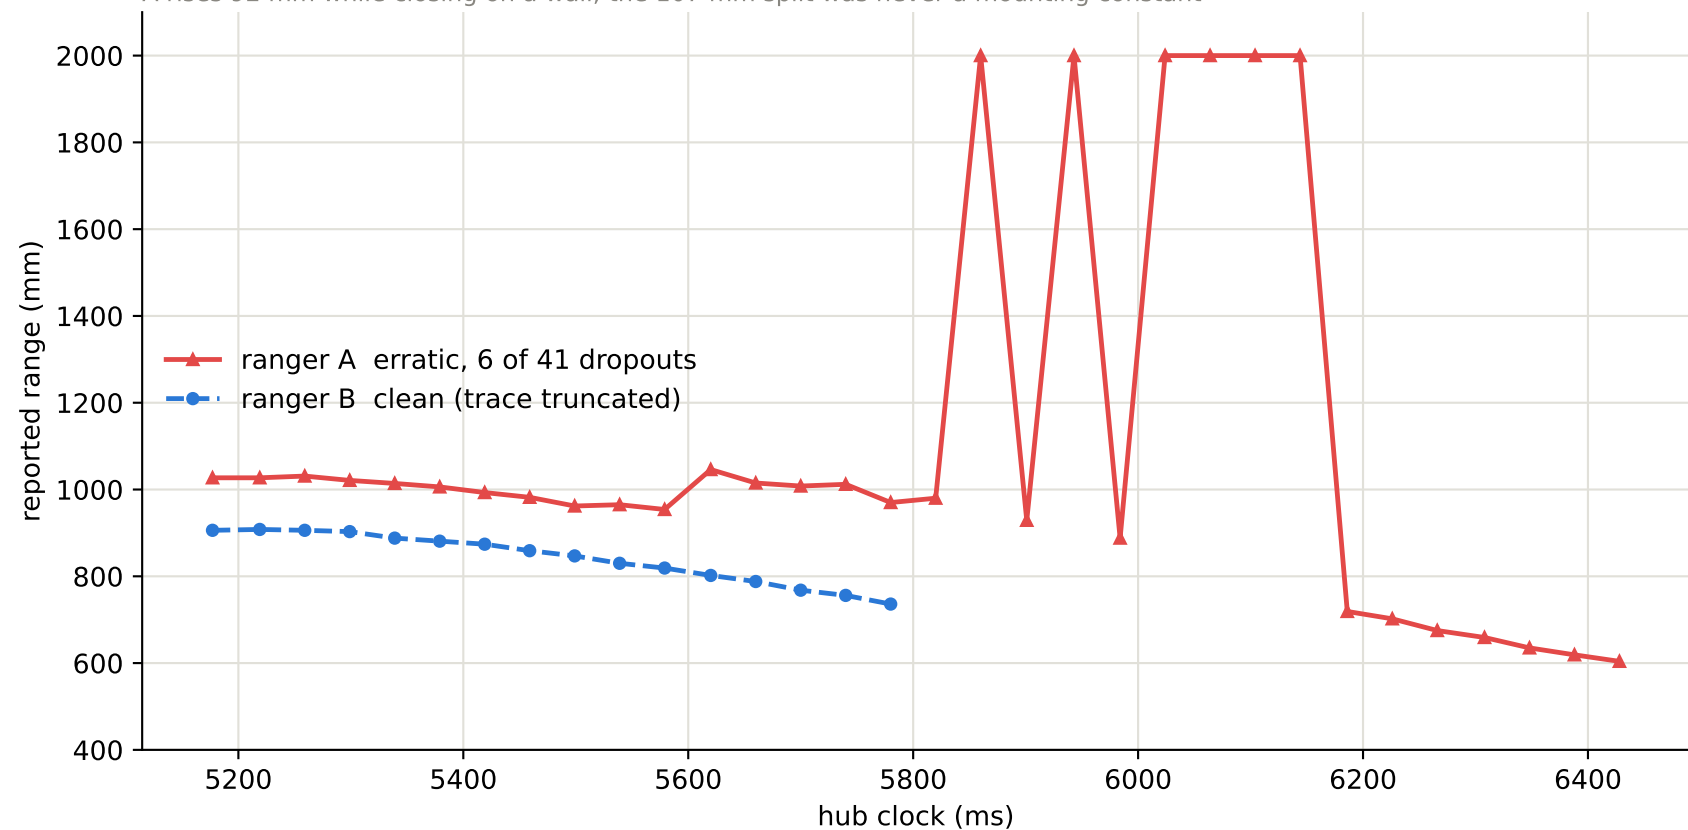


RUN-3 the ranger cannot track a closing wall

reported value falls up to 196 mm behind truth, then snaps back once stopped; 600 mm is never reported

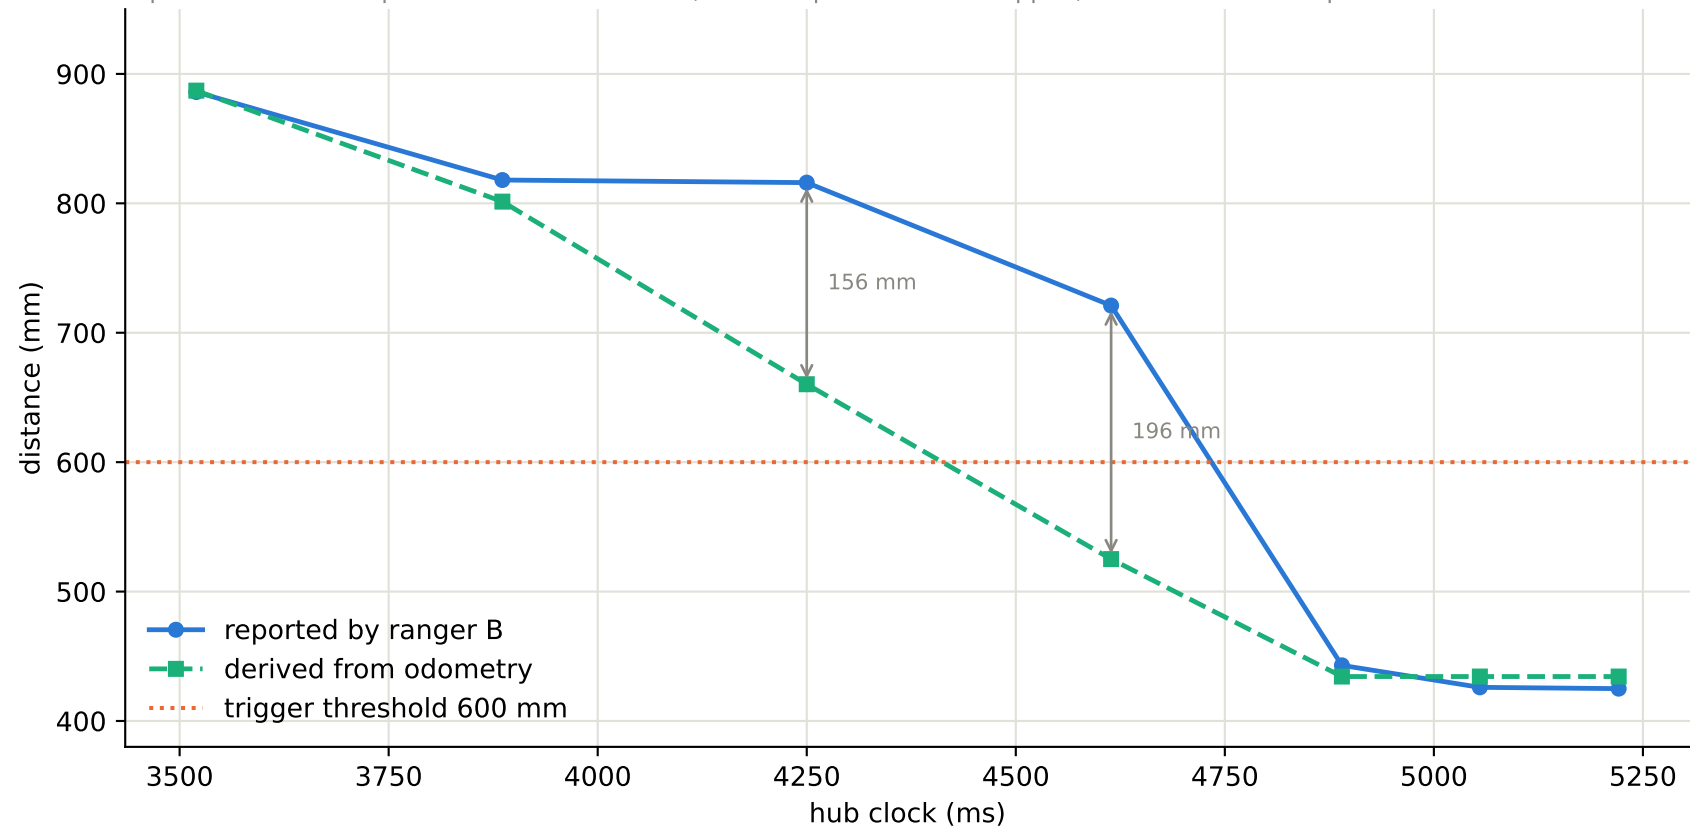


Verification v1 odometric trigger, first flight

measured 52 mm: gap clause held, estimate clause failed by 15.5 mm

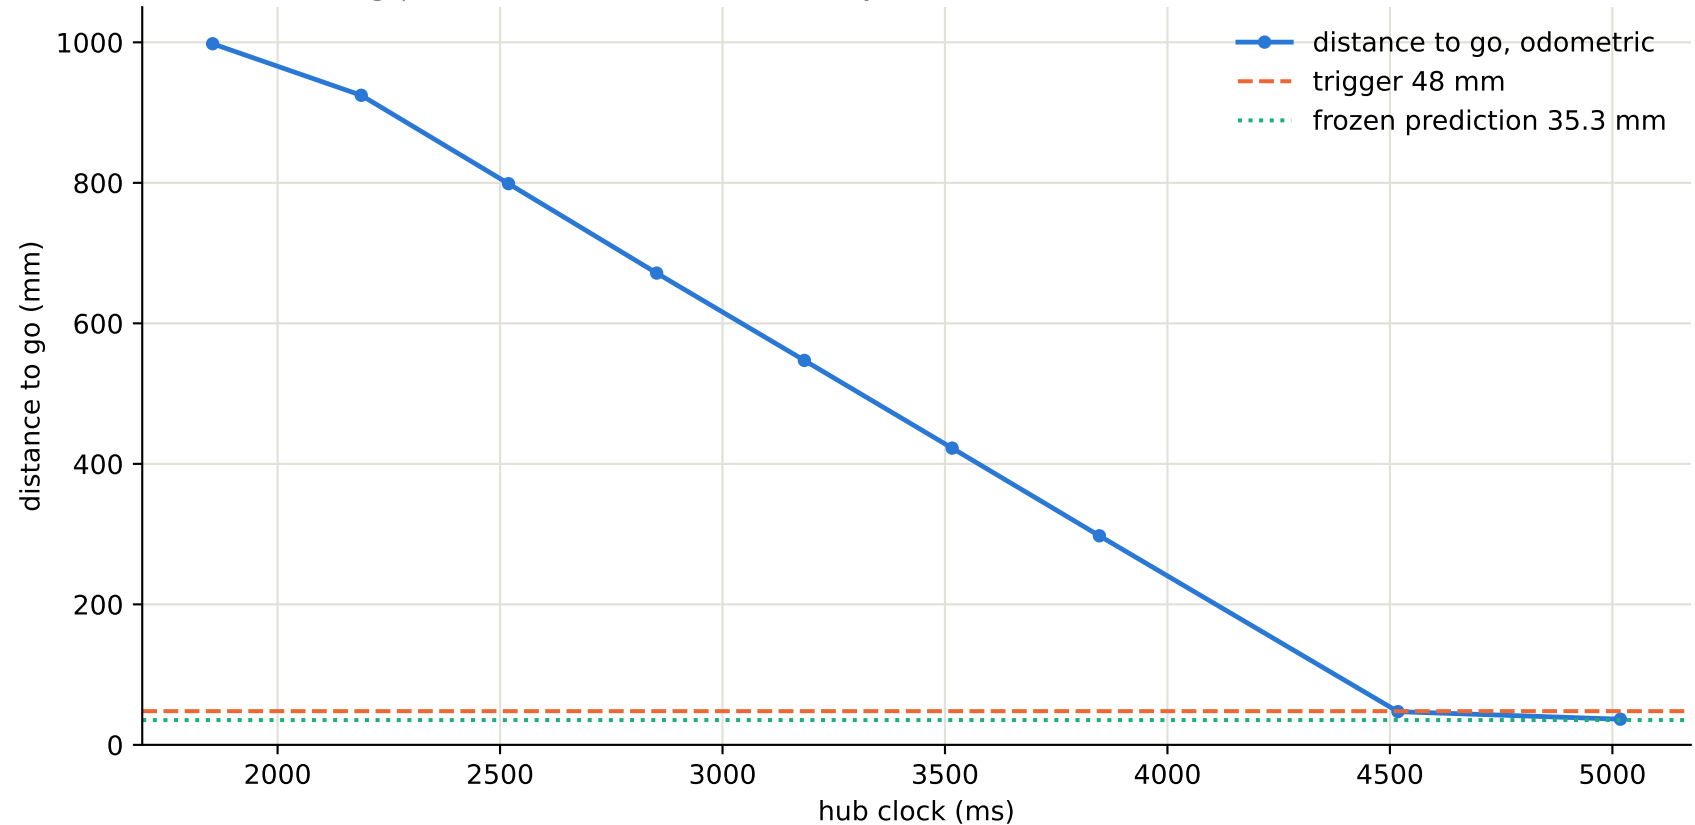


Verification v2 anchor moved to 990 mm

measured 43 mm: falsified again by 12.05 mm; the 990 was my own profile-mixing artifact

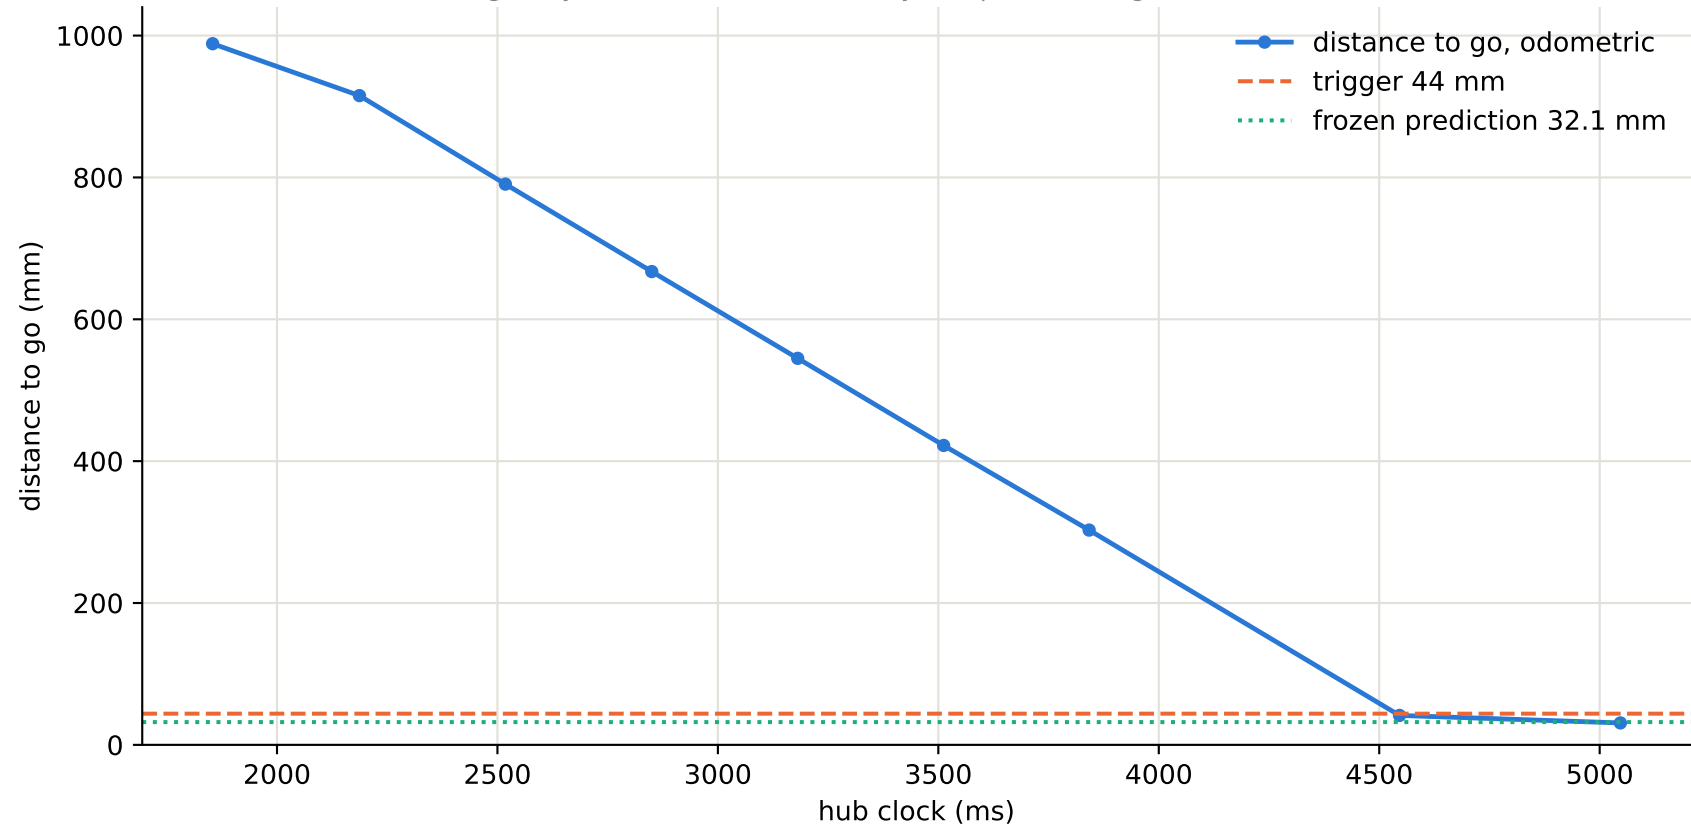


Frozen predictions the estimate clause is what caught the systematic

labelled value is the estimate error: 15.46, 12.05, then 0.19 mm

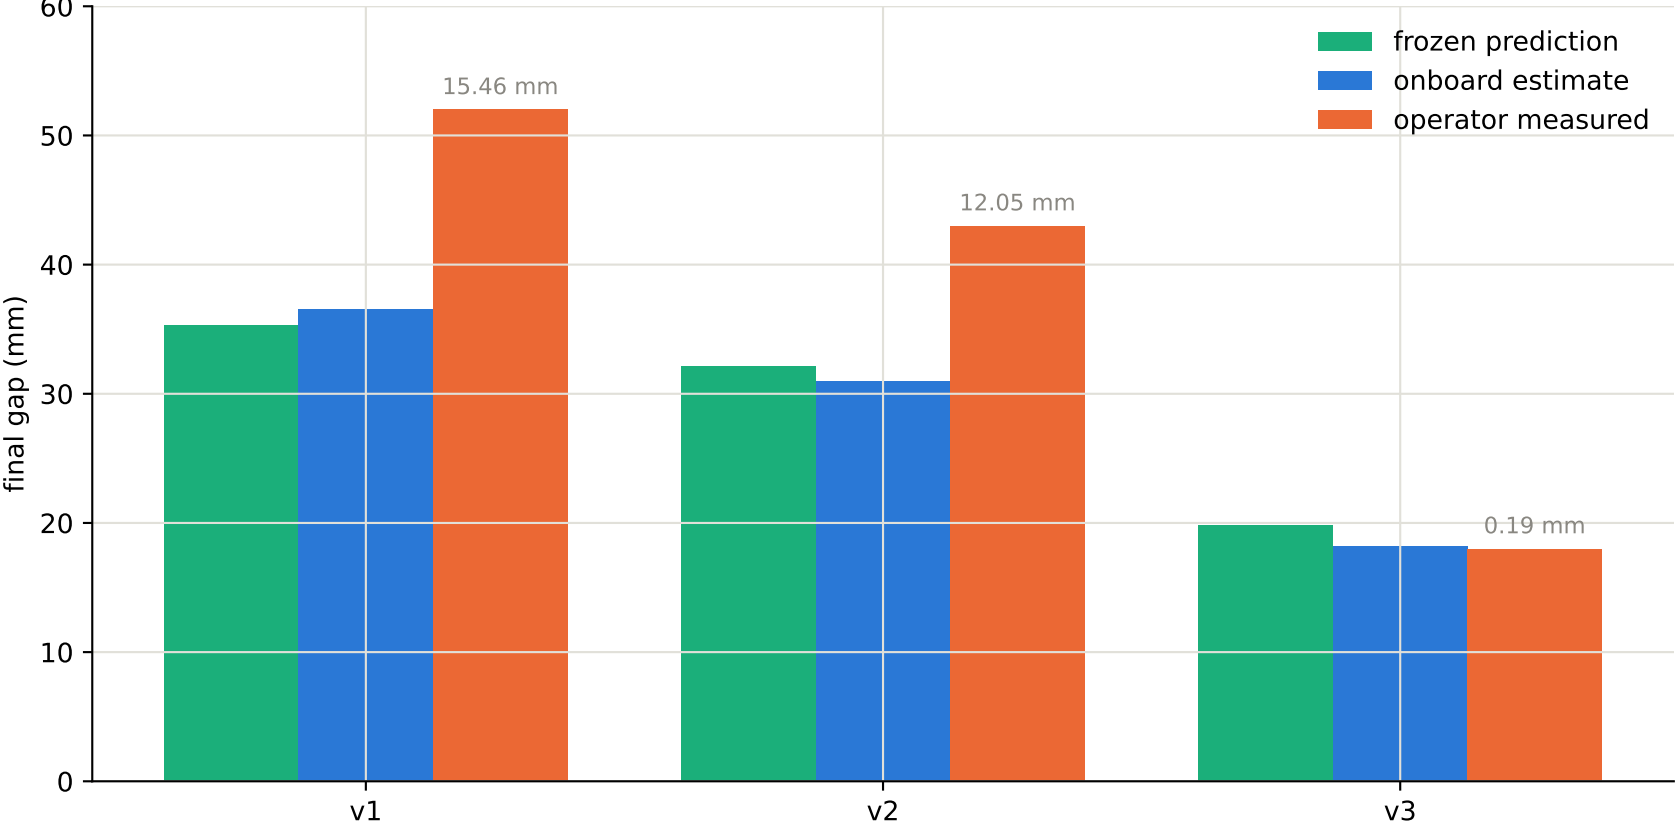

Operation the five onboard estimates, committed before ground truth

mean 20.20 mm, sd 0.76 mm, range 1.72 mm

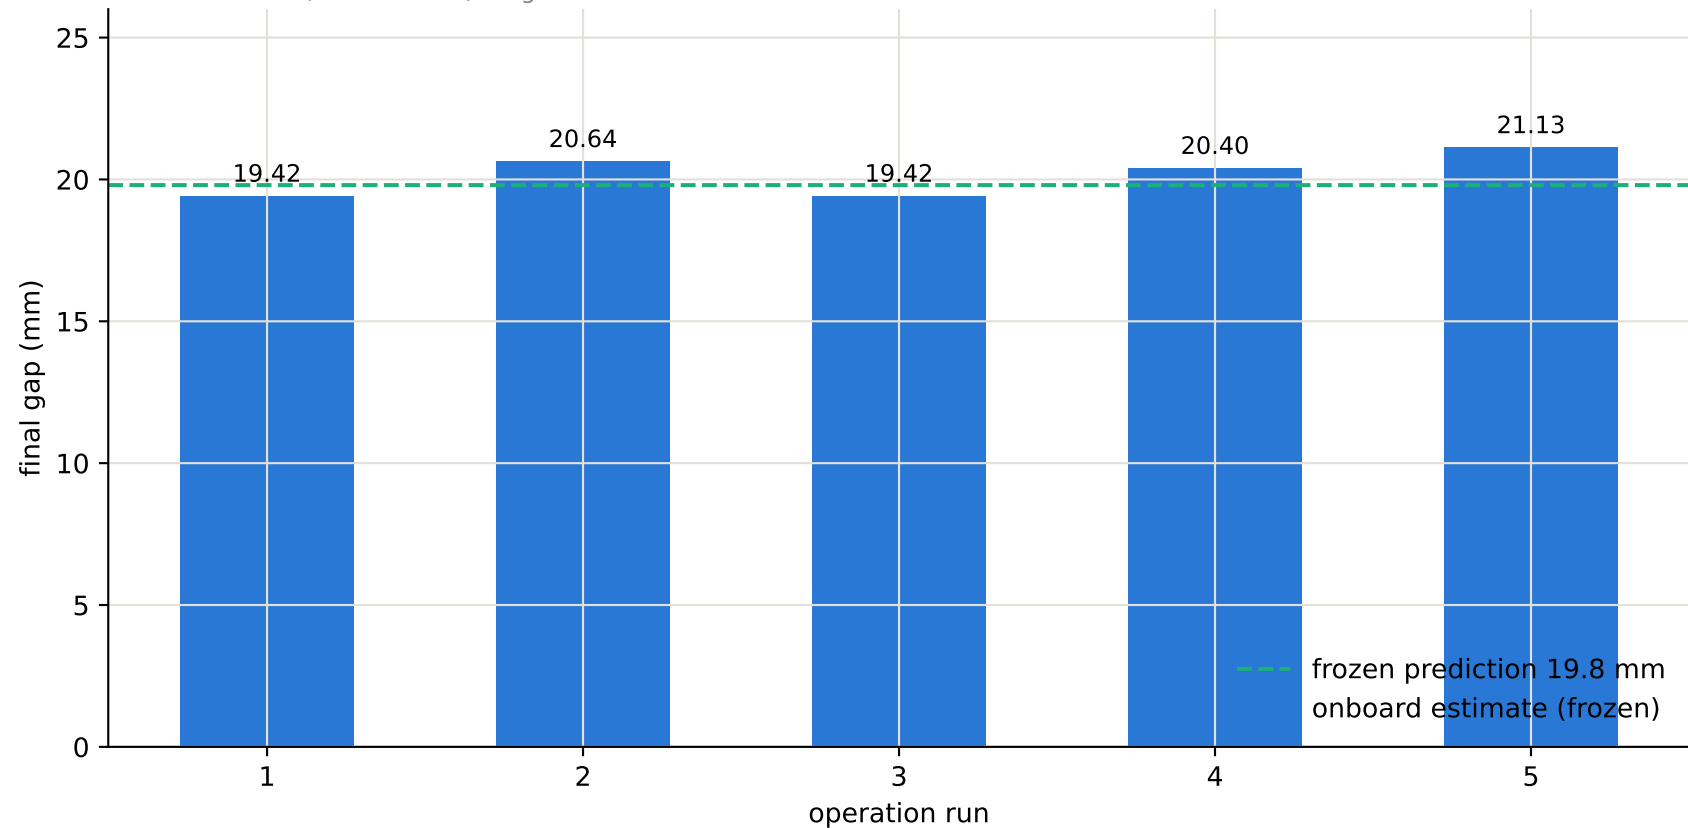

Close-out the whole operation error is start-line placement
odometry at rest varied 1.72 mm across all five runs; the result varied 19 mm

