

MAIN DDR (DETAILED DIAGNOSTIC REPORT)

Generated strictly from: Sample Report.pdf and Thermal Images.pdf
No outside data. Missing or unclear details are marked as Not Available.

Source Document Details

Field	Extracted value
Inspection date and time	27.09.2022 14:28 IST
Inspected by	Krushna & Mahesh
Property type	Flat
Floors	11
Previous structural audit done	No
Previous repair work done	No
Thermal report date	27/09/22
Thermal device	GTC 400 C Professional

1. Property Issue Summary

- Point 1: Observed dampness at the skirting level of Hall of Flat No. 103; linked exposed side finding: Observed gaps between the tile joints of Common Bathroom of Flat No. 103.
- Point 2: Observed dampness at the skirting level of the Common Bedroom of Flat No. 103; linked exposed side finding: Observed gaps between the tile joints of Common Bathroom of Flat No. 103.
- Point 3: Observed dampness at the skirting level of Master Bedroom of Flat No. 103; linked exposed side finding: Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103.
- Point 4: Observed dampness at the skirting level of Kitchen of Flat No. 103; linked exposed side finding: Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103.
- Point 5: Observed dampness & efflorescence on the wall surface of Master Bedroom of Flat No. 103; linked exposed side finding: Observed cracks on the External wall of building near Master Bedroom of Flat No. 103.
- Point 6: Observed leakage at the Parking ceiling below Flat No. 103; linked exposed side finding: Observed plumbing issue & gaps between the tile joints of Common Bathroom of Flat No. 103.
- Point 7: Observed mild dampness at the ceiling of Common Bathroom of Flat No. 103; linked exposed side finding: Observed gap between tile joints of Common & Master Bedroom Bathrooms of Flat No. 203.


2. Area-wise Observations

Point 1 - Hall of Flat No. 103


Inspection observation: Observed dampness at the skirting level of Hall of Flat No. 103
Linked exposed/positive-side observation: Observed gaps between the tile joints of Common Bathroom of Flat No. 103
Thermal readings from mapped thermal pages: Page 1 (RB02380X.JPG): Hotspot 28.8 °C, Coldspot 23.4 °C; Page 2 (RB02386X.JPG): Hotspot 27.4 °C, Coldspot 22.4 °C; Page 3 (RB02395X.JPG): Hotspot 27 °C, Coldspot 22 °C; Page 4 (RB02402X.JPG): Hotspot 25.7 °C, Coldspot 20.7 °C
Image evidence from provided PDFs:

UrbanRoof

Point No	Impacted area (vs side)	Point No	Exposed area (vs side)
1	Observed dampness at the skirting level of Hall of Flat No. 103	1.1	Observed gaps between the tile joints of Common Bathroom of Flat No. 103
2	Observed dampness at the skirting level of the Common Bedroom of Flat No. 103	2.1	Observed gaps between the tile joints of Common Bathroom of Flat No. 103
3	Observed dampness at the skirting level of Master Bedroom of Flat No. 103	3.1	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103
4	Observed dampness at the skirting level of Kitchen of Flat No. 103	4.1	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103
5	Observed dampness & efflorescence on the wall surface of Master Bedroom of Flat No. 103	5.1	Observed cracks on the External wall of building near Master Bedroom of Flat No. 103
6	Observed leakage at the Parking ceiling below Flat No. 103	6.1	Observed plumbing issue & gaps between the tile joints of Common Bathroom of Flat No. 103
7	Observed mild dampness at the ceiling of Common Bathroom of Flat No. 103	7.1	Observed gap between tile joints of Common & Master Bedroom Bathrooms of Flat No. 203.

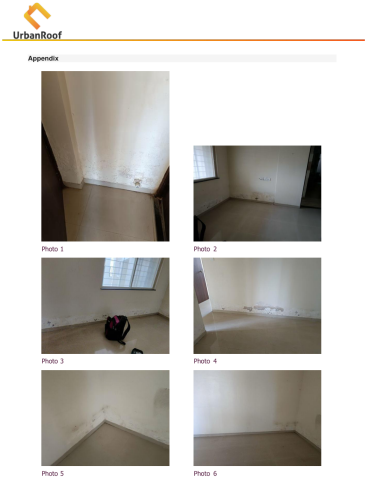

1

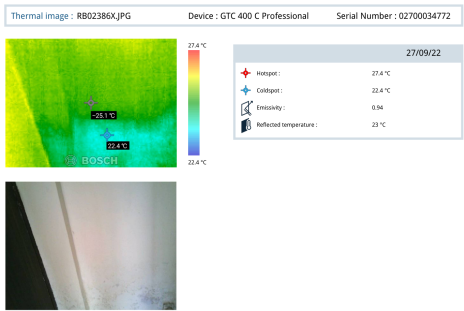

2


Point 2 - Common Bedroom of Flat No. 103

Inspection observation: Observed dampness at the skirting level of the Common Bedroom of Flat No. 103
Linked exposed/positive-side observation: Observed gaps between the tile joints of Common Bathroom of Flat No. 103
Thermal readings from mapped thermal pages: Page 5 (RB02403X.JPG): Hotspot 25.5 °C, Coldspot 20.5 °C; Page 6 (RB02404X.JPG): Hotspot 25.8 °C, Coldspot 20.8 °C; Page 7 (RB02405X.JPG): Hotspot 26.2 °C, Coldspot 21.2 °C; Page 8 (RB02406X.JPG): Hotspot 26.5 °C, Coldspot 21.5 °C
Image evidence from provided PDFs:


UrbanRoof

Point No	Impacted area (vs side)	Point No	Exposed area (vs side)
1	Observed dampness at the skirting level of Hall of Flat No. 103	1.1	Observed gaps between the tile joints of Common Bathroom of Flat No. 103
2	Observed dampness at the skirting level of the Common Bedroom of Flat No. 103	2.1	Observed gaps between the tile joints of Common Bathroom of Flat No. 103
3	Observed dampness at the skirting level of Master Bedroom of Flat No. 103	3.1	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103
4	Observed dampness at the skirting level of Kitchen of Flat No. 103	4.1	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103
5	Observed dampness & efflorescence on the wall surface of Master Bedroom of Flat No. 103	5.1	Observed cracks on the External wall of building near Master Bedroom of Flat No. 103
6	Observed leakage at the Parking ceiling below Flat No. 103	6.1	Observed plumbing issue & gaps between the tile joints of Common Bathroom of Flat No. 103
7	Observed mild dampness at the ceiling of Common Bathroom of Flat No. 103	7.1	Observed gap between tile joints of Common & Master Bedroom Bathrooms of Flat No. 203.



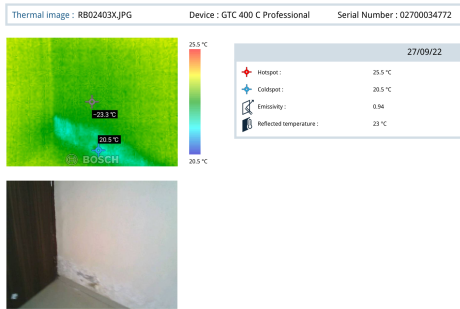

5

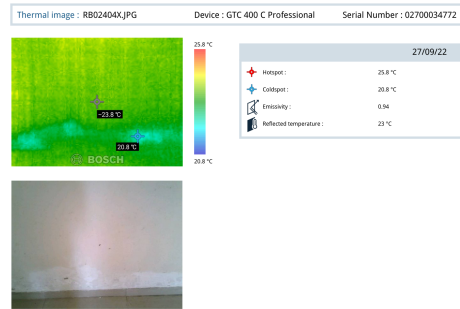

6

Point 3 - Master Bedroom of Flat No. 103

Inspection observation: Observed dampness at the skirting level of Master Bedroom of Flat No. 103

Linked exposed/positive-side observation: Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103


Thermal readings from mapped thermal pages: Page 9 (RB02392X.JPG): Hotspot 25.8 °C, Coldspot 20.8 °C; Page 10 (RB02393X.JPG): Hotspot 25.9 °C, Coldspot 20.9 °C; Page 11 (RB02394X.JPG): Hotspot 26 °C, Coldspot 21 °C; Page 12 (RB02396X.JPG): Hotspot 26.1 °C, Coldspot 21.1 °C

Image evidence from provided PDFs:

UrbanRoof

SUMMARY TABLE

Point No.	Impacted area (see side)	Point No.	Exposed area (see side)
1	Observed dampness at the skirting level of Hall of Flat No. 103	1.1	Observed gaps between the tile joints of Common Bathroom of Flat No. 103
2	Observed dampness at the skirting level of the Common Bedroom of Flat No. 103	2.1	Observed gaps between the tile joints of Common Bathroom of Flat No. 103
3	Observed dampness at the skirting level of Master Bedroom of Flat No. 103	3.1	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103
4	Observed dampness at the skirting level of Kitchen of Flat No. 103	4.1	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103
5	Observed dampness & efflorescence on the wall surface of Master Bedroom of Flat No. 103	5.1	Observed cracks on the External wall of building near Master Bedroom of Flat No. 103
6	Observed leakage at the Parking ceiling below Flat No. 103	6.1	Observed plumbing issue & gaps between the tile joints of Common Bathroom of Flat No. 103
7	Observed mild dampness at the ceiling of Common Bathroom of Flat No. 103	7.1	Observed gap between tile joints of Common & Master Bedroom Bathrooms of Flat No. 103

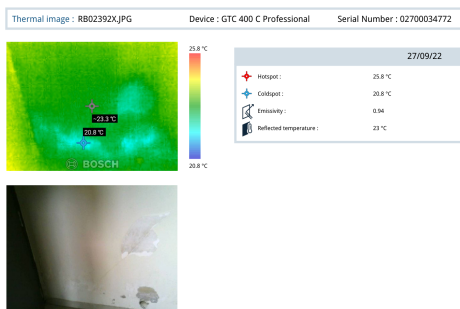

9



10

Point 4 - Kitchen of Flat No. 103

Inspection observation: Observed dampness at the skirting level of Kitchen of Flat No. 103

Linked exposed/positive-side observation: Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103

Thermal readings from mapped thermal pages: Page 13 (RB02397X.JPG): Hotspot 26.3 °C, Coldspot 21.3 °C; Page 14 (RB02398X.JPG): Hotspot 25.6 °C, Coldspot 20.6 °C; Page 15 (RB02399X.JPG): Hotspot 26.5 °C, Coldspot 21.5 °C; Page 16 (RB02400X.JPG): Hotspot 25.2 °C, Coldspot 20.2 °C

Image evidence from provided PDFs:

SUMMARY TABLE

Point No.	Impacted area (vne side)	Point No.	Exposed area (vne side)
1	Observed dampness at the skirting level of Hall of Flat No. 103	1.1	Observed gaps between the tile joints of Common Bathroom of Flat No. 103
2	Observed dampness at the skirting level of the Common Bedroom of Flat No. 103	2.1	Observed gaps between the tile joints of Common Bathroom of Flat No. 103
3	Observed dampness at the skirting level of Master Bedroom of Flat No. 103	3.1	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103
4	Observed dampness at the skirting level of Kitchen of Flat No. 103	4.1	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103
5	Observed dampness & efflorescence on the wall surface of Master Bedroom of Flat No. 103	5.1	Observed cracks on the External wall of building near Master Bedroom of Flat No. 103
6	Observed leakage at the Parking ceiling below Flat No. 103	6.1	Observed plumbing issue & gaps between the tile joints of Common Bathroom of Flat No. 103
7	Observed mild dampness at the ceiling of Common Bathroom of Flat No. 103	7.1	Observed gap between the joints of Common & Master Bedroom Bathrooms of Flat No. 203

Photo 31



Photo 33

Photo 32


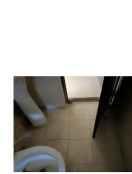



Photo 34

Thermal image : RB02397X.JPG Device : GTC 400 C Professional Serial Number : 02700034772

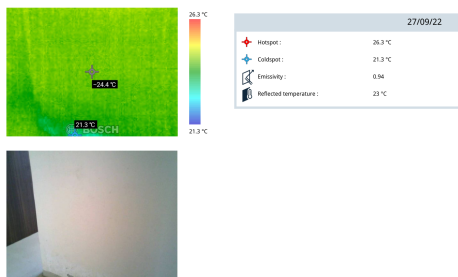

13

Thermal image : RB02398X.JPG Device : GTC 400 C Professional Serial Number : 02700034772

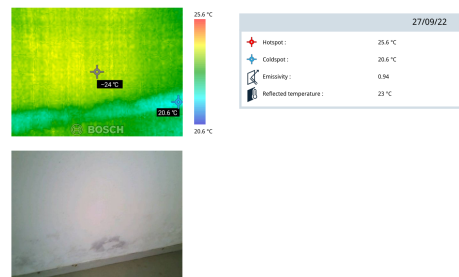

14

Point 5 - Master Bedroom wall / External wall near Master Bedroom of Flat No. 103

Inspection observation: Observed dampness & efflorescence on the wall surface of Master Bedroom of Flat No. 103

Linked exposed/positive-side observation: Observed cracks on the External wall of building near Master Bedroom of Flat No. 103

Thermal readings from mapped thermal pages: Page 17 (RB02401X.JPG): Hotspot 25.6 °C, Coldspot 20.6 °C; Page 18 (RB02381X.JPG): Hotspot 27 °C, Coldspot 22 °C; Page 19 (RB02382X.JPG): Hotspot 26.7 °C, Coldspot 21.7 °C; Page 20 (RB02383X.JPG): Hotspot 26.5 °C, Coldspot 21.5 °C

Image evidence from provided PDFs:

SUMMARY TABLE

Point No.	Impacted area (vne side)	Point No.	Exposed area (vne side)
1	Observed dampness at the skirting level of Hall of Flat No. 103	1.1	Observed gaps between the tile joints of Common Bathroom of Flat No. 103
2	Observed dampness at the skirting level of the Common Bedroom of Flat No. 103	2.1	Observed gaps between the tile joints of Common Bathroom of Flat No. 103
3	Observed dampness at the skirting level of Master Bedroom of Flat No. 103	3.1	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103
4	Observed dampness at the skirting level of Kitchen of Flat No. 103	4.1	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103
5	Observed dampness & efflorescence on the wall surface of Master Bedroom of Flat No. 103	5.1	Observed cracks on the External wall of building near Master Bedroom of Flat No. 103
6	Observed leakage at the Parking ceiling below Flat No. 103	6.1	Observed plumbing issue & gaps between the tile joints of Common Bathroom of Flat No. 103
7	Observed mild dampness at the ceiling of Common Bathroom of Flat No. 103	7.1	Observed gap between tile joints of Common & Master Bedroom Bathrooms of Flat No. 203

Photo 39

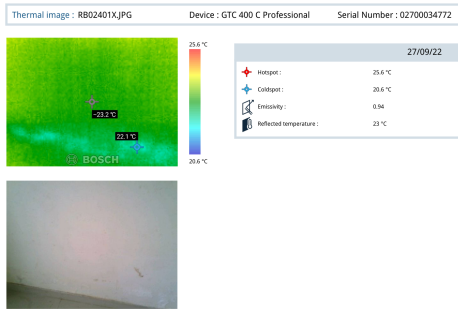


Photo 41


Photo 40



Photo 42



17

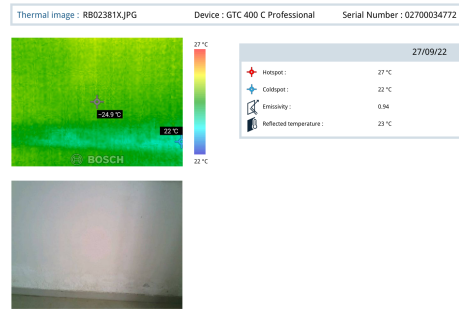

18

Point 6 - Parking ceiling below Flat No. 103

Inspection observation: Observed leakage at the Parking ceiling below Flat No. 103


Linked exposed/positive-side observation: Observed plumbing issue & gaps between the tile joints of Common Bathroom of Flat No. 103

Thermal readings from mapped thermal pages: Page 21 (RB02384X.JPG): Hotspot 27.3 °C, Coldspot 22.3 °C; Page 22 (RB02385X.JPG): Hotspot 27.3 °C, Coldspot 22.3 °C; Page 23 (RB02387X.JPG): Hotspot 25.2 °C, Coldspot 20.2 °C; Page 24 (RB02388X.JPG): Hotspot 25.1 °C, Coldspot 20.1 °C


Image evidence from provided PDFs:

UrbanRoof

SUMMARY TABLE			
Point No.	Impacted area (see side)	Point No.	Exposed area (see side)
1	Observed dampness at the skirting level of Hall of Flat No. 103	1.1	Observed gaps between the tile joints of Common Bathroom of Flat No. 103
2	Observed dampness at the skirting level of the Common Bedroom of Flat No. 103	2.1	Observed gaps between the tile joints of Common Bathroom of Flat No. 103
3	Observed dampness at the skirting level of Master Bedroom of Flat No. 103	3.1	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103
4	Observed dampness at the skirting level of Kitchen of Flat No. 103	4.1	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103
5	Observed dampness & efflorescence on the wall surface of Master Bedroom of Flat No. 103	5.1	Observed cracks on the External wall of building near Master Bedroom of Flat No. 103
6	Observed leakage at the Parking ceiling below Flat No. 103	6.1	Observed plumbing issue & gaps between the tile joints of Common Bathroom of Flat No. 103
7	Observed mild dampness at the ceiling of Common Bathroom of Flat No. 103	7.1	Observed gap between the joints of Common & Master Bedroom Bathrooms of Flat No. 203.

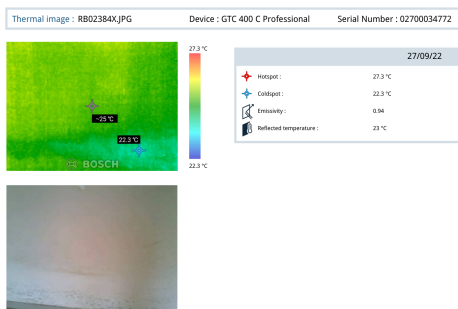

21

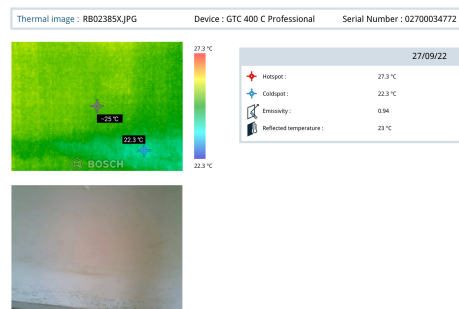

22

Point 7 - Common Bathroom ceiling of Flat No. 103 / Common & Master Bedroom Bathrooms of Flat No. 203

Inspection observation: Observed mild dampness at the ceiling of Common Bathroom of Flat No. 103

Linked exposed/positive-side observation: Observed gap between tile joints of Common & Master Bedroom Bathrooms of Flat No. 203

Thermal readings from mapped thermal pages: Page 25 (RB02389X.JPG): Hotspot 25.9 °C, Coldspot 20.9 °C; Page 26 (RB02390X.JPG): Hotspot 26.9 °C, Coldspot 21.9 °C; Page 27 (RB02391X.JPG): Hotspot 25.6 °C, Coldspot 20.6 °C; Page 28 (RB02377X.JPG): Hotspot 26.9 °C, Coldspot 21.9 °C; Page 29 (RB02378X.JPG): Hotspot 26.4 °C, Coldspot 21.4 °C; Page 30 (RB02379X.JPG): Hotspot 27.8 °C, Coldspot 22.8 °C

Image evidence from provided PDFs:

SUMMARY TABLE

Point No.	Impacted area (v/vr side)	Point No.	Exposed area (v/vr side)
1	Observed dampness at the skirting level of Hall of Flat No. 103	1.1	Observed gaps between the tile joints of Common Bathroom of Flat No. 103
2	Observed dampness at the skirting level of the Common Bedroom of Flat No. 103	2.1	Observed gaps between the tile joints of Common Bathroom of Flat No. 103
3	Observed dampness at the skirting level of Master Bedroom of Flat No. 103	3.1	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103
4	Observed dampness at the skirting level of Kitchen of Flat No. 103	4.1	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103
5	Observed dampness & efflorescence on the wall surface of Master Bedroom of Flat No. 103	5.1	Observed cracks on the External wall of building near Master Bedroom of Flat No. 103
6	Observed leakage at the Parking ceiling below Flat No. 103	6.1	Observed plumbing issue & gaps between the tile joints of Common Bathroom of Flat No. 103
7	Observed mild dampness at the skirting of Common Bathroom of Flat No. 103	7.1	Observed gap between the joints of Common & Master Bedroom Bathrooms of Flat No. 203



Photo 55



Photo 56

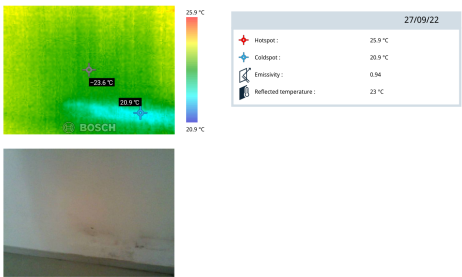


Photo 57

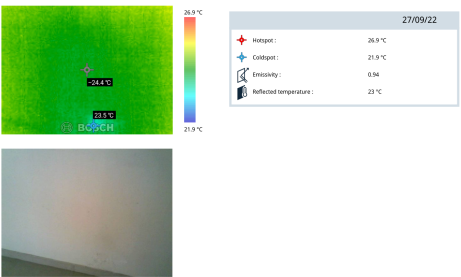


Photo 58

Thermal image : RB02389X.JPG Device : GTC 400 C Professional Serial Number : 02700034772



Thermal image : RB02390X.JPG Device : GTC 400 C Professional Serial Number : 02700034772



3. Probable Root Cause

- Leakage due to concealed plumbing: Yes
- Leakage due to damage in Nahani trap / Brickbat coba under tile flooring: Yes
- Gaps/Blackish dirt observed in tile joints: Yes
- Gaps around Nahani Trap Joints: Yes
- Loose plumbing joints/rust around joints and edges (Flush Tank/shower/angle cock/bibcock, washbasin, etc): Yes
- Internal WC/Bath/Balcony leakage observed: Yes

4. Severity Assessment (with reasoning)

Overall severity: Moderate.

Reasoning based only on inspection checklist values:

- Checklist flagged items: 1 flagged
- Condition of cracks observed on RCC Column and Beam: Moderate
- Major or minor cracks observed over external surface: Moderate
- External plumbing pipes cracked and leaked condition: Moderate
- Algae fungus and Moss observed on external wall: Moderate

5. Recommended Actions

- Repair concealed plumbing leakage points mentioned in the inspection checklist.
- Repair the Nahani trap / Brickbat coba related leakage source mentioned in the inspection checklist.
- Seal gaps between tile joints in the Common Bathroom and Master Bedroom Bathroom areas mentioned in the summary table.
- Rectify loose plumbing joints/rust around joints and edges mentioned in the inspection checklist.
- Repair external wall cracks near the Master Bedroom mentioned in the summary table.
- Recheck affected dampness/leakage areas after repair.

6. Additional Notes

The thermal images provide hotspot and coldspot readings, but exact area labels for every thermal page are Not Available in the thermal PDF text.

Thermal pages are grouped with observations based on document order and supporting visual evidence only.

The seven-point summary table is used as the master issue list to avoid duplicate points.

7. Missing or Unclear Information

- Customer Name: Not Available
- Mobile: Not Available
- Email: Not Available
- Address: Not Available
- Property Age: Not Available
- Exact room/location label for each individual thermal page: Not Available
- Individual thermal images are not labelled area-wise inside Thermal Images.pdf: Not Available

Thermal Reading Appendix

Page	Thermal image	Date	Hotspot °C	Coldspot °C
1	RB02380X.JPG	27/09/22	28.8	23.4
2	RB02386X.JPG	27/09/22	27.4	22.4
3	RB02395X.JPG	27/09/22	27	22
4	RB02402X.JPG	27/09/22	25.7	20.7
5	RB02403X.JPG	27/09/22	25.5	20.5
6	RB02404X.JPG	27/09/22	25.8	20.8
7	RB02405X.JPG	27/09/22	26.2	21.2
8	RB02406X.JPG	27/09/22	26.5	21.5
9	RB02392X.JPG	27/09/22	25.8	20.8
10	RB02393X.JPG	27/09/22	25.9	20.9
11	RB02394X.JPG	27/09/22	26	21
12	RB02396X.JPG	27/09/22	26.1	21.1
13	RB02397X.JPG	27/09/22	26.3	21.3
14	RB02398X.JPG	27/09/22	25.6	20.6
15	RB02399X.JPG	27/09/22	26.5	21.5
16	RB02400X.JPG	27/09/22	25.2	20.2
17	RB02401X.JPG	27/09/22	25.6	20.6
18	RB02381X.JPG	27/09/22	27	22
19	RB02382X.JPG	27/09/22	26.7	21.7
20	RB02383X.JPG	27/09/22	26.5	21.5
21	RB02384X.JPG	27/09/22	27.3	22.3
22	RB02385X.JPG	27/09/22	27.3	22.3
23	RB02387X.JPG	27/09/22	25.2	20.2
24	RB02388X.JPG	27/09/22	25.1	20.1
25	RB02389X.JPG	27/09/22	25.9	20.9
26	RB02390X.JPG	27/09/22	26.9	21.9
27	RB02391X.JPG	27/09/22	25.6	20.6
28	RB02377X.JPG	27/09/22	26.9	21.9
29	RB02378X.JPG	27/09/22	26.4	21.4
30	RB02379X.JPG	27/09/22	27.8	22.8