

MAIN DDR (DETAILED DIAGNOSTIC REPORT)

Generated strictly from provided PDFs only: Sample Report.pdf and Thermal Images.pdf

Inspection Date and Time	27.09.2022 14:28 IST
Inspected By	Krushna & Mahesh
Property Type	Flat
Floors	11
Previous Structural audit done	No
Previous Repair work done	No
Customer Name	Not Available
Mobile	Not Available
Email	Not Available
Address	Not Available
Property Age	Not Available

Source Summary Table from Sample Report (page 10)

SUMMARY TABLE

Point No	Impacted area (-ve side)	Point No	Exposed area (+ve side)
1	Observed dampness at the skirting level of Hall of Flat No. 103	1.1	Observed gaps between the tile joints of Common Bathroom of Flat No. 103
2	Observed dampness at the skirting level of the Common Bedroom of Flat No. 103	2.1	Observed gaps between the tile joints of Common Bathroom of Flat No. 103
3	Observed dampness at the skirting level of Master Bedroom of Flat No. 103	3.1	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103
4	Observed dampness at the skirting level of Kitchen of Flat No. 103	4.1	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103
5	Observed dampness & efflorescence on the wall surface of Master Bedroom of Flat No. 103	5.1	Observed cracks on the External wall of building near Master Bedroom of Flat No. 103
6	Observed leakage at the Parking ceiling below Flat No. 103	6.1	Observed plumbing issue & gaps between the tile joints of Common Bathroom of Flat No. 103
7	Observed mild dampness at the ceiling of Common Bathroom of Flat No. 103	7.1	Observed gap between tile joints of Common & Master Bedroom Bathrooms of Flat No. 203.

1. Property Issue Summary

- Dampness is recorded at skirting level in Hall, Common Bedroom, Master Bedroom, and Kitchen of Flat No. 103.
- Dampness and efflorescence are recorded on the wall surface of Master Bedroom of Flat No. 103.
- Leakage is recorded at the parking ceiling below Flat No. 103.
- Mild dampness is recorded at the ceiling of Common Bathroom of Flat No. 103.
- Gaps between tile joints are recorded in Common Bathroom and Master Bedroom Bathroom areas.
- Plumbing issue is recorded in the Common Bathroom of Flat No. 103.
- Cracks are recorded on the external wall of the building near Master Bedroom of Flat No. 103.

- Thermal Images.pdf provides thermal images dated 27/09/22 with hotspot and coldspot readings for each page; exact room labels are not available in the thermal document text.

2. Area-wise Observations

2.1 Hall, Flat No. 103

Inspection observation	Observed dampness at the skirting level of Hall of Flat No. 103
Linked exposed/positive side finding	Observed gaps between the tile joints of Common Bathroom of Flat No. 103
Severity note	Moderate (checklist records leakage condition and related defects as moderate/yes where applicable).
Image reference	Sample Report page 11, Photos 1-7; Thermal Report pages 1-8

Relevant source image(s):

sample page 11



UrbanRoof

Appendix



Photo 1



Photo 2

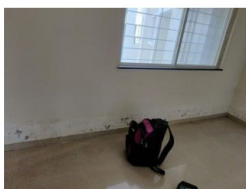


Photo 3

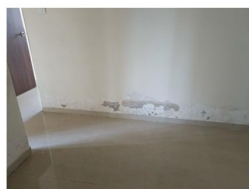


Photo 4

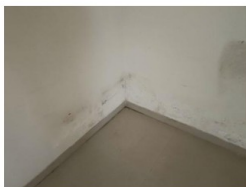


Photo 5



Photo 6

thermal page 01



1

2.2 Common Bedroom, Flat No. 103

Inspection observation

Observed dampness at the skirting level of the Common Bedroom of Flat No. 103

Linked exposed/positive side finding

Observed gaps between the tile joints of Common Bathroom of Flat No. 103

Severity note

Moderate (same checklist category and dampness/leakage context).

Image reference

Sample Report pages 12-13, Photos 12-20; Thermal Report pages 9-17

Relevant source image(s):

sample page 13

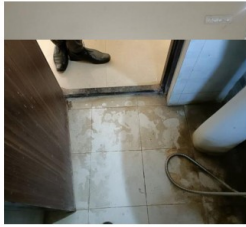


Photo 15

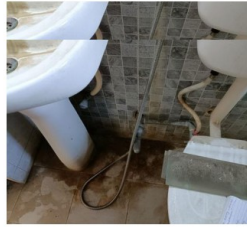


Photo 16



Photo 17



Photo 18

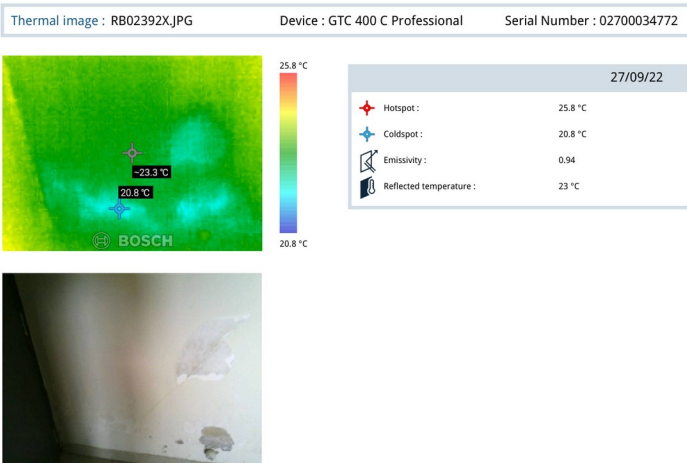


Photo 19



Photo 20

thermal page 09



9

2.3 Master Bedroom, Flat No. 103

Inspection observation

Linked exposed/positive side finding

Observed dampness at the skirting level of Master Bedroom of Flat No. 103

Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103

Severity note

Moderate (same checklist category and dampness/leakage context).

Image reference

Sample Report pages 13-15, Photos 20-30; Thermal Report pages 18-22

Relevant source image(s):

sample page 14



Photo 21



Photo 23



Photo 25

Photo 22

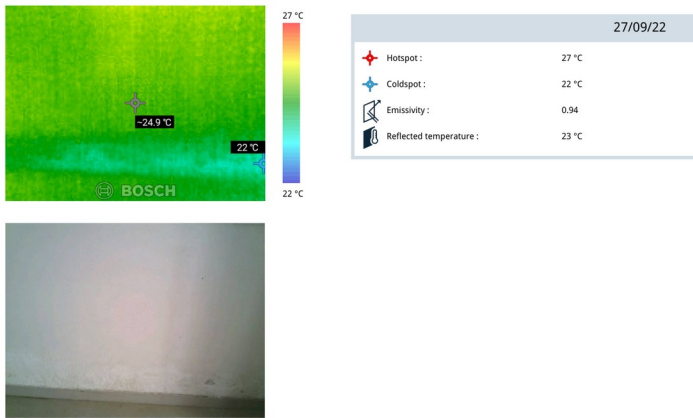


Photo 24



Photo 26

thermal page 18



18

2.4 Kitchen, Flat No. 103

Inspection observation

Observed dampness at the skirting level of Kitchen of Flat No. 103

Linked exposed/positive side finding

Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103

Severity note

Moderate (same checklist category and dampness/leakage context).

Image reference

Sample Report page 16, Photos 31-37; Thermal Report pages 23-27

Relevant source image(s):

sample page 16

Photo 31



Photo 33

Photo 32


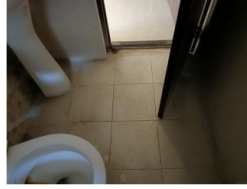


Photo 34

thermal page 23

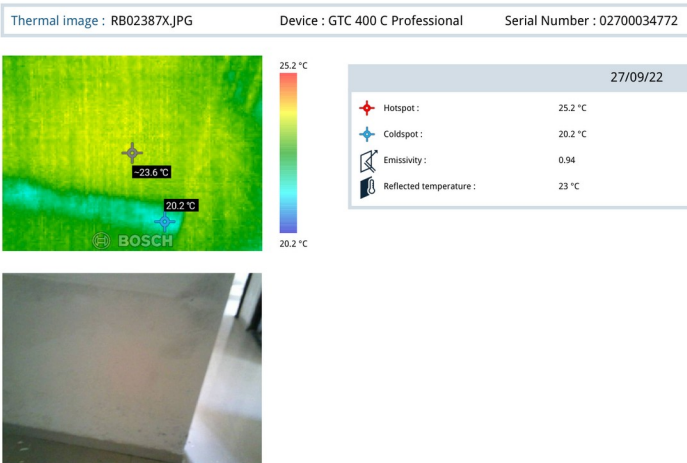

23

2.5 Master Bedroom wall / External wall near Master Bedroom, Flat No. 103

Inspection observation

Observed dampness & efflorescence on the wall surface of Master Bedroom of Flat No. 103

Linked exposed/positive side finding

Observed cracks on the External wall of building near Master Bedroom of Flat No. 103

Severity note

Moderate (external wall cracks are recorded as Moderate).

Image reference

Sample Report pages 17-20, Photos 38-48; Thermal Report pages 28-30

Relevant source image(s):

sample page 18



UrbanRoof

Photo 39



Photo 41

Photo 40



Photo 42

sample page 19



Photo 43



Photo 44

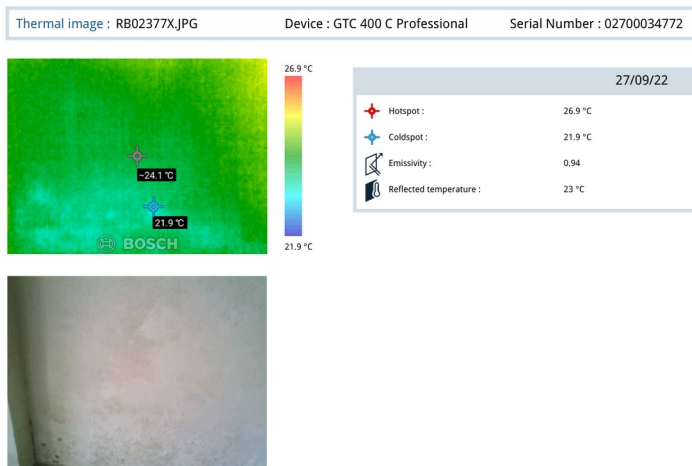


Photo 45



Photo 46

thermal page 28



28

2.6 Parking ceiling below Flat No. 103

Inspection observation

Observed leakage at the Parking ceiling below Flat No. 103

Linked exposed/positive side finding

Observed plumbing issue & gaps between the tile joints of Common Bathroom of Flat No. 103

Severity note

Moderate (leakage/plumbing related checklist items marked

Image reference

Yes; type of tile marked Moderate).

Sample Report pages 20-22, Photos 49-57; Thermal image specific to this exact parking point: Image Not Available

Relevant source image(s):

sample page 20



UrbanRoof



Photo 47



Photo 48



Photo 49



Photo 50

sample page 22

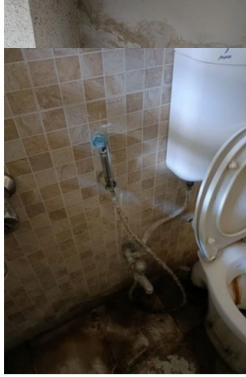


Photo 55



Photo 56



Photo 57



Photo 58

2.7 Common Bathroom ceiling, Flat No. 103 / Bathrooms of Flat No. 203

Inspection observation

Observed mild dampness at the ceiling of Common Bathroom of Flat No. 103

Linked exposed/positive side finding

Observed gap between tile joints of Common & Master Bedroom Bathrooms of Flat No. 203

Severity note

Moderate (inspection mentions mild dampness, but checklist still records relevant leakage causes as Yes).

Image reference

Sample Report pages 22-23, Photos 58-64; Thermal image specific to this exact ceiling point: Image Not Available

Relevant source image(s):

sample page 22



Photo 55



Photo 56



Photo 57



Photo 58

Photo 59



Photo 61



Photo 63

Photo 60



Photo 62



Photo 64

3. Probable Root Cause

- Leakage due to concealed plumbing: Yes.
- Leakage due to damage in Nahani trap / Brickbat coba under tile flooring: Yes.
- Gaps / blackish dirt observed in tile joints: Yes.
- Gaps around Nahani Trap joints: Yes.
- Loose plumbing joints / rust around joints and edges: Yes.
- Internal WC/Bath/Balcony leakage observed: Yes.
- External wall cracks are recorded near the Master Bedroom of Flat No. 103.

4. Severity Assessment

Overall severity: Moderate

- Condition of cracks observed on RCC Column and Beam: Moderate.
- Major or minor cracks over external surface: Moderate.
- External plumbing pipes cracked and leaked condition: Moderate.
- Algae fungus and moss observed on external wall: Moderate.
- The inspection form reports one flagged item and score 85.71%.
- No higher severity value is stated in the provided documents.

5. Recommended Actions

- Attend to concealed plumbing leakage points recorded as Yes in the inspection checklist.
- Attend to Nahani Trap / Brickbat coba related leakage points recorded as Yes.
- Seal or repair gaps between tile joints in Common Bathroom and Master Bedroom Bathroom areas.
- Check and rectify loose plumbing joints / rust around plumbing joints and edges recorded as Yes.
- Address external wall cracks near the Master Bedroom of Flat No. 103.
- Recheck affected dampness areas after completing the above rectification work.

6. Additional Notes

- Thermal Images.pdf contains 30 thermal image pages dated 27/09/22.
- Thermal pages include hotspot, coldspot, emissivity, reflected temperature, device and serial number details.
- Thermal document does not provide explicit room-wise labels in the extracted text; therefore exact area matching has been kept conservative.
- All customer identity fields that are blank in the provided report are marked Not Available.

Thermal Readings Extracted from Thermal Images.pdf

Page	Thermal Image	Hotspot °C	Coldspot °C	Date
1	RB02380X.JPG	28.8	23.4	27/09/22
2	RB02386X.JPG	27.4	22.4	27/09/22
3	RB02395X.JPG	27	22	27/09/22
4	RB02402X.JPG	25.7	20.7	27/09/22
5	RB02403X.JPG	25.5	20.5	27/09/22
6	RB02404X.JPG	25.8	20.8	27/09/22
7	RB02405X.JPG	26.2	21.2	27/09/22
8	RB02406X.JPG	26.5	21.5	27/09/22
9	RB02392X.JPG	25.8	20.8	27/09/22
10	RB02393X.JPG	25.9	20.9	27/09/22
11	RB02394X.JPG	26	21	27/09/22
12	RB02396X.JPG	26.1	21.1	27/09/22
13	RB02397X.JPG	26.3	21.3	27/09/22
14	RB02398X.JPG	25.6	20.6	27/09/22
15	RB02399X.JPG	26.5	21.5	27/09/22
16	RB02400X.JPG	25.2	20.2	27/09/22
17	RB02401X.JPG	25.6	20.6	27/09/22
18	RB02381X.JPG	27	22	27/09/22
19	RB02382X.JPG	26.7	21.7	27/09/22
20	RB02383X.JPG	26.5	21.5	27/09/22
21	RB02384X.JPG	27.3	22.3	27/09/22

22	RB02385X.JPG	27.3	22.3	27/09/22
23	RB02387X.JPG	25.2	20.2	27/09/22
24	RB02388X.JPG	25.1	20.1	27/09/22
25	RB02389X.JPG	25.9	20.9	27/09/22
26	RB02390X.JPG	26.9	21.9	27/09/22
27	RB02391X.JPG	25.6	20.6	27/09/22
28	RB02377X.JPG	26.9	21.9	27/09/22
29	RB02378X.JPG	26.4	21.4	27/09/22
30	RB02379X.JPG	27.8	22.8	27/09/22

7. Missing or Unclear Information

- Customer Name: Not Available
- Mobile: Not Available
- Email: Not Available
- Address: Not Available
- Property Age: Not Available
- Exact room label for each thermal image: Not Available
- Exact mapping between every thermal page and every inspection photo: Not Available
- Specific thermal image for Parking ceiling leakage: Image Not Available
- Specific thermal image for Common Bathroom ceiling mild dampness: Image Not Available
- Conflicting information: Not Available / No direct conflict found in extracted text.

Appendix: Source Documents Used

- Sample Report.pdf
- Thermal Images.pdf