Detailed Diagnostic Report (DDR)

TABLE OF CONTENTS

1. Inspection Form
2. Checklists / Inspection Checklists
3. Impacted Areas/Rooms
4. Inspection Checklists
5. SUMMARY TABLE
6. Appendix

SECTION 1: INTRODUCTION

Background:

This Detailed Diagnostic Report is prepared for the inspection of a residential flat.

Objective:

To identify sources of leakage, dampness, and structural defects, and provide a comprehensive report on the overall condition of the property.

Scope of Work:

Inspection of Hall, Bedroom, Kitchen, Master Bedroom, Parking Area, Common bathroom, WC, and External Wall including RCC members, plaster, paint adhesion, and plumbing.

Tools Used:

GTC 400 C Professional Thermal Camera, Moisture Meter, Visual Inspection

SECTION 2: GENERAL INFORMATION

Report ID	Not Available
Site Address	Not Available
Type of Structure	Residential Building
Property Type	Flat
Floors	11
Year of Construction	Not Available
Age Building years	Not Available
Inspection Date	27.09.2022
Inspector Names	Krushna & Mahesh
Customer Name	Not Available
Customer Mobile	Not Available
Customer Email	Not Available

Detailed Diagnostic Report (DDR)

INSPECTION SUMMARY

Checklists Flagged: 1 out of 2 flagged

Overall Score: 85.71%

Condition Statistics:

Good: 0

Moderate: 4

Poor: 0

Yes: 7

No: 1

N/A: 19

Not sure: 1

Detailed Diagnostic Report (DDR)

SECTION 3: INSPECTION CHECKLISTS

WC

Score: 16.67%

Condition of leakage at adjacent walls	Not Available
Condition of leakage below WC	Not Available
Leakage during:	All time
Leakage due to concealed plumbing	Yes
Leakage due to damage in Nahani trap/Brickbat coba under tile flooring	Yes
Gaps/Blackish dirt Observed in tile joints	Yes
Gaps around Nahani Trap Joints	Yes
Tiles Broken/Loosed anywhere	No
Loose Plumbing joints/rust around joints and edges (Flush Tank/shower/ang le cock/bibcock, washbasin, etc)	Yes
Type of tile	Not Available

External Wall

Score: 0%

Condition of leakage at interior side	Not Available
Leakage during:	All time
Leakage due to concealed plumbing	Yes
Internal WC/Bath/Balcony leakage observed	Yes
Existing type of paint and manufacturer	Not sure
Condition of cracks observed on RCC Column and Beam	Moderate
Condition of rust marks observed in RCC Beam and Column	N/A
Condition of corrosion/spall ing of concrete/expose d reinforcement observed in column/beams/ro of slab ceiling	N/A
Expansion joints condition if any	N/A
Are there any major or minor cracks observed over external surface?	Moderate
Are the sealants applied on the window frame joints intact?	N/A
Condition of wall mounted AC Frames, holes, drain pipes over the wall.	N/A
Are the external plumbing pipes cracked and leaked? If yes its condition.	Moderate
Are the openings around the pipes in external wall properly grouted? If not its condition.	N/A

Detailed Diagnostic Report (DDR)

Condition of any vegetation growth, dish antennas fixed on parapet wall observed?	N/A
Chalking and flaking in paint film.	N/A
Algae fungus and Moss observed on external wall?	Moderate
Bird droppings condition observed on external wall and Chajja	N/A
Condition of corrosion on metal rods and MS window grills	N/A
Patchwork plaster required? if yes its condition?	N/A
Entire replaster required? if yes its condition?	N/A
Condition of separation cracks observed at beam-column junction	N/A
Condition of leakage observed from overhead water tank	N/A
Loose plaster/hollow sond on external surfaces?if observed,	N/A

Detailed Diagnostic Report (DDR)

AREA-WISE OBSERVATIONS

Area: Hall, Common Bathroom

Negative Side (Damage / Seepage):

Hall Skirting level Dampness

Positive Side (Probable Cause):

Common Bathroom tile hollowness

Normal Images:

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

Area: Bedroom, Common Bathroom

Negative Side (Damage / Seepage):

Bedroom Skirting level Dampness

Positive Side (Probable Cause):

Common Bathroom tile hollowness

Normal Images:

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

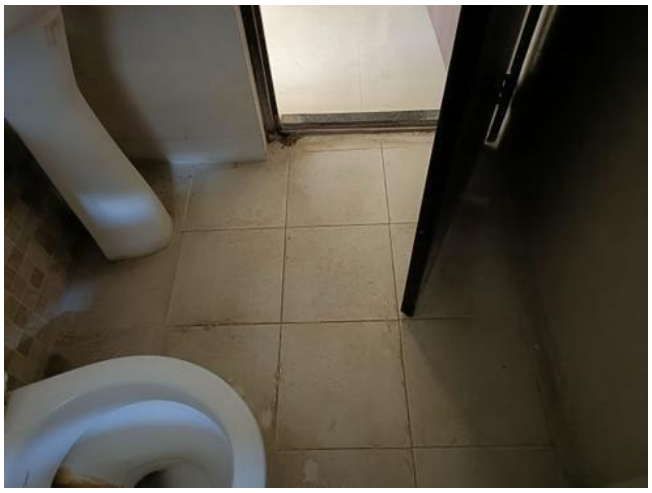

Detailed Diagnostic Report (DDR)

Area: Master Bedroom, MB Bathroom

Negative Side (Damage / Seepage):

Master bedroom Skirting level Dampness

Positive Side (Probable Cause):

MB Bathroom tile hollowness

Normal Images:

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

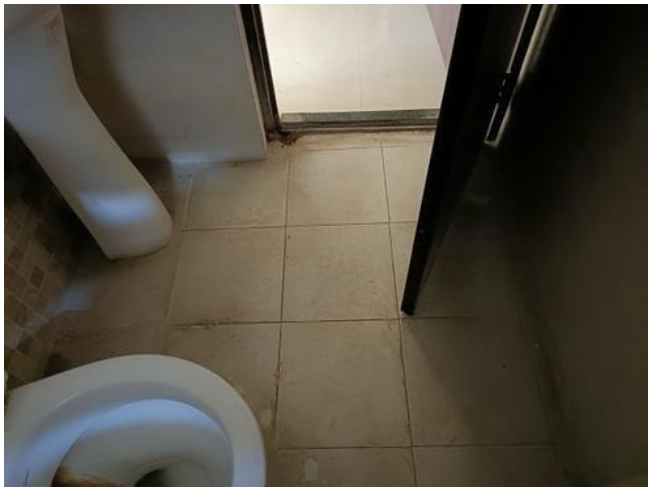

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

Area: Kitchen, Master bedroom bathroom

Negative Side (Damage / Seepage):

Kitchen Skirting level Dampness

Positive Side (Probable Cause):

Master bedroom bathroom

Normal Images:

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

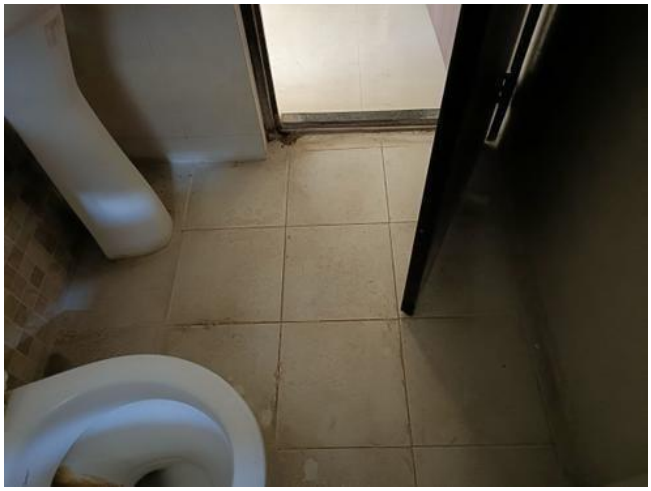

Detailed Diagnostic Report (DDR)

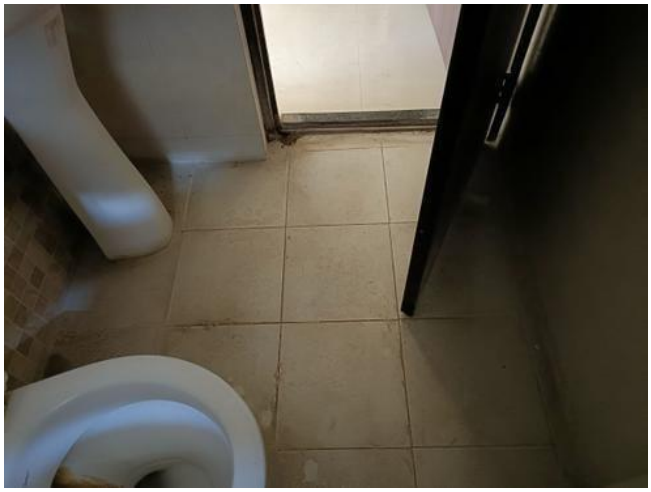

Detailed Diagnostic Report (DDR)

Area: Master bedroom wall, External wall

Negative Side (Damage / Seepage):

Master bedroom wall damness

Positive Side (Probable Cause):

External wall crack and Duct Issue

Normal Images:

Detailed Diagnostic Report (DDR)

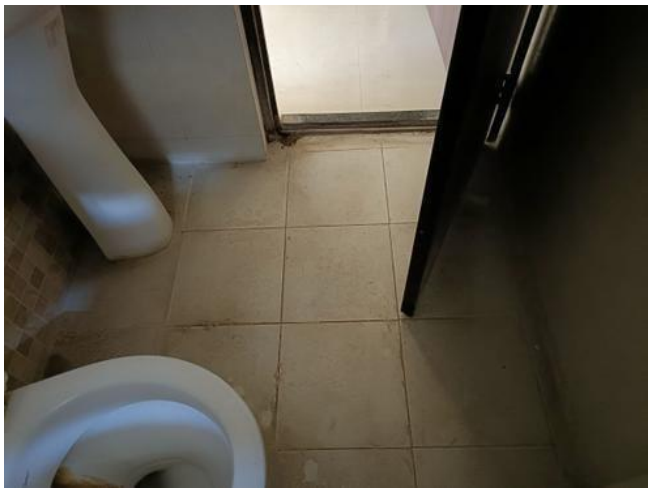

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

Area: Parking Area, Common Bathroom

Negative Side (Damage / Seepage):

Parking Area seepage

Positive Side (Probable Cause):

Common Bathroom tile hollowness and plumbing issue

Normal Images:

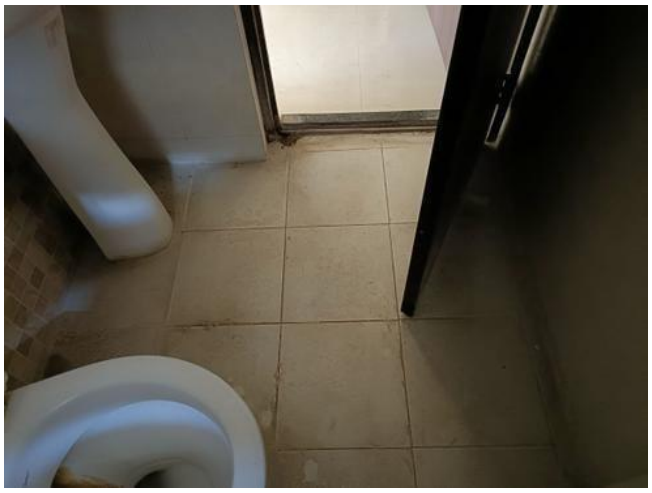

Detailed Diagnostic Report (DDR)

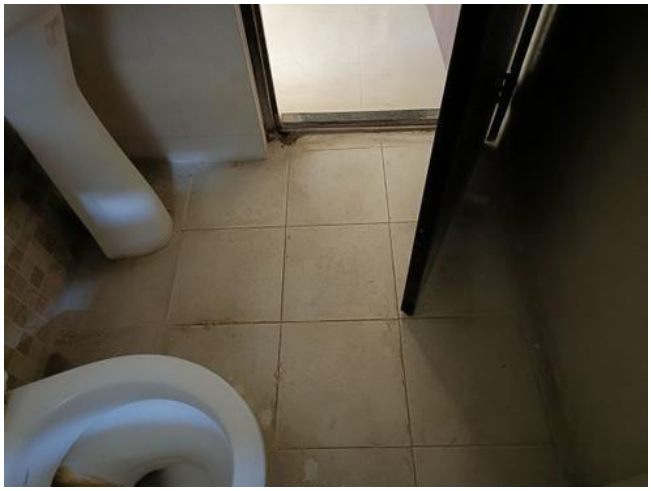

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

Area: Common Bathroom Ceiling, Flat No 203

Negative Side (Damage / Seepage):

Common Bathroom Ceiling Dampness

Positive Side (Probable Cause):

Flat no 203 tile joint open and outlet Leakage

Normal Images:

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

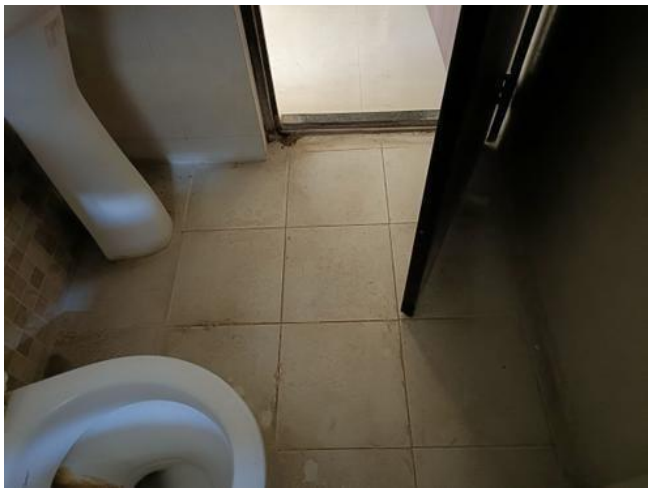

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

SECTION 4: SUMMARY TABLE

Impacted Area	Observed Issue	Probable Cause	Severity	Suggested Remedy
Hall of Flat No. 103	Observed dampness at the skirting level of Hall.	Gaps between the tile joints and hollowness in the Common Bathroom of Flat No. 103, leading to water seepage.	**Medium**	Epoxy injection grouting of Common Bathroom tile joints and re-grouting of Nahani trap joints in Common Bathroom.
Common Bedroom of Flat No. 103	Observed dampness at the skirting level of the Common Bedroom.	Gaps between the tile joints and hollowness in the Common Bathroom of Flat No. 103, leading to water seepage.	**Medium**	Epoxy injection grouting of Common Bathroom tile joints and re-grouting of Nahani trap joints in Common Bathroom.
Master Bedroom of Flat No. 103	Observed dampness at the skirting level of Master Bedroom.	Gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103, allowing water ingress.	**Medium**	Epoxy injection grouting of Master Bedroom Bathroom tile joints.
Kitchen of Flat No. 103	Observed dampness at the skirting level of Kitchen.	Gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103, allowing water ingress.	**Medium**	Epoxy injection grouting of Master Bedroom Bathroom tile joints.
Master Bedroom of Flat No. 103 (Wall surface)	Observed dampness & efflorescence on the wall surface of Master Bedroom.	Cracks on the External wall of the building near Master Bedroom of Flat No. 103.	**Medium**	Repair and seal cracks on the external wall using appropriate waterproofing sealant. Address any duct issues identified.
Parking ceiling below Flat No. 103	Observed leakage at the Parking ceiling below Flat No. 103.	Plumbing issue and gaps between the tile joints of Common Bathroom of Flat No. 103, causing active water seepage.	**High**	Conduct plumbing leak detection and repair in Common Bathroom. Epoxy injection grouting for all tile joints in Common Bathroom. Assess for waterproofing membrane re-application.
Common Bathroom Ceiling of Flat No. 103	Observed mild dampness at the ceiling of Common Bathroom.	Gaps between tile joints of Common & Master Bedroom Bathrooms of Flat No. 203 (upper floor) and outlet leakage from Flat No. 203.	**High**	Contact the resident of Flat No. 203 to inspect and repair tile joint gaps and outlet leakage in their Common and Master Bedroom Bathrooms. Repair and re-paint the ceiling of the Common Bathroom in Flat No. 103 after source repair.

Detailed Diagnostic Report (DDR)

OVERALL RECOMMENDATIONS

1. Address all identified tile joint gaps and hollowness in Common Bathroom and Master Bedroom Bathroom of Flat No. 103 immediately with epoxy injection grouting to prevent further seepage.
2. Investigate and repair concealed plumbing issues in Common Bathroom of Flat No. 103 to stop active leakage impacting the parking area below.
3. Implement external wall crack repair using polyurethane sealants for the cracks observed near the Master Bedroom of Flat No. 103 to prevent water ingress and dampness.
4. Coordinate with the resident of Flat No. 203 to facilitate necessary repairs to tile joints and plumbing outlets in their bathrooms, as they are a probable cause for dampness in the Common Bathroom ceiling of Flat No. 103.
5. Monitor affected skirting and wall areas after primary repairs for any recurring dampness and address any underlying issues promptly.
6. Consider a comprehensive waterproofing assessment for wet areas if the current issues are extensive or recurrent, to ensure long-term protection.