Detailed Diagnostic Report (DDR)

TABLE OF CONTENTS

1. Metadata
2. Checklists / Inspection Checklists Overview
3. Impacted Areas/Rooms
3.1 Impacted Area 1
3.2 Impacted Area 2
3.3 Impacted Area 3
3.4 Impacted Area 4
3.5 Impacted Area 5
3.6 Impacted Area 6
3.7 Impacted Area 7
4. Inspection Checklists
4.1 WC Checklist
4.2 External Wall Checklist
5. Summary Table
6. Overall Recommendations
7. Limitation and Precaution

SECTION 1: INTRODUCTION

Background:

This Detailed Diagnostic Report is prepared for the inspection of a flat to identify sources of leakage, dampness, and structural defects, and provide recommendations for remediation.

Objective:

To identify sources of leakage, dampness, and structural defects within the inspected property and to provide actionable recommendations for their repair and prevention.

Scope of Work:

The inspection covered various areas including the Hall, Bedroom, Kitchen, Master Bedroom, Parking Area, and Common Bathroom.

Tools Used:

GTC 400 C Professional Thermal Camera, Moisture Meter, Visual Inspection

---

Detailed Diagnostic Report (DDR)

SECTION 2: GENERAL INFORMATION

Report ID	Not Available
Site Address	Not Available
Type of Structure	Residential Building
Property Type	Flat
Floors	11
Year of Construction	Not Available
Age Building years	Not Available
Inspection Date	27.09.2022
Inspector Names	Krushna & Mahesh
Customer Name	Not Available
Customer Mobile	Not Available
Customer Email	Not Available

INSPECTION SUMMARY

Checklists Flagged: 1 flagged

Overall Score: 85.71%

Condition Statistics:

Good: 1

Moderate: 11

Poor: 0

Detailed Diagnostic Report (DDR)

SECTION 3: INSPECTION CHECKLISTS

WC

Score: 16.67%

Condition of leakage at adjacent walls	Not Available
Condition of leakage below WC	Not Available
Leakage due to concealed plumbing	Yes
Leakage due to damage in Nahani trap/Brickbat coba under tile flooring	Yes
Gaps/Blackish dirt Observed in tile joints	Yes
Gaps around Nahani Trap Joints	Yes
Tiles Broken/Loosed anywhere	No
Loose Plumbing joints/rust around joints and edges (Flush Tank/shower/ang le cock/bibcock, washbasin, etc)	Yes
Type of tile	Not Available

External Wall

Score: 0%

Condition of leakage at interior side	Not Available
Leakage during:	All time
Leakage due to concealed plumbing	Yes
Internal WC/Bath/Balcony leakage observed	Yes
Existing type of paint and manufacturer	Not sure
Condition of cracks observed on RCC Column and Beam	Moderate
Condition of rust marks observed in RCC Beam and Column	N/A
Condition of corrosion/spall ing of concrete/expose d reinforcement observed in column/beams/ro of slab ceiling	N/A
Expansion joints condition if any	N/A
Are there any major or minor cracks observed over external surface?	Moderate
Are the sealants applied on the window frame joints intact?	N/A
Condition of wall mounted AC Frames, holes, drain pipes over the wall.	N/A
Are the external plumbing pipes cracked and leaked? If yes its condition.	Moderate
Are the openings around the pipes in external wall properly grouted? If not its condition.	N/A

Detailed Diagnostic Report (DDR)

Condition of any vegetation growth, dish antennas fixed on parapet wall observed?	N/A
Chalking and flaking in paint film.	N/A
Algae fungus and Moss observed on external wall?	Moderate
Bird droppings condition observed on external wall and Chajja	N/A
Condition of corrosion on metal rods and MS window grills	N/A
Patchwork plaster required? if yes its condition?	N/A
Entire replaster required? if yes its condition?	N/A
Condition of separation cracks observed at beam-column junction	N/A
Condition of leakage observed from overhead water tank	N/A
Loose plaster/hollow sond on external surfaces?if observed,	N/A

Detailed Diagnostic Report (DDR)

AREA-WISE OBSERVATIONS

Area: Hall, Common Bathroom

Negative Side (Damage / Seepage):

Hall Skirting level Dampness

Positive Side (Probable Cause):

Common Bathroom tile hollowness

Normal Images:

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

Area: Bedroom, Common Bathroom

Negative Side (Damage / Seepage):

Bedroom Skirting level Dampness

Positive Side (Probable Cause):

Common Bathroom tile hollowness

Normal Images:

Detailed Diagnostic Report (DDR)

Area: Master bedroom, MB Bathroom

Negative Side (Damage / Seepage):

Master bedroom Skirting level Dampness

Positive Side (Probable Cause):

MB Bathroom tile hollowness

Normal Images:

Detailed Diagnostic Report (DDR)

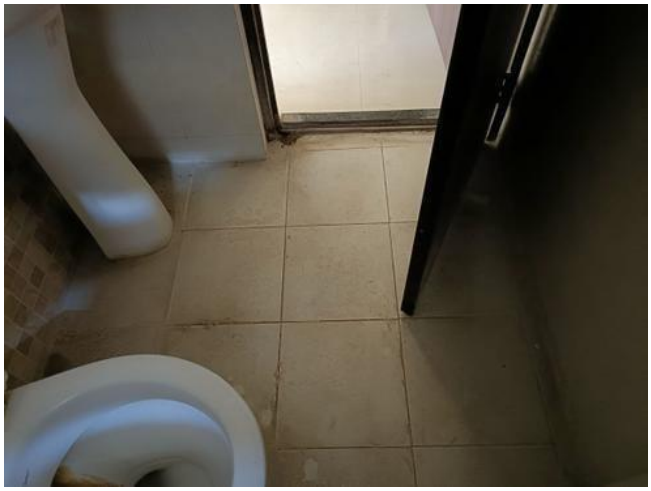

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

Area: Kitchen, Master bedroom bathroom

Negative Side (Damage / Seepage):

Kitchen Skirting level Dampness

Positive Side (Probable Cause):

Master bedroom bathroom

Normal Images:

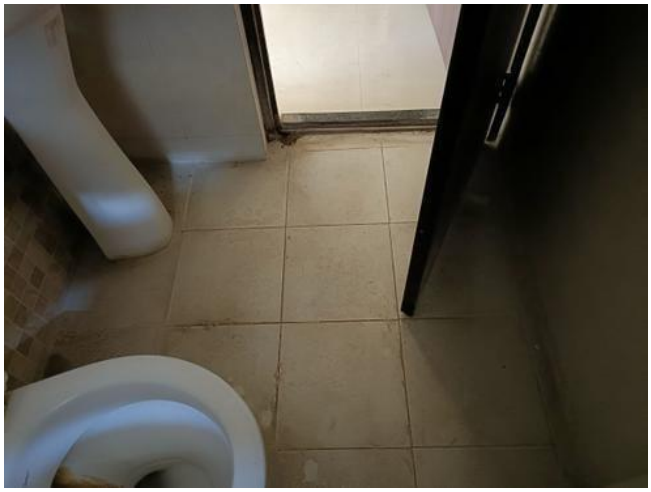

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

Area: Master bedroom, External wall and Duct

Negative Side (Damage / Seepage):

Master bedroom wall dampness

Positive Side (Probable Cause):

External wall crack and Duct Issue

Normal Images:

Detailed Diagnostic Report (DDR)

Area: Parking Area, Common Bathroom

Negative Side (Damage / Seepage):

Parking Area seepage

Positive Side (Probable Cause):

Common Bathroom tile hollowness and plumbing issue

Normal Images:

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

Area: Common Bathroom, Flat no 203

Negative Side (Damage / Seepage):

Common Bathroom Ceiling Dampness

Positive Side (Probable Cause):

Flat no 203 tile joint open and outlet Leakage

Normal Images:

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

SECTION 4: SUMMARY TABLE

Impacted Area	Observed Issue	Probable Cause	Severity	Suggested Remedy
Hall of Flat No. 103	Observed dampness at the skirting level of Hall of Flat No. 103	Observed gaps between the tile joints of Common Bathroom of Flat No. 103	**Medium**	Thorough cleaning and epoxy injection grouting of existing tile joints in Common Bathroom of Flat No. 103.
Common Bedroom of Flat No. 103	Observed dampness at the skirting level of the Common Bedroom of Flat No. 103	Observed gaps between the tile joints of Common Bathroom of Flat No. 103	**Medium**	Thorough cleaning and epoxy injection grouting of existing tile joints in Common Bathroom of Flat No. 103.
Master Bedroom of Flat No. 103	Observed dampness at the skirting level of Master Bedroom of Flat No. 103	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103	**Medium**	Thorough cleaning and epoxy injection grouting of existing tile joints in Master Bedroom Bathroom of Flat No. 103.
Kitchen of Flat No. 103	Observed dampness at the skirting level of Kitchen of Flat No. 103	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103	**Medium**	Thorough cleaning and epoxy injection grouting of existing tile joints in Master Bedroom Bathroom of Flat No. 103.
Master Bedroom of Flat No. 103	Observed dampness & efflorescence on the wall surface of Master Bedroom of Flat No. 103	Observed cracks on the External wall of building near Master Bedroom of Flat No. 103	**Medium**	Repair external wall cracks near Master Bedroom of Flat No. 103 with polyurethane sealant, followed by replastering and repainting the impacted internal wall surface.
Parking ceiling below Flat No. 103	Observed leakage at the Parking ceiling below Flat No. 103	Observed plumbing issue & gaps between the tile joints of Common Bathroom of Flat No. 103	**High**	Conduct leak detection for concealed plumbing in Common Bathroom of Flat No. 103, repair any identified leaks, and perform epoxy injection grouting of tile joints. Repair ceiling plaster in parking area.
Common Bathroom of Flat No. 103	Observed mild dampness at the ceiling of Common Bathroom of Flat No. 103	Observed gap between tile joints of Common & Master Bedroom Bathrooms of Flat No. 203.	**Medium**	Thorough cleaning and epoxy injection grouting of existing tile joints in Common & Master Bedroom Bathrooms of Flat No. 203.

Detailed Diagnostic Report (DDR)

OVERALL RECOMMENDATIONS

1. Undertake epoxy injection grouting of all tile joints in the Common Bathroom and Master Bedroom Bathroom of Flat No. 103 to address identified tile hollowness and gaps, preventing further seepage to adjacent areas.
2. Investigate and repair concealed plumbing issues in the Common Bathroom of Flat No. 103, which is a probable cause for leakage at the parking ceiling below.
3. Implement external wall crack repair using polyurethane sealant near the Master Bedroom of Flat No. 103 to prevent water ingress and recurring dampness.
4. Address the identified gaps in tile joints and potential outlet leakages in the Common & Master Bedroom Bathrooms of Flat No. 203, as these are contributing to ceiling dampness in Flat No. 103.
5. Consider a comprehensive internal wall treatment, including re-plastering and repainting, for all areas affected by dampness and efflorescence after source repairs are completed.