Detailed Diagnostic Report (DDR)

TABLE OF CONTENTS

1. Inspection Form
2. Checklists / Inspection Checklists Overview
3. Impacted Areas/Rooms
4. Detailed Inspection Checklists
4.1 WC Checklist
4.2 External Wall Checklist
5. Summary Table
6. Appendix

SECTION 1: INTRODUCTION

Background:

This Detailed Diagnostic Report is prepared based on the inspection of a residential flat.

Objective:

To assess the structural and thermal conditions of the property, identify sources of leakage, dampness, and other defects, and provide recommendations for remediation.

Scope of Work:

Hall, Bedroom, Kitchen, Master Bedroom, Parking Area, Common bathroom, WC, External Wall.

Tools Used:

GTC 400 C Professional Thermal Camera, Visual Inspection

SECTION 2: GENERAL INFORMATION

Report ID	Not Available
Site Address	Not Available
Type of Structure	Residential Building
Property Type	Flat
Floors	11
Year of Construction	Not Available
Age Building years	Not Available
Inspection Date	27.09.2022
Inspector Names	Krushna & Mahesh
Customer Name	Not Available
Customer Mobile	Not Available
Customer Email	Not Available

Detailed Diagnostic Report (DDR)

INSPECTION SUMMARY

Checklists Flagged: 1 flagged

Overall Score: 85.71%

Condition Statistics:

Good: 1

Moderate: 14

Poor: 0

Detailed Diagnostic Report (DDR)

SECTION 3: INSPECTION CHECKLISTS

WC

Score: 12.5

Condition of leakage at adjacent walls	Moderate
Condition of leakage below WC	Moderate
Leakage during:	All time
Leakage due to concealed plumbing	Yes
Leakage due to damage in Nahani trap/Brickbat coba under tile flooring	Yes
Gaps/Blackish dirt Observed in tile joints	Yes
Gaps around Nahani Trap Joints	Yes
Tiles Broken/Loosed anywhere	No
Loose Plumbing joints/rust around joints and edges (Flush Tank/shower/ang le cock/bibcock, washbasin, etc)	Yes
Type of tile	Not Available

External Wall

Score: 0

Condition of leakage at interior side	Moderate
Leakage during:	All time
Leakage due to concealed plumbing	Yes
Internal WC/Bath/Balcony leakage observed	Yes
Existing type of paint and manufacturer	Not sure
Condition of cracks observed on RCC Column and Beam	Moderate
Condition of rust marks observed in RCC Beam and Column	N/A
Condition of corrosion/spall ing of concrete/expose d reinforcement observed in column/beams/ro of slab ceiling	N/A
Expansion joints condition if any	N/A
Are there any major or minor cracks observed over external surface?	Moderate
Are the sealants applied on the window frame joints intact?	N/A
Condition of wall mounted AC Frames, holes, drain pipes over the wall.	N/A
Are the external plumbing pipes cracked and leaked? If yes its condition.	Moderate
Are the openings around the pipes in external wall properly grouted? If not its condition.	N/A

Detailed Diagnostic Report (DDR)

Condition of any vegetation growth, dish antennas fixed on parapet wall observed?	N/A
Chalking and flaking in paint film.	N/A
Algae fungus and Moss observed on external wall?	Moderate
Bird droppings condition observed on external wall and Chajja	N/A
Condition of corrosion on metal rods and MS window grills	N/A
Patchwork plaster required? if yes its condition?	N/A
Entire replaster required? if yes its condition?	N/A
Condition of separation cracks observed at beam-column junction	N/A
Condition of leakage observed from overhead water tank	N/A
Loose plaster/hollow sond on external surfaces?if observed,	N/A

Detailed Diagnostic Report (DDR)

AREA-WISE OBSERVATIONS

Area: Hall, Common Bathroom

Negative Side (Damage / Seepage):

Hall Skirting level Dampness

Positive Side (Probable Cause):

Common Bathroom tile hollowness

Normal Images:

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

Area: Bedroom, Common Bathroom

Negative Side (Damage / Seepage):

Bedroom Skirting level Dampness

Positive Side (Probable Cause):

Common Bathroom tile hollowness

Normal Images:

Area: Master bedroom, MB Bathroom

Negative Side (Damage / Seepage):

Master bedroom Skirting level Dampness

Positive Side (Probable Cause):

MB Bathroom tile hollowness

Normal Images:

Detailed Diagnostic Report (DDR)

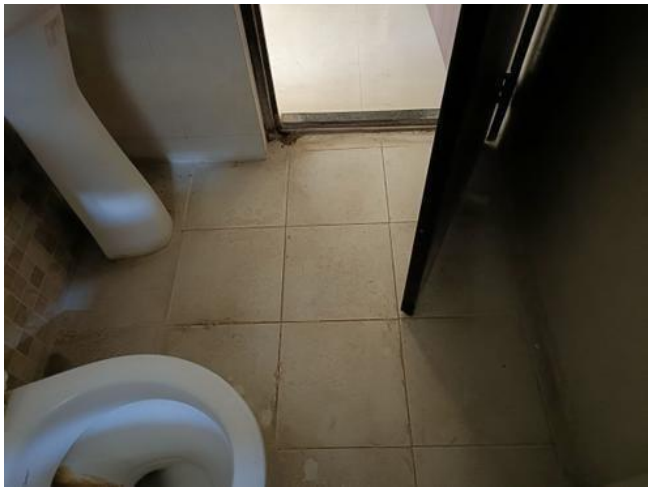

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

Area: Kitchen, Master bedroom bathroom

Negative Side (Damage / Seepage):

Kitchen Skirting level Dampness

Positive Side (Probable Cause):

Master bedroom bathroom

Normal Images:

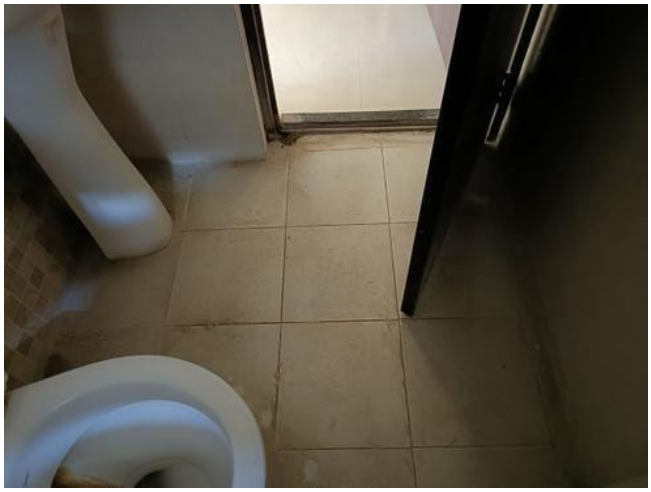

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

Area: Master bedroom wall, External wall and Duct

Negative Side (Damage / Seepage):

Master bedroom wall damness

Positive Side (Probable Cause):

External wall crack and Duct Issue

Normal Images:

Detailed Diagnostic Report (DDR)

Area: Parking Area, Common Bathroom

Negative Side (Damage / Seepage):

Parking Area seepage

Positive Side (Probable Cause):

Common Bathroom tile hollowness and plumbing issue

Normal Images:

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

Area: Common Bathroom Ceiling, Flat no 203

Negative Side (Damage / Seepage):

Common Bathroom Ceiling Dampness

Positive Side (Probable Cause):

Flat no 203 tile joint open and outlet Leakage

Normal Images:

Detailed Diagnostic Report (DDR)

Detailed Diagnostic Report (DDR)

SECTION 4: SUMMARY TABLE

Impacted Area	Observed Issue	Probable Cause	Severity	Suggested Remedy
Hall of Flat No. 103	Observed dampness at the skirting level of Hall of Flat No. 103	Observed gaps between the tile joints of Common Bathroom of Flat No. 103	**Medium**	Epoxy injection grouting of tile joints in Common Bathroom of Flat No. 103.
Common Bedroom of Flat No. 103	Observed dampness at the skirting level of the Common Bedroom of Flat No. 103	Observed gaps between the tile joints of Common Bathroom of Flat No. 103	**Medium**	Epoxy injection grouting of tile joints in Common Bathroom of Flat No. 103.
Master Bedroom of Flat No. 103	Observed dampness at the skirting level of Master Bedroom of Flat No. 103	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103	**Medium**	Epoxy injection grouting of tile joints in Master Bedroom Bathroom of Flat No. 103.
Kitchen of Flat No. 103	Observed dampness at the skirting level of Kitchen of Flat No. 103	Observed gaps between the tile joints of Master Bedroom Bathroom of Flat No. 103	**Medium**	Epoxy injection grouting of tile joints in Master Bedroom Bathroom of Flat No. 103.
Master Bedroom of Flat No. 103	Observed dampness & efflorescence on the wall surface of Master Bedroom of Flat No. 103	Observed cracks on the External wall of building near Master Bedroom of Flat No. 103	**Medium**	Polyurethane sealant application for external wall crack repair near Master Bedroom of Flat No. 103.
Parking ceiling below Flat No. 103	Observed leakage at the Parking ceiling below Flat No. 103	Observed plumbing issue & gaps between the tile joints of Common Bathroom of Flat No. 103	**High**	Concealed plumbing leak detection and repair in Common Bathroom of Flat No. 103, followed by epoxy injection grouting of tile joints.
Common Bathroom of Flat No. 103, Flat No. 203	Observed mild dampness at the ceiling of Common Bathroom of Flat No. 103	Observed gap between tile joints of Common & Master Bedroom Bathrooms of Flat No. 203.	**Medium**	Epoxy injection grouting of tile joints in Common & Master Bedroom Bathrooms of Flat No. 203 to resolve ceiling dampness.

OVERALL RECOMMENDATIONS

1. Address all identified tile joint gaps in Common and Master Bedroom bathrooms of Flat No. 103 and Flat No. 203 with epoxy injection grouting to prevent water ingress.
2. Investigate and repair the concealed plumbing issue in the Common Bathroom of Flat No. 103 to resolve active leakage in the Parking Area.
3. Repair external wall cracks near the Master Bedroom of Flat No. 103 using appropriate polyurethane sealants to prevent moisture penetration.
4. Monitor and address any future signs of dampness or efflorescence promptly to maintain structural integrity and indoor air quality.
5. Consider re-evaluating the external wall for additional waterproofing measures if cracks and algae growth persist.

6. Conduct regular inspections of plumbing systems and tile joints to prevent recurrence of leakage issues.