INNOLUX
群創光電

■產品□設備技術通報				■異常處理手法 □技術傳承文件	
題目	Remain型態ESD處理方式	KM編號		作者	莊沅臻
Defect Code	REMAIN	Cause Code	ESD	■適用設備： □適用產品：	CFDV& CV傳送

一、狀況描述 ：


起因：生產玻璃基板於CV2傳送時，長期磨擦後造成與ROLLER接觸面積增加，而發生CV-ROLLER靜電累積增加(材質為非導體設計)而生產基板流經後吸附過多電荷。

結果：生產基板帶電後經過藥刀噴灑，接觸藥膜而瞬間釋放電荷，

從而導致靜電擊傷




CV2-ROLLER型態：
直接量測ROLLER表面最高可到3~4K V

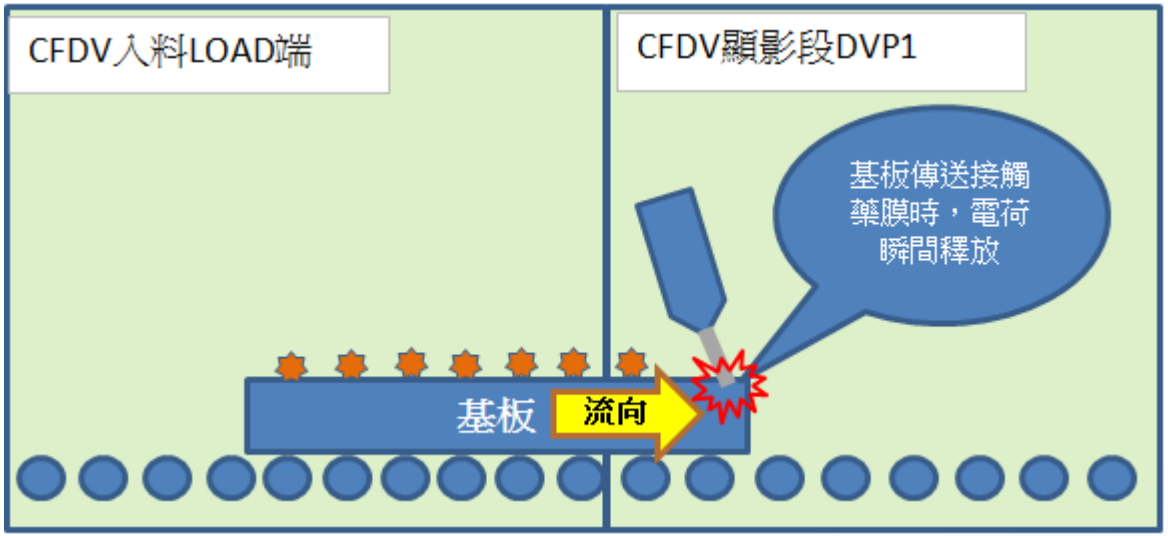


基板流向與接觸藥膜放電

INNOLUX 群創光電

二、異常DEFECT與MAP

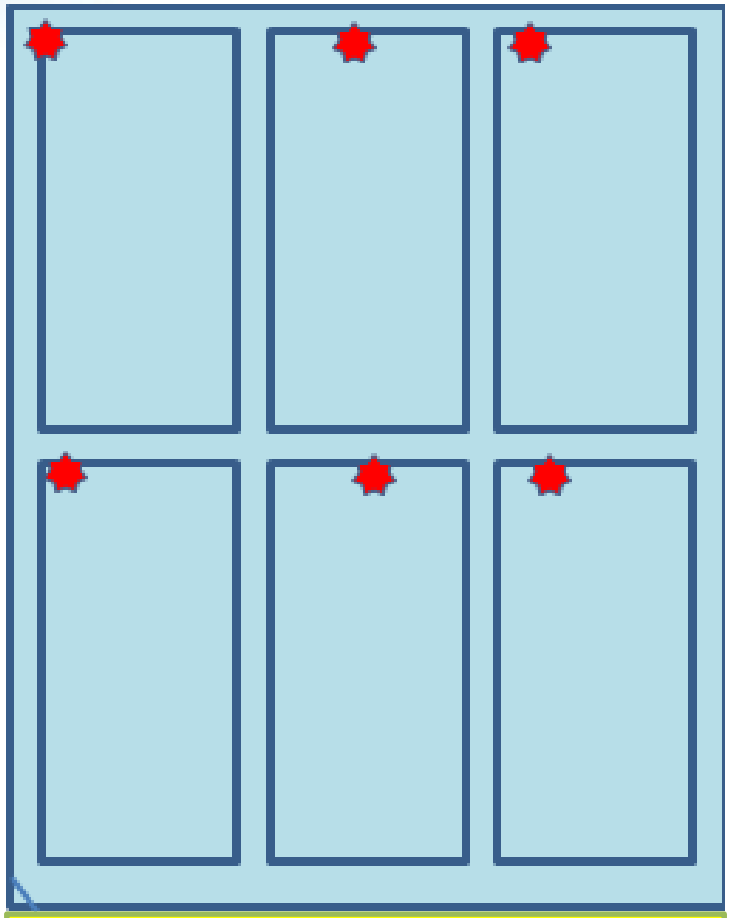


DF MAP：DF位置集中於每膜傳送進板端

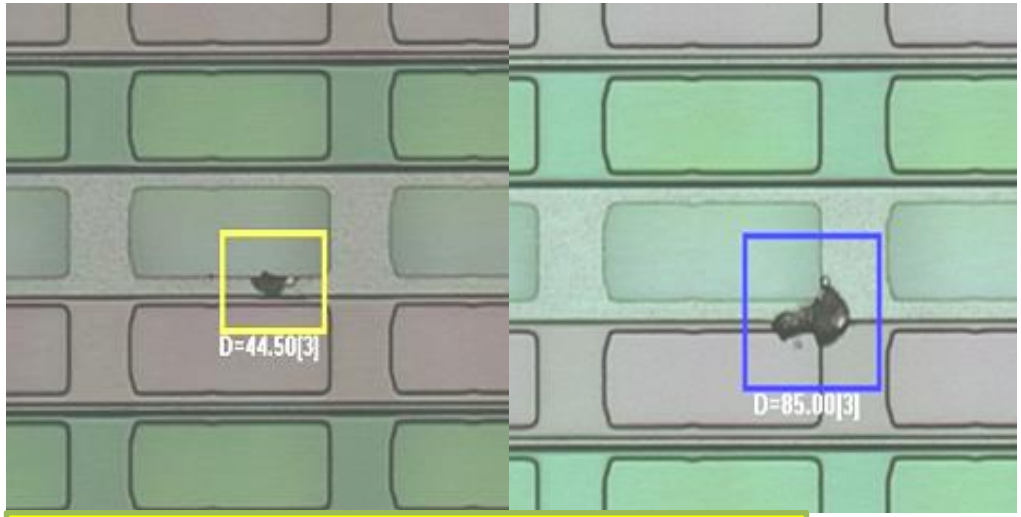

DF型態：R_LAYER與BM邊框上疑似REMAIN TYPE的ESD

INNOLUX 群創光電

三、改善內容 ：

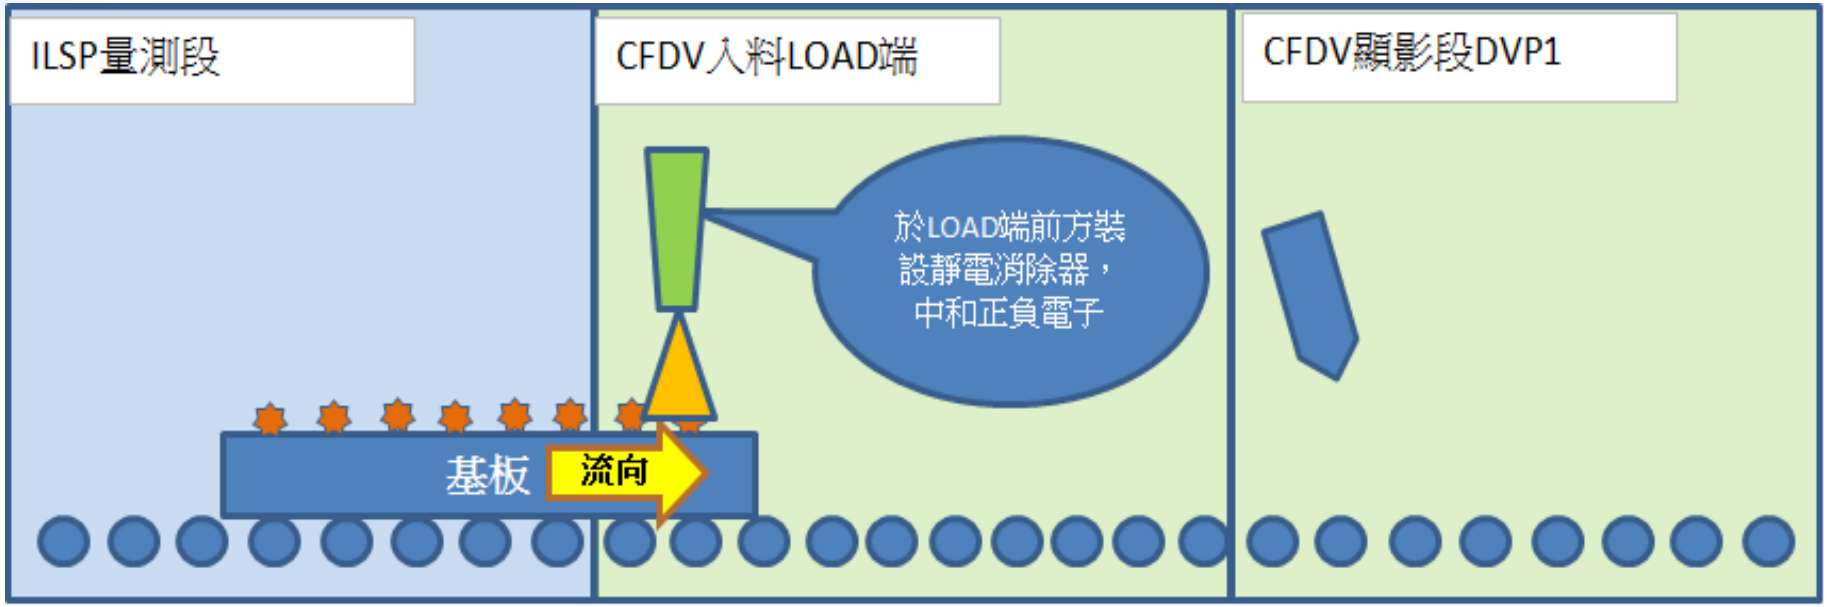

改善方式

1.於CFDV LOAD段前方裝設靜電消除器中和基板上多餘電荷，以解決瞬間放電ISSUE。

INNOLUX 群創光電

四、準備工具 ：



一組靜電消除器與電源線及固定座即可。

INNOLUX
群創光電

五、實際完成圖



靜電消除器針頭位置距離基板約8公分

INNOLUX 群創光電

六、平展

針對廠內R/G/B產品線別優先於CFDV LOAD端安裝靜電消除器。

INNOLUX 群創光電

Q & A

This information contained in this file is the exclusive intellectual property or confidential document of Innolux Corporation ("INX"), and shall not be distributed, reproduced, or disclosed in whole or in part without prior written permission of INX. INX shall not be liable for any information and unauthorized misuse, abuse, modification of this file.

www.innolux.com

Thank you!

INNOLUX
群創光電