
DI1KO-09

DTC	B2796/99	No Communication in Immobiliser System
-----	----------	--

CIRCUIT DESCRIPTION

DTC No.	DTC Detection Condition	Trouble Area
B2796/99	No communication	Key Transponder key coil Transponder key amplifier Wire harness ECM

WIRING DIAGRAM

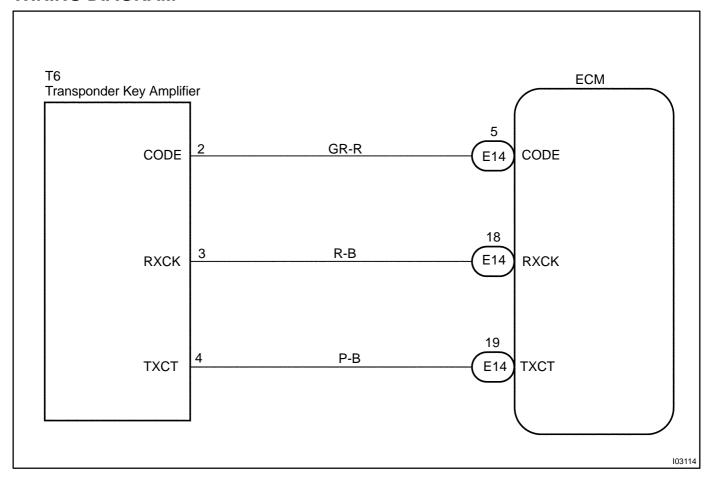

INSPE	ECTION PROCEDURE
1	Check transponder key coil (See page BE-172).
	NG Replace transponder key coil.
ОК	
2	Check harness and connector between transponder key amplifier and ECM (See page IN-28).
	NG Repair or replace harness or connector.
ОК	
3	Does it operate normally after replacement of transponder key amplifier?
	Yes Replace transponder key amplifier.
No	
Repla	ice ECM.

2002 4RUNNER (RM887U)

Author: Date: 682