



Goldshell Mini Doge III Miner Setup Guide

Your home miner connects to the Honest.Money merged-mining pool — **pool.honest.money** — mining Litecoin (LTC), Dogecoin (DOGE), Textcoin (TXC), Iskander (ISK), and Zero Chill U (ZCU); merge-mined over the same connection. **Only LTC and DOGE are paid out to you.** These payouts help offset the electricity cost of running the miner.

You'll need your own LTC and DOGE receive addresses. **Use a hot or hardware wallet you control, not an exchange address** — many exchanges don't accept the small "dust" deposits mining payouts arrive in. The same wallet can hold both addresses.

Wallets confirmed to support LTC and DOGE:

- **Hot wallet:** We recommend the <https://mobile.honest.money/> wallet!
- **Hardware wallet:** Tangem, Ledger, or Trezor.

STEP 1 — REGISTER YOUR WALLETS WITH THE POOL


Before connecting your miner, register your LTC and DOGE addresses with the pool so your payouts are credited correctly. This is a one-time, per-pool registration. If you've already registered these addresses with the previous pool (pool.textitcoin.org), skip this step, the same LTC address and dogelink token will work on the new pool.

1. Go to: <https://pool.honest.money/register>
2. Enter your LTC mining wallet address and your DOGE payout address, then answer the simple security question and submit. Both must be mainnet addresses — LTC begins with ltc1, L, M, or 3; DOGE begins with D, A, or 9. The pool validates each address against its coin wallet before registering it.
3. **Note:** If signing up for the first time, use brand-new LTC/DOGE addresses only — each LTC address links to exactly one DOGE address (and vice versa), so double-check both before submitting. If you've mined here before under this LTC address, use the DOGE-link panel on your wallet page instead.
4. The confirmation screen shows your **Permanent DOGE Token** — labeled there as both "Permanent DOGE Token" and "Miner Password" (same value). Copy it down; you'll use it as the password in Step 3.

The screenshot shows the 'Register LTC + DOGE payouts' page on the HME POOL website. At the top, there's a header with the pool name and a search bar. The main heading is 'Register LTC + DOGE payouts'. Below it, a paragraph explains that users mine with their LTC address as the stratum username and get paid in DOGE, receiving a permanent dogeLink token for their miner's password. The registration form has three sections: 'LTC MINING ADDRESS' with a text input field containing 'ltc1q...', a note that this becomes the stratum username, and a dropdown menu; 'DOGE PAYOUT ADDRESS' with a text input field containing 'D...', a note about where merged-mined DOGE is sent, and a dropdown menu; and 'HUMAN CHECK' with a text input field containing '818888' and a security question 'What is 7 + 8?' with a dropdown menu. A green 'Create registration' button is at the bottom. A footer note states that only the two addresses and the token are stored, and both are verified against the live LTC and DOGE daemons before anything is written, and that registration is additive.

STEP 2 — SET UP THE MINER HARDWARE

1. Unbox and confirm you have: the miner, a PSU with a 6-pin cable, an Ethernet cable, and an AC power cord.
2. Connect the PSU to the miner and the Ethernet cable between the miner and your router, then plug in the AC power cord — it powers on automatically.
3. Wait a few minutes for it to boot up and initialize.
4. On a computer connected to the **same local network** as the miner, go to find.goldshell.com. It lists any Goldshell miners it detects, with their IP address (as columns: Miner / IP / UpdateTime / Setting).
5. Click the miner's row (or its Setting link) to open its dashboard — or enter its IP address directly into your browser.
6. In the top right corner, click the Chinese Flag and then the American flag from the dropdown.

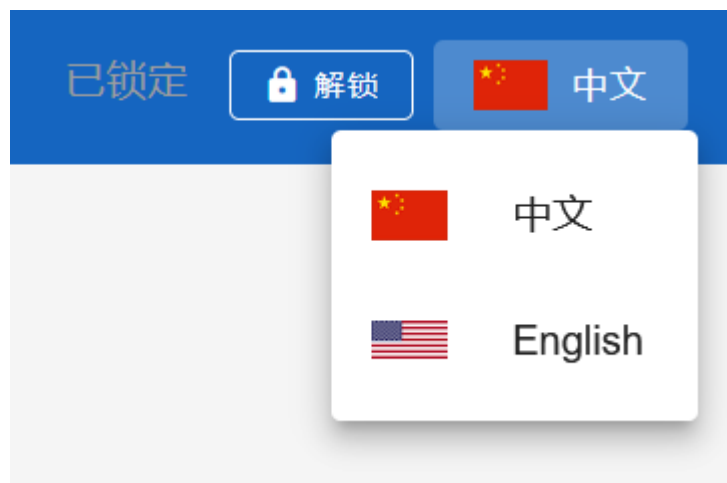

7. Click **Unlock** and log in with **Username: admin, Password: 123456789** (default).

Unlock miner

Username

admin

Password

The initial password is 123456789

UNLOCK

STEP 3 — CONNECT TO THE POOL

In the miner's dashboard, go to **Miner** → **Pool settings** and click **ADD** to open the Pool Config box. It has four fields — Protocol, URL, Miner Name, and Password:

- **Protocol:** stratum+tcp
- **URL:** stratum.pool.honest.money:3433
- **Miner Name:** your LTC wallet address by itself — no "@" symbol, nothing appended.
- **Password:** dogelink=<your Permanent DOGE Token from Step 1>

Pool Config

Protocol: stratum+tcp

URL

 DXPOOL

 F2POOL

 VIABTC

 POOLIN

Miner Name

Password

[CANCEL](#) [APPLY](#)

Example format:

Protocol: stratum+tcp

URL: stratum.pool.honest.money:3433


Miner Name: ltc1qexampleaddress000000000000000000000000

Password: dogelink=A1B2C3D4E5F60708A9B0C1D2

1. Click **Apply** to store the pool entry.
2. You need to reboot the miner. Click **System**, then scroll to the bottom and click **RESTART**.
3. The pool status should turn green once it connects.
4. Confirm it's mining: the dashboard's Home/Status page should show a Hashrate near 700 MH/s and an active Hashrate chart.

Mining status				Goldshell-MiniDOGE III	
Avg	707.31 MH/s	Fan speed (RPM)	1320 / 1320	Model	Goldshell-MiniDOGE III
HW error	0.60%	Reject rate	0.00%	Firmware version	2.2.4
Powerplan	Hashrate Mode	Online for	0d 0h 20m	Hardware version	20.10.SA
Temp (°C)	76.6				

5. After a few hours, your Hashrate chart should look like this.

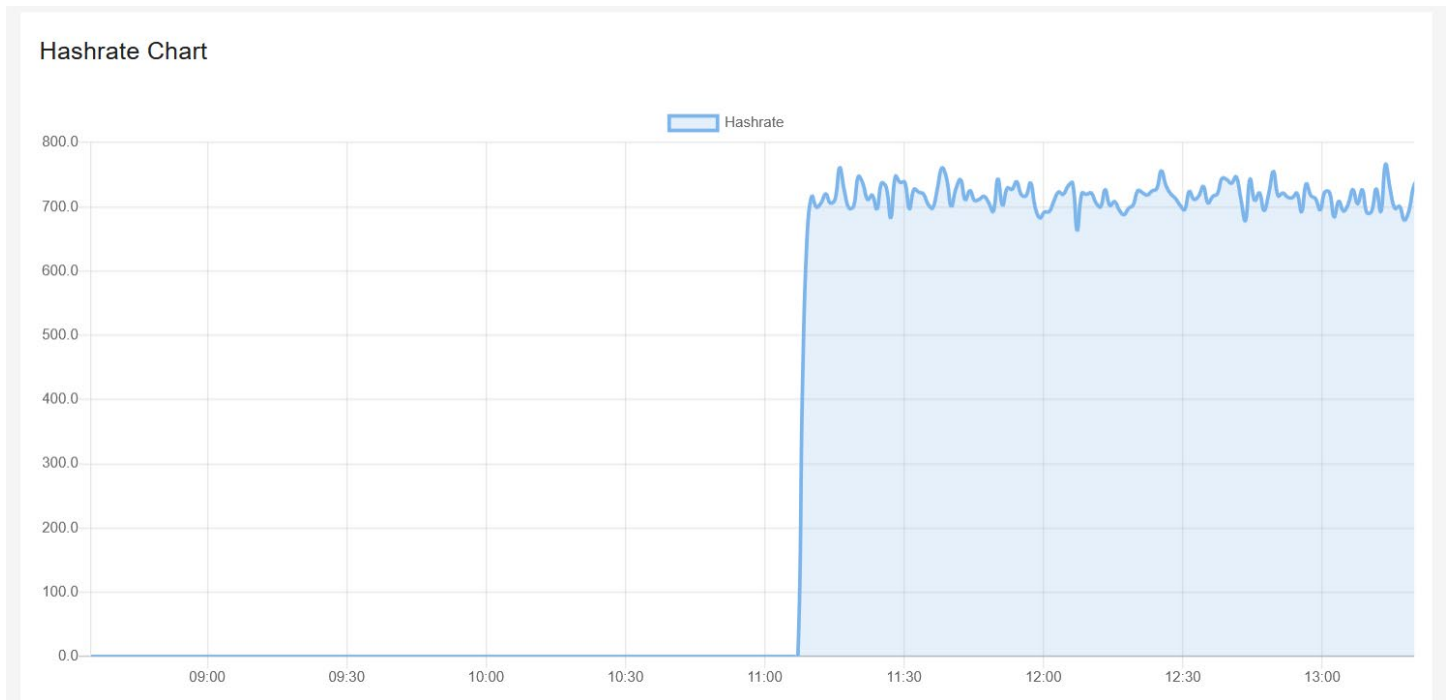

TROUBLESHOOTING NOTE

If mining stops or Hashrate drops sharply, check temperature and airflow first — Script ASIC miners in this class throttle or stop under excess heat as a built-in safety measure.