F3 BUILDING SURVEYORS

BUILDING SURVEY REPORT

The Co-Proprietors per Trinity Factors

65 Caledonian Crescent, James Square, Edinburgh
Project Number: 21049
Date: 30-Nov-21
Revision: Not applicable

F3 BUILDING SURVEYORS
99 Giles Street, Edinburgh EH6 6BZ
0131 554 8050 | **f3surveyors.com**

65 CALEDONIAN CRESCENT, JAMES SQUARE, EDINBURGH

BUILDING SURVEY REPORT

CONTENTS

1. INTRODUCTION 3
2. GENERAL OBSERVATIONS 5
3. RECOMMENDED WORKS 7
4. CONCLUSION 7
APPENDIX 1 – BUDGET COSTS 8
APPENDIX 2 – STANDARD CONDITIONS 10

This report has been prepared by F3 Building Surveyors Limited with all reasonable skill, care and diligence, within the terms of the Contract with the Client. The report is confidential to the Client and F3 Building Surveyors Limited accepts no responsibility of whatever nature to third parties to whom this report may be made known.

1. INTRODUCTION

1.1. On behalf of The Co-Proprietors per Trinity Factors, we were requested to undertake a building fabric survey to the roof area of the property comprising 65 Caledonian Crescent, part of the James Square development, Edinburgh.

1.2. We undertook our survey on 14th October, this was undertaken by David Bonar, MRICS, Chartered Building Surveyor and Sally Orr, MRICS, Chartered Building Surveyor, with access provided by onsite co-ordinator.

1.3. The property comprises a flatted residential block within a larger development, the block in question is over three floors. Our understanding is that the properties are on the site of a former timber store and sawmill / furniture works (see map below). The property is not a listed building and neither is it within a Conservation Area.

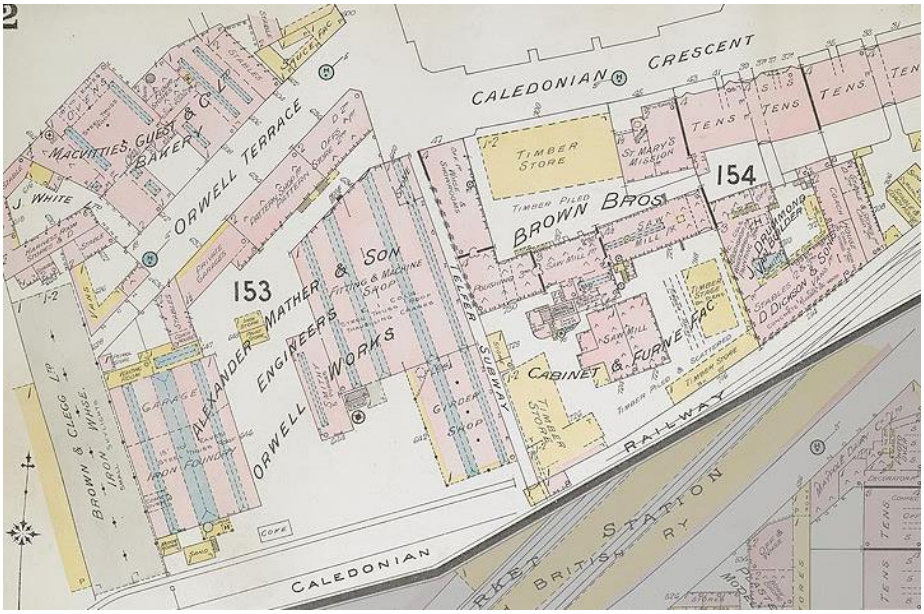

1.4. The property appears to be traditionally constructed with a wet dash wall finish and slated pitched roof sections.

1.5. The property is located on Caledonian Crescent, Edinburgh.

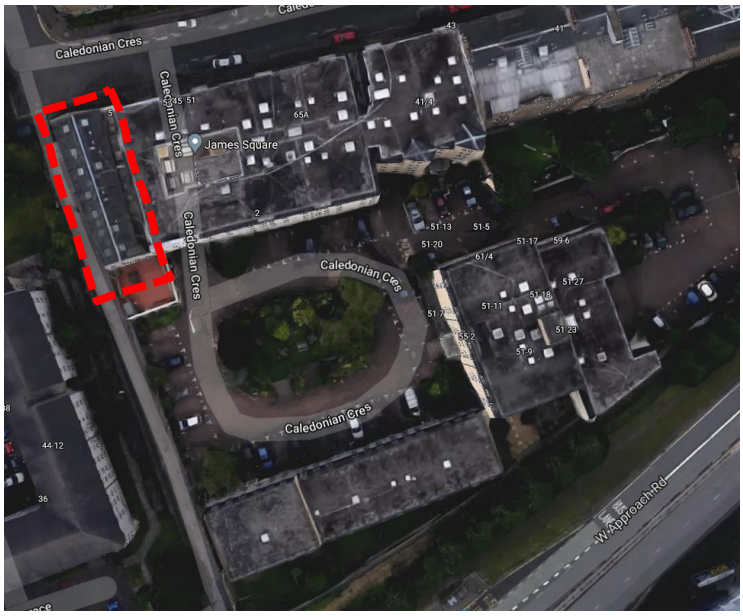

1. INTRODUCTION (cont)

1.6. We were given access to the following areas:

1.6.1. External fabric: Please refer to separate report with regard to the elevations.

1.6.2. Roof coverings: We were able to undertake an inspection via access through the common stair hatch to block 51 to inspect the pitched roof coverings. We were also able to take a limited inspection with a cherry picker to the north end of the property.

1.6.3. External curtilage: Not applicable for the purpose of our survey.

1.6.4. Internally: No access was gained.

1.7. Areas of no access: We gained access to all relevant areas for the purposes of the survey.

1.8. For the purposes of the report, the front elevation to the property on Caledonian Crescent is assumed to face north. All references to left hand side and right hand side are taken when viewing the relevant elevation from external facing the building.

1.9. We were not provided with any Health and Safety file nor the Operation & Maintenance Manual for the building. We have not been provided with any information for example builders estimates or the like.

1.10. Please note that this report is not intended for issue to contractors for pricing works. In the event that the owners decide to proceed with the works we would strongly recommend that full and comprehensive tender documentation be prepared, we can undertake this if required.

2. GENERAL OBSERVATIONS

2.1. The building is generally in a fair condition however the roof coverings now require some repair:

2.1.1. Slatework: The slatework comprises a regular coursed slate. The slatework generally is in a fair condition, there have been previous repairs carried out, there are some slipped and broken slates and we would recommend in the short term the replacement of slipped and missing slates is carried out.

2.1.2. Guttering: There are uPVC deep flow gutters in place however these have bowed in places therefore we have allowed for re-grading and additional brackets in the short term.

2.1.3. Roof lights: There are Velux windows varying in size to the roof area, generally these appear to be in a fair condition, we have not included for any works at this time.

2.1.4. Ridge: The ridge comprises zinc and is generally in a fair condition, again, we have included for no works at this time.

2.1.5. There are lead watergates and capping to the southmost copes, again these appear in a fair condition, and we have not included for any works.

2.1.6. Copes: there are pre-cast copes to north end of the roof. We have allowed for pointing up of any open joints generally in the short term, and dowel fixing the copes to ensure they are secure. To the south end the copes have been clad in lead, this is in fair condition, we have included to provide a short section of cover flashing to the upstand in the short term.

2.1.7. Felt works: At gutter level, we did not note any under slating felt draping into the gutter, we would recommend that in the short term that works are carried out to provide new felt work at the eaves level to prevent water ingress.

Photo 01 – General view of the roof

Photo 02 – No felt draping into the gutter – hand can be seen to rear of gutter.

Photo 03 – Open joints to cope stones.

Photo 04 – Cover flashing required at south elevation.

2. GENERAL OBSERVATIONS (cont)

Photo 05 – Loose slate requiring to be re-fixed.

Photo 06 – Previous slate repairs, and loose, slipped slates requiring refixing.

3. RECOMMENDED WORKS

3.1. Our recommendations would be to undertake the repairs as required to the following areas:

RED PRIORITY: IMMEDIATE / SHORT TERM (YEARS 1-2):

3.2. In terms of immediate / short term actions we would recommend the following:

3.2.1. Asbestos: We have included for an asbestos refurbishment survey to the roof prior to repairs.

3.2.2. Slate overhaul to replace broken and missing slates, in conjunction with this, provision of feltwork draping into the guttering.

3.2.3. Point up the existing concrete copes and dowel fixings.

3.2.4. Guttering: Allow for re-grade and additional brackets.

3.2.5. Provide lead cover flashing at south elevation.

AMBER PRIORITY: MEDIUM TERM (YEARS 3-5):

3.3. In terms of medium term actions, we would recommend the following:

3.3.1. Assuming that the short term works are carried out, we do not anticipate any medium term works are carried out. With the exception of ongoing maintenance – gutter clearing and the like.

GREEN PRIORITY: LONGER TERM (YEARS 6-10):

3.4. In terms of longer term actions, we would recommend the following:

3.4.1. We would suggest that a strip and re-slate may be required in the longer term in years 10-15, we have not included for a cost for these works at this time.

4. CONCLUSION

4.1. In conclusion, based on our survey, repairs are required in the short term to the roof.

4.2. We refer you to our budget costs which highlight the short and medium term repairs required.

4.3. If you wish our further input or assistance in this regard, we would be delighted to do so.

4.4. We thank you for asking us to assist.

Prepared by F3 Building Surveyors Ltd.
30-Nov-21

Prepared by:	**SO**	Date:
Checked by:	**RS**	**3-Dec-21**

APPENDIX 1 – BUDGET COSTS

Description	Quantity	Units	Rate	Total	RED: Short Term	AMBER: Medium Term	GREEN: Longer Term
65 James Square Roofing							
SUPERSTRUCTURE							
Roof							
Roof coverings							
Pitched Roof							
Slated Pitches - replace slipped, broken and loose slates.	138	m2	10	1,380.00	1,380.00		
Slated Pitches - Eaves repairs to install new felt.	46	m	50	2,300.00	2,300.00		
Copes - Point up and dowel fix	6	m	80	480.00	480.00		
Leadwork - New coverflashing	1	m	65	65.00	65.00		
Roof drainage							
Guttering							
Clear out and repairs.	46	m	15	690.00	690.00		
PRELIMINARIES							
Facilitating Works							
Toxic / Hazardous / Contaminated Material Treatment							
Asbestos Refurbishment Survey	1	Item	500	500.00	500.00		
Main Contractor's Preliminaries							
Scaffolding / Work at height							
Scaffolding / Work at height							
Short Term	1	Item	5000	5,000.00	5,000.00		
Management and General Prelims							
Short Term	6	wks	600	3,600.00	3,600.00		
SUB-TOTAL CONSTRUCTION COSTS				**£14,015.00**	**£ 14,015.00**	**£ -**	**£ -**
UNALLOCATED							
Unallocated							
Non-Construction Costs							
Professional Fees							
Short Term	1	Item	2000	2,000.00	2,000.00		
TOTAL INCLUDING FEES				**£16,015.00**	**£ 16,015.00**	**£ -**	**£ -**
VAT			**20%**	**£ 3,203.00**	**£ 3,203.00**	**£ -**	**£ -**
TOTAL INCLUDING VAT				**£19,218.00**	**£ 19,218.00**	**£ -**	**£ -**

APPENDIX 2 – STANDARD CONDITIONS

Content of the Report

In accordance with these terms the Surveyor will use his or her best endeavours to report upon:

a. The main aspects of the Property including assessing the site/location, the design, structural framework, fabric and services;

b. The grounds, boundaries and environmental aspects considered to affect the Property;

c. Any requirements for further investigation arising from the inspection.

Assumptions

Unless otherwise expressly agreed the Surveyor while preparing the Report will reasonably assume that:

a. The Building(s) (if for sale) is offered with vacant possession;

b. The Building(s) is connected to mains services with appropriate rights on a basis that is known and acceptable to the Client; and

c. Access to the Building(s) is as of right upon terms known and acceptable to the Client.

Scope of the inspection

A. Generally

a. The Surveyor will consider his or her advice carefully but is not required to advise on any matter the significance of which in relation to the Building(s) is not apparent at the time of inspection from the inspection itself.

b. The Surveyor will inspect diligently but is not required to undertake any action that would risk damage to the Building(s) or injury to himself, herself or any other party.

c. The Surveyor will not undertake any structural or other calculations.

d. The Surveyor will not produce a repair schedule, planned maintenance report, feasibility report or advise on design, procurement or project management unless expressly agreed with the client.

B. Accessibility

a. The Surveyor will inspect as much of the internal and external surface area of the building as is practicable but will not inspect those areas which are covered, unexposed or not reasonably accessible from within the site, or adjacent public areas.

b. The Surveyor is not required to move any obstruction to inspection including, but not limited to, fixtures, fittings and floor coverings.

c. The surveyor will not open up or cut into the building fabric without specific directions from the client. Such intrusive investigations, if instructed by the client, will be at the risk and liability of the client and will be assumed to be with agreement between the client and the building owner.

C. Floors

a. The Surveyor will lift accessible sample loose floorboards and trap doors, if any, which are not covered by heavy furniture, ply or hardboard, fitted carpets or other fixed floor coverings. The Surveyor will not attempt to cut or lift fixed floorboards or other floor fabric without the express permission of the owner.

D. Fixed covers or housings

a. The Surveyor will not attempt to remove securely fixed covers or housings without the express permission of the owner.

E. Roofs

a. The Surveyor will inspect the roof spaces if there is a safe working platform available to work from. Where no safe working platform or access is available, the roof spaces will not be inspected. Similarly, outer surfaces of the roof or adjacent areas will be inspected using binoculars, but will be excluded if they cannot be seen.

F. Boundaries, grounds and outbuildings

a. Where reasonable access is available the inspection will include boundaries, grounds and permanent outbuildings but will not include temporary buildings or structures.

G. Services

a. The Surveyor will carry out a visual inspection of the service installations where reasonably accessible. Drainage inspection covers will be lifted where they are reasonably accessible and it is safe and practicable to do so. No tests of the service installations will be carried out unless previously agreed, although general overall comments will be made where reasonably possible and practicable. The Surveyor will report if it is considered that tests are advisable. Specialist inspection of electrical installations or gas mains will not be undertaken.

H. Areas not inspected

a. The Surveyor will identify any areas which would normally be inspected but which he or she was unable to reasonably inspect.

I. Environmental and other issues

a. Particular noise, dust, flooding or contaminated land and disturbance affecting the Property will only be noted if it is reasonably significant at the time of the inspection or if specific investigation has been agreed between the Surveyor and the Client and confirmed in writing.

b. The Surveyor will report on any reasonably obvious health and safety hazards to the extent that they are apparent from elements of the Property considered as part of the inspection.

c. The Surveyor will not undertake a fire risk assessment or consider fire safety risks to the extent that they are apparent from elements of the property considered as part of the inspection.

J. Hazardous materials

a. Unless otherwise expressly stated in the Report, the Surveyor will assume that no deleterious or hazardous materials or techniques have been used in the construction of the Property. However, the Surveyor will advise in the Report if, in his or her view, there is a likelihood that deleterious material has been used in the construction and specific enquiries should then be made or tests carried out by a specialist.

b. Subject to section B to page 1, the Surveyor, based upon a limited visual inspection, will note and advise upon the presence of lead water supply pipes and asbestos.

c. The Surveyor will advise in the Report if, to the best of his or her knowledge, the Property is in an area where, based on information published by the National Radiological Protection Board, there is a risk of radon. In such cases the Surveyor may advise that tests should be carried out to establish the radon level.

d. The Surveyor will endeavour to advise if there are transformer stations or overhead power lines which might give rise to an electromagnetic field, either over the subject Property or visible immediately adjacent to the Property. The Surveyor is not required to assess any possible effect on health or to report on any underground cables.

K. Ground conditions

a. The Surveyor will not be required to comment upon the possible existence of noxious substances, landfill or mineral extraction implications, or other forms of contamination, nor will the Surveyor advise on the adequacy of the substratum for any particular purpose unless geotechnical tests or specialist advice are commissioned by the client.

L. Consents, approvals and searches

a. The Surveyor will be entitled to assume that the Building or site is not subject to any unusual or onerous restrictions, obligations or covenants which apply to the Property or affect the reasonable enjoyment of the Property.

b. The Surveyor will be entitled to assume that all planning, Building Regulations and other consents required in relation to the Property have been obtained. The Surveyor will not verify whether such consents have been obtained. Any enquiries should be made by the Client or the Client's legal advisers. Drawings and specifications will not be inspected by the Surveyor unless otherwise previously agreed.

c. The Surveyor will be entitled to assume that the Property is unaffected by any matters which would be revealed by a Local Search and replies to the usual enquiries, or by a Statutory Notice, and that neither the Property, nor its condition, its use or its intended use, is or will be unlawful.

M. Exclusions

a. We have not inspected woodwork or other parts of the structure which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

b. We must stress that we have not carried out any investigation to determine whether any high alumina cement was used during the construction of the building inspected and we are therefore unable to report that the building is free from risk in this respect. In view of the possible potential danger connected with high alumina cement we strongly recommend that the appropriate investigations, inspections and tests be carried out immediately by a suitably qualified engineer.