F3 BUILDING SURVEYORS

## BUILDING SURVEY REPORT

# The Co-Proprietors per Trinity Factors

39 - 65 Caledonian Crescent, James Square, Edinburgh
Project Number: 21049
Date: 17-Nov-21
Revision: Not applicable

**F3 BUILDING SURVEYORS**
99 Giles Street, Edinburgh EH6 6BZ
0131 554 8050 | **f3surveyors.com**

# 39 – 65 CALEDONIAN CRESCENT, JAMES SQUARE, EDINBURGH

# BUILDING SURVEY REPORT

## CONTENTS

1. INTRODUCTION ..... 3
2. GENERAL OBSERVATIONS ..... 5
3. RECOMMENDED WORKS ..... 7
4. EXTERNAL FABRIC – ELEVATIONS ..... 8
5. EXTERNAL FABRIC – WINDOWS AND EXTERNAL DOORS ..... 12
6. EXTERNAL CURTILAGE ..... 12
7. CONCLUSION ..... 14
APPENDIX 1 – BOUNDARY WALL PLAN ..... 15
APPENDIX 2 – BUDGET COSTS ..... 17
APPENDIX 3 – STANDARD CONDITIONS ..... 22

This report has been prepared by F3 Building Surveyors Limited with all reasonable skill, care and diligence, within the terms of the Contract with the Client. The report is confidential to the Client and F3 Building Surveyors Limited accepts no responsibility of whatever nature to third parties to whom this report may be made known.

## 1. INTRODUCTION

1.1. On behalf of The Co-Proprietors per Trinity Factors, we were requested to undertake a building fabric survey to the elevations and boundary walls to each of the properties comprising 39 – 65 Caledonian Crescent, the James Square development, Edinburgh.

1.2. We undertook our survey on 1st September 2021, with a follow up survey on 14th October, this was undertaken by Sally Orr, MRICS, Chartered Building Surveyor and Katherine Glancy, Trainee Building Surveyor. We were accompanied by Ian Bruce from IB Access to undertake a cherry picker survey to all accessible high-level areas.

1.3. The properties comprise flatted residential blocks within the James Square development. The blocks range in three to six storeys in height. Our understanding is that the properties are on the site of a former timber store and sawmill / furniture works (see map below). The properties are not listed and are not within a Conservation Area.

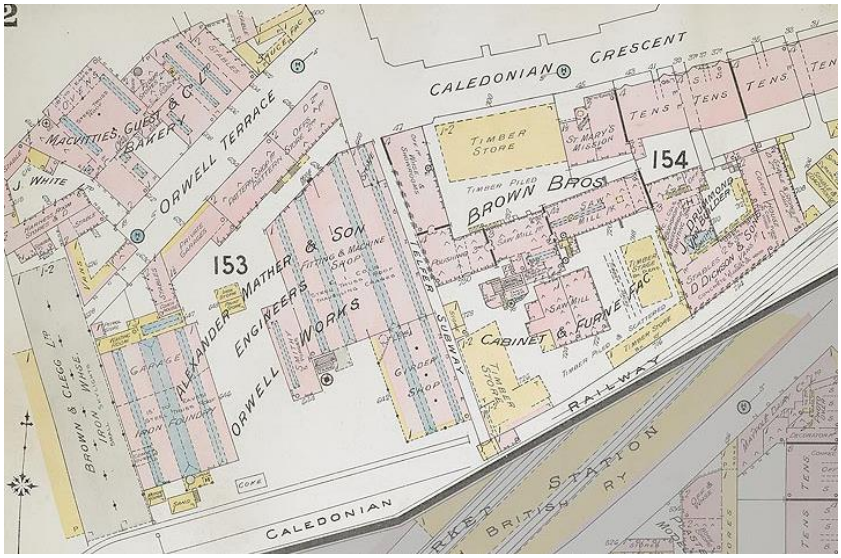


1.4. The properties appear to be traditionally constructed with a wet dash wall finish, slated mansard sections to the top floor and the roofs are of a flat roof construction, with the exception of the block at 65 including the swimming pool has a pitched slated roof.

1.5. The properties are located on Caledonian Crescent, Edinburgh.

## 1. INTRODUCTION (cont)

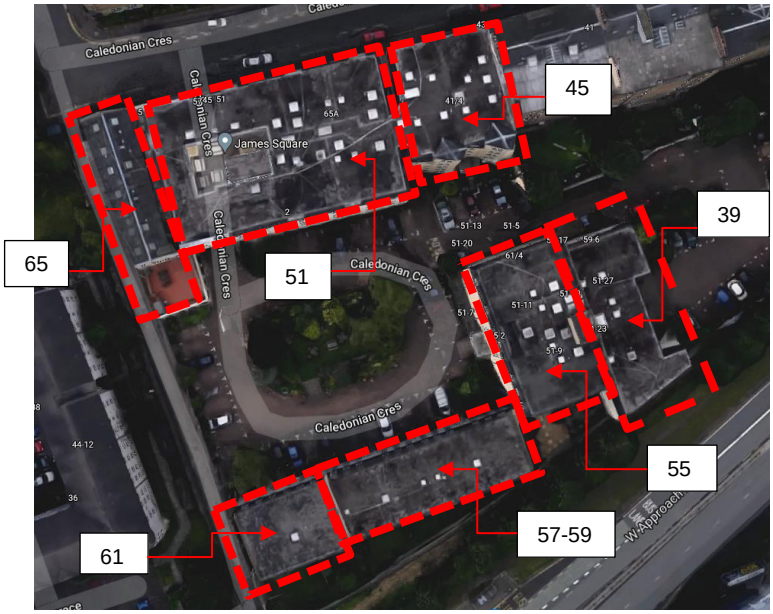


1.6. We were given access to the following areas:

1.6.1. External fabric: We were able to undertake a ground level inspection to elevations.

1.6.2. External fabric: We were able to undertake a high-level survey to accessible areas utilizing the cherry picker.

1.6.3. External curtilage: We were able to have a walk round survey of all accessible curtilage / external boundary wall areas.

1.7. Areas of no access: We were unable to access the full length of the western approach roadside to the boundary wall due to limited access. We were also unable to access the mutual side of the boundary wall within the rear garden of 37 Caledonian Crescent. At high level, we were unable to access the south west most area of block 51 and west most of 65 full length due to the public footpath running adjacent. We were also unable to access the rear of blocks 57 – 61, 55 and 39 due to the layout of the development (however were able to access on foot). Due to the narrow cut out between blocks 45 and 51 (on the Caledonian Crescent elevation) we were unbale to access with the cherry picker this small area.

1.8. For the purposes of the report, the elevations facing onto Caledonian Crescent is assumed to face north. All references to left hand side and right hand side are taken when viewing the relevant elevation from external facing the building.

1.9. We were not provided with any Health and Safety file nor the Operation & Maintenance Manual for the building. We have not been provided with any information for example builders estimates or the like.

1.10. Please note that this report is not intended for issue to contractors for pricing works. In the event that the owners decide to proceed with the works we would strongly recommend that full and comprehensive tender documentation be prepared, we can undertake this if required.

## 2. GENERAL OBSERVATIONS

2.1. The properties are generally in a fair condition, however there are repairs required to the elevations:

2.1.1. Block 65: There are some bossed areas to the render, which will require repairs in the short term. There is a large crack to the east elevation above the door front door, as well as bossed render to this area, we would recommend that this is repaired in the short term. There are planters to the elevation onto Caledonian Crescent and we would recommend that these are painted, and fixings are checked. To the rear at the swimming pool patio, there are various areas of cracking and bossed render, the render does appear to be on a lath (a mesh which can sound hollow when tapped as its nature), however repairs are still required.

2.1.2. Block 51: To the west most elevation, there have been previous repairs, these are bossed and the areas we were able to access from the cherry picker to the front at Caledonian Crescent and to the west gable had areas of bossed render and we would recommend repairs in the short term. To the remaining elevations, there are some areas of bossed render throughout, and we would recommend that in the medium term works are carried out.

To the timber portico to the front elevation, there are painterwork and repairs required to replace rotten timbers and repairs are also required to improve the drainage outlet in the short term.

To the rear / south elevation, at the corner of 65, there is a crack to the full height, there is also what would appear to be a wasp's nest at high level behind the slatework. There are bossed areas around the rear in particular at high level, we have included for a check by a structural engineer to significant cracking at high level.

Security light: The light above car parking space 51/7 there is only one fixing and this fixing is loose, we would recommend in the short term that this is re-fixed.

2.1.3. Block 45: To the Caledonian Crescent elevation, generally the elevation is in a fair condition, there are minor pockets of bossed render, we have included in the medium term for repairs associated with painterwork. There are picture frames and glass etc which have been thrown onto the canopy over the entrance door, we would recommend that these are removed. The timber portico has rotten sections and we have allowed for timber repairs and painterwork.

To the South (rear) elevation, there are repairs required in the short term including removal of loose render and replacement sections of rotten timber fascia. We removed a loose section of render at high level to here at the time of survey.

2.1.4. Block 39: Generally the elevations are in a fair condition, there has been previous render repairs to the adjacent property at 55 which has debris in the gutter of 39 which we would recommend that this is cleared.

We had limited inspection to the rear due to locked gates, we would note that there is cracking to the ground floor levels to the rear and we have allowed a sum for a hammer test and minor patch repairs. There is also vegetation growth to the elevation which we would recommend is removed.

2.1.5. Block 55: To the east of the property, there are signs of fairly recent repairs, the repair and the areas around are generally bossed and we would recommend that this elevation is hacked off and renewed in the short term. To the remaining elevations, there is cracking in particular to the west (front) elevation as well as bossed areas, we have recommended that the cracking is checked by a structural engineer as there is a fairly wide crack at high level. We would recommend that repairs are carried out in the short term to the render.

## 2. GENERAL OBSERVATIONS (cont)

Block 55 balcony: Although not part of the original survey remit, we were requested to make comment on the balcony at the west (front) elevation at high level, there have been previous repairs carried out, these are to a basic standard and the balcony surface is in a fairly poor condition. We would recommend that the rubberised tiles are lifted and the balcony is properly repaired and re-covered in a liquid waterproofing, which would also include for provision of correct upstand detailing and detailing around the balcony railings. We did note that there appears to have been fairly recently replaced leadwork to either side of the balcony, this appeared in a good condition. There have been mastic repairs to the high-level shiplap cladding, this mastic work is poor and we would allow for a short term rake out and replacement.

Block 55 Portico: The Portico roof is of a mastic asphalt finish, this is cracked throughout and in the short term we would allow for an overcoat of either liquid plastic or feltwork. The timberwork to the Portico is also rotten in places and requires timber repairs and painterwork to be carried out.

2.1.6. Block 57/59: Generally, the elevations are in a good condition, we would recommend that ivy growth is removed to the north (front) elevation and that hold fasts are provided to the branch connections to the downpipes. To the south (rear), the base course is in a fairly poor condition and in the short term we have allowed for a hack off and renew. To the east gable, there is a section of render at high level which is missing, we would allow for repairs at high level in the short term.

2.1.7. Block 61: To the east most gable above 57/59, the render is cracked however the render around these cracks is fairly tight therefore we would recommend works are carried out in the short term to fill the cracks. To the north (front) elevation, there is cracking to below the kneeler stones and we would recommend that this is repaired in the short term. To the south (rear) elevation, there are minor bossed sections to the low level areas, and we would recommend that minor patch repairs are carried out in the medium term as well as raking out and re-point of the movement joint.

2.1.8. Boundary walls: The boundary walls are significant to the development and our comments are that there are repairs required in the short and medium term.

2.1.9. Boundary walls were surveyed to both sides where possible.

2.1.10. Western approach road (South wall).To the extensive boundary wall to the western approach road, the render is bossed in large sections of this to the James Square side, in the medium term we would allow for a hack off and renew of render and associated stonework repairs. To the areas accessed to the mutual side on the western approach road, the wall is much lower in height however there are areas of partial collapse, we would recommend that this is referred to The City of Edinburgh Council and / or check title deeds for James Square regarding repair obligations.

2.1.11. To the boundary wall mutual with the plumber's merchant (to the East): There is a significant crack and movement to the wall, it is our understanding that the tree immediately adjacent to this area is being removed. We would anticipate this section of the wall will require to be taken down and re-built once the tree has been removed, however would recommend a structural engineer confirms, including if the removal of the remaining trees will be required. There may also be tree root damage to the plumber's yard, which may also require repairs, we have not included this within our costs.

2.1.12. To the mutual section with the tenements on Caledonian Crescent at 37-43 on the mutual side there are repairs required in the short term – we have not included for these in our costs as have assumed this would be the tenement's responsibility. However to the James Square side, there are repairs required to the render in the medium term.

## 2. GENERAL OBSERVATIONS (cont)

2.1.13. To the west most boundary wall, there has been recent render replacement carried out, this is in a fair condition, we have referred to Trinity Factors a small section of bossed render at block 65 for the contractor to return and repair. There will be pointing and stonework repairs required to the mutual side onto the public footpath in the short term.

2.1.14. Windows: There are a number of the windows which will require to have timber repairs undertaken, these are to the individual properties, and we would recommend the owners have the windows checked by a joiner, and repairs carried out. We have not included for individual window repairs.

2.1.15. Guttering: There are repairs required to the guttering to the development, we have included for repairs in the short term.

2.1.16. Painterwork: We have included for elevation painterwork following any repairs.

## 3. RECOMMENDED WORKS

3.1. Our recommendations would be to undertake the repairs as required to the following areas:

**RED PRIORITY: IMMEDIATE / SHORT TERM (YEARS 1-2):**

3.2. In terms of immediate / short term actions we would recommend the following:

3.2.1. To the elevations generally, render repairs to blocks 65, 51, 45, 55. and thereafter painterwork to elevations.

3.2.2. Ivy growth / vegetation removal generally to elevations walls and boundary walls.

3.2.3. Boundary walls: Take down and re-build to section at plumbers' yard.

3.2.4. Boundary walls: Generally, maintenance repairs in the short term.

3.2.5. Windows: Individual owners (not included within our costs) to have windows checked and loose timber / rotten timbers replaced / repaired.

3.2.6. Guttering: Repairs to guttering particularly where leaking.

3.2.7. Security lighting: Check all fixings and re-fix where required.

**AMBER PRIORITY: MEDIUM TERM (YEARS 3-5):**

3.3. In terms of medium term actions, we would recommend the following:

3.3.1. We would recommend that repairs are carried out to the large boundary wall at the western approach road in the medium term.

3.3.2. Render repairs to blocks 39, 55/57 and 61, and thereafter painterwork to elevations.

**GREEN PRIORITY: LONGER TERM (YEARS 6-10):**

3.4. In terms of longer term actions, we would recommend the following:

3.4.1. Assuming the works are carried out in the short and medium term as recommended, there is likely to be no significant longer term works with the exception of cyclical external decoration and minor render repairs when required. We would note however that an ongoing maintenance program will be required to maintain the asset value of the properties.

## 4. EXTERNAL FABRIC – ELEVATIONS

4.1. Generally to the development, the elevations comprise wet dash painted render. We undertook both ground and high-level inspections to the elevations and our observations are as below:

**BLOCK 65:**

4.1.1. The property comprises 3 storey flatted block with the swimming pool to the ground floor, the west most elevation faces on to the public footpath / lane. To the west elevation there have been previous repairs carried out at high level and there are balconies to the flats within this area, sections of the balcony render is cracked. To the low level areas of the property is the cement rendered wall of the public footpath / lane, this has graffiti / painted finish and is in a fair condition, we would note that repairing obligations for the elevation are clarified – especially the low level areas.

4.1.2. Condition: Generally, the wet dash is in a fair condition however there are repairs required in the short term.

Photo 01 – Cracking to balcony

Photo 02 – Previous repairs

**BLOCK 51:**

4.1.3. The block comprises 5 storey flatted block with wet dash painted render with driveway pend, main common stair entrance and large double door set with Portico entrance over. There is also a roller shutter door to the front onto Caledonian Crescent into the car park area.

4.1.4. Condition: There are short term repairs required to the render in particular to the rear where there is high level cracking to the rear elevation and to the west elevation where previous repairs are bossed as are the lower levels.

4.1.5. Portico: There are timber repairs and painterwork required to the portico as there are rotten timbers. We would allow for an upgrade to the drainage detail to allow for bigger outlet and to re-seal the pipework, to prevent future rot to the timbers.

4.1.6. Guttering: To the uPVC gutters, there are gutter repairs required particularly to the front elevation where previous repairs are poorly made.

## 4. EXTERNAL FABRIC - ELEVATIONS (cont)

Photo 03 – Previous repair to cracking

Photo 04 – Timber at portico

**BLOCK 45:**

4.1.7. Block 45 comprises 5 storey flatted block with wet dash painted render with two triangular bays to full height at the front and rear elevations.

4.1.8. Condition: To the front elevation, there are small bossed pockets of render however the elevation is generally in fair condition. We have allowed for medium term undertake repairs and painterwork as well as to rake out and re-do the movement joints. To the canopy over the entrance door, we have allowed for removal of the broken glass and picture frames etc in the short term. To the rear, we have allowed for repairs and rake out and re-point to the risband joint between 51 and 45, at high level we removed loose render and there is cracking and bossed render throughout the rear elevation, we would allow for short term hack off and render repairs, and thereafter painterwork.

4.1.9. Portico: To the timber portico, we have allowed for timber repairs and painterwork as there are rotten timbers in the short term.

Photo 05 – Cracking at high level

Photo 06 – Previous repair at high level

**BLOCK 39:**

4.1.10. The block comprises a 4 storey flatted block, consistent with others in the development, with a painted wet dash finish.

4.1.11. Condition: Block 39 is generally in fair condition with only minor repairs required to the rear elevation where cracking is noted to the elevation in the short term. We have also included for removal of ivy growth in the short term.

## 4. EXTERNAL FABRIC - ELEVATIONS (cont)

Photo 07 – Cracking at window

Photo 08 – Ivy growth

**BLOCK 55:**

4.1.12. The block comprises a 5 storey flatted block, consistent with others in the development, with a painted wet dash finish.

4.1.13. Condition: There are repairs required in the short term to this property including structural engineer to assess cracking at high level. There is cracking throughout and bossed render to the elevations, we have allowed in the short term a hack off and renew to the bossed render as well as painterwork.

4.1.14. Balcony to top floor property: We have allowed in the short term for repairs to the balcony finish as well as mastic repairs at the shiplap cladding.

Photo 09 – Cracking at high level

Photo 10 – Cracking to portico roof

**BLOCK 57/59:**

4.1.15. The block comprises a 3 storey flatted block, consistent with others in the development, with a painted wet dash finish.

4.1.16. Condition: Generally the render is in a good condition, we have allowed for the removal of climbing plants and to the rear repairs to the base course. There is also a section at the east most gable which is missing, we have allowed for short term repairs to this.

## 4. EXTERNAL FABRIC - ELEVATIONS (cont)

Photo 11 – East most gable section where render missing

Photo 12 – Area of bossed render to rear

**BLOCK 61:**

4.1.17. The block comprises a 4 storey flatted block, consistent with others in the development, with a painted wet dash finish.

4.1.18. Condition: We have allowed render repairs in the short term to minor bossed areas. We have included for repairs to the fascia and an alteration to the leadwork detailing to prevent future rot to the timbers. We have allowed to rake out and re-point the raking copes and repairs to the render to the bottom “skew putt” stone, where it has cracked the render. We have included to provide a hold fast to the branch connection to the downpipe as this was loose.

4.1.19. Portico over front entrance door: We have included for timber repairs and painterwork.

Photo 13 – Existing leadwork detailing

Photo 14 – Area of bossed render to west most gable end

## 5. EXTERNAL FABRIC – WINDOWS AND EXTERNAL DOORS

5.1. **Windows:** Although not part of our survey, we did note that throughout the development there were a number of the owners windows which are requiring repair, a number where the mock astragals are either missing or ready to fall from the window, generally we would recommend that each of the owners undertake repairs to their windows individually. We have NOT included for any repairs to windows.

5.2. **External doors:** Not part of the remit of our survey.

## 6. EXTERNAL CURTILAGE

6.1. Our observations in relation to the external curtilage are as follows:

6.1.1. **Boundary wall section A:** Comprises the east most boundary walls along the south east corner of block 45 round to the south east most corner of to the bike store, which encompasses the car parking area as well as the bike store – Refer to Boundary Wall plan within appendix 01. The first section is mutual to the tenement at 41/43 Caledonian Crescent. There are repairs required to the James Square side of the wall, render is bossed in areas and cracked. To the section of the wall where the bins were in place at the time of survey and obscured the wall, to the areas visible the wall is in a fair condition. The internal face to the tenement at 41/43 requires some stone repairs and pointing works as well as render repairs. We have however not included for these within our costs, as we would assume these are the responsibility of the tenement owners.

6.1.2. Mutual with block 37 Caledonian Crescent: This wall has recently been re-rendered and is in good condition, the mutual side was unable to be accessed as private garden. A section of the wall is leaning slightly, we would note however that there are large trees within the tenement side of the wall. The internal face to the tenement (as viewed from the driveway pend) is brickwork and appears in a fair condition, there is some open joints – we have not included for any works to the mutual side as we would assume these are the responsibility of the tenement owners.

6.1.3. Section mutual with plumbers' yard: Established trees growing within car park area. A section of the wall has moved and creating a large crack and we would anticipate the wall requires to be taken down and re-built as well as removal of offending tree, we have included for a structural engineer to attend to confirm. We would note that it is likely that other sections of the wall may also have movement in future years due to the large trees growing. Consideration to remove trees should be given. We have not included to remove all of the trees as at this time.

6.1.4. Mutual side within plumbers' yard: Also wet dash render with cracking along certain areas, we have included for render repairs and associated brickwork repairs.

6.1.5. Bike store: Generally, the bike store is in a fair condition, we have included for some repairs to the flat roof and flashings in the short term.

6.1.6. Wall section at western approach road: Wall is generally bossed along its length; we have included for medium term render repairs and associated stonework repairs.

## 6. EXTERNAL CURTILAGE (cont)

Photo 15 – Wall mutual to block 37 leaning

Photo 16 – Section mutual with plumbers' yard

6.1.7. **Boundary wall section B:** Comprises the east to west on the western approach road to blocks 39 – 61. To the James Square elevation, there is a dry dash render, generally this is in a fairly good condition and would appear to have been re-rendered fairly recently. There is a small section of bossed render at low level to the west most corner however this is minor.

6.1.8. External face on the western approach road: Only a small section was able to be observed safely from the verge, there are sections where the exposed masonry have partially collapsed, repairs are required in the short term. Copes stones require to be re-pointed where open joints etc also.

Photo 17 – Wall section bossed slightly in corner

Photo 18 – Wall at western approach road

6.1.9. **Boundary wall section C:** Comprises the west most section to the public footpath between Caledonian Crescent and Orwell Terrace leading up to the western approach road. Sections of this have been recently roughcast by Trinity Factors. The remainder of the wall comprises square coursed masonry with a cement rendered portion which has been decorated in art to the north most section. There is vegetation growth to the copes to the north most section at block 65 and other small sections to the wall, this vegetation requires to be removed. There is a brickwork section to this elevation which is exposed, this has some open joints and we would recommend is re-pointed in the short term. To the masonry sections, there are open joints and softer sections of stone, in the short term we have allowed for rake out and re-point to isolated areas and in the medium term we have included for stonework repairs. To the internal face, this has been re-rendered recently and is in good condition.

## 6. EXTERNAL CURTILAGE (cont)

Photo 19 – Wall section of coursed masonry with rendered portion above

Photo 20 – Recently re rendered internal face

## 7. CONCLUSION

7.1. In conclusion, based on our survey, repairs are required in the short term to the elevations and to the boundary walls.

7.2. We refer you to our budget costs which highlight the short and medium term repairs required.

7.3. If you wish our further input or assistance in this regard, we would be delighted to do so.

7.4. We thank you for asking us to assist.

**Prepared by F3 Building Surveyors Ltd.**
**17-Nov-21**

| | | |
|---|---|---|
| Prepared by: | **SO** | Date: |
| Checked by: | **KG** | **17-Nov-21** |

## APPENDIX 1 – BOUNDARY WALL PLAN

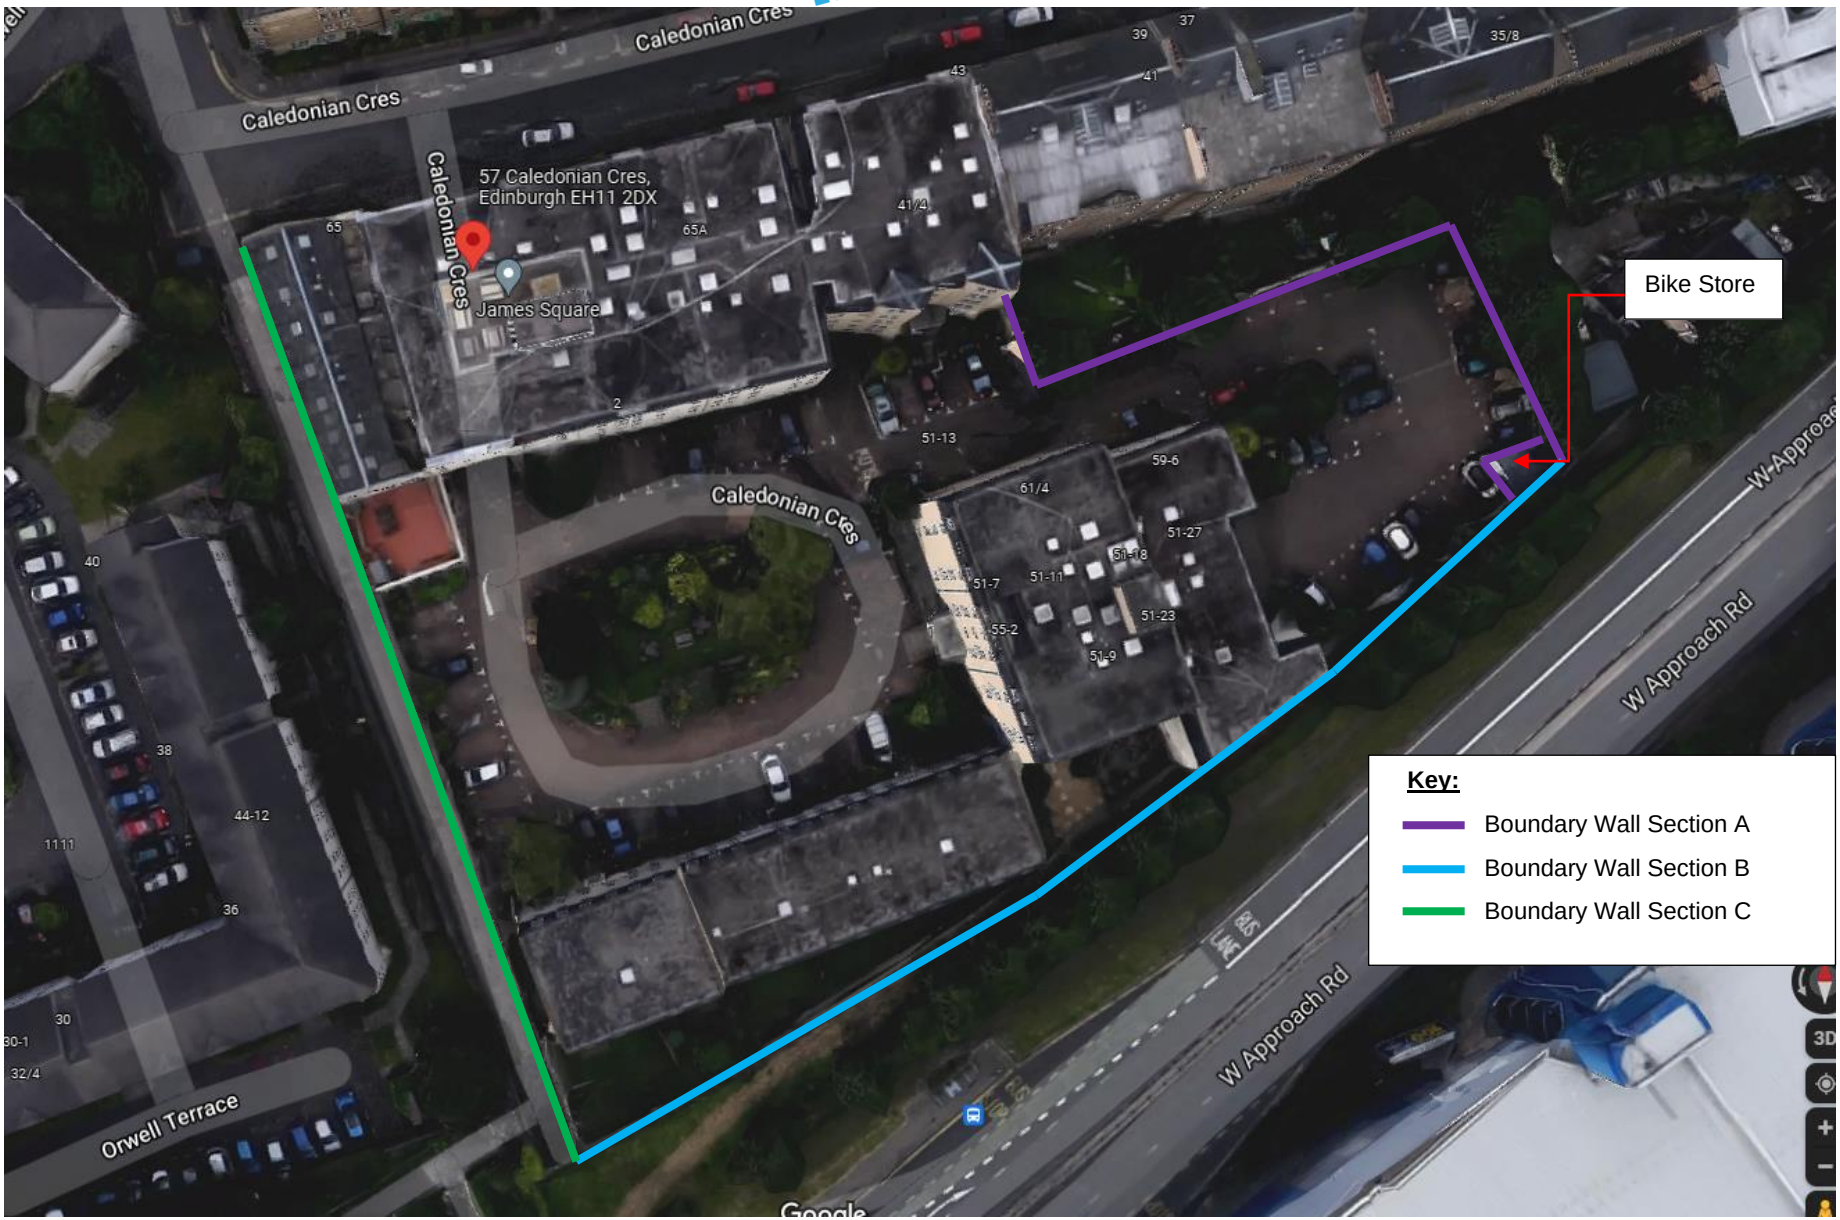
Caledonian Cres
Caledonian Cres
Caledonian Cres
57 Caledonian Cres,
Edinburgh EH11 2DX
James Square
Caledonian Cres
Orwell Terrace
W Approach Rd
W Approach Rd
Bike Store
Key:
Boundary Wall Section A
Boundary Wall Section B
Boundary Wall Section C

## APPENDIX 2 – BUDGET COSTS

| Description | Quantity | Units | Rate | Total | RED: Short Term | AMBER: Medium Term | GREEN: Longer Term |
|---|---|---|---|---|---|---|---|
| **21049 39-65 Caledonian Crescent, James Square, Elevations and Boundary Walls** | | | | | | | |
| **SUPERSTRUCTURE** | | | | | | | |
| Roof | | | | | | | |
| Roof drainage | | | | | | | |
| Gutters - 39 | | | | | | | |
| Clear debris to guttering. | 1 | Item | 150 | 150.00 | 150.00 | | |
| Gutters - 51 | | | | | | | |
| Repairs / replacement sections. | 10 | m | 50 | 500.00 | 500.00 | | |
| External walls | | | | | | | |
| Block 65 | | | | | | | |
| Render | | | | | | | |
| Hack off bossed, and replace with new wet dash render. Allowance for 50% | 195 | m2 | 110 | 21,450.00 | 21,450.00 | | |
| Painterwork to elevations following render works. | 455 | m2 | 20 | 9,100.00 | 9,100.00 | | |
| Crack repairs above front door. | 1 | Item | 1000 | 1,000.00 | 1,000.00 | | |
| Planters | | | | | | | |
| Check fixings and paint. | 3 | No | 100 | 300.00 | 300.00 | | |
| Block 61 | | | | | | | |
| Render | | | | | | | |
| Short term render patching. | 5 | m2 | 110 | 550.00 | 550.00 | | |
| Dowel fix to cope stones | 8 | No | 40 | 320.00 | 320.00 | | |
| Medium Term Painterwork | 335 | m2 | 20 | 6,700.00 | | 6,700.00 | |
| Medium Term Rake out and repoint movement joint and minor patch repairs | 1 | Item | 500 | 500.00 | | 500.00 | |
| Short term check Juliette Balcony Fixings. | 6 | No | 50 | 300.00 | 300.00 | | |
| Medium Term painterwork Juliette Balcony | 6 | No | 100 | 600.00 | | 600.00 | |
| Block 57-59 | | | | | | | |
| Render | | | | | | | |

| Description | Quantity | Units | Rate | Total | RED: Short Term | AMBER: Medium Term | GREEN: Longer Term |
|---|---|---|---|---|---|---|---|
| Remove vegetation / ivy growth. | 1 | Item | 200 | 200.00 | 200.00 | | |
| Short term repairs to base course. | 5 | m2 | 80 | 400.00 | 400.00 | | |
| Short term render repairs to east gable. | 3 | m2 | 110 | 330.00 | 330.00 | | |
| Painterwork to elevations - MediumTerm | 397 | m2 | 20 | 7,940.00 | | 7,940.00 | |
| Downpipes | | | | | | | |
| Replace holdfasts. | 2 | No | 20 | 40.00 | 40.00 | | |
| Block 55 | | | | | | | |
| Render | | | | | | | |
| Hack off and re-render bossed areas. Short Term | 50 | m2 | 110 | 5,500.00 | 5,500.00 | | |
| Cracking to be inspected by Structural engineer. | 1 | Item | 500 | 500.00 | 500.00 | | |
| Repaint Elevation following render works. | 545 | m2 | 15 | 8,175.00 | 8,175.00 | | |
| Extra over for structural repairs - Brick ties etc. | 1 | Item | 5000 | 5,000.00 | 5,000.00 | | |
| Portico | | | | | | | |
| Timber repairs and painterwork. | 1 | Item | 500 | 500.00 | 500.00 | | |
| Mastic asphalt roof - overlay. | 6 | m2 | 60 | 360.00 | 360.00 | | |
| Balcony to top floor flat. | | | | | | | |
| Allowance for balcony deck repairs / replacement finish and mastic replacement to cladding. | 1 | Item | 1500 | 1,500.00 | 1,500.00 | | |
| Block 51 | | | | | | | |
| Render | | | | | | | |
| Short Term: Hack off bossed render, and replace with new wet dash render. | 90 | m2 | 110 | 9,900.00 | 9,900.00 | | |
| Hack off bossed, and replace with new wet dash render 25%. Medium Term | 239 | m2 | 110 | 26,290.00 | | 26,290.00 | |
| Structural Engineer to assess cracking at high level. | 1 | Item | 500 | 500.00 | 500.00 | | |
| Painterwork to render - West Gable | 184 | m2 | 20 | 3,680.00 | 3,680.00 | | |
| Painterwork to render. Medium Term. | 1200 | m2 | 20 | 24,000.00 | | 24,000.00 | |
| Portico | | | | | | | |
| Timber repairs and painterwork | 1 | Item | 750 | 750.00 | 750.00 | | |
| Repairs to drainage outlet. | 1 | Item | 200 | 200.00 | 200.00 | | |
| External Lighting | | | | | | | |
| Refix security lights. | 1 | Item | 30 | 30.00 | 30.00 | | |

| Description | Quantity | Units | Rate | Total | RED: Short Term | AMBER: Medium Term | GREEN: Longer Term |
|---|---|---|---|---|---|---|---|
| Check Security lights generally | 1 | No | 30 | 30.00 | 30.00 | | |
| Block 45 | | | | | | | |
| Render | | | | | | | |
| Medium term render repairs. | 40 | m2 | 110 | 4,400.00 | | 4,400.00 | |
| Medium term painterwork | 547 | m2 | 20 | 10,940.00 | | 10,940.00 | |
| Clear debris to canopy | 1 | Item | 25 | 25.00 | 25.00 | | |
| Short term repairs to cracked and loose render. | 10 | m2 | 110 | 1,100.00 | 1,100.00 | | |
| Portico | | | | | | | |
| Timber repairs and painterwork. | 1 | Item | 500 | 500.00 | 500.00 | | |
| Fascia | | | | | | | |
| Replacement of rotten sections with non-combustible board. | 5 | m | 60 | 300.00 | 300.00 | | |
| Block 39 | | | | | | | |
| Render | | | | | | | |
| Medium term painterwork | 490 | m2 | 20 | 9,800.00 | | 9,800.00 | |
| Medium term patch repairs to render to rear. | 10 | m2 | 100 | 1,000.00 | | 1,000.00 | |
| Remove vegetation to elevation. | 1 | Item | 250 | 250.00 | 250.00 | | |
| Guttering | | | | | | | |
| Clear Guttering and check joints. | 1 | Item | 350 | 350.00 | 350.00 | | |
| **EXTERNAL WORKS** | | | | | | | |
| Site works | | | | | | | |
| Site enclosure and division | | | | | | | |
| Boundary Wall Ref A | | | | | | | |
| Render repairs. Medium Term | 101 | m2 | 110 | 11,110.00 | | 11,110.00 | |
| Stone Repairs Medium Term | 1 | Item | 5000 | 5,000.00 | | 5,000.00 | |
| Take down and rebuild section to plumber's yard. Allowance subject to SE assessment. | 1 | Item | 4000 | 4,000.00 | 4,000.00 | | |
| Allowance for repairs to mutual wall at 37, leaning. | 1 | Item | 2000 | 2,000.00 | 2,000.00 | | |
| Check bolt fixings to archway and painterwork. | 1 | Item | 300 | 300.00 | 300.00 | | |
| Remove vegetation short term . | 1 | Item | 200 | 200.00 | 200.00 | | |
| Boundary Wall Ref B | | | | | | | |
| Medium Term Render repairs | 50 | m2 | 110 | 5,500.00 | | 5,500.00 | |

| Description | Quantity | Units | Rate | Total | RED: Short Term | AMBER: Medium Term | GREEN: Longer Term |
|---|---|---|---|---|---|---|---|
| Short Term Stone repairs. | 1 | Item | 5000 | 5,000.00 | 5,000.00 | | |
| Boundary Wall Ref C | | | | 0 | | | |
| Remove vegetation Short term. | 1 | Item | 200 | 200.00 | 200.00 | | |
| Repointing isolated areas Short Term | 5 | m2 | 50 | 250.00 | 250.00 | | |
| Stonework repairs - Medium Term | 1 | Item | 5000 | 5,000.00 | | 5,000.00 | |
| Block 51 | | | | | | | |
| Front wall on to Caledonian Crescent, render repairs. | 10 | m2 | 110 | 1,100.00 | | 1,100.00 | |
| Bike Store | | | | | | | |
| Flat roof repairs and flashing repairs. | 2 | Days | 250 | 500.00 | 500.00 | | |
| **PRELIMINARIES** | | | | | | | |
| General contractors preliminaries | | | | | | | |
| Short term works | 26 | wks | 600 | 15,600.00 | 15,600.00 | | |
| Medium Term Works | 20 | wks | 600 | 12,000.00 | | 12,000.00 | |
| **NON-CONSTRUCTION COSTS** | | | | | | | |
| Non - Construction Costs | | | | | | | |
| Professional Fees | | | | | | | |
| Short Term | 1 | Item | 4000 | 4,000.00 | 4,000.00 | | |
| Medium Term | 1 | Item | 4500 | 4,500.00 | | 4,500.00 | |
| Wasp Nest Removal | 1 | Item | 200 | 200.00 | 200.00 | | |
| Access Equipment | | | | | | | |
| Short Term | | | | | | | |
| Scaffolding - 65 | 1 | Item | 4000 | 4,000.00 | 4,000.00 | | |
| Scaffolding - 61 | 1 | Item | 750 | 750.00 | 750.00 | | |
| Scaffolding 57-59 | 1 | Item | 500 | 500.00 | 500.00 | | |
| Scaffolding - 55 | 1 | Item | 15000 | 15,000.00 | 15,000.00 | | |
| Scaffolding - 51 | 1 | Item | 10000 | 10,000.00 | 10,000.00 | | |
| Scaffolding - 45 | 1 | Item | 3000 | 3,000.00 | 3,000.00 | | |
| Cherry picker - 39 | 1 | Item | 250 | 250.00 | 250.00 | | |
| Boundary Wall A Cherry Picker | 1 | Item | 250 | 250.00 | 250.00 | | |
| Medium Term | | | | | | | |
| Scaffolding - 65 | 1 | Item | 8000 | 8,000.00 | | 8,000.00 | |

F3 BUILDING SURVEYORS

| Description | Quantity | Units | Rate | Total | RED: Short Term | AMBER: Medium Term | GREEN: Longer Term |
|---|---|---|---|---|---|---|---|
| Scaffolding - 61 | 1 | Item | 4000 | 4,000.00 | | 4,000.00 | |
| Scaffolding 57-59 | 1 | Item | 5000 | 5,000.00 | | 5,000.00 | |
| Scaffolding - 51 | 1 | Item | 20000 | 20,000.00 | | 20,000.00 | |
| Scaffolding - 45 | 1 | Item | 10000 | 10,000.00 | | 10,000.00 | |
| Scaffolding - 39 | 1 | Item | 5000 | 5,000.00 | | 5,000.00 | |
| Boundary Wall A Scaffolding | 1 | Item | 3000 | 3,000.00 | | 3,000.00 | |
| Boundary Wall C Scaffolding | 1 | Item | 2000 | 2,000.00 | | 2,000.00 | |
| **SUB-TOTAL CONSTRUCTION COSTS** | | | | **333,170.00** | **139,790.00** | **193,380.00** | **0.00** |
| **VAT** | | | | **20%** | **27,958.00** | **38,676.00** | **0.00** |
| | | | | | **167,748.00** | **232,056.00** | **0.00** |

## APPENDIX 3 – STANDARD CONDITIONS

**Content of the Report**

In accordance with these terms the Surveyor will use his or her best endeavours to report upon:

a. The main aspects of the Property including assessing the site/location, the design, structural framework, fabric and services;

b. The grounds, boundaries and environmental aspects considered to affect the Property;

c. Any requirements for further investigation arising from the inspection.

**Assumptions**

Unless otherwise expressly agreed the Surveyor while preparing the Report will reasonably assume that:

a. The Building(s) (if for sale) is offered with vacant possession;

b. The Building(s) is connected to mains services with appropriate rights on a basis that is known and acceptable to the Client; and

c. Access to the Building(s) is as of right upon terms known and acceptable to the Client.

**Scope of the inspection**

**A. Generally**

a. The Surveyor will consider his or her advice carefully but is not required to advise on any matter the significance of which in relation to the Building(s) is not apparent at the time of inspection from the inspection itself.

b. The Surveyor will inspect diligently but is not required to undertake any action that would risk damage to the Building(s) or injury to himself, herself or any other party.

c. The Surveyor will not undertake any structural or other calculations.

d. The Surveyor will not produce a repair schedule, planned maintenance report, feasibility report or advise on design, procurement or project management unless expressly agreed with the client.

**B. Accessibility**

a. The Surveyor will inspect as much of the internal and external surface area of the building as is practicable but will not inspect those areas which are covered, unexposed or not reasonably accessible from within the site, or adjacent public areas.

b. The Surveyor is not required to move any obstruction to inspection including, but not limited to, fixtures, fittings and floor coverings.

c. The surveyor will not open up or cut into the building fabric without specific directions from the client. Such intrusive investigations, if instructed by the client, will be at the risk and liability of the client and will be assumed to be with agreement between the client and the building owner.

**C. Floors**

a. The Surveyor will lift accessible sample loose floorboards and trap doors, if any, which are not covered by heavy furniture, ply or hardboard, fitted carpets or other fixed floor coverings. The Surveyor will not attempt to cut or lift fixed floorboards or other floor fabric without the express permission of the owner.

**D. Fixed covers or housings**

a. The Surveyor will not attempt to remove securely fixed covers or housings without the express permission of the owner.

**E. Roofs**

a. The Surveyor will inspect the roof spaces if there is a safe working platform available to work from. Where no safe working platform or access is available, the roof spaces will not be inspected. Similarly, outer surfaces of the roof or adjacent areas will be inspected using binoculars, but will be excluded if they cannot be seen.

**F. Boundaries, grounds and outbuildings**

a. Where reasonable access is available the inspection will include boundaries, grounds and permanent outbuildings but will not include temporary buildings or structures.

**G. Services**

a. The Surveyor will carry out a visual inspection of the service installations where reasonably accessible. Drainage inspection covers will be lifted where they are reasonably accessible and it is safe and practicable to do so. No tests of the service installations will be carried out unless previously agreed, although general overall comments will be made where reasonably possible and practicable. The Surveyor will report if it is considered that tests are advisable. Specialist inspection of electrical installations or gas mains will not be undertaken.

**H. Areas not inspected**

a. The Surveyor will identify any areas which would normally be inspected but which he or she was unable to reasonably inspect.

**I. Environmental and other issues**

a. Particular noise, dust, flooding or contaminated land and disturbance affecting the Property will only be noted if it is reasonably significant at the time of the inspection or if specific investigation has been agreed between the Surveyor and the Client and confirmed in writing.

b. The Surveyor will report on any reasonably obvious health and safety hazards to the extent that they are apparent from elements of the Property considered as part of the inspection.

c. The Surveyor will not undertake a fire risk assessment or consider fire safety risks to the extent that they are apparent from elements of the property considered as part of the inspection.

**J. Hazardous materials**

a. Unless otherwise expressly stated in the Report, the Surveyor will assume that no deleterious or hazardous materials or techniques have been used in the construction of the Property. However, the Surveyor will advise in the Report if, in his or her view, there is a likelihood that deleterious material has been used in the construction and specific enquiries should then be made or tests carried out by a specialist.

b. Subject to section B to page 1, the Surveyor, based upon a limited visual inspection, will note and advise upon the presence of lead water supply pipes and asbestos.

c. The Surveyor will advise in the Report if, to the best of his or her knowledge, the Property is in an area where, based on information published by the National Radiological Protection Board, there is a risk of radon. In such cases the Surveyor may advise that tests should be carried out to establish the radon level.

d. The Surveyor will endeavour to advise if there are transformer stations or overhead power lines which might give rise to an electromagnetic field, either over the subject Property or visible immediately adjacent to the Property. The Surveyor is not required to assess any possible effect on health or to report on any underground cables.

**K. Ground conditions**

a. The Surveyor will not be required to comment upon the possible existence of noxious substances, landfill or mineral extraction implications, or other forms of contamination, nor will the Surveyor advise on the adequacy of the substratum for any particular purpose unless geotechnical tests or specialist advice are commissioned by the client.

**L. Consents, approvals and searches**

a. The Surveyor will be entitled to assume that the Building or site is not subject to any unusual or onerous restrictions, obligations or covenants which apply to the Property or affect the reasonable enjoyment of the Property.

b. The Surveyor will be entitled to assume that all planning, Building Regulations and other consents required in relation to the Property have been obtained. The Surveyor will not verify whether such consents have been obtained. Any enquiries should be made by the Client or the Client's legal advisers. Drawings and specifications will not be inspected by the Surveyor unless otherwise previously agreed.

c. The Surveyor will be entitled to assume that the Property is unaffected by any matters which would be revealed by a Local Search and replies to the usual enquiries, or by a Statutory Notice, and that neither the Property, nor its condition, its use or its intended use, is or will be unlawful.

**M. Exclusions**

a. We have not inspected woodwork or other parts of the structure which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

b. We must stress that we have not carried out any investigation to determine whether any high alumina cement was used during the construction of the building inspected and we are therefore unable to report that the building is free from risk in this respect. In view of the possible potential danger connected with high alumina cement we strongly recommend that the appropriate investigations, inspections and tests be carried out immediately by a suitably qualified engineer.