

ENGINEERING REPORT

ISSUE NO.: **ER-26-0157-01**

MODEL: L1268	TITLE: Gap abnormal between Top_Cover and Right_Cover	APPROVED BY:  MURAKAMI ATSUSHI
PART NO.: RC7-0183-000	PURPOSE: Record and sharing	CHECKED BY: Le Thi Dung
PART NAME: Right_Cover		ISSUED BY: Ha Hoc Tu
		DATE: 2026-05-28 EXT: 8453

DETAILS: (☒ Trouble: 1. Problem, 2. Cause, 3. Temporary solution, 4. Permanent solution
☐ Technical report: 1. Background, 2. Conclusion, 3. Result)

1. PROBLEM:

- What (NG phenomenon): Gap abnormal between Top_Cover and Right_Cover
- Model/Cell/Station): L1268
- When (Happened date/Quarter/time): 12-Dec-2025
- Who (detect by): ASSY
- Quantity: 2 machines
- Body: Other
- Maker: Rishi

OK



NG

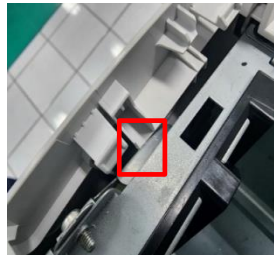


Gap spec: 0~2mm

Actual 2.4 mm

2. CAUSE:

Cause: Interfere with Left cover and Cover_Gear because Part RC7-0183 have shape not good.

**3. TEMPORARY SOLUTION:**

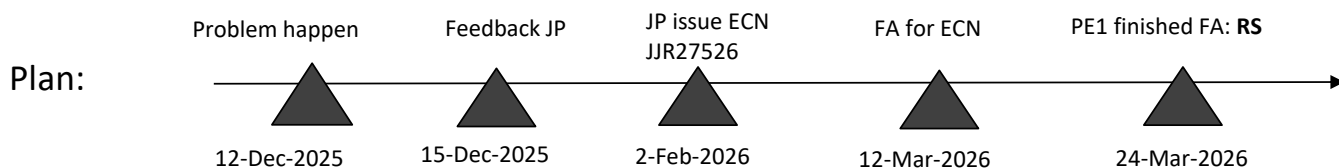
Check 3D VPS newest
PE1 rework part 87/87 (finished)

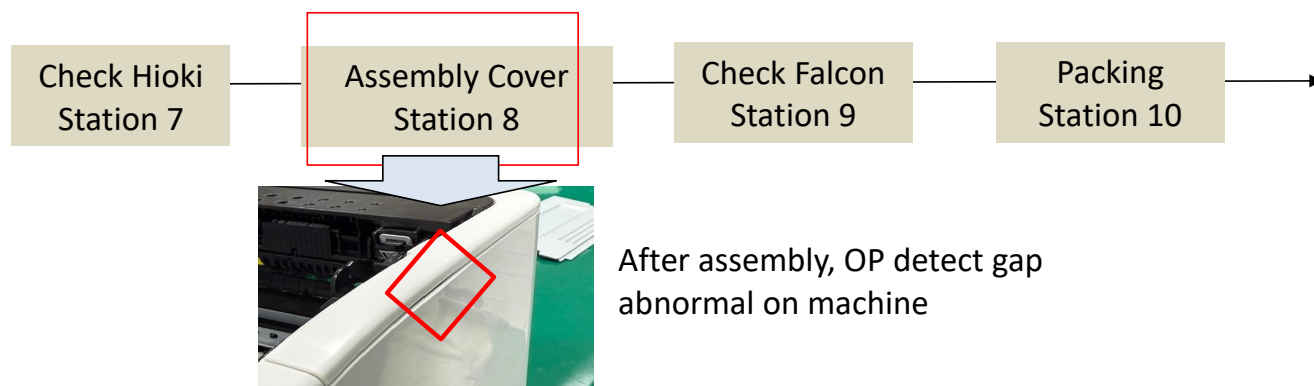
4. PERMANENT SOLUTION:

Feedback to JP change DWG (12-Dec-25)

JP issue ECN **JJR27526**

Check appearance verify by sheet paper & record measurement data actual



Attached sheet for:
ER-26-0157-01**Phenomenon:****Check Assembly (Working position)**

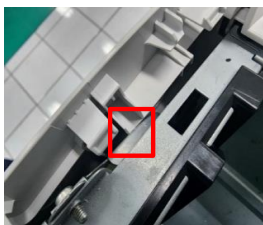
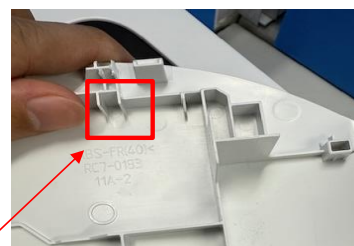
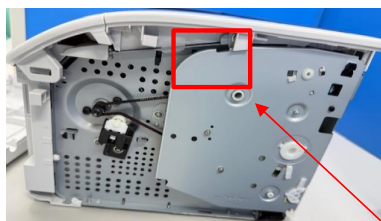
Right side machine : OK - Assembly unit complete



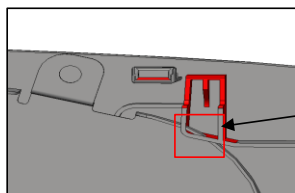
Right Plate: OK - Child part no have abnormal about shape



Check assembly situation: NG - Part have interfere

Assembly again
replace by FA part : Still NG

Interfere position

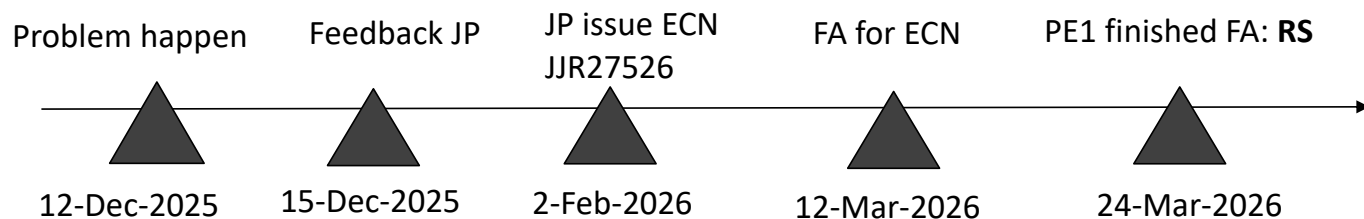
Check VPS 3D:Realize interfere between Right_Cover and Gear_Cover
➔ Conclusion Part shape not good.

Attached sheet for:
ER-26-0157-01

Countermeasure:

- Feedback to JP

Plan:

**Prevent solution:**

Verify by document inspection & record measurement result when check assembly FA

