

Weekly Site Report

BLACK ROCK WEEKLY REPORT

Weekly PSD Report
EPIROC SA

Contents

Weekly Service Report – Black Rock Mine Operations	2
Report Summary	2
General Summary	3
BEV - Critical Issues Summary	3
CAS L9 Implementation - Critical Issues Summary	3
Certiq & Mobilaris - Critical Issues Summary	3
BEV – MH4.0 Upgrades	3
Passport 360 Compliance	3
BEV Report	4
Weekly machine utilization summary:	4
Planned work for the coming week (Week 29):	11
Battery and Charger Status Report	11
General summary	11
FST Report Summary	13
Field Service on site:	13
CAS Report Summary	13
Critical Issues	14
Progress Update	14
Certiq & Mobilaris Report Summary	15
General summary	15

Weekly Service Report – Black Rock Mine Operations

Report type:	Weekly	Submitted to:	Sello Taku and Sipho
Week Date:	26 June 2025	End Date	13 July 2025
Reported By:	Philip Moller		
BEV:			
Service Tech:	Ivan Phiri	Service Tech:	Lukas Serumola
Service Tech:	Patricia Mazinyo	Service Tech Assistant:	Patrick Yoko
Specialist:	Frikkie van der Walt (Leave)		
Field Service:			
Service Tech:	Alpheus Mareke	Service Tech:	Mathews Mosemane
CAS Project:			
Team Leader:	Bradley Nast	Service Tech:	Phineas Sibanda
Service Tech:	Julius Manamela	Service Tech:	
Certiq Project:			
Team Leader:	Segunda Fernando	Service Tech:	
Mobilaris:			
Team Leader:	Rupert Grobler		

Report Summary

General Summary

The purpose of this report is to give an overview of all the Epiroc activities at Blackrock Mine Operations (BRMO).

BEV - Critical Issues Summary

- DT147 – Auxiliary motor failed. Motor was replaced and on start-up no hydraulic functions were present. Need to strip to get to Pump drive. Focus was put on getting FL99 back in production. Auxiliary motor stripped out. Pump drive splines worn, and pump drive stuck. Waiting on new pump drive, to be delivered 16/05/2025
Wheel that was flat was fixed 25/05/2025. Stripping of the pump drive must continue today. (Manpower issue) (90D02H36min)
- Sourcing of level sensor for PDT that broke when the PDT was removed. **No stock in SA.** Lead time 21-25 days. I would suggest keeping one in store stock.

CAS L9 Implementation - Critical Issues Summary

-

Certiq & Mobilaris - Critical Issues Summary

- Machine availability to review the installation and collect evidence for the commissioning documents
- Passport 360 issues to be resolved

BEV – MH4.0 Upgrades

- MH4.0 software upgrades project update to be sent for approval.

Passport 360 Compliance

- BEV Technicians: **96%**
- CASL9 (Gloria): **98%**
- CASL9 (Nch2): **97%**
- CAS L9 (Nch3): **97%**
- Certiq & Mobilaris N2: **97%**
- Certiq & Mobilaris Gloria: **98%**
- Training: **Pack archived**
- Epiroc SLA: **84%**

BEV Report

Weekly machine utilization summary:

Thursday 26 June 2025:

1. L 98 –
2. FL 99 –
3. FL 107 –
4. FL 108 –
5. FL 112 - *Afternoon shift:* Mechanical breakdown – No data or feedback. (2H16min)
6. FL 113 -
7. DT 146 – *Afternoon shift:* Electrical down - HVIL Fault - Fixed HV door switch. (3H14min)
8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)
9. DT 149 – *Night shift:* Electrical breakdown - No feedback. (17min)
10. DT 150 –
11. DT 162 –
12. DT 163 –
13. DT 171 – *Morning shift:* 3rd party supplier fault: Strata. (34min)
Mechanical breakdown: No feedback. (1H05min)

Friday 27 June 2025

1. FL 98 –
2. FL 99 –
3. FL 107 –
4. FL 108 –
5. FL 112 -
6. FL 113 -
7. DT 146 –
8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)
9. DT 149 –
10. DT 150 –
11. DT 162 –
12. DT 163 –
13. DT 171 –

Saturday 28 June 2025:

1. FL 98 –
2. FL 99 –
3. FL 107 –
4. FL 108 –
5. FL 112 -
6. FL 113 -
7. DT 146 –
8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)
9. DT 149 –

- 10. DT 150 –
- 11. DT 162 – *Morning shift:* 3rd supplier breakdown, Strata. (1H07min)
- 12. DT 163 –
- 13. DT 171 –

Sunday 29 June 2025:

- 1. FL 98 –
- 2. FL 99 –
- 3. FL 107 –
- 4. FL 108 –
- 5. FL 112 –
- 6. FL 113 –
- 7. DT 146 –
- 8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)
- 9. DT 149 –
- 10. DT 150 –
- 11. DT 162 – *Afternoon shift:* 3rd supplier breakdown, Strata. (20H15min)
- 12. DT 163 –
- 13. DT 171 –

Monday 30 June 2025:

- 1. FL 98 –
- 2. FL 99 –
- 3. FL 107 –
- 4. FL 108 – *Night shift:* Electrical breakdown. No feedback. (14min)
- 5. FL 112 –
- 6. FL 113 – *Afternoon shift:* Electrical breakdown – No feedback. (20H18min)
Night shift: Mechanical breakdown - Standing for tyre bay. No feedback on what was done. (15H58min)
- 7. DT 146 –
- 8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)
- 9. DT 149 –
- 10. DT 150 –
- 11. DT 162 –
- 12. DT 163 –
- 13. DT 171 –

Tuesday 01 July 2025:

- 1. FL 98 –
- 2. FL 99 –
- 3. FL 107 –
- 4. FL 108 – *Afternoon shift:* Electrical breakdown. No data or feedback. (4H19min)
- 5. FL 112 –

6. FL 113 - *Night shift*: Mechanical breakdown - At boiler shop for half arrows. (13H47min)
7. DT 146 –
8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)
9. DT 149 – *Morning shift*: 3rd party supplier fault – Strata. (1H35min)
10. DT 150 –
11. DT 162 –
12. DT 163 –
13. DT 171 – *Afternoon shift*: At boiler shop. No feedback on what was done. (05H37min)

Wednesday 02 July 2025:

1. FL 98 –
2. FL 99 – *Morning shift*: Mechanical breakdown. No data or feedback. (01H35min)
3. FL 107 –
4. FL 108 – *Afternoon shift*: Electrical breakdown. No data or feedback. (01H20min)
5. FL 112 -
6. FL 113 -
7. DT 146 –
8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)
9. DT 149 – *Afternoon shift*: 3rd party supplier fault. Strata. (05H50min)
10. DT 150 –
11. DT 162 –
12. DT 163 –
13. DT 171 –

Thursday 03 July 2025:

1. FL 98 –
2. FL 99 –
3. FL 107 –
4. FL 108 –
5. FL 112 -
6. FL 113 - *Afternoon shift*: Mechanical breakdown. No feedback. (09H51min)
7. DT 146 –
8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)
9. DT 149 –
10. DT 150 –
11. DT 162 – *Morning shift*: Electrical breakdown - Articulation light not working. (20min)
12. DT 163 –
13. DT 171 – *Morning shift*: 3rd party supplier. Strata. (01H49min)

Friday 04 July 2025:

1. FL 98 –
2. FL 99 – *Afternoon shift:* 3rd party supplier fault. Strata. (55min)
Night shift: Electrical breakdown. No feedback. (3H12min)
3. FL 107 –
4. FL 108 – *Morning shift:* Mechanical breakdown. No feedback. (38min)
5. FL 112 –
6. FL 113 - *Afternoon shift:* Mechanical Breakdown. No feedback. (19H51min)
7. DT 146 –
8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)
9. DT 149 –
10. DT 150 – *Morning shift:* 3rd party supplier fault. Strata. (3H12min)
Afternoon shift: Electrical breakdown. No feedback. (1H30min)
11. DT 162 –
12. DT 163 –
13. DT 171 –

Saturday 05 July 2025:

1. FL 98 –
2. FL 99 –
3. FL 107 –
4. FL 108 – *Morning shift:* Electrical breakdown. No feedback. (05H36min)
5. FL 112 –
6. FL 113 –
7. DT 146 –
8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)
9. DT 149 –
10. DT 150 –
11. DT 162 –
12. DT 163 –
13. DT 171 –

Sunday 06 July 2025:

1. FL 98 –
2. FL 99 –
3. FL 107 –
4. FL 108 –
5. FL 112 –
6. FL 113 –
7. DT 146 –
8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)

9. DT 149 –
10. DT 150 –
11. DT 162 –
12. DT 163 –
13. DT 171 –

Monday 07 July 2025:

1. FL 98 –
2. FL 99 –
3. FL 107 –
4. FL 108 –
5. FL 112 –
6. FL 113 - *Afternoon shift:* Electrical breakdown. No feedback. (1H20min)
7. DT 146 –
8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)
9. DT 149 – *Night shift:* Electrical breakdown. No data or feedback. (01h42min)
10. DT 150 –
11. DT 162 – *Night shift:* 3rd party supplier fault. Strata. (2H16min)
12. DT 163 –
14. DT 171 –

Tuesday 08 July 2025:

1. FL 98 –
2. FL 99 – *Morning shift:* Mechanical breakdown. No data or feedback. (1H32min)
Afternoon shift: wrong booking. Serviced machine. (1D01H53min)
3. FL 107 –
4. FL 108 –
5. FL 112 –
6. FL 113 - *Afternoon shift:* Mechanical breakdown. At tyre bay. No feedback. (1H33min)
7. DT 146 – *Afternoon shift:* 3rd party supplier fault. Strata. (1D00H41min)
8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)
9. DT 149 – *Afternoon shift:* Electrical breakdown. No feedback. (5H)
10. DT 150 –
11. DT 162 – *Afternoon shift:* Electrical breakdown. Rear traction motor temp high. Used another temp sensor. (40min)
12. DT 163 –
13. DT 171 –

Wednesday 09 July 2025:

1. FL 98 –
2. FL 99 –
3. FL 107 –
4. FL 108 –
5. FL 112 - *Morning shift*: Mechanical breakdown - Bucket and steering movement issues as well as a warning siren that comes on sometimes. Waiting pump. Pump arrived 15/07/2025. (4D22H57min)
6. FL 113 -
7. DT 146 – *Afternoon shift*: Electrical breakdown - Reported with red stop lamp (fixed) reset RCS. (3H39min)
8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)
9. DT 149 – *Morning shift*: Electrical breakdown. No feedback. (27min)
Afternoon shift: Wrong booking, Battery swap. (53min)
10. DT 150 – *Afternoon shift*: DCDC Dilivering 26v causing the battery pack to cut off. (6H32min)
Afternoon shift: 3rd party supplier fault. Strata. (7H25min)
11. DT 162 – *Afternoon shift*: 3rd party supplier fault. Strata. (3H30min)
12. DT 163 –
13. DT 171 –

Thursday 10 July 2025:

1. FL 98 –
2. FL 99 –
3. FL 107 –
4. FL 108 –
5. FL 112 -
6. FL 113 -
7. DT 146 –
8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)
9. DT 149 –
10. DT 150 – *Night shift*: 3rd party supplier fault. Strata. (1H13min)
11. DT 162 –
12. DT 163 –
13. DT 171 –

Friday 11 July 2025:

1. FL 98 – *Night shift*: Electrical breakdown. No feedback. (14min)
2. FL 99 – *Morning shift*: Mechanical breakdown. At boiler shop for half arrows. (12H18min)
3. FL 107 –
4. FL 108 –
5. FL 112 -

6. FL 113 - *Afternoon shift*: Electrical breakdown. Standing with low clutch pressure and transmission, calibrated transmission. (2H29min)
Night shift: Mechanical breakdown – Repaired battery lockout switch. (55min)
7. DT 146 –
8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)
9. DT 149 – *Afternoon shift*: Electrical breakdown - standing with inverter U810 did current calibration and ID run machine fixed. (5H01min)
Afternoon shift: 3rd party supplier fault. Strata. (1H11min)
10. DT 150 – *Morning shift*: Operational delay – No fault. Light switch was not switched on. (1H23min)
Afternoon shift: Mechanical breakdown – Gears shifting to neutral. No feedback on what was fixed. (18H37min)
11. DT 162 – *Afternoon shift*: 3rd party supplier fault. Strata. (47min)
12. DT 163 –
13. DT 171 –

Saturday 12 July 2025:

1. FL 98 –
2. FL 99 –
3. FL 107 – *Morning shift*: Mechanical breakdown. At boiler shop for half arrows. (20H38min)
4. FL 108 –
5. FL 112 –
6. FL 113 - *Morning shift*: Electrical breakdown. No feedback. (3H29min)
7. DT 146 –
8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)
9. DT 149 –
10. DT 150 –
11. DT 162 –
12. DT 163 –
13. DT 171 –

Sunday 13 July 2025:

1. FL 98 –
2. FL 99 –
3. FL 107 –
4. FL 108 –
5. FL 112 –
6. FL 113 –
7. DT 146 –
8. DT 147 – Changed Pump drive, auxiliary motor. (121D3H32min)
9. DT 149 –
10. DT 150 – *Morning shift*: 3rd party supplier fault. Strata. (4H27min)
11. DT 162 – *Morning shift*: 3rd party supplier fault. Strata. (1H58min)
12. DT 163 –
13. DT 171 –

Planned work for the coming week:

- Battery pack reinforcements ongoing
- FL108 to return from side frame reinforcements.

SERVICES:

Battery and Charger Status Report

General summary

ST14 – B4 battery packs

- We currently have 8 x ST14 – B4 battery packs and 5 x ST14 machines operational underground. This is equal to the committed ratio of 1.6 batteries per machine.

MT42 – B5 battery packs

- We currently have 10 x MT42 – B5 battery packs operational underground. This is above the committed ratio of 1.6 batteries per machine.

160 kW Chargers

- Module 4 was found to be the fault on charger 7, charger module needs to be replaced.
- Charger 1 has a faulty fan that need to be replaced.

General

- Damage audits have been completed on battery packs, communication for repairs and battery upkeep was sent to BRMO with the respective quotations to ensure adequate battery upkeep. Meeting between Epiroc and Black Rock to take place to discuss general wear and tear vs damages.
- There are more noted charger stops; this is being investigated with initial indications being worn out charger and CCS battery inlet connectors.

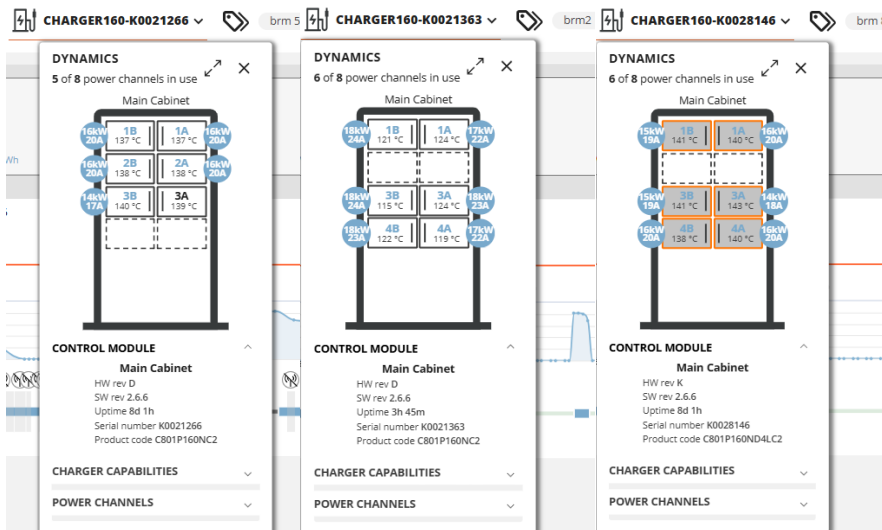


Figure 1: Chargers 2, 5 and 7 are missing 1 module each

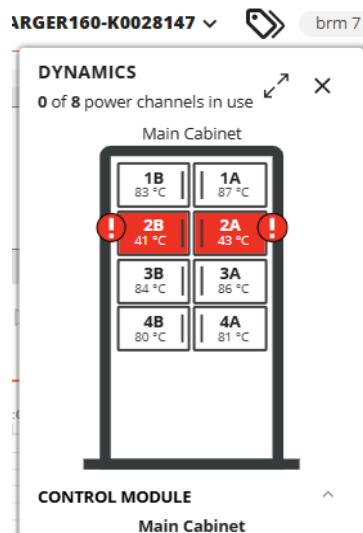


Figure 2: Chargers 1, 8 and 7 have faulty fans that need to be replaced

Table 1: Battery pack availability for week 10 2025

Battery Type	Battery ID	Status	Comment
B4 - ST14	VPY-00011	Working	
B4 - ST14	VPY-00031	Working	
B4 - ST14	VPY-00051	Working	
B4 - ST14	VPY-00048	Working	
B4 - ST14	VPY-00049	Working	
B4 - ST14	VPY-00088	Working	
B4 - ST14	VPY-00086	Working	
B4 - ST14	VPY-00076	Working	
B4 - ST14	VPY-00083	Working	
B4 - ST14	VPY-00041	Working	
B5 - MT42	VPX-00016	Working	
B5 - MT42	VPX-00006	Working	On DT147 with PDT
B5 - MT42	VPX-00023	Working	
B5 - MT42	VPX-00017	Working	
B5 - MT42	VPX-00010	Working	
B5 - MT42	VPX-00050	Working	
B5 - MT42	VPX-00031	Working	
B5 - MT42	VPX-00036	Working	
B5 - MT42	VPX-00028	Working	
B5 - MT42	VPX-00026	Working	
B5 - MT42	VPX-00024	Working	
B5 - MT42	VPX-00048	Working	
B5 - MT42	VPX-00044	Surface	On machine: 8997901500

FST Report Summary

Field Service on site:

- Need to send field service to FL119 on Gloria to inspect aircon issues.

CAS Report Summary

Report Type:

Weekly

Project Leader:

Hennie van Niekerk

Start Date: 09-Jun-2025
End Date: 13-Jun-2025

Report By: Bradley Nast
Contract No: BPE145D

Critical Issues

1. Request received to delay L9 switch-on and software standardization until BRMO financial year end conclusion.
2. Team will continue with software standardization in the interim.

Progress Update

1. All machine installations/up at NCH2 have been completed.
2. Team aims to upgrade software on various machines to ensure conformity etc, to be planned.
3. Status updates etc. to be distributed in due course.

CertiQ & Mobilaris Report Summary

General summary

NCH 2 and Gloria are in the project phase. Installations are complete and review and commissioning in progress. NCH3 is on a support contract.

NCH2:

From the 22 machines:

- 9 Machines, documentations have been sent for signatures,
- 5 machines are in order the project team is currently preparing the commissioning document,
- 8 machines are under investigation

Gloria:

From the 13 machines:

- 4 machines are commissioned
- 6 machines, commissioning documents are sent for signatures
- 1 Machine the engine hours are on the portal are not corresponding with the actual machine hours
- 2 machines are exempted from the project do to the ECU

NCH3:

1. Mobilaris

- a. Primary machines 52.
- b. Primary machines reporting on Mobilaris is 43
- c. Total compliance 82%

2. CertiQ

- a. Primary machines 52
- b. Primary machines with kits installed 38
- c. Total number of machines reporting 29
- d. Total compliance 76%

3. Issue log and resolutions

Issues	resolutions
DT0154 machine is online but no data	Change the machine name from the DT0154 to the serial number on the MCG
HD0050 & HD0051 CCI faulty	Raised ACIGN before requesting new part
HD0062, HD0054 & HD0055 incorrect RCS software on the machine.	Replace software with correct one
machine is healthy data on the HAPI but nothing on the portal	ACIGN raised.
HD0058, HD0058, RT0044 CAN Termination and Address Plug	Quotation submitted for order.