

Weekly Site Report

BLACK ROCK WEEKLY REPORT

Weekly PSD Report
EPIROC SA

Contents

Weekly Service Report – Black Rock Mine Operations	2
Report Summary	2
General Summary	2
BEV - Critical Breakdown Summary.....	2
CAS L9 Implementation - Critical Issues Summary	3
Certiq & Mobilaris - Critical Issues Summary	3
Passport 360 Compliance	3
BEV Report.....	3
Weekly machine utilization summary:	3
Planned work for the coming week:	6
Improvement and actions:.....	6
Services.....	6
Battery and Charger Status Report.....	7
General summary.....	7
Battery charger summary:.....	8
FST Report Summary	13
Field Service on site:	14
CAS Report Summary	14
Critical Issues	14
Progress Update	14

Weekly Service Report – Black Rock Mine Operations

Report type:	Weekly	Submitted to:	Sello Taku and Sipho
Week Date:	30 January 2026	End Date	05 February 2026
Reported By:	Philip Moller		
BEV:			
Service Tech:	Ivan Phiri	Service Tech:	Mathews Mosemane
Service Tech:	Patricia Bulelwa	Service Tech Assistant:	Patrick Yoko (Batteries)
Specialist:	Frikkie van der Walt (Batteries)		
Field Service:			
Service Tech:	Lucas Slaffa	Service Tech:	Phineas Sibanda
CAS Project:			
Team Leader:	Wisani Shilenge	Service Tech:	Phineas Sibanda
Service Tech:	Julius Manamela	Service Tech:	Joseph Mampa
Certiq Project:			
Team Leader:	Segunda Fernando	Service Tech:	
Mobilaris:			
Team Leader:	Rupert Grobler		

Report Summary

General Summary

The purpose of this report is to give an overview of all the Epiroc activities at Blackrock Mine Operations (BRMO).

BEV - Critical Breakdown Summary

- DT171 - A-frame that was previously damaged failed again. A-frame was not in a good state previously when repaired. Piet ordered a new A-frame. It will stand until new A-frame arrived. Lead

time is 60 days. We are expediting it to see if we can fly it in. My suggestion would be to remove A-frame and send to Epiroc for repairs. **(ongoing breakdown)**

•

CAS L9 Implementation - Critical Issues Summary

- Lab scale tests with new software currently underway.
- Invoicing and sign off to be completed.
- MH4.0 software to be loaded on the BEV machines. Currently busy with the lab scale tests and approval of the software.

CertiQ & Mobilaris - Critical Issues Summary

Passport 360 Compliance

- BEV Technicians: **96%**
- CASL9 (Gloria): **99%**
- CASL9 (Nch2): **95%**
- CAS L9 (Nch3): **98%**
- CertiQ & Mobilaris N2: **99%**
- CertiQ & Mobilaris Gloria: **88%**

BEV Report

Weekly machine utilization summary:

Friday 30 January 2026:

1. FL 98 -
2. FL 99 -
3. FL 107 -
4. FL 108 -
5. FL 112 -
6. FL 113 -
7. DT 146 -
8. DT 147 - Morning shift: Auto electrical breakdown – No feedback. (42min)
9. DT 149 – Morning shift: Electrical breakdown – Wipers. No feedback. (1H46min)
10. DT 150 -
11. DT 162 -
12. DT 163 -
13. DT 171 - Ongoing breakdown – A frame needs to be replaced

Saturday 31 January 2026:

14. FL 98 - Morning shift: Auto electrical breakdown – No feedback. (1H10min)

15. FL 99 - Morning shift: Mechanical breakdown – No feedback. (3H03min)
16. FL 107 -
17. FL 108 -
18. FL 112 -
19. FL 113 -
20. DT 146 -
21. DT 147 - Morning shift: Mechanical breakdown – No feedback. (2H08min)
22. DT 149 - Morning shift: Electrical breakdown – Replaced wiper blade. (58min)
23. DT 150 -
24. DT 162 - Morning shift: Mechanical breakdown – Replaced hydraulic hose. (2D10H26min)
25. DT 163 -
26. DT 171 - Ongoing breakdown – A frame needs to be replaced

Sunday 01 February 2026:

1. FL 98 - Morning shift: Electrical breakdown – No feedback. (4H03min)
2. FL 99 -
3. FL 107 -
4. FL 108 -
5. FL 112 - Morning shift: Mechanical breakdown – HVIL fault, Adjusted HVIL switch in HV box. (23H34min)
6. FL 113 -
7. DT 146 -
8. DT 147 -
9. DT 149 -
10. DT 150 -
11. DT 162 -
12. DT 163 -
13. DT 171 - Ongoing breakdown – A frame needs to be replaced

Monday 02 February 2026:

1. FL 98 - Morning Shift: Boilermaker breakdown – Half arrows. (1D09H43min)
2. FL 99 -
3. FL 107 -
4. FL 108 -
5. FL 112 -
6. FL 113 -
7. DT 146 -
8. DT 147 – Night shift: Mechanical breakdown – No feedback. (3H31min)
9. DT 149 – Morning shift: Mechanical breakdown – No feedback. (57min)
10. DT 150 -
11. DT 162 -
12. DT 163 -
13. DT 171 - Ongoing breakdown – A frame needs to be replaced

Tuesday 03 February 2026:

1. FL 98 -
2. FL 99 – Night shift: 3rd party supplier fault – Petroman. (2H14min)
3. FL 107 -
4. FL 108 -
5. FL 112 -
6. FL 113 -
7. DT 146 – Afternoon shift: Electrical breakdown – Isolation fault – Need to do proper fault finding on HVIL cables. (2H56min)
8. DT 147 –
9. DT 149 –
10. DT 150 – Morning shift: 3rd Party Supplier Fault – Strata. (3H54min)
11. DT 162 – Afternoon shift: Electrical breakdown – No feedback. (2H41min)
12. DT 163 -
13. DT 171 - Ongoing breakdown – A frame needs to be replaced

Wednesday 04 February 2026:

1. FL 98 -
2. FL 99 -
3. FL 107 -
4. FL 108 – Morning shift: 3rd Party Supplier Fault – Strata. (25min)
5. FL 112 - Morning shift: 3rd Party Supplier Fault – Strata. (30min)
6. FL 113 -
7. DT 146 -
8. DT 147 – Morning shift: Electrical breakdown – No feedback. (1H01min)
9. DT 149 – Morning shift: Auto electrical breakdown – Isolation fault on battery pack VPX-00036. (2H49min)
Morning shift: 3rd Party Supplier Fault – Strata. (02H19min)
Morning shift: Electrical breakdown – No feedback. (30min)
10. DT 150 – Morning shift: Auto electrical breakdown – No feedback. (37min)
Night shift: Electrical breakdown – No feedback. (8H05min)
11. DT 162 -
12. DT 163 -
13. DT 171 - Ongoing breakdown – A frame needs to be replaced

Thursday 05 February 2026:

1. FL 98 -
2. FL 99 -
3. FL 107 -
4. FL 108 -
5. FL 112 -
6. FL 113 – Night shift: Electrical breakdown – No feedback. (8H40min)
7. DT 146 -
8. DT 147 -
9. DT 149 – Morning shift: Electrical breakdown – No feedback. (20H28min)
10. DT 150 -

11. DT 162 -
12. DT 163 -
13. DT 171 - Ongoing breakdown – A frame needs to be replaced

Planned work for the coming week:

NCH2:

- Remove cab from new loader. Install dummy cab and take machine underground. Commission machine.
- Commission RT0061 (New close cab machine)

Gloria

- Safety systems audit to be done
- Audit of RT0045 and RT0046. Machines have low availability.

Improvement and actions:

1. We need to look at the data of the charger interrupts. Kishore to update data.
2. Post 3,6 and 7 cables replaced, Piet to put in an order for all other chargers.
3. Auxiliary motor spline grease TSNB not done. Only DT147 completed) We need to schedule the machines to complete this campaign. Grease already on site. This have been raised multiple times; I need BR to schedule the machines.
4. Regeneration knob set to 100% completed. Need to sign off change management and attendance register for operators and artisans underground.
5. Need to physically check status of chargers and compare to report.
6. VCA, VCB cables and discharge resistors identified machines to be replaced. Parts partially ordered. Followed up from buyers, some orders still in approval phase.
7. Audits to be done on all A frame retaining bolts of dump trucks.
8. Software TSNB on batteries to prevent all these lockout of sub packs.

Services

Nchwaning 3

Maintenance Schedule Feb 2026				
Friday	Monday	Tuesday	Wednesday	Thursday
6-Feb-26	9-Feb-26	10-Feb-26	11-Feb-26	12-Feb-26
DT0171	DT0162	DT0154	DT0160	DT0149
		FL0112	FL0121	
HD0051	HD0052	HD0055	HD0056	HD0057
RT0058	RT0025	RT0044	RT0047	RT0048
SR0038	SR0039	SR0043	SR0044	SR0024
	UV0126	UV0131	UV0134	UV0135
	UV0107	UV0112	UV0122	UV0132
LD0604	LD0606	LD0608	LD0609	LD0611
VPY-00041(BY0029)	VPX00016 (BY0008)	VPY00048 (BY0011)	VPX00017 (BY0005)	VPY00049 (BY0021)

Battery and Charger Status Report

General summary

ST14 – B4 battery packs

- We currently have 10 x ST14 – B4 battery packs and 6 x ST14 machines operational underground. This is equal to the committed ratio of 1.6 batteries per machine.

MT42 – B5 battery packs

- We currently have 12 x MT42 – B5 battery packs operational underground. This is above the committed ratio of 1.6 batteries per machine.

160 kW Chargers

- Post 7 CCS connector cables need to be replaced. New 300A cables was order and received. Parts arrived and must still to be installed.

General


- There are more noted charger stops; this is being investigated with initial indications being worn out charger and CCS battery inlet connectors. DCDC campaign completed.
- TSNB software V6.3 to be installed on batteries. (level 3 safe state)
- Fleet number stickers ordered for batteries for better identification.

Table 1: Battery pack availability for week 2025

Battery Type	Battery ID	Status	Comment
B4 - ST14	VPY-00011	Working	
B4 - ST14	VPY-00031	Working	TMS fans short circuit – Changed 2 coolant hoses. (6Days)
B4 - ST14	VPY-00051	Working	Replaced TMS (6 Days)
B4 - ST14	VPY-00048	Working	
B4 - ST14	VPY-00049	Working	
B4 - ST14	VPY-00088	Breakdown	VPC #2 level 3 safe state. (14Days)
B4 - ST14	VPY-00086	Working	
B4 - ST14	VPY-00076	Working	
B4 - ST14	VPY-00083	Working	
B4 - ST14	VPY-00041	Working	
B5 - MT42	VPX-00016	Working	
B5 - MT42	VPX-00015	Working	Swapped TMS – Both water pumps failed. (3 Days)
B5 - MT42	VPX-00023	Working	
B5 - MT42	VPX-00017	Breakdown	VPC#1, #4 and #5 safe state (12Days)
B5 - MT42	VPX-00010	Working	Re-load software (2 Hours)
B5 - MT42	VPX-00050	Working	
B5 - MT42	VPX-00031	Working	
B5 - MT42	VPX-00036	Working	Repaired coolant leak and re-pressurized the system. (3H)
B5 - MT42	VPX-00028	Breakdown	Replaced sub pack. Busy changing water pumps and loading software. (4Days)
B5 - MT42	VPX-00026	Working	
B5 - MT42	VPX-00024	Working	
B5 - MT42	VPX-00048	Working	
B5 - MT42	VPX-00044	Surface	On machine: 8997901500


Battery charger summary:

Charger (BRM 1)

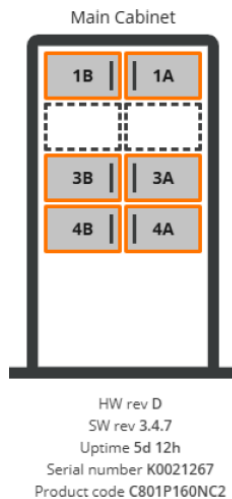


- Charger status has not changed since the last report in December 2025
- Charger still missing 2X power modules
- Charging power still reduced
- Modules still need to be replaced
- Charger currently running with no faults
- When Charger modules are highlighted orange, Means charger is currently charging
- Charger currently on new SW V3.4.7

Charger (BRM 2)

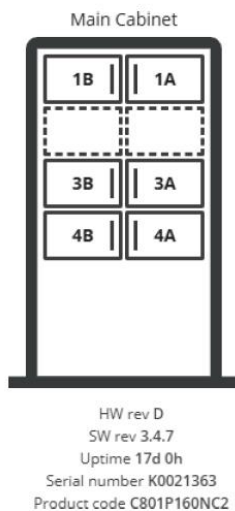


- Charger status has not changed since the last report in December 2025
- Charger still missing 2X power modules
- Charging power still reduced
- Modules still need to be replaced
- Charger currently running with no faults
- Charger currently on new SW V3.4.7

Charger (BRM 3)

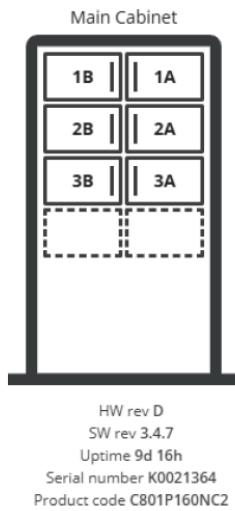


- Charger status has not changed since the last report in December 2025
- Charger still missing 2X power modules
- Charging power still reduced
- Modules still need to be replaced
- Charger currently running with no faults
- Charger currently on new SW V3.4.7

Charger (BRM 4)

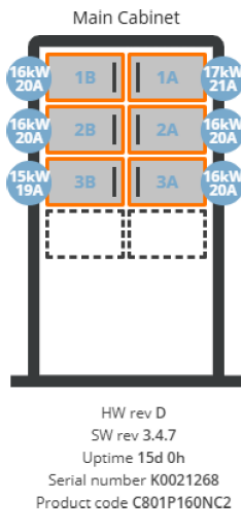

- Charger status has not changed since the last report in December 2025
- Charger still missing 2X power modules
- Charging power still reduced
- Modules still need to be replaced
- Charger currently running with no faults
- When Charger modules are highlighted orange, Means charger is currently charging
- Charger currently on new SW V3.4.7

Charger (BRM 5)

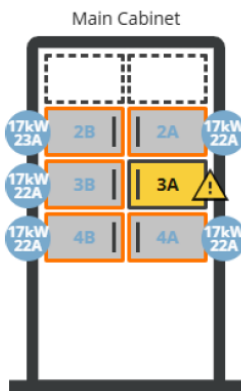

HW rev D
SW rev 3.4.7
Uptime 2h 59m
Serial number K0021266
Product code C801P160NC2

ERRORS

POWER MODULE FAULT
MC 3A

- FAN_CURRENT
MC 3A
- RT_CONNECTOR_PMC_ERROR
MC 3A
- SSC_PMC_FAN_CURRENT
MC 3A

POWER MODULE FAULT

PMC 3A on Main cabinet: SSC_PMC_FAN_CURRENT

Remote investigation required

POTENTIAL IMPACT
No information

STEPS TO FIX
No information


DETAILS

Error code	CE_PMC_ERROR	Copy
Vendor	Kempower	
Occurred	17.11.2025 13:32 (UTC+2)	
Cause	No information	
Documentation	No information	

- Charger status has not changed since the last report in December 2025
- Charger still missing 2X power modules
- Charging power still reduced
- Charger still currently running with a defective fan on the power module highlighted yellow, Charger fan needs to be replaced.
- Charger on new SW V3.4.7

All rights reserved by Epiroc. 7


Charger (BRM 6)

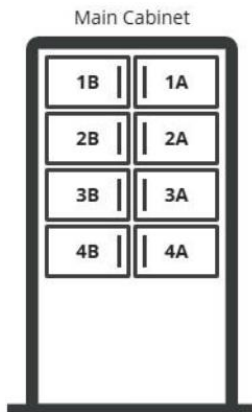

HW rev D
SW rev 3.4.7
Uptime 1h 5m
Serial number K0021365
Product code C801P160NC2


- Charger currently offline, online Audit not possible for now.
- Charger currently on new SW V3.4.7

Charger (BRM 7)

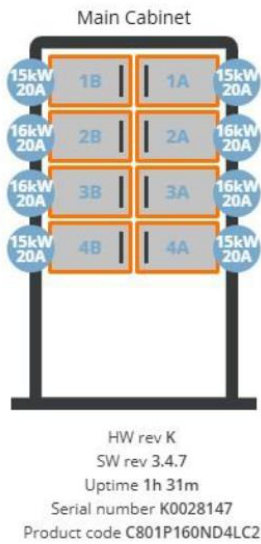


- Charger currently running with no faults
- Charger currently on new SW V3.4.7

Charger (BRM 8)

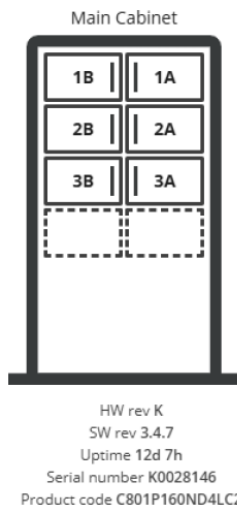

- Charger status has not changed since the last report in December 2025
- Charger still missing 2X power modules
- Charging power still reduced
- Modules still need to be replaced
- Charger currently running with no faults
- Charger currently on new SW V3.4.7

Charger (BRM 9)

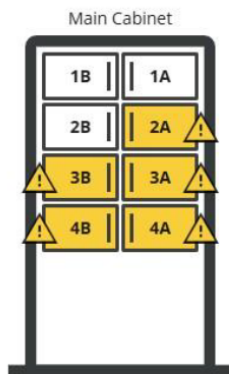

HW rev L
SW rev 3.4.7
Uptime 17h 49m
Serial number K0032320
Product code
C801MVP160ND4LC2

ALERT DETAILS

ERRORS

- POWER MODULE FAULT
MC 2A, 3A, 3B, 4A, 4B
- SSC_PMC_ENABLE_LINE_ERROR
MC 2A, 3A, 3B, 4A, 4B

SSC_PMC_ENABLE_LINE_ERROR

22.12.2025 14:30 (UTC+2)

Power Module channel (PMC) could not validate the enable line signal during system self-check.
Remote investigation required

POTENTIAL IMPACT

Charging power unit's total output reduced by 25 kW.

STEPS TO FIX

N/A


DETAILS

Error code	SSC_PMC_ENABLE_LINE_ERROR	Copy
Vendor	Kempower	
Occurred	22.12.2025 14:30 (UTC+2)	
Cause	Dynamic charging power units: If this error appears with other error codes, prioritize this one. The enable line circuit between the dynamic power distribution module (DPM) and Power Module is open or always in enabled state. Power Module cannot receive the 24 V signal.	

- Charger with multiple power module failure or module switched off
- Charger output reduced by 75KW
- Power module needs to be replaced if defective, Charger needs to be reset and investigated on site
- Charger on new SW version V3.4.7

All rights reserved by Epiroc. 11

Charger (BRM 10)

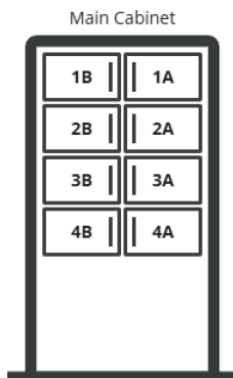

HW rev L
SW rev 2.4.20
Uptime 9m
Serial number K0032321
Product code
C801MVP160ND4LC2

- Charger still not connected to the Grid and offline
- Charger still on old software and needs to be upgraded to SW V3.4.7

All rights reserved by Epiroc. 12

Field Service on site:

CAS Report Summary

Report Type:	Weekly	Project Leader:	Hennie van Niekerk
Start Date:		Report By:	
End Date:		Contract No:	BPE145D

Critical Issues

Progress Update