

Check the shaft brake switch and circuit connection

Does this solve the problem?


1] Yes


2] No


3] I don't know

- **Explanation**

Check the Cable termination tightness and re-tighten, if found loose connection;

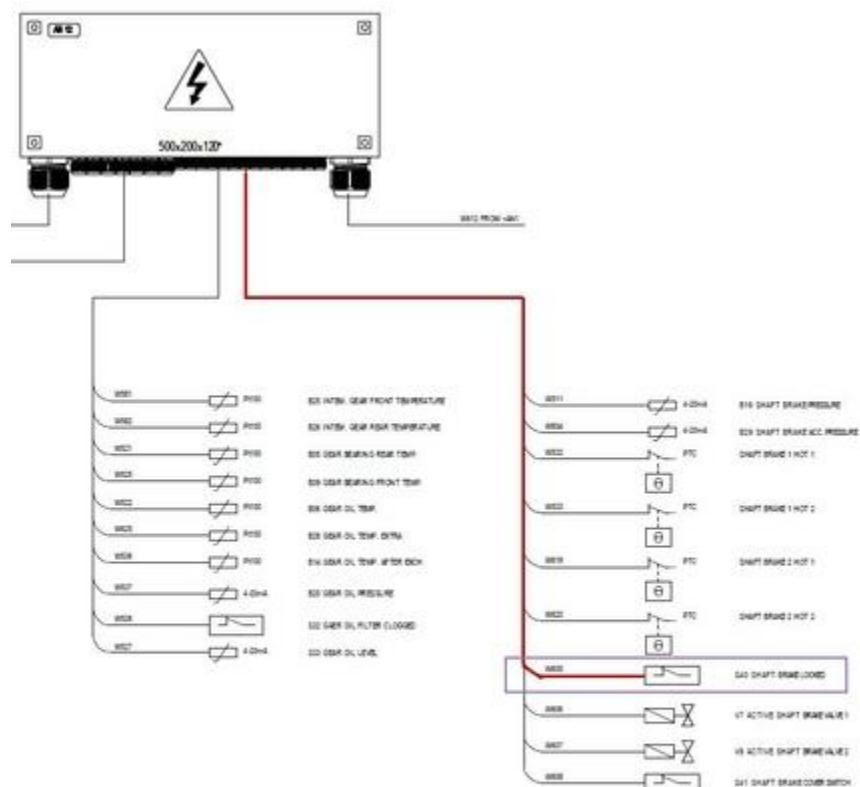

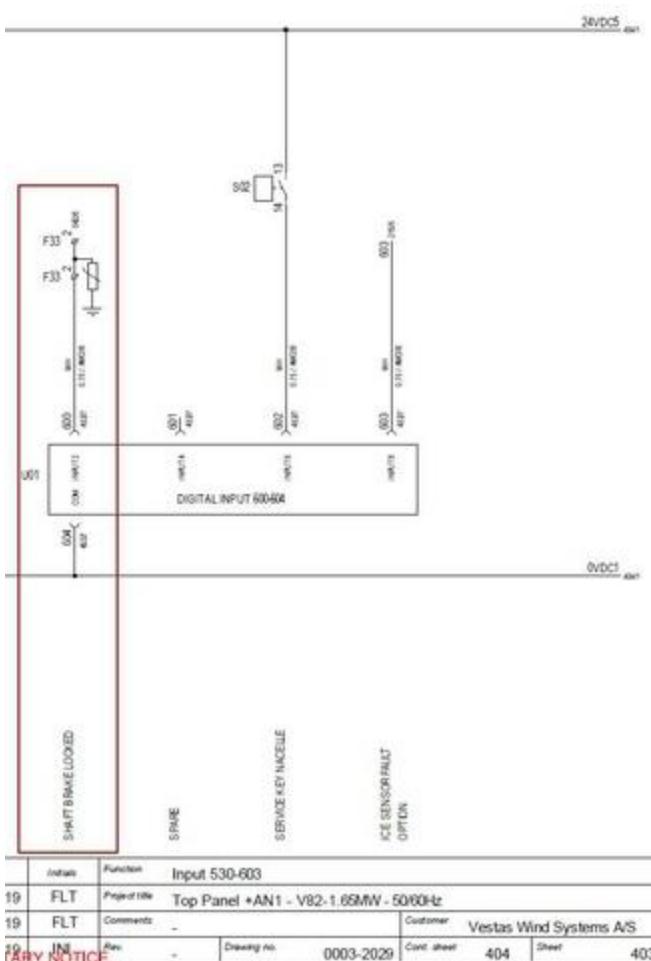

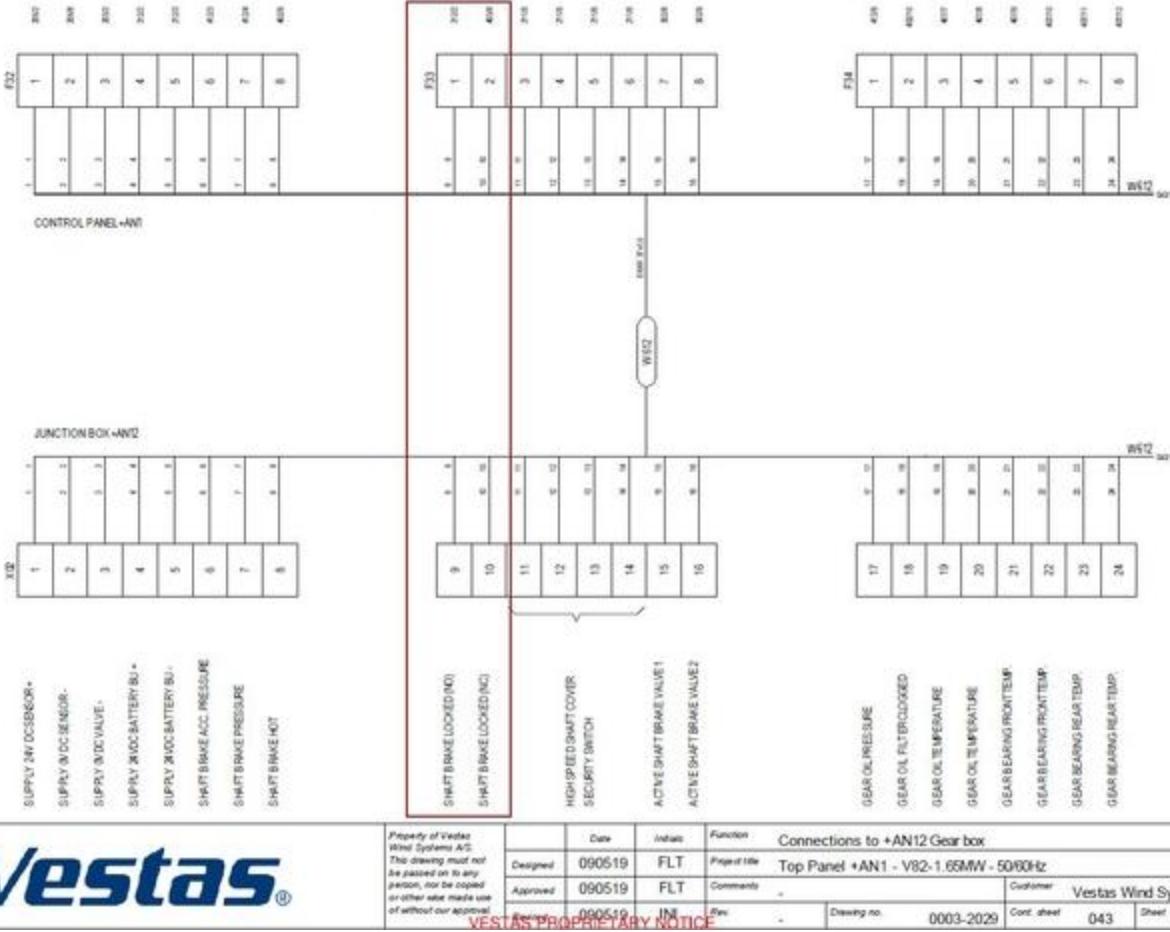

Vestas®

	Date	Initials	Function	Connections to +AN12 Gear box	
Designed	090519	FLT	Project title	Top Panel +AN1 - V82-1.65MW - 50/60Hz	
Approved	090519	FLT	Comments		
	090519	INN	Rev	Drawing no.	Customer

VESTAS PROPRIETARY NOTICE: This drawing must not be passed on to any person, nor be copied or other wise made use of without our express written consent.

Check and Replace the switch

Does this solve the problem?

1] Yes

2] No

3] I don't know

Explanation

Check the Operation of S40 Switch and replace, if not operating as intended.

Activate the spring mechanism and check the continuity between 13 -14 and 21-22



Relevant spare parts	
Description	Item No.
ENDSTOP SWITCH 6021194379 GC-S	60103640