



Change the PT100 if sensor is defect

Does this solve the problem?


- 1] Yes
- 2] No
- 3] I don't know

● [Explanation](#)

Change the PT100 if defect.

Sparepart No.: 60009279

Connection see document no.: [0000-1638](#) page 408

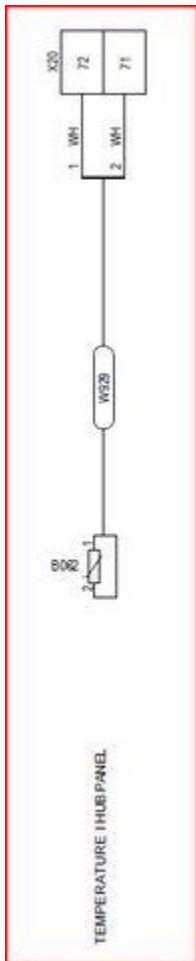


Change the PT100 if cable on sensor is broken

Does this solve the problem?

- 1] Yes
- 2] No
- 3] I don't know

● [Explanation](#)

Broken wire from PT100
Change the PT100 if defect.
Sparepart No.: 60009279
Connection see document no.: [0000-1638](#) page 408

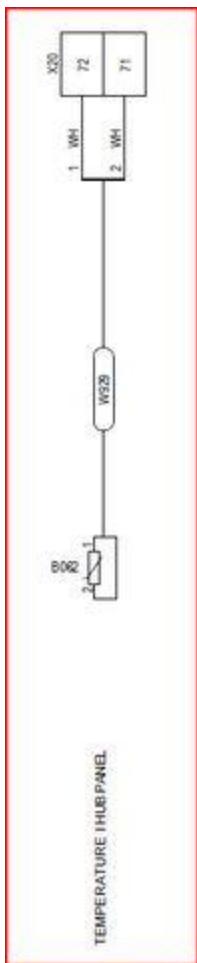

878 - PT100 fault hub panel - NM72,NM82,V82 Mk1-5



Change the Hub Computer

Does this solve the problem?

- 1] Yes
- 2] No
- 3] I don't know

● [Explanation](#)

In the temperature panel, check *temperature of hub panel*: If value is unreal, we could assume that something is failing with the PT100.

Compare the temperature with the Pitch Oil Temp. If value is unreal too, we could assume that something is wrong with the hub computer.

Change the Hub Computer and adjust/calibrate the blade postions.

Sparepart No.: 51701801REN

