Service Bulletin

Bulletin No.: 19-NA-037
Date: March, 2019

TECHNICAL

Subject: No Start, Hard Start with Belt Squeal, Belt Break, Loss of Power Steering and/or Power Brake Assist


Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Express	2018	2019			4.3L - LV1	All
GMC	Savana	2018	2019				

Involved Region or Country	North America, N.A. Export Regions
Additional Options (RPOs)	
Condition	Some customers may comment on one or more of the following: • Vehicle will not start. • Vehicle hard to start, with a squeal noise originating from the engine compartment. • Vehicles fan belt broken. • Loss of power steering • Loss of vehicles power brake assist.
Cause	The cause of the condition may be water leaking from the cowl area into the generator vents. Under certain weather conditions, this water can freeze inside and prevent the generator from turning.


Copyright 2019 General Motors LLC. All Rights Reserved.

Correction

- Replace generator, belt, and any other pulleys that have been contaminated with rubber build up from the belt heating up. Refer to the appropriate repair procedure in SI.

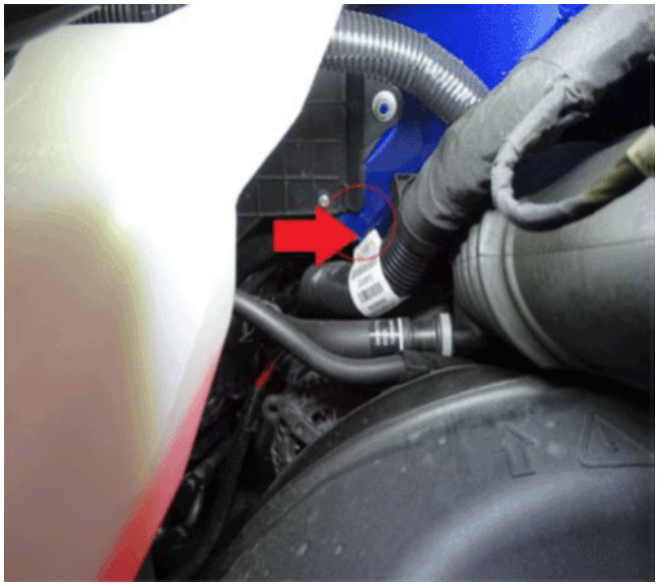

5246048

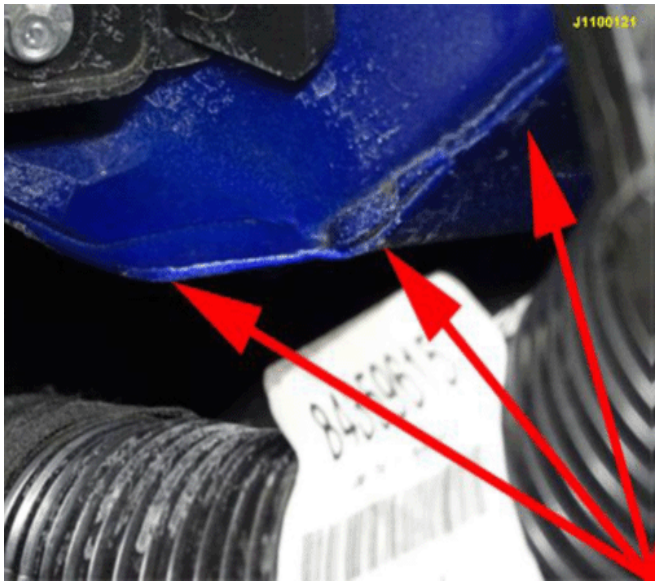


5246049

Note: The common location of the water leak path is shown in the graphics above.

- Seal water leak at cowl with Kent Automotive High-Tech™ Clear Seam Sealer, following the steps in the Service Procedure below.

Service Procedure

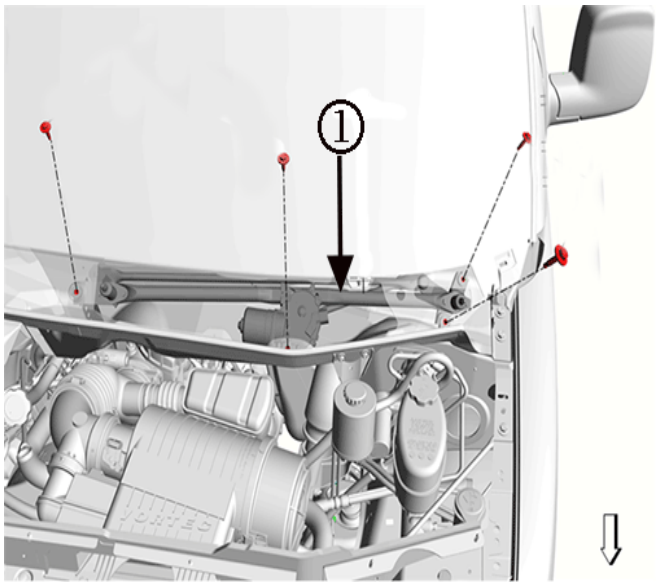

5246053

1. Remove the air inlet grille panels and the windshield wiper system module (1). Refer to *Windshield Wiper System Module Replacement,* in SI.



5246055

2. Note the location of the inner lower right side seam circled in the graphic above.



5246057

Important: Be sure to apply the sealer to the entire inner lower right side seam.

3. Apply Kent Automotive High-Tech™ Clear Seam Sealer, # P10200, to the seam.
4. Reinstall the windshield wiper system module (1) and the air inlet grille panels. Refer to *Windshield Wiper System Module Replacement,* in SI.

Parts Information

For replacement of generator, belt or pulleys, use the vehicle identification number (VIN), and the GM Electronic Parts Catalogue to determine the proper part to order.

To obtain the High-Tech™ Clear Seam Sealer, contact Kent Automotive at 1-888-YES-KENT (1-888-937-5368).

Causal Part	Description	Part Number	Qty
N/A*	Kent Automotive High-Tech™ Clear Seam Sealer*	P10200 (5 oz)	As needed
* For warranty transactions, DO NOT mark this/these parts as the Causal Part. Enter the word “Bulletin” in the Causal Part Description free-flow text field			

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
1481178*	Wiper System Module R & R and Cowl Reseal	0.8 hr
* This is a unique Labor Operation for Bulletin use only. For consequential damage, use the labor operation associated with this bulletin. All parts and labor associated should be claimed on the same transaction, using OLH as necessary to cover the labor for repair/replacement of the subsequently damaged part(s). Refer to bulletin 18-NA-146 for additional information.		

Version	1
Modified	Released February 26, 2019

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION