

The 1e mount is a 2.5" HDD + 2.5" HDD Adapter



There are 2 positions for the drive, on each side of the board.



Fix the drive with 4 Philips Bolt Washer Head screws M3x6

The 2e mount is a 2.5" HDD + GC100



Drill hole 3mm >

Connector hole >



^ replace the connector ^

There are 2 positions for the drive, on each side of the board.



Fix the drive with 4 Philips Bolt Washer Head screws M3x6
 Fix the GC100 with 2 Philips Bolt Washer Head screws M2.5x10 + M2.5 nut,
 use piece GRP board or M2.5 nut's as spacer under the board.

The 3e mount is a SD35VC0




Remove connector >

Cut pins 1mm >



There are 2 positions for the SD35VC0, on each side of the board.

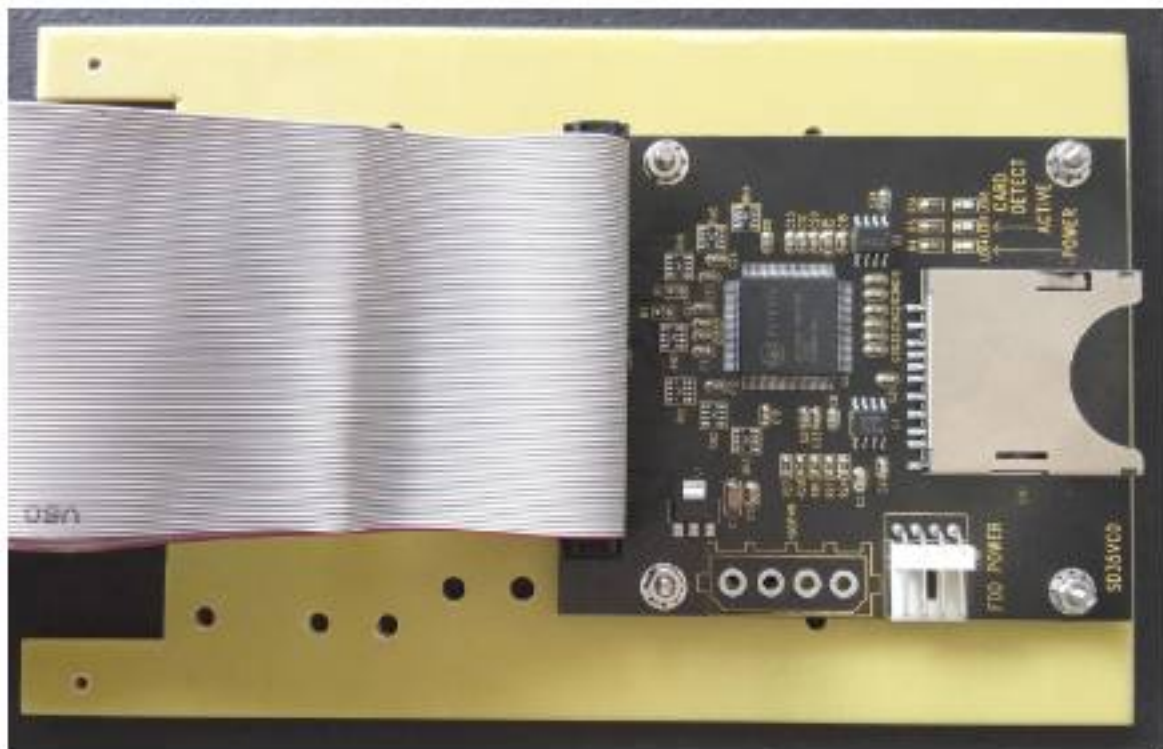

Fix the SD35VC0 with 4 Philips Bolt Washer Head screws M2.5x10 + M2.5 nut, use 1.4mm fiber rings as spacer under the board.

The 4e mount is a TF35VA0




Remove connector >

Cut pins 1mm >



There is 1 position for the TF35VA0, on each side of the board.

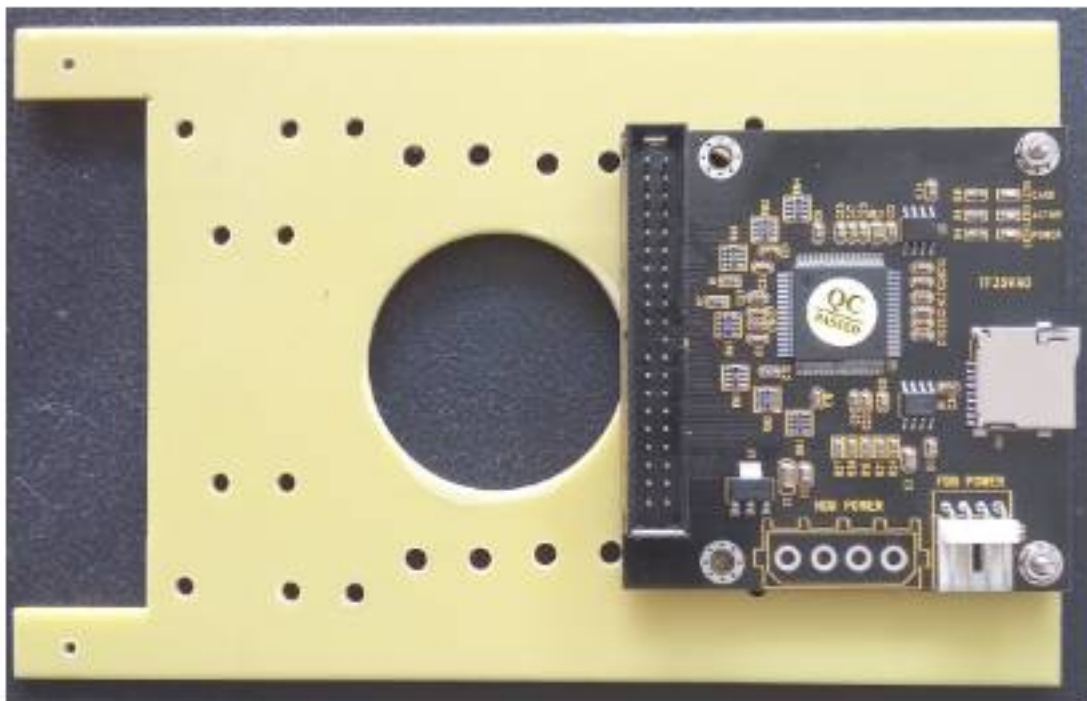


Fix the TF35VA0 with 2 Philips Bolt Washer Head screws M2.5x10 + M2.5 nut, use 1.4mm fiber rings or M2.5 nut's as spacer under the board.

The 5e mount is a ST307



ST307 can be on each side of the board.

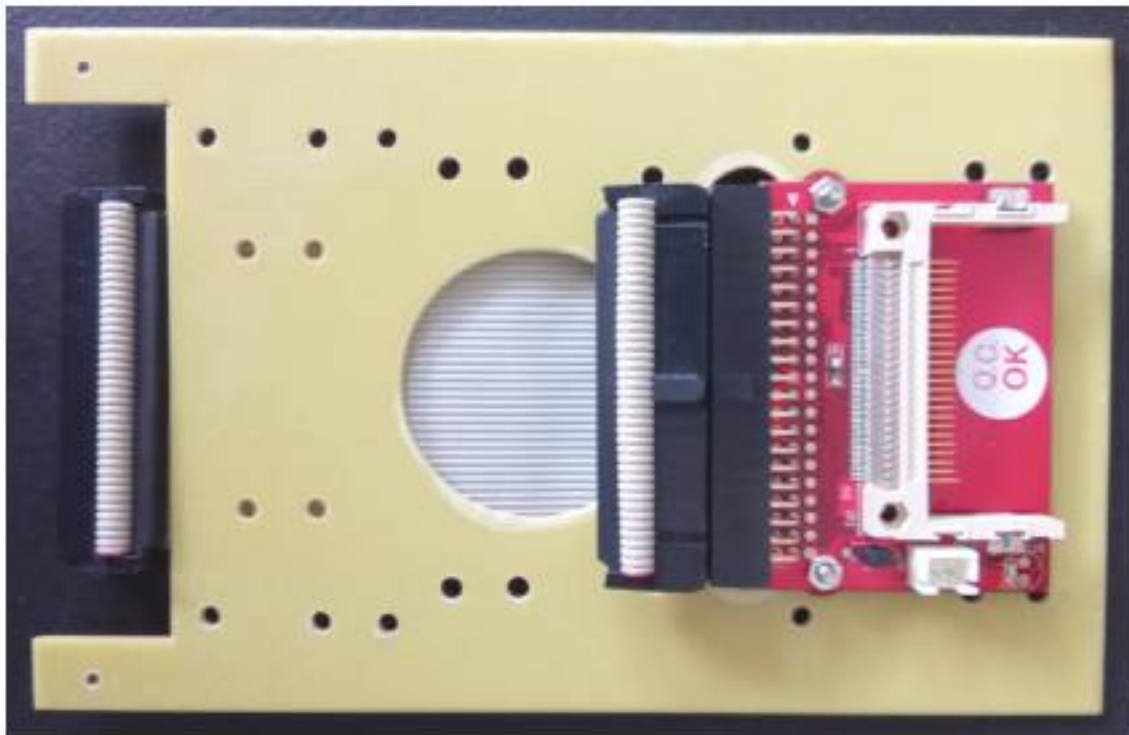


Fix the ST307 with 2 Philips Bolt Washer Head screws M2.5x10 + M2.5 nut, use 1.4mm fiber rings or M2.5 nut's as spacer under the board.

The 6e mount is a CF-IDE44.V.H0



CF-IDE44.V.H0 can be on each side of the board

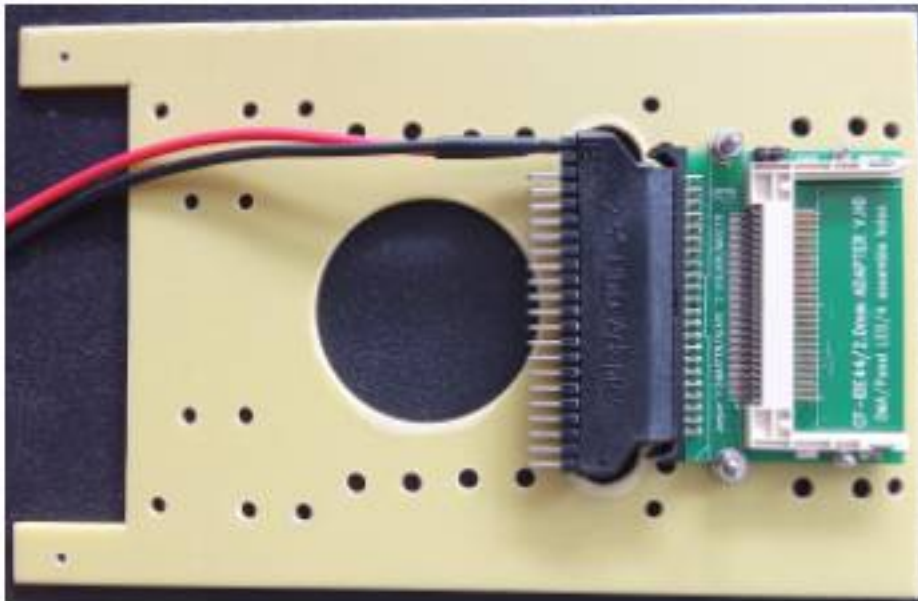

Fix the CF-IDE44.V.H0 with


- ^ 2x M1.6x10
- | 2mm spacer
- | 2x M1.6 nut
- ^ 2x M2.5x10 + M2.5 flat washer
- 2mm spacer
- 2x M2.5 nut

For the M1.6 you can use M2.0x10 and M2*3*3.5 Brass heat insert nut.

The 7e mount is a CF-IDE40.V.E0



CF-IDE40.V.E0 can be on each side of the board

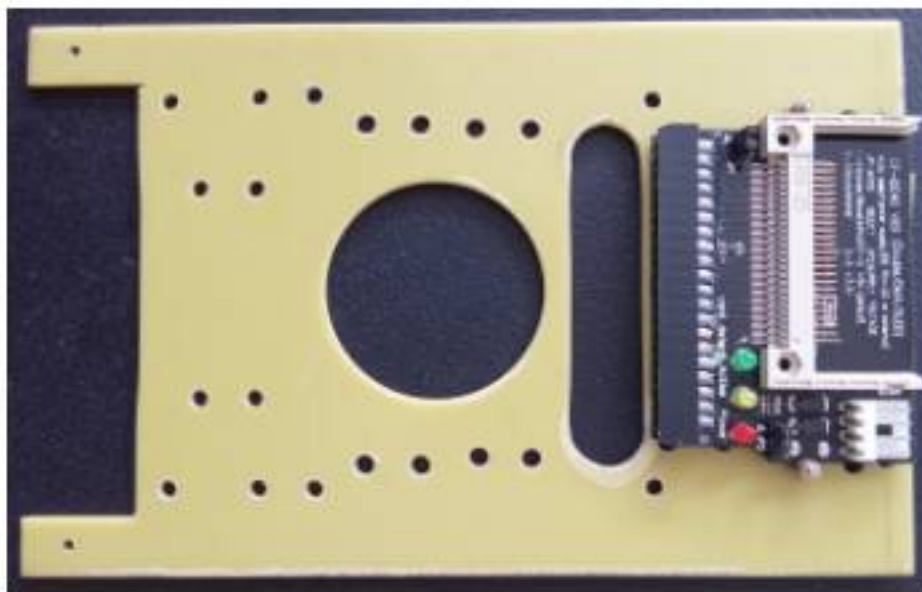

Fix the CF-IDE40.V.E0 with

- 2x M2.0x10 + M2 flat washer
- 2x M2.0 nut
- 4mm spacer
- 2x M2*3*3.5 Brass heat insert nut.