HOME INSPECTION REPORT

Anonymized example for educational use

Property address, client/inspector identifiers, identifying photographs, and personal details have been removed for public sharing.

Table of Contents

General 3

Exterior 4

Garage 9

Roofing 10

Structure 15

Electrical 19

Heating 22

Cooling 23

Plumbing 28

Appliances 32

Interior 33

Report Summary 36

General

A home inspection is primarily visible and done in a limited time. Not every defect will be discovered. For further clarification of the components, procedures and limitations of the home inspection consult the Standard of Practice the inspection was performed under.

Occupied

Yes

Furnished

Yes

Weather

Sunny

Temperature

55°

Soil Condition

Wet

Door Faces

North

People Present

Client

Exterior

The visible condition of exterior coverings, trim, entrances and drainage are inspected with respect to their effect on the condition of the building.

Exterior Covering

Vinyl

Exterior Trim Material

Aluminum

Walking Surface Types

Walks, Stoops, Steps

Walking Surface Materials

Concrete, Brick

Chimney Type

Not Present

Exterior Comments

Comment 1
Deficiency

Driveway has a sunken area at the connection point for the addition. This is a safety concern. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.

Comment 2
Deficiency

Side door entering the east side of the garage shows signs of deferred maintenance. Lower left side of jam has damaged/missing wood and also areas of missing paint is visible. This greatly reduces the life expectancy of the door. Also, provides direct access for unwanted pests to enter the area. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.





Comment 3
Deficiency

Cracking is present in the brick veneer skirt located on the back south east corner of the residence. Unable to determine the cause of cracking at this level of inspection. Some cracking is visible from the crawl space. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.









Comment 4
Deficiency

Top section of vinyl siding located on the back south east corner of the residence is improperly attached. This can allow water to enter the wall area. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.






Comment 5
Deficiency

Several sections of vinyl siding are loose/ improperly installed, located on the back south corner of the residence. Also a section of vinyl siding in that area has several cracks present. This provides a wind catch and also a point for water to enter the area. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.















Comment 6
Deficiency

Condensation drain line located on the back south side of the residence has an excessively long drain pipe attached. This drain line is exiting uphill. This makes it impossible for the device to drain properly. Recommend further inspection, evaluation, and repairs be completed by a licensed HVAC contractor.





Garage

Outbuildings and detached garages are not defined in the Standards of Practice. This is only a cursory check of the listed elements. Electrical, plumbing and HVAC comments are recorded in their respective sections of the report.

Garage Type

Attached

Vehicle Door Type

Overhead

Mechanical Opener

Yes

Plumbing Present

Yes

HVAC Present

Yes

The visible condition of the roof covering, flashings, skylights, chimneys and roof penetrations are inspected. The purpose of the inspection is to determine general condition, NOT to determine life expectancy.

Inspection Method

Walked

Roofing Material

Architectural shingles

Ventilation Present

Roof, Soffit

Gutter Material

Metal

Roofing Comments

Comment 7
Deficiency

No kick out flashing is installed on the lower front roof section and the back side of the garage roof. This can provide water direct access into the wall area. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.






Comment 8
Deficiency

Large amount of granular covering are missing from the roof shingles. This granular covering is the protection for the inner fiberglass membrane of the shingle. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.

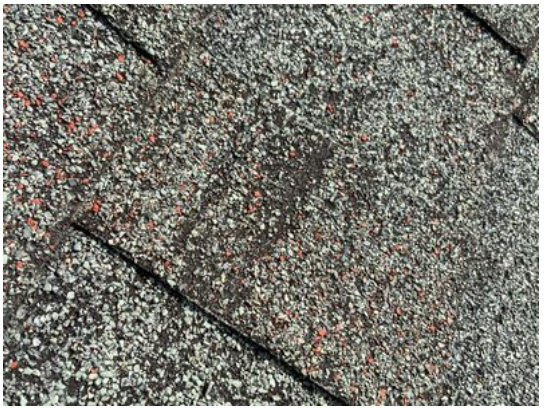

Comment 9
Deficiency

Both plumbing vent flange and all attic box vents have exposed fasteners and several are damaged. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.














Comment 10
Deficiency

Both final ridge caps have exposed fasteners. Also, several ridge caps have damaged areas present. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.







Comment 11
Deficiency

Front lower section of the residence roof gutter material has large amounts of fungal growth present. This prevents the gutter from draining properly and can cause water to back up into the roof system. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.





The visible condition of the structural components is inspected. The determination of adequacy of structural components is beyond the scope of a home inspection.

Foundation Types

Crawl

Foundation Materials

Concrete, Block, Brick

Floor Structure

Wood Framed

Wall Structure

Wood Framed

Attic

Ceiling Structure

Wood Framed

Roof Structure

Wood Framed

Inspection Method

Inside

Attic Insulation

Loose Fill

Crawl Space

Vapor Retarder

Installed

Inspection Method

Inside

Underfloor Insulation

Batts

Crawl Space Comments

Comment 12
Deficiency

Moisture content of the subfloor is high. This greatly affects the life expectancy of the subfloor system. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.

Comment 13
Deficiency

A mildew/fungal type growth is visible in some areas on the subfloor system. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.






Comment 14
Deficiency

Many sections of insulation are out of place in the subfloor area. This greatly affects the insulation integrity of the subfloor. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.











Comment 15
Deficiency

Vapor barrier does not cover 100% of the crawlspace floor. This can allow moisture to enter the subfloor area. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.



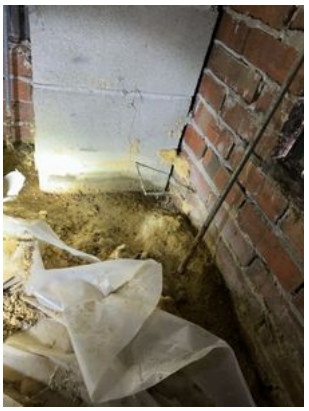






Electrical

The inspector can not inspect hidden wiring or verify if the number of outlets is per the National Electric Code. A representative number of outlets, switches and fixtures are tested for operation.

Type of Service

Underground

Service Panel Location

Interior

Service Voltage

240 volts

Service Amperage

200 amps

Over Current Devices

Breakers

Main Disconnect Location

Service Panel

Subpanel Locations

Not Present

Wiring Method

Conventional Copper

Smoke Detectors Present

Yes

Electrical Comments

Comment 16
Deficiency

Residence has a tankless water heater install. This is located on the back north east corner of the residence. However, a drop cord is providing power to the unit. This drop cord is not rated for exterior weather exposure. Recommend further inspection, evaluation, and repairs be completed by a licensed electrical contractor.





Comment 17
Deficiency

Circuit breaker 17 labeled nook is a AFCI type breaker. This breaker does not test by normal means. This is a safety hazard. Recommend further inspection, evaluation, and repairs be completed by a licensed electrical contractor.







Comment 18
Deficiency

Three receptacles located in the dinning room area indicate open “Hot”. This is a faulty indication. Recommend further inspection, evaluation, and repairs be completed by a licensed electrical contractor.







Comment 19
Deficiency

Hall bathroom vent fan does not operate by normal means. Recommend further inspection, evaluation, and repairs to be completed by a licensed electrical contractor.



Heating

The heating system is inspected visually and operated by normal controls to determine general condition NOT life expectancy. The capacity or adequacy of the heating system is beyond the scope of a home inspection. A licensed HVAC contractor should be consulted if in question.

Energy Source

Electric

Type of Equipment

Heat Pump

Type of Distribution

Flexible Ducting

Cooling

The cooling system is inspected by operation of the equipment by normal controls to determine general condition NOT life expectancy. The capacity or adequacy of cooling system is beyond the scope of a home inspection. A licensed HVAC contractor should be consulted if in question.

Energy Source

Electric

Type of Equipment

Split System

Type of Distribution

Flexible Ducting

Cooling Comments

Comment 20
Information

HVAC compressor manufacturers date is January 2008



Comment 21
Deficiency

HVAC compressor located on the west side of the residence has a large rosebush growing directly beside it. This can greatly affect the operating efficiency of the unit. Recommend further inspection, evaluation, and repairs be completed by a licensed HVAC technician.



Comment 22
Deficiency

HVAC compressor located on the west side of the residence has a large amount of grass and debris blocking the cooling coils. This can greatly affect the operating efficiency of the unit and reduce life expectancy. Recommend further inspection, evaluation, and repairs be completed by a licensed HVAC technician.









Comment 23
Information

Mitsubishi Minisplit located on the east side of the residence manufacturers date, March 2013



Comment 24
Deficiency

Mitsubishi Minisplit located on the east side of the residence, has large foliage growing in direct contact with the unit. This greatly affects the operating efficiency of the system and makes it difficult to inspect. Recommend further inspection, evaluation, and repairs be completed by a licensed HVAC technician.







Comment 25
Deficiency

Unable to operate the Minisplit system located in the finished room above the garage by normal means.Recommend further inspection, evaluation, and repairs be completed by a licensed HVAC technician.





Comment 26
Information

HVAC air handler located in the residence attic manufacturers date July 2011





Comment 27
Deficiency

HVAC air handler overflow catch pan located below the air handler in the attic area is severely corroded. This catch pan is the last line of defense. Should the air handler start to leak. Recommend further inspection, evaluation, and repairs be completed by a licensed HVAC tech technician.





Plumbing

The plumbing system is inspected visually and by operating a representative number of fixtures. Private water and waste systems are beyond the scope of a home inspection.

Waste Pipe Material

Plastic

Supply Pipe Material

Plastic

Location of Water Shutoff

At Meter

Location of Fuel Shutoff

At the tank

Water Heater Fuel

Gas

Water Heater Capacity

Tankless

Plumbing Comments

Comment 28
Deficiency

Resident water heater located on the back north east side of the residence has an improper fastener securing the access door to the unit. Also, the door does not seal properly. Recommend further inspection, evaluation, and repair repairs be completed by a licensed plumbing contractor.







Comment 29
Deficiency

Unable to access the service area for the water heater located on the back south west corner of the residence due to material being installed in that area. This material appears to have melted together. Recommend further inspection, evaluation, and repairs be completed by a licensed plumbing contractor.





Comment 30
Information

Tankless water heater located on the back south west corner of the residence manufacturers date, 2007





Comment 31
Deficiency

Frostproof faucet located on the back south side of the residence has a garden hose that is corroded in place. Recommend further inspection, evaluation, and repairs be completed by a licensed plumbing contractor.





Comment 32
Deficiency

Left kitchen sink drain trap assembly shows signs of leaking. Unable to determine if a leak is present at this time. Recommend further inspection and repairs be completed by a licensed plumbing contractor.








Comment 33
Deficiency

Primary bedroom, en suite left vanity sink drain stopper does not operate by normal means. This prevents the owner from being able to hold water in the sink area. Recommend further inspection, evaluation, and repairs be completed by a licensed plumbing contractor.

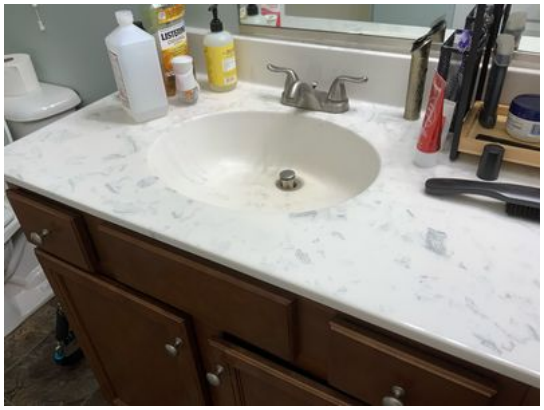



Comment 34
Deficiency

Primary bedroom en suite tub/shower drain assembly missing stopper. This prevents the homeowner from being able to hold water in the tub assembly. Recommend further inspection, evaluation, and repairs be completed by a licensed plumbing contractor.







Appliances

This is a cursory check only of the specified appliances. The accuracy or operation of timers, temperature or power level controls is beyond the scope of this inspection.

Types Installed

Dishwasher, Range, Range Vent, Microwave

Cooking Fuel

Electric

Ventilation Type

Recirculating

Interior

The interior inspection is limited to readily accessible areas that are not concealed by furnishings or stored items. A representative number of windows and doors.

Window Types

Single Hung

Window Materials

Vinyl

Entry Door Types

Hinged

Entry Door Materials

Metal

Fireplace/Stove Type

Not Present

Interior Comments

Comment 35
Deficiency

Window screen located on the back south corner of the residence has several holes in the assembly. This prevents the homeowner from raising their window without allowing unwanted pests to enter the area. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.





Comment 36
Deficiency

Unable to inspect the finished room above the garage due to large amounts of the owners personal effects being stored in the area. Recommend further inspection once the area is accessible.

Comment 37
Information

Unable to inspect below or behind the washer, dryer, stove, or refrigerator. They are in position and unable to move.









Comment 38
Deficiency

A crack is radiating from the upper left corner closet door of the first bedroom, located on the right side of the hall. Unable to determine the cause of cracking at this level of inspection. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.





This summary page is not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your real estate agent or an attorney.

Deficiency

Exterior

Driveway has a sunken area at the connection point for the addition. This is a safety concern. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.

Exterior

Side door entering the east side of the garage shows signs of deferred maintenance. Lower left side of jam has damaged/missing wood and also areas of missing paint is visible. This greatly reduces the life expectancy of the door. Also, provides direct access for unwanted pests to enter the area. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.







Exterior

Cracking is present in the brick veneer skirt located on the back south east corner of the residence. Unable to determine the cause of cracking at this level of inspection. Some cracking is visible from the crawl space. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.













Exterior

Top section of vinyl siding located on the back south east corner of the residence is improperly attached. This can allow water to enter the wall area. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.







Exterior

Several sections of vinyl siding are loose/ improperly installed, located on the back south corner of the residence. Also a section of vinyl siding in that area has several cracks present. This provides a wind catch and also a point for water to enter the area. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.










Exterior

Condensation drain line located on the back south side of the residence has an excessively long drain pipe attached. This drain line is exiting uphill. This makes it impossible for the device to drain properly. Recommend further inspection, evaluation, and repairs be completed by a licensed HVAC contractor.



Roofing

No kick out flashing is installed on the lower front roof section and the back side of the garage roof. This can provide water direct access into the wall area. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.






Roofing

Large amount of granular covering are missing from the roof shingles. This granular covering is the protection for the inner fiberglass membrane of the shingle. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.

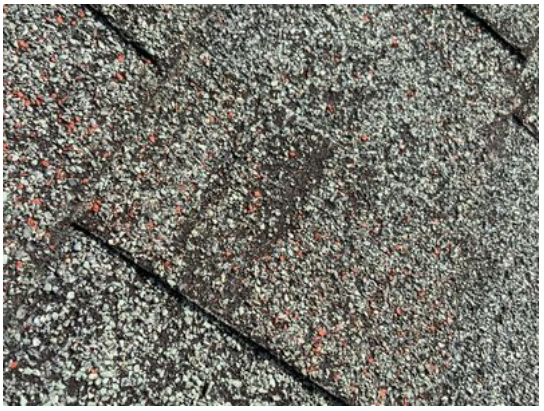

Roofing

Both plumbing vent flange and all attic box vents have exposed fasteners and several are damaged. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.










Roofing

Both final ridge caps have exposed fasteners. Also, several ridge caps have damaged areas present. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.











Roofing

Front lower section of the residence roof gutter material has large amounts of fungal growth present. This prevents the gutter from draining properly and can cause water to back up into the roof system. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.








Structure: Crawl Space

Moisture content of the subfloor is high. This greatly affects the life expectancy of the subfloor system. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.

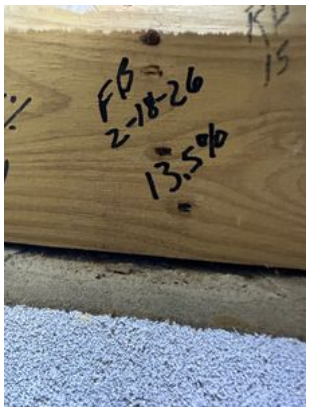







Structure: Crawl Space


A mildew/fungal type growth is visible in some areas on the subfloor system. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.






Structure: Crawl Space

Many sections of insulation are out of place in the subfloor area. This greatly affects the insulation integrity of the subfloor. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.

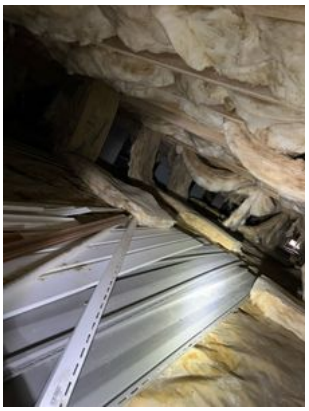






Structure: Crawl Space

Vapor barrier does not cover 100% of the crawlspace floor. This can allow moisture to enter the subfloor area. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.



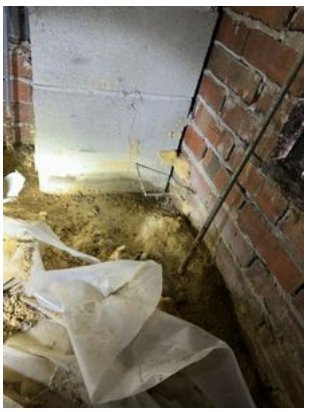






Electrical

Residence has a tankless water heater install. This is located on the back north east corner of the residence. However, a drop cord is providing power to the unit. This drop cord is not rated for exterior weather exposure. Recommend further inspection, evaluation, and repairs be completed by a licensed electrical contractor.




Electrical

Circuit breaker 17 labeled nook is a AFCI type breaker. This breaker does not test by normal means. This is a safety hazard. Recommend further inspection, evaluation, and repairs be completed by a licensed electrical contractor.






Electrical

Three receptacles located in the dinning room area indicate open “Hot”. This is a faulty indication. Recommend further inspection, evaluation, and repairs be completed by a licensed electrical contractor.







Electrical

Hall bathroom vent fan does not operate by normal means. Recommend further inspection, evaluation, and repairs to be completed by a licensed electrical contractor.



Cooling

HVAC compressor located on the west side of the residence has a large rosebush growing directly beside it. This can greatly affect the operating efficiency of the unit. Recommend further inspection, evaluation, and repairs be completed by a licensed HVAC technician.



Cooling

HVAC compressor located on the west side of the residence has a large amount of grass and debris blocking the cooling coils. This can greatly affect the operating efficiency of the unit and reduce life expectancy. Recommend further inspection, evaluation, and repairs be completed by a licensed HVAC technician.







Cooling

Mitsubishi Minisplit located on the east side of the residence, has large foliage growing in direct contact with the unit. This greatly affects the operating efficiency of the system and makes it difficult to inspect. Recommend further inspection, evaluation, and repairs be completed by a licensed HVAC technician.






Cooling

Unable to operate the Minisplit system located in the finished room above the garage by normal means.Recommend further inspection, evaluation, and repairs be completed by a licensed HVAC technician.





Cooling

HVAC air handler overflow catch pan located below the air handler in the attic area is severely corroded. This catch pan is the last line of defense. Should the air handler start to leak. Recommend further inspection, evaluation, and repairs be completed by a licensed HVAC tech technician.





Plumbing

Resident water heater located on the back north east side of the residence has an improper fastener securing the access door to the unit. Also, the door does not seal properly. Recommend further inspection, evaluation, and repair repairs be completed by a licensed plumbing contractor.







Plumbing

Unable to access the service area for the water heater located on the back south west corner of the residence due to material being installed in that area. This material appears to have melted together. Recommend further inspection, evaluation, and repairs be completed by a licensed plumbing contractor.





Plumbing

Frostproof faucet located on the back south side of the residence has a garden hose that is corroded in place. Recommend further inspection, evaluation, and repairs be completed by a licensed plumbing contractor.





Plumbing

Left kitchen sink drain trap assembly shows signs of leaking. Unable to determine if a leak is present at this time. Recommend further inspection and repairs be completed by a licensed plumbing contractor.








Plumbing

Primary bedroom, en suite left vanity sink drain stopper does not operate by normal means. This prevents the owner from being able to hold water in the sink area. Recommend further inspection, evaluation, and repairs be completed by a licensed plumbing contractor.

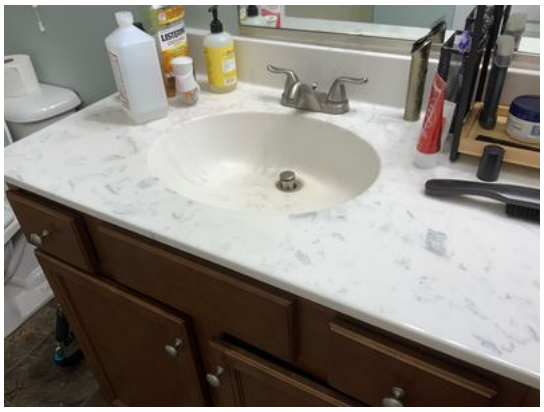



Plumbing

Primary bedroom en suite tub/shower drain assembly missing stopper. This prevents the homeowner from being able to hold water in the tub assembly. Recommend further inspection, evaluation, and repairs be completed by a licensed plumbing contractor.







Interior

Window screen located on the back south corner of the residence has several holes in the assembly. This prevents the homeowner from raising their window without allowing unwanted pests to enter the area. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.





Interior

Unable to inspect the finished room above the garage due to large amounts of the owners personal effects being stored in the area. Recommend further inspection once the area is accessible.

Interior

A crack is radiating from the upper left corner closet door of the first bedroom, located on the right side of the hall. Unable to determine the cause of cracking at this level of inspection. Recommend further inspection, evaluation, and repairs be completed by a licensed contractor.



