Post-Cleaning Service Report

Kitchen Exhaust System

Demonstration report | Fictional project | AI-generated photographs

Job information

CONTRACTOR	Cascadia Commercial Vent & Hood Services	SERVICE DATE	November 14, 2026
CUSTOMER	Pinecrest Family Diner	SERVICE WINDOW	9:30 PM - 2:15 AM
SITE	742 Evergreen Way, Suite 100, Olympia, WA 98502	WORK ORDER	WO-88412
SYSTEM	Single exhaust canopy and rooftop assembly | OLY-EXH-01	TECHNICIAN	Derek Sullivan (Lead Tech); Elena Ramos

Service summary

The crew reported protecting the cook line and floor area; cleaning the hood interior and plenum, eight baffle filters, the accessible lower vertical riser duct, the rooftop upblast exhaust fan, and the grease-containment box; and replacing the saturated absorbent pad. The fan was reported restored to service and test-run without abnormal vibration. On-site completion was acknowledged by the general manager.

Work reported as performed

[x] Cooking and preparation areas protected	[x] Hood interior and plenum cleaned
[x] Baffle filters cleaned and reinstalled	[x] Accessible duct surfaces cleaned
[x] Accessible fan-housing surfaces cleaned	[x] Grease-containment area cleaned
[x] Before/after photographs captured	[x] Other: grease absorbent pad replaced

This report documents the service information and photographs provided. It is not a certification, compliance determination, or safety inspection.


Photo documentation

01 Hood interior

BEFORE



AFTER

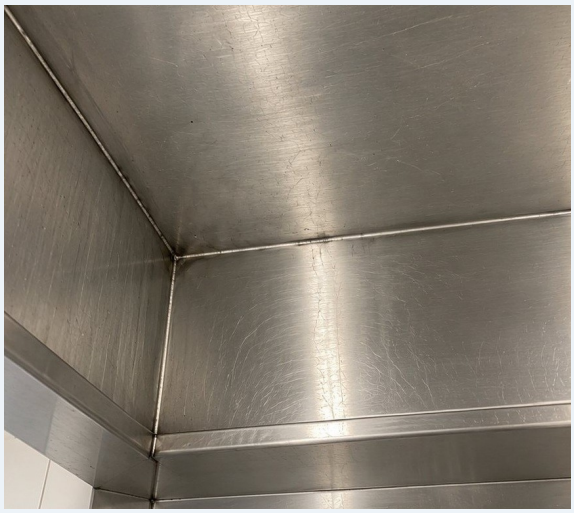

Before - Grease residue is visible across the canopy interior before service.
After - Canopy interior is shown after the reported degreasing, power washing, and wipe-down.

02 Baffle filters

BEFORE



AFTER



Before - Grease residue is visible across the baffle filters and surrounding hood surfaces.
After - Baffle filters and surrounding surfaces are shown after the reported cleaning and reinstallation.

This report documents the service information and photographs provided. It is not a certification, compliance determination, or safety inspection.

03 Accessible duct

BEFORE



AFTER




Before - Heavy grease residue is visible in the accessible lower vertical riser duct.
After - Accessible duct surfaces are shown after the reported scraping and degreasing.

04 Rooftop exhaust fan

BEFORE



AFTER

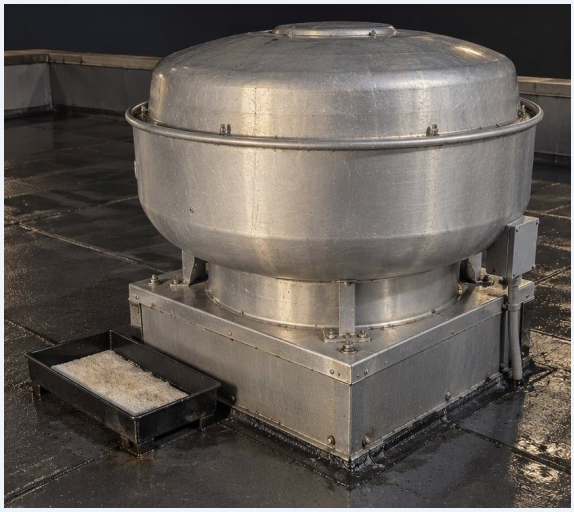

Before - Heavy grease residue is visible on the fan housing, bowl, and curb assembly.
After - Rooftop fan housing and bowl are shown after the reported degreasing and pressure washing.

This report documents the service information and photographs provided. It is not a certification, compliance determination, or safety inspection.

05 Grease-containment area

BEFORE



AFTER



Before - The absorbent pad is visibly saturated and grease residue is present around the catch box.
After - The catch box is shown clean with replacement absorbent media installed.

Observations and follow-up

AREA / ITEM	OBSERVATION	STATUS / FOLLOW-UP
Hood interior and plenum	Stainless was reported sound with no weld damage.	No deficiency reported
Accessible duct	Rear lower transition buildup was reported removed; seams intact.	No external grease leakage reported
Rooftop exhaust fan	Belt tension was reported normal; hinge greased; test-run without abnormal vibration.	No deficiency reported
Grease containment	Catch box was cleaned; saturated absorbent media was reported replaced.	No deficiency reported

Information not supplied or pending confirmation

Credential / licence fields	Not provided
AHJ or inspection fields	Not provided
Equipment / system identifier	OLY-EXH-01
Next required service date	Not provided
Other	Work order WO-88412; no additional information provided

Customer acknowledgment

Customer name	Martin Walsh, General Manager
Acknowledgment	On-site completion acknowledged
Date	November 15, 2026

This report documents the service information and photographs provided. It is not a certification, compliance determination, or safety inspection.