

Executive Statement

Lot WQ-7314 shows a localized edge-band yield loss after the September 18 ETCH-08 chamber A run.

Affected scope

Wafer WQ-7314 · route R17B · ETCH-08 / chamber A · inline metrology sample 4,812 · paired reference wafer WQ-7298.

Affected vs paired-reference yield


98% → 91.8%

Affected edge-band yield

91.8%

Affected die yield


113 observations · 0 missing · Value 91.8 to 98

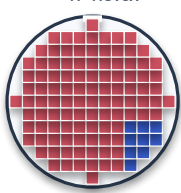


MEASURED VALUE

91.8 98

Process stability and specification

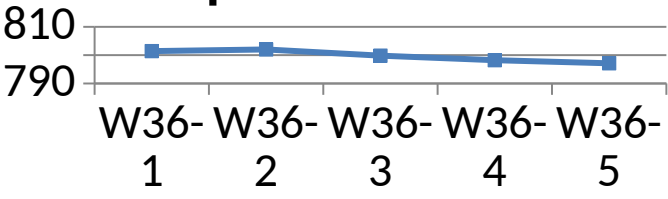

Control versus affected distribution

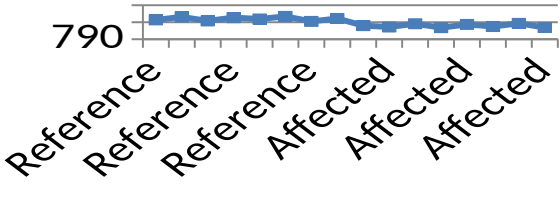

Verified finding

Signal · WQ-7314 edge-band yield is below the paired reference. Nine lower-right edge-band records average 91.8% versus a 98.0% paired-reference mean. Pressure shift begins after PM-44719; cause remains unconfirmed. Keep the lot contained through endpoint calibration and matched rerun.

Needs verification

Process Flow

Excursion signal


Compare affected and reference

Verify chamber mechanism

Confirm corrective action

Synthetic paired-die renderer subset A

4 observations · 0 missing · Delta -8 to -4

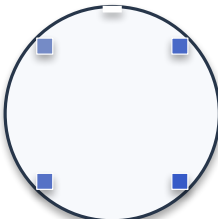

SIGNED DELTA · AFFECTED - REFERENCE

-8 +8

Measure	Affected	Reference	Review
Edge-band yield	91.8%	98.0%	Contain pending matched rerun
Film thickness	798.0 nm	802.1 nm	Check endpoint calibration
Pressure offset	+2.4 kPa	Baseline	Association only; verify

Corrective action

Contain WQ-7314 pending chamber requalification

Do not release the lot from one correlated pressure trace. Verify endpoint calibration and a matched chamber B rerun.

Contain