# Hydraulic System Inspection Summary

This summary records the third quarter inspection of the main and nose landing gear hydraulic actuators. Internal leakage was measured three times per actuator at 3000 psi with fluid at 40 C. Results are listed in Table 1 and plotted in Figure 1.

| Actuator | Part number | Leakage cc/min | Action |
|---|---|---|---|
| L/H MLG | 114A3200-5 | 3.2 | Replace |
| R/H MLG | 114A3200-5 | 1.9 | Monitor |
| NLG steering | 114A3410-2 | 1.1 | None |

Table 1. Leakage by actuator (mean of three measurements)

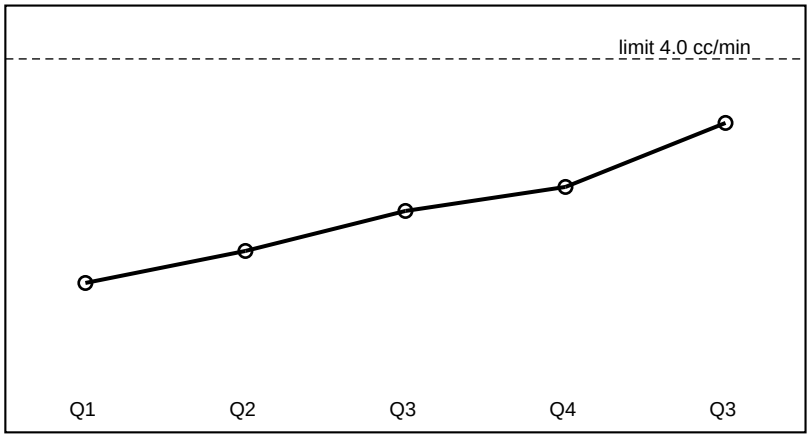


Figure 1. L/H MLG actuator leakage trend over five inspections

Conclusion. The left main landing gear actuator (114A3200-5) has reached 80 percent of the allowable leakage and is scheduled for replacement before the next inspection interval. A functional test and leakage re-measurement follow the replacement.