

Application Note 005
EVK Troubleshooting

Revision 1

Vayyar Imaging Ltd.

Web: https://vayyar.com

Notice

Copyright 2020 Vayyar Imaging Ltd. All rights reserved.

This document is the property of Vayyar and all materials and information contained herein are the confidential and proprietary information of Vayyar and are protected by international copyright laws. The copyrights are owned by Vayyar or the original creator of the material. The materials and information contained herein are provided to you for internal information purposes only, and no portion of the materials and information herein may be copied, reproduced, distributed, transmitted, displayed, published, broadcasted or used in any way whatsoever directly or indirectly without the prior written consent of Vayyar or in any case of third party materials, without that third party's consent. This document shall be returned to Vayyar promptly upon request.

The materials and information contained herein are provided "AS IS" and Vayyar does not provide any warranties of any kind, whether express or implied, including but not limited to implied warranties of merchantability, fitness for a particular purpose, and non-infringement

Revision History

Revision	Date	Author	Description
1	February 2019	Yuval Mekamel	

Table of Contents

1. Checking the Presence of DLLs 5
2. Blocked DLL Workaround 6
3. Engine Crashing 7
4. Working with a proper cable 9
5. Clearing Cookies 9
6. Error using save 11
7. Black Heat Map 11
8. RECAPI_GENERAL_ERROR 12
9. “You Need to Add an IP Listener” Error 13

List of Figures

Figure 1: List of DLL Files 5
Figure 2: Unblocking a Blocked DLL 6
Figure 3: Engine Crash Error 1 7
Figure 4: Engine Crash Error 2 7
Figure 5: The Engine at the Task Manager 7
Figure 6: Clearing temp data folder 8
Figure 7: Skip the undeletable 8
Figure 8: USB cable solution 9
Figure 9: Settings → More tools → Developer tools 9
Figure 10: Clear Cookies 10
Figure 11: Empty cache and Hard reload 10
Figure 12: Error using save Error Message 11
Figure 13: Black Heatmap 11
Figure 14: RECAPI error message 12
Figure 15: Special USB port 12
Figure 16: Self-powered USB hub 12
Figure 17: End the Vayyar App Task 14

1. Checking the Presence of DLLs

In some cases, not all of the DLL files are copied to the target system due to Windows defender policy.

➔ **To check that all the DLL files have been properly copied:**

1. Navigate to the EVK folder and enter the MPR_vXXX folder.
2. Check the presence of all eight DLL files, as seen in the figure below:

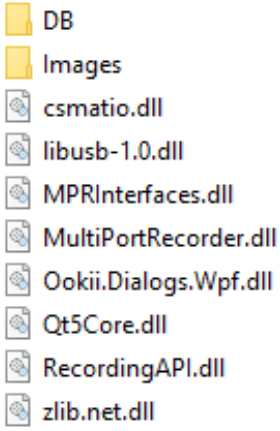


Figure 1: List of DLL Files

3. If any DLL file is missing, disable periodic scanning by the Windows Defender Antivirus. Optionally, if periodic scanning can't be disabled, you can exclude the MPR_vXXX folder in the Windows Defender Antivirus settings.

2. Blocked DLL Workaround

In some cases, when downloading the EVK software from the web, some DLL files appear “blocked”.

➔ **To unblock a blocked DLL file:**

1. Navigate to the EVK folder and enter the MPR_vXXX folder.
2. Right click on the MultiportRecorder.dll file and choose **Properties**.
3. If blocked, a security warning is displayed as shown in the figure below.

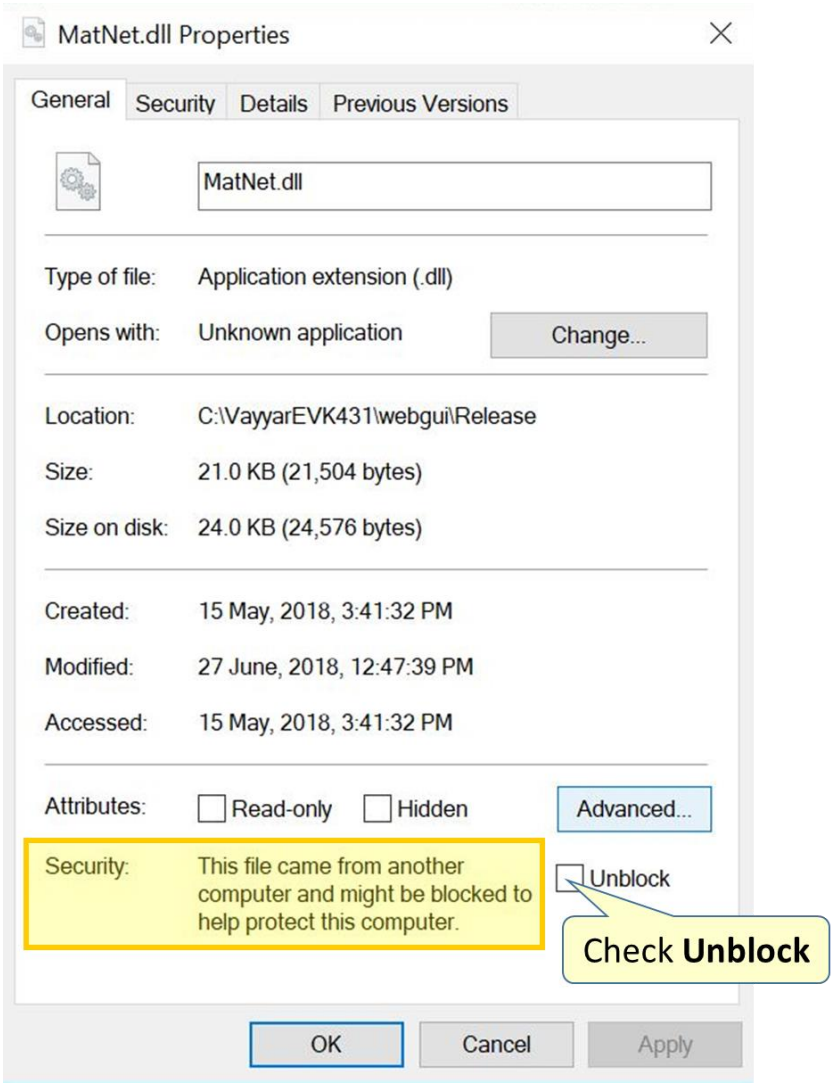


Figure 2: Unblocking a Blocked DLL

4. To unblock file, check the **Unblock** checkbox and click **Apply**.
5. Repeat the above steps for all the DLL files in the folder.
6. There are additional DLL files in the WebGUI\Release folder that may require the same unblocking procedure.

3. Engine Crashing

Sometimes the VayyarEVKEngine.exe will crash after a few second with one of the below errors:

```
Based on version: 4edb07ad675a49f1b2cbf822fafc4ffb583c7736
**********************************************************************************************
      Configuration file used: ozoiqjt
**********************************************************************************************
Error using resahbc (line 6)
Message: Failed to listen on prefix 'http://+:1234/' because it conflicts with an existing registration on the machine.
Source: System
HelpLink:
Error in dzeaowr (line 11)


Error in pbxuhoz (line 212)
MATLAB:NET:CLRException:MethodInvoke
```

Figure 3: Engine Crash Error 1

```
Undefined function or variable 'matlabrc'.

Undefined function or variable 'ctfroot'.

Error in checkRequiredMCRProducts (line 22)

Undefined function or variable 'ctfroot'.
```

Figure 4: Engine Crash Error 2

➔ **To solve this error:**

1. Open Task Manager (Ctrl+Shift+Esc) and search for the VayyarEVKEngine.exe program.
2. If the program is running – end the task:

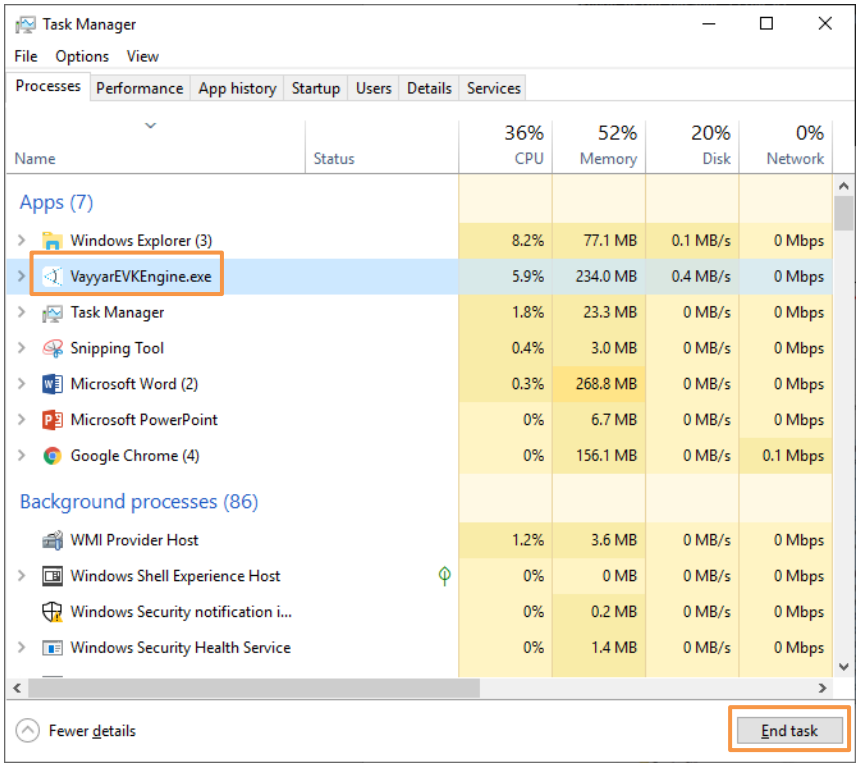


Figure 5: The Engine at the Task Manager

3. Navigate to “C:\Users\(YOUR_USER_NAME)\AppData\Local\Temp” and delete its content:

NOTE

The folder "C:\Users\(YOUR_USER_NAME)\AppData" is a hidden folder.

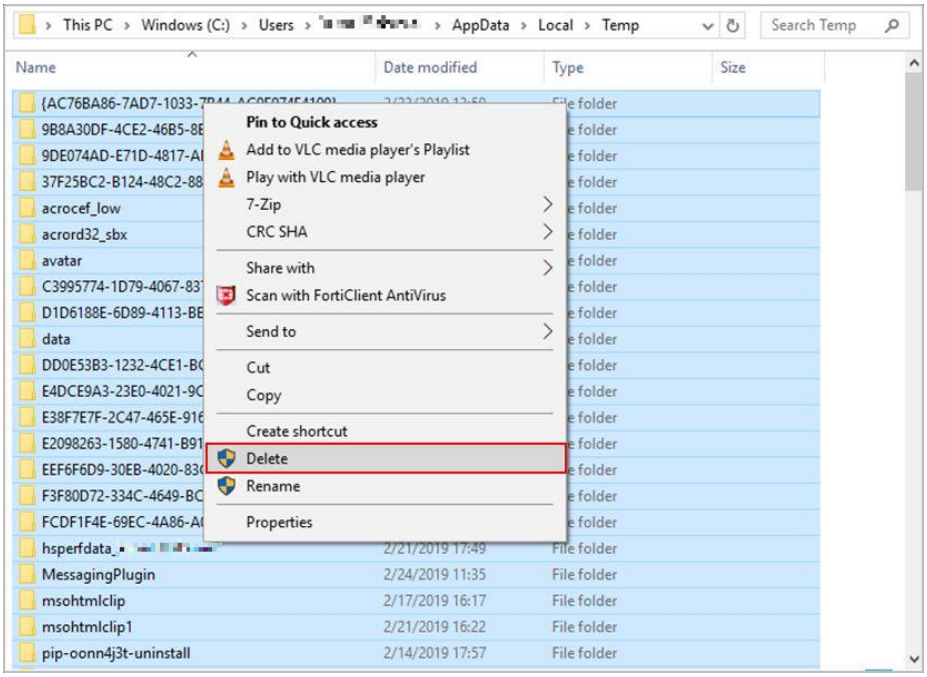


Figure 6: Clearing temp data folder

4. Skip all the undeletable data

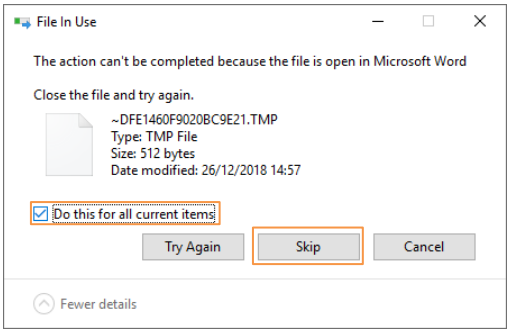


Figure 7: Skip the undeletable

5. Restart the engine.

NOTE

It is completely safe to delete the “temp” folder. More information can be found here.

4. Working with a proper cable

Many connectivity problems can be due to using an improper USB cable.

It is strongly recommended to use the USB cable provided with the kit: equal or shorter than 2m, AWG24 or thicker for the VBUS and GND wires.

If a longer cable is required, self-powered USB HUB can be used.

You can also try the below type of USB cable solutions where VBUS and GND are divided to 2 USB Type-A connectors:



Figure 8: USB cable solution

5. Clearing Cookies

When using several EVK versions on the same PC and changing between them, some WebGUI errors related to web cookies might occur.

To solve that, clear cookies following the steps below:

1. In the chrome browser, go to settings → More tools → Developer tools.

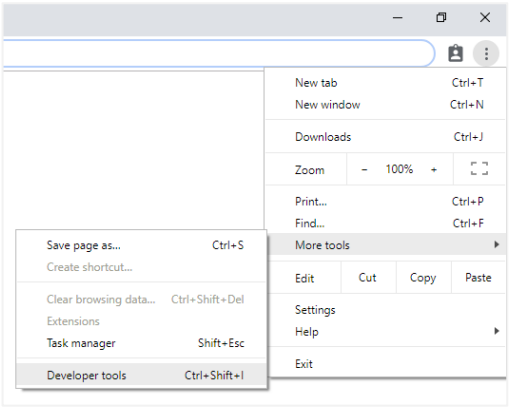


Figure 9: Settings → More tools → Developer tools

2. In the upper menu select "application". Then in the menu to the left open the “cookies” tab and right click the address which appears. Select “Clear”.

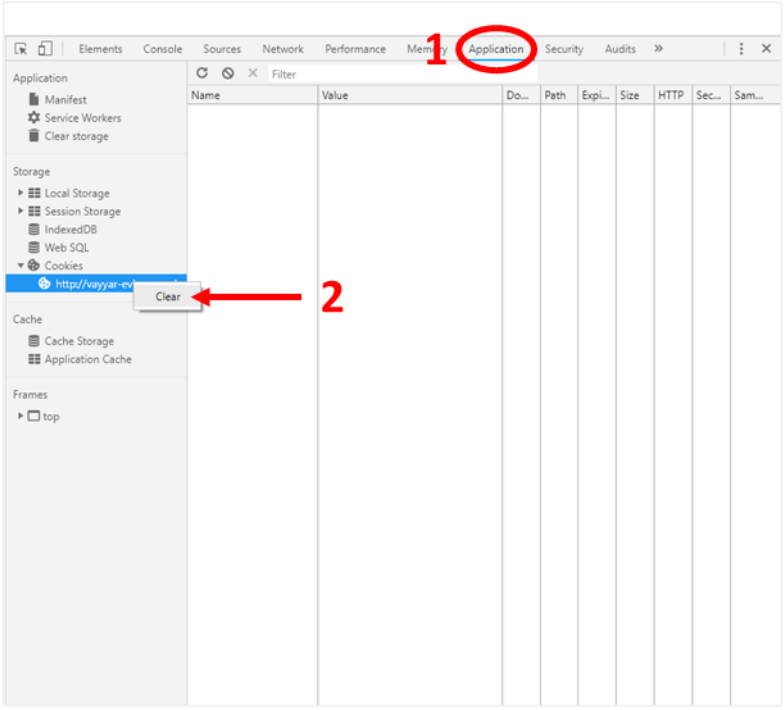


Figure 10: Clear Cookies

3. Right click on the browser “Refresh” button – select “Empty Cache and Hard Reload”.

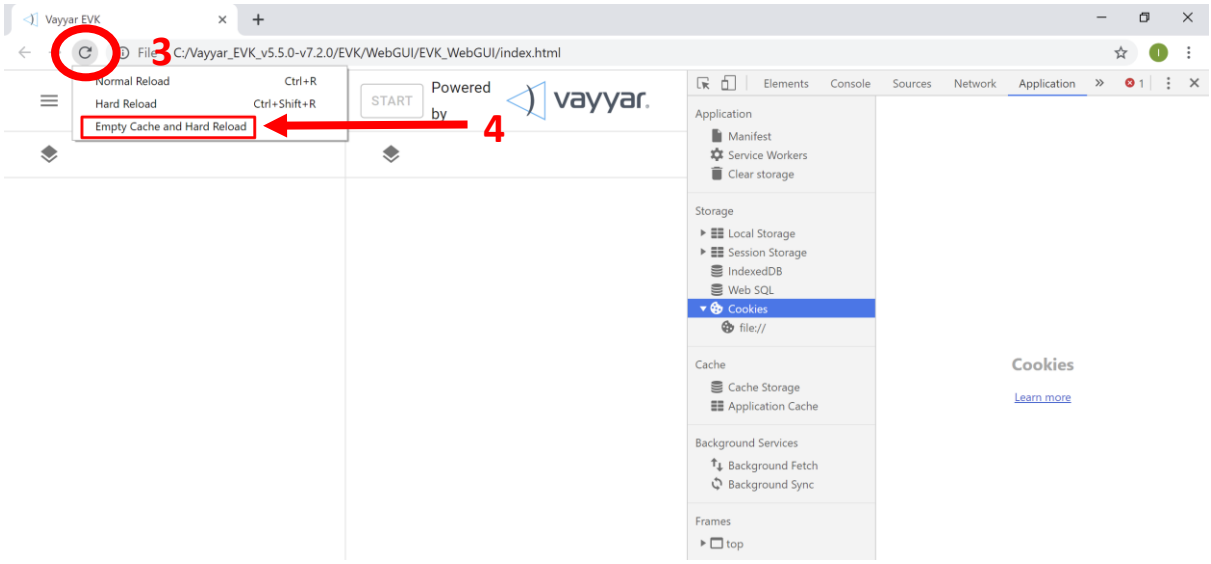


Figure 11: Empty cache and Hard reload

4. Restart the Engine and the WebGUI.

6. Error using save

Sometimes when trying to save data, the following error will occur:

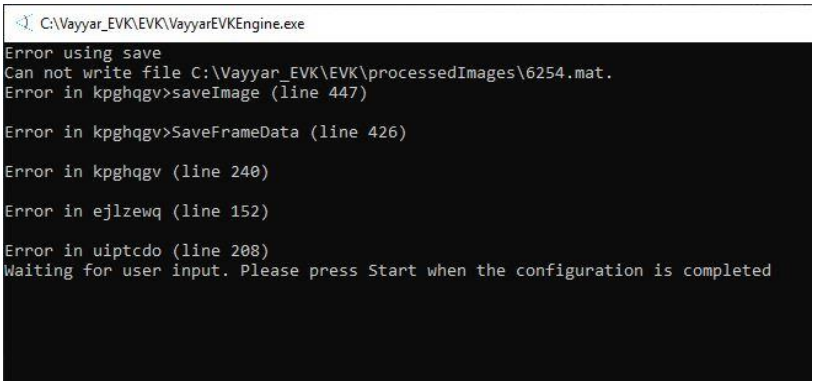


Figure 12: Error using save Error Message

This happens due to no more available memory on the PC. In order to keep recording, clear space in your PC.

7. Black Heat Map

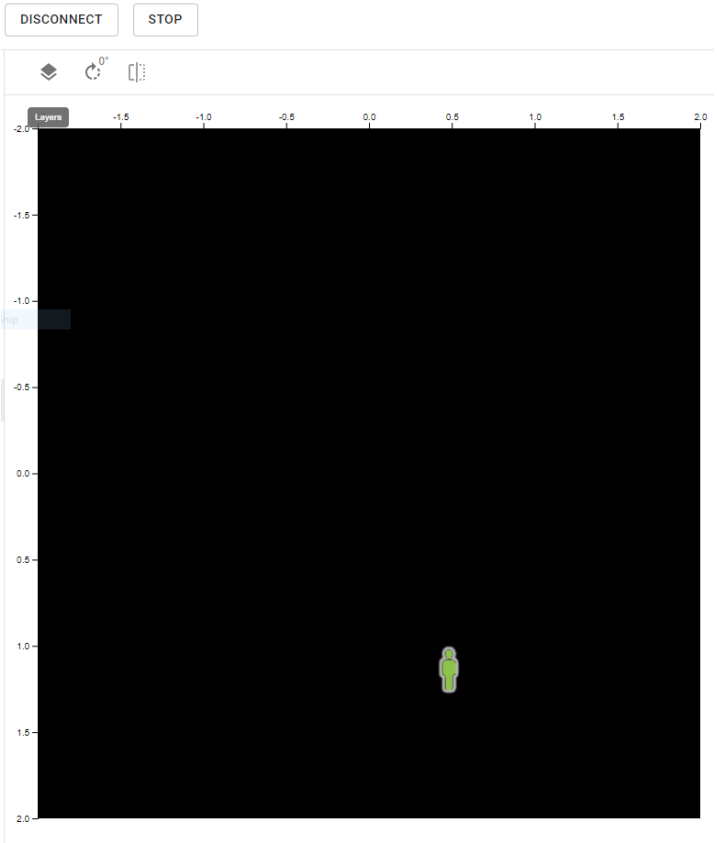


Figure 13: Black Heatmap

When this happens, clear the cookies as explained in section 5 above.

8. RECAPI_GENERAL_ERROR

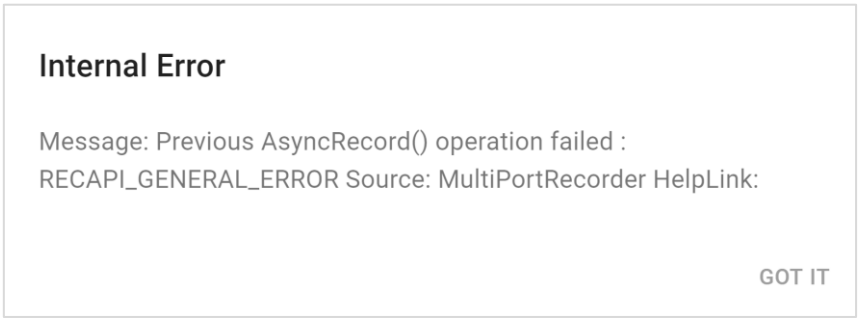


Figure 14: RECAPI error message

The above error is due to low power supply and occurs mostly when:

1. The USB cable is not connected properly (micro USB side of the cable). Usually, disconnecting and reconnecting the sensor to the cable solves the problem.
    a. Some laptops have a special USB port for high power consumers / always-on use. It is preferable to use it.



Figure 15: Special USB port

2. The USB cable is too long (more than 2 meters) or not of good quality. Please use the USB cable provided by Vayyar with the kit or a cable that fits the requirements specified in section 4: equal or shorter than 2m, AWG24 or thicker for the VBUS and GND wires.
3. Connecting the sensor via a USB Type-C adapter.

To ensure a stable high power provision, you can connect the sensor via a self-powered USB hub.



Figure 16: Self-powered USB hub

9. "You Need to Add an IP Listener" Error

When running the Vayyar EVK SW, you might encounter the below error message:

```
You need to add an IP listener: run cmd as admin, restart matlab, and execute the following commands:
netsh http add iplisten 0.0.0.0,
netsh http add urlacl url="http://+:1234/" user=Everyone
```

➔ **If your operation system's language is not English:**

The installation process of the SW includes a few commands for adding a new IP address to the IP listen list and adding a URL reservation entry (for non-administrator users and accounts).

These commands might not be executed properly if the OS language is not English.

To fix that:

1. Open an elevated command prompt.
2. Type the following commands; replace the word "Everyone" (colored red) with the equivalent word in your OS language:
    a. *netsh http add iplisten 0.0.0.0*
    b. *netsh http add urlacl url="http://+:1234/" user=**Everyone***

    For example, for **German**:

    *netsh http add urlacl url="http://+:1234/" user= **Jeder***

    For **Polish**:

    *netsh http add urlacl url="http://+:1234/" user= **Wszyscy***
3. Re-run the SW.

➔ **If your operation system's language is English (or if the steps above did not solve the issue):**

1. Open a Task Manager (Ctrl+Shift+Esc) and search for the Vayyar app task.
2. If the program is running – end the task:

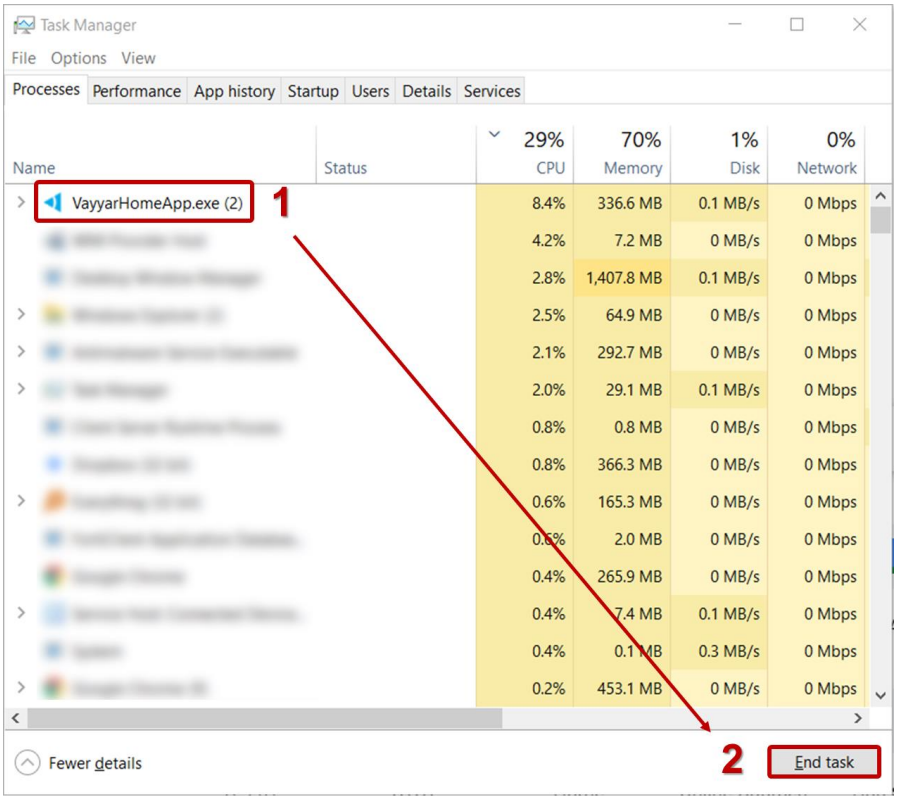


Figure 17: End the Vayyar App Task

3. Re-run the SW.

END OF DOCUMENT