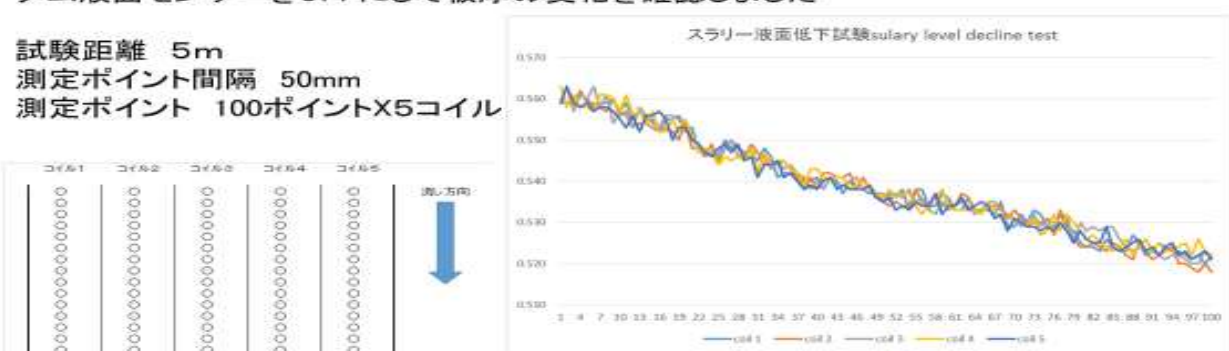


Customer:		PANASONIC JAPAN		Date:	22-Aug-18	Time:	14:00																																																																													
Participant From Maruwa 1. Mr SivaMMSB QA 2. Mr MatsumotoJP MW SALES 3. Mr InagakiJP MARUWA 4. 5.				Participant From Organizer 1. Mr YoshidaQA 2. Ms HamadaIQC 3. Mr OkuiSQM 4 Mr IshikawaPurchasing MGR 5.		Report To 1. Mr.Anthony,Mr.Ogawa 2. Mr.Seeni,Mr.Naga,Mr.Sinna 3. Mr.Theva,Mr.Shahrudin,Mr.Justin 4 Mr Loga, Mr Azham, Mr Rajan 5.																																																																														
Agenda																																																																																				
Meeting start at 2:00pm Explain on the SD-2-585NH Thickness small claim. Explanation start from a. FTA preparation b. Slim down 3 possibles root cause i. DAM slurry level ii. Wrong setting iii. Mix of coil thickness Each occurrence i DAM slurry level																																																																																				
MARUWA CONFIDENTIAL 検証1 ダム液面センサーの故障の再現試験 ダム液面センサーをOFFにして板厚の変化を確認しました 試験距離 5m 測定ポイント間隔 50mm 測定ポイント 100ポイントX5コイル  スラリーの供給が止まりダム内のスラリーが減ると板厚も薄くなっていくことがわかります 今回の不良は0.50と0.38mmの板厚で今回のような徐々に変化したものではないと判断できます。				MARUWA CONFIDENTIAL 検証2 板厚設定ミス 板厚設定ミスした場合、15分毎の板厚確認で検出可能 該当ロット: PD04の検査結果にて異常値の履歴なし 生産履歴 PD04 10ロール 板厚検査結果 (生産時の板厚検査データを添付します) <table><tr><th></th><th>Roll 1</th><th>Roll 2</th><th>Roll 3</th><th>Roll 4</th><th>Roll 5</th><th>Roll 6</th><th>Roll 7</th><th>Roll 8</th><th>Roll 9</th><th>Roll 10</th></tr><tr><td>MAX</td><td>0.5784</td><td>0.5788</td><td>0.5826</td><td>0.5858</td><td>0.5846</td><td>0.5840</td><td>0.5832</td><td>0.5806</td><td>0.5810</td><td>0.5786</td></tr><tr><td>MIN</td><td>0.6044</td><td>0.5998</td><td>0.6002</td><td>0.6130</td><td>0.5986</td><td>0.5982</td><td>0.5978</td><td>0.5980</td><td>0.5980</td><td>0.6004</td></tr><tr><td>R</td><td>0.0260</td><td>0.0210</td><td>0.0176</td><td>0.0272</td><td>0.0140</td><td>0.0142</td><td>0.0146</td><td>0.0174</td><td>0.0170</td><td>0.0218</td></tr><tr><td>AVE</td><td>0.5878</td><td>0.5872</td><td>0.5915</td><td>0.5944</td><td>0.5936</td><td>0.5908</td><td>0.5884</td><td>0.5884</td><td>0.5882</td><td>0.5869</td></tr><tr><td>Stdev</td><td>0.0050</td><td>0.0041</td><td>0.0041</td><td>0.0041</td><td>0.0033</td><td>0.0029</td><td>0.0028</td><td>0.0035</td><td>0.0041</td><td>0.0039</td></tr><tr><td>cpk</td><td>1.1781</td><td>1.3931</td><td>1.4972</td><td>1.2662</td><td>1.6831</td><td>2.2431</td><td>2.2148</td><td>1.7584</td><td>1.4910</td><td>1.4598</td></tr></table>					Roll 1	Roll 2	Roll 3	Roll 4	Roll 5	Roll 6	Roll 7	Roll 8	Roll 9	Roll 10	MAX	0.5784	0.5788	0.5826	0.5858	0.5846	0.5840	0.5832	0.5806	0.5810	0.5786	MIN	0.6044	0.5998	0.6002	0.6130	0.5986	0.5982	0.5978	0.5980	0.5980	0.6004	R	0.0260	0.0210	0.0176	0.0272	0.0140	0.0142	0.0146	0.0174	0.0170	0.0218	AVE	0.5878	0.5872	0.5915	0.5944	0.5936	0.5908	0.5884	0.5884	0.5882	0.5869	Stdev	0.0050	0.0041	0.0041	0.0041	0.0033	0.0029	0.0028	0.0035	0.0041	0.0039	cpk	1.1781	1.3931	1.4972	1.2662	1.6831	2.2431	2.2148	1.7584	1.4910	1.4598
	Roll 1	Roll 2	Roll 3	Roll 4	Roll 5	Roll 6	Roll 7	Roll 8	Roll 9	Roll 10																																																																										
MAX	0.5784	0.5788	0.5826	0.5858	0.5846	0.5840	0.5832	0.5806	0.5810	0.5786																																																																										
MIN	0.6044	0.5998	0.6002	0.6130	0.5986	0.5982	0.5978	0.5980	0.5980	0.6004																																																																										
R	0.0260	0.0210	0.0176	0.0272	0.0140	0.0142	0.0146	0.0174	0.0170	0.0218																																																																										
AVE	0.5878	0.5872	0.5915	0.5944	0.5936	0.5908	0.5884	0.5884	0.5882	0.5869																																																																										
Stdev	0.0050	0.0041	0.0041	0.0041	0.0033	0.0029	0.0028	0.0035	0.0041	0.0039																																																																										
cpk	1.1781	1.3931	1.4972	1.2662	1.6831	2.2431	2.2148	1.7584	1.4910	1.4598																																																																										
Thickness reduction by trend not sudden drop to 0.38t ==> This root cause eliminated				Thickness data for 15min didn't show any abnormal. --> This rootcause eliminated																																																																																
iii. Mix of coil				During preparation of sample. The coil which is on lower thickness (G/Sheet : 0.47t) was accidentally pressed in SD-2-585 mc (G/Sheet : 0.59). Realizing this, product cleared from machine but can't gurantee for the arrayed product.																																																																																
MARUWA CONFIDENTIAL 検証3 混入 SD-2-585NHは0.50±0.04mmの製品で0.38mm品は存在しない 工程内での製品混入ではない 成形機での巻き取り後は、ロール、コイル単位にラベル発行して管理されている 原料工程での問題ではないと考えています 今回異常が発生したロットの管理No.: MQ2230831について履歴調査しました 工程内異常の発行はありませんでしたが、この管理Noは工程内改善サンプルロットでありました。 サンプル担当者に聞き取りしましたが、特に問題となる異常の覚えはないとの事でした。 他のメンバーにも確認すると、当時コイル間違いをしてプレスしたとの記憶があり ただ該製品がSD-2-585NHであったかは不明 当時は他製品のサンプルも同時に製作していたため間違ったとの事 間違って生産したものは全て廃棄したため通常品として処理をしていた。 (工程異常書の発行はしていませんでした。) 状況から今回の板厚不良はコイル打ち間違いによる異常であると判断します																																																																																				
Mr Yoshida Comment																																																																																				
The analysis is simple and might not be the right cause for the occurrence. Request to conduct analysis in depth before making any conclusion. Below is the sample analysis for mix				Requested to fill in this table to understand where exactly it went wrong. Since there is no records to submit this, detail anaylsis need to be carry out in order to understand the actual rootcause.																																																																																
Task for complete																																																																																				
a. Re-analyse the occurrence by detail analysis with the above table				PIC: Mr Siva & Mr Salleh																																																																																
b. To rediscuss thru telephone meeting on 06th Sept 1pm				Team																																																																																
c. Review the training/task for new member				Ms Marlina																																																																																
d. Establish of internal sample evaluation procedure				Ms Marlina & Mr Salleh																																																																																
e. Schedule for Press thickness sensor=> 1st machine & for other machines				Mr Siva																																																																																
Meeting adjourned at 415pm																																																																																				
CONCLUSION																																																																																				
Mr Yoshida requested to have in detail anaylsis and expected to close it by Sept'18. He also requested production to join for customer visit in order to undertsand the requirement																																																																																				