

期間 Date 2019/10/23

添付資料 Attachment 有 Yes 無 No

出張者 Name Mr Siva

同行者 Colleague Mr Ronny, Ms Liya

出張先 Customer	UNIROYAL (KUNSHAN)	相手先 面談者 Attendance	Mr Zhao – HEAD OF ENGINEERING Mr Louise – HEAD OF OPERATION Ms Hong – BUYER
出張目的 Visit Purpose	☒ 3080M – Yellowish ☒ RA12-4 – No printing on slit ☒ 7910 – Sample status	会議フロアアップ項目 Meeting Follow Up	☒ As attach in below table ☐ ☐

報告内容 Report

Meeting begin at 1:30PM

Meeting attended by top management of Uniroyal chip resistor

Summary of discussion

1. 3080M – Yellowish

3 samples of variaes color ratio (500gm, 150gm & white) submitted for confirmation that yellowish isn't from MM colour

Result : No tellowish detected

Next action : Submit 2000pcs each color ratio to finalise the defect (CV shipment

COMPARISON SANKANG & MM V GROOVE DEPTH DEFECT : 874M - NO PRINTING

2. RA12-4 – No printing on slit

Royal agreed for MM action by changing the V groove from 30° to 25°

ON HOLD STATUS

Total on hold – 300kpcs

Royal : Return the product to MM

MM : Not accepted for return since there is no specification for V groove
Action

三峰	SANKANG	V型深	0.047	0.043	0.040	0.049	0.038
		V型深	0.174	0.165	0.173	0.158	0.167
光和	MM	V型深	0.029	0.038	0.038	0.029	0.030
		V型深	0.020	0.018	0.025	0.036	0.025

Royal will do a special release for the inventory. MM need to segregate the inventory according to mould shot life. Mould shots towards service will be special release. Other product will be in normal process

Special release method : 2x printing (To fill paste in the V Groove)

3. Thin Substrate 65x74x0.2t

Substrate material sample evaluation result : found 0.6% scribing NG (3/500pcs)

Below is the images



Laser scribe NG samples will courier to Japan for Mr Sasaki to further evaluate the defect.
Defect % have improved from 3% ==> 0.6%


HBS 2 ==> Schedule will be provide to Maruwa Shanghai Mr Ronny

Sankang - V Groove depth high but hairline crack short
MM - V groove depth shallow but hairline crack long
Requested MM to check the V groove impact for RA12-4

4. 7910M – Sample Status

Received claim from Royal's customer for peel off

平面凹凸出立起皮無銀

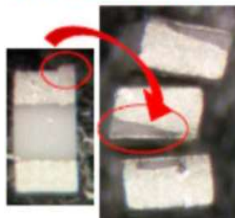

The grey area where the ceramic peeled and created open defect

Royal requested MM to look into

a. WD depth

b. Alignment

c. Material strenght

Current failure have been shifted from LD to WD.

Will have internal discussion to develop new action plan

5. Mfg date in Outer carton



Requested MM to include the MFG date in the outer carton.

Discussion will be held with Mr Ravi to auto generate the report so that the similar date will appear

6. Delivery abnormal – 874M

874M – Not required rank shipped

Non required rank shipped : Total qty 876kpcs pending for disposition

Royal would like to know reason of shipping despite informing the requirement

Royal strictly decided to return since it's the 2nd case pass 3 months

PIC: Mr Rosli


Meeting adjourned at 5:00pm

意見・Opinion

Overall comment : Focus on 65x74x0.2t & 7910M

Reminded by Royal to follow the delivery instruction. The excessive shipment will be return to MM since the qty is not required.

No	Product	Activity	MM		UNIROYAL	
			Date	PIC	Date	PIC
1	3080M YELLOWISH	Submitted sample for evaluation 500gm - 300pcs 50gm - 300pcs White - 300pcs Previous failure rate : 0.6% ~ 1.0% Current result : 0% Next Evaluation Requested 2000pcs each to finalise the any abnormal in our color	TBC	Mr Amirol Mr Vasant		
2	RA12-4 No printing on Slit	Further discussion to V groove width MM action ==> Change the V groove angle from 30° to 25° Activity a. Confirmation mould shot qty vs V groove size. b. V groove depth vs hairline crackivity to determine Purpose To determine the max V groove size that Royal can accept Example of V groove (Other competitor) Product type: 874M ON HOLD STATUS Total on hold - 300kpcs Royal : Return the product to MM MM : Not accepted for return since there is no specification for V groove Action Royal will do a special release for the inventory. MM need segregate the inventory according to mould shot life. Mould shots towards service will be special release Special release method : 2x printing (To fill paste in the V Groove)		Mr Theva Mr Punin Mr Muto Mr Siva Mr Sinna Mr Theva		

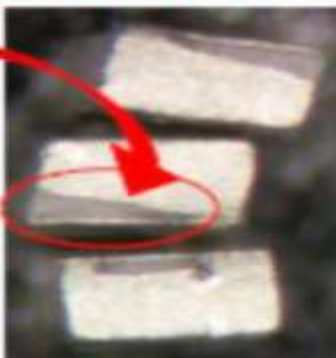4	65x74x0.2t New sample	Submitted sample NO 11 3 type of samples develop by the Engineering team Material : HBS 2 Sample 1 :TEMP 1560 ++> OK Sample 2 : TEMP 1530 ==> OK Sample 3 :TEMP 1490 ==> OK Submitted Sample NO 12 => HBS2 Material <table><tr><th>Sample</th><th>2015</th><th>2017</th><th>Sample 1</th><th>Sample 2</th><th>Sample3</th></tr><tr><td></td><td>2015 Sample</td><td>2017 Sample</td><td></td><td></td><td></td></tr><tr><td>RESULT</td><td>No Image</td><td>Schedule 19/Sept</td><td></td><td></td><td></td></tr><tr><td></td><td>OK YIELD : 100%</td><td>3NG/500 0.6%</td><td>OK YIELD : 100%</td><td>OK YIELD : 100%</td><td>OK YIELD : 100%</td></tr></table>  Defect will be analyse in Japan. ETD Shanghai :28th Oct	Sample	2015	2017	Sample 1	Sample 2	Sample3		2015 Sample	2017 Sample				RESULT	No Image	Schedule 19/Sept					OK YIELD : 100%	3NG/500 0.6%	OK YIELD : 100%	OK YIELD : 100%	OK YIELD : 100%		Mr Sasaki Mr Muto & Team		
Sample	2015	2017	Sample 1	Sample 2	Sample3																									
	2015 Sample	2017 Sample																												
RESULT	No Image	Schedule 19/Sept																												
	OK YIELD : 100%	3NG/500 0.6%	OK YIELD : 100%	OK YIELD : 100%	OK YIELD : 100%																									
5	7910M - Product Design Improvement	7910M - Royal received 3 claim for open issue (substrate chipoff). Detail as below 平面看凸出,立起来看侧無銀 	TBC	Mr Siva Mr Naga																										