

Pre Purchase Building Inspection Report



11 Dunster Street
Christchurch, Burnside 8053



Table of Contents

General Information	3
TERMS AND CONDITIONS	5
Discription Of Property	7
Kitchen	9
Living Space	12
Common Area	20
Bedroom	22
Bathroom	30
Laundry Room/Area	36
Heating System	38
Water Heating	39
Electrical	40
Ceiling Space	41
Sub Floor	44
Roof	46
Exterior	48



Table of Contents (continued)

Garage	50
Lots and Grounds	52
Certificate Of Inspection	53
Summary Of Features Inspected	54
Summary	57



General Information

Property Information

Property Address 11 Dunster Street

City Christchurch **Suburb** Burnside **Post Code** 8053

Client Information

Client Name Kaushik and Sauvika Roychowdhury

Cell 021 160 1470

E-Mail krchome@hotmail.com

File Name 11 Dunster Street

Thermal Imaging Yes- This is a full pre purchase report including thermal imaging

Inspection Company

Inspector Name Chris Westeneng

Company Name The Building Inspection Company

Address PO.Box 495

City Rangiora **Suburb** **Post Code** 7440

Office Phone (03) 5512147

Inspector Chris Westeneng - BOINZ Accredited Building Surveyor # 20095270

Qualification Chris Westeneng - Qualified Carpenter with over 18yrs Experience - Qualified Level 1 Thermographer

Inspector Cell 021 652 799

Email chris@thebic.co.nz

Professional Liability Insurance AIG NZ Ltd

G.S.T Number 100766817



General Information (Continued)

Conditions

Scope Of Inspection The scope of this inspection is as defined in the letter of engagement and carried out in accordance with NZS 4306:2005 Residential Property Inspection

Others Present Home Owner **Property Occupied** Yes

Estimated Age 1960 - 1969 **Property Orientation** North East

Inspection Date 11/01/17

Start Time 9:00 **End Time** 11:00

Electric On Yes

Water On Yes

Water Source City **Sewage Disposal** City

Temperature 21 degC

Weather Over Cast **Wind Speed** Light Breeze

Soil Dry

Rain Past 3 Days No



TERMS AND CONDITIONS

THE B.I.C. Terms & Conditions –

1.0 Purpose of Report

The Building Inspection Company (Legal identity being Thermal Vision NZ Ltd but trading as and henceforth referred to as The B.I.C.) agrees to prepare this report ("the Report") as request by the client ("the Client") based on the findings of a visual inspection of the building inspected ("the building") and carried out by The B.I.C. This is not a weather tightness guarantee.

2.0 Limited-time Visual Inspection Only and details

This Property report is a visual only and a non invasive inspection of the areas of the building elements that can be seen easily and does not include any item that is closed in or concealed including flooring, walls, ceiling, framing, plumbing, drainage, heating, ventilation, wiring and does not cover hidden piping, beams, bracing or support elements or any other item that would require physical removal of material (eg: floor coverings, furniture, appliances, personal property, vehicles, vegetation, debris or soil).

This report does not purport to be a structural or land stability survey. It assumes that all local authority building codes, regulations and by-law have been complied with, including all matters relevant to the Resource Management Act 1991, the Building Act 2004 unless otherwise noted in the report. The report does not cover accuracy of fence lines, boundary lines or survey pegs.

The B.I.C. has no liability for occupied/unoccupied homes and structures, and the inspection is only good until the inspector leaves the property. Disgruntled sellers/squatters often change the condition of the property and no guaranties will be made by The B.I.C.

This report is not a guarantee, warranty or any form of insurance.

2.1 Thermal Imaging Inspection Reports:

The Thermal Imaging Inspection report is a non invasive inspection using a Flir T200 camera and moisture readings are taken with a non invasive Trotec T650 Moisture meter.

2.2 The purpose of the inspections is to assess the general condition of the building based on a visual inspection as described in (2.0 Visual Inspection only), this report does not identify all past, present or future defects. Descriptions in this report of systems or appliances relate to existence only and not adequacy or life expectancy. Any area, component of the building or any item or system not specifically identified in this report as having been inspected was excluded from the scope of the inspection. This is not a weather tightness guarantee.

3.0 Concealed and Structural Defects

The B.I.C. does not assess and is not liable for defects concealed by walls, linings or within areas of the building that requires physical removal of material or belongings. This report relates only to those areas that could be reasonably accessed. Reasonable access that is safe and unobstructed and has a minimum clearance of 450-400mm opening access door that can be safely accessed from a 3.6meter ladder in the ceiling space and a 500 x 400mm access and crawl space of 500mm vertical clearance for the sub floor area. Roof access must be able to be accessed safely from a 3.6meter ladder. If minimum clearance is not available, the area should be within the inspector's unobstructed line of vision.

3.1 The B.I.C. does not assess and is not liable for defects arising from latent defects in the building, in fixtures or fittings attached to the building; the soundness of the structure of the building; or the presence of any rot, borer, other pest infestation, or any other hidden defects.

4.0 Asbestos

The B.I.C. does not assess the presence of asbestos in the building.

5.0 Water Damage

The B.I.C. does not use an invasive water meter when inspecting the building. The B.I.C. has no liability for buildings constructed without a wall/framing cavity. Signs of water ingress and potential problem areas such as, Timber floors, Window frames and around showers are checked. Rotted Timber framing can only be detected by invasive testing and that would require the removal of interior and exterior wall linings. This would only be carried out with written permission from the owner of the property. No Liability can be assessed for any defect relating to the Leaky building syndrome.

The B.I.C. is not liable for any loss, cost defect or damage to any building or structure whether identified or not in the Building inspection, nor any claim, defence cost or inquiry cost which is directly related to or caused by the following.

"The actions or effects of mould, fungi, mildew, rot, decay, micro organisms, bacteria or similar or like forms in any building structure or

"The failure of any building or structure to meet or conform to the requirements of the New Zealand Building Code contained in the



TERMS AND CONDITIONS (Continued)

first schedule to the Building Regulations 1992 (or any amendment or substitution therefore in relation to: 1: external water or moisture or 2: either durability or protection from external water or moisture penetrating that building or structure or the effects: or any failure to discover or identify any defect or damage referred to in 1-2

6.0 Electrical Wiring, Appliances and Plumbing

This report does not include the structural, electrical, plumbing or gas piping plus fittings, home heating on the premises. Our consultants are not qualified to carry out this type of inspection. Arrangements can be made for qualified persons to carry out this type of reports if required.

7.0 Compliance with Legislation and Building Standards

This inspection does not include compliance with the NZ Building Code including the Codes Weather Tightness requirements, or structural aspects. Any suspected unauthorized work will be stated in the report but the client will need to cross reference with the Lim report, The B.I.C. holds no liability for any unauthorized, non permitted compliance work, identified in the report or not.

7.1 The Report cannot be construed as support by The B.I.C. for the use of any non-approved appliances (including swimming pools and spas). The B.I.C. recommends that any such non-approved appliance be removed or replaced with an approved appliance, and that all required consents be obtained before installation.

8.0 Use of the Report

This Report is prepared and provided for the private and confidential use of the Client, their solicitor, insurer or lender and does not purport to be anything other than a visual inspection. This Report may not be copied, reproduced, passed on or sold on, in whole or in part or in any form whatsoever unless specifically authorised in writing by The B.I.C. The format and the content of the report remains the property of The B.I.C.

8.1 This report may not be used or relied upon by any person other than the Client unless specifically authorised in writing by The B.I.C.

8.2 The B.I.C. is not liable for any reliance placed on the Report, or any direct, indirect or consequential loss suffered by any person other than the Client.

9.0 Consumer Guarantees Act 1993

Nothing in these terms shall be deemed to exclude or restrict any rights or remedies the Customer may have under the Fair Trading Act 1986 or the Consumer Guarantees Act 1993 unless Customer intends to use the Report for business purposes.

10.0 Limitation of Liability

Subject to clause 10, where permitted by law:

(a) If the Client intends to use the Report for business purposes, the guarantees under the Consumer Guarantees Act 1993 does not apply;

(b) The B.I.C. its employees and agents exclude all statutory and common law conditions, guarantees and warranties; will not be bound by any representations made unless they are in writing; and will not be liable to the Customer for any claim for breach of Statute or breach of duty in Tort (including negligence) or for any claim in Equity or otherwise at law for any losses or damages whether general, exemplary, punitive, direct, indirect or consequential in respect of the services provided under this agreement and:

(c) the Client's sole remedy against The B.I.C. will be limited to breach of contract and The B.I.C.'s sole and total liability for any such claim shall be limited to the amount of the Report fee in relation to the services provided.

11.0 Payment

The client acknowledges that they are liable for the full cost of the inspection and will pay The B.I.C. in full on receipt of the report and/or invoice unless other wise arranged and agrees to pay in full for verbal only inspections at time of inspection.

11.1 If the Client fails to make payment on receipt of the report and/or invoice, then The B.I.C. shall, in addition to any other remedy, charge penalty interest of 4% per month from the date of delivery. The Client shall pay all costs and disbursements (including legal costs on a solicitor-client basis) incurred by The B.I.C. in recovering or attempting to recover any amounts outstanding under this agreement.

Reading Of This Report Indicates The above Terms and Conditions have been read and agreed to.



Description Of Property

North Elevation .



East Elevation .



South Elevation .



West Elevation .





Description Of Property (Continued)

Description Of Property

This is a single level property consisting of three bedrooms, two bathrooms and separate double garage.

There have been a number of alterations and additions over the years with the most significant addition being the separate lounge and semi enclosing the pergola area over the deck, other alterations have been done but difficult to determine without the original floor plans.



Construction Type

Timber Structure / Summer Hill Stone Cladding / Corrugated Iron Roof

Floor Construction

Timber Structure / T&G Flooring



Kitchen


Kitchen



Ceiling: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.



Walls: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.

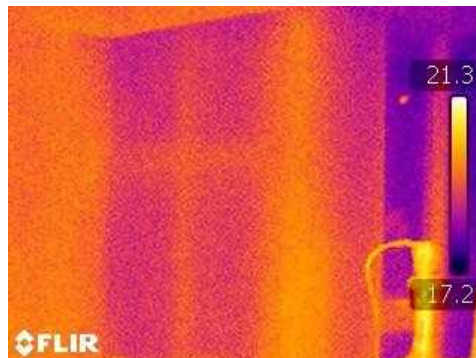



Kitchen (Continued)

Walls: (continued)



Floor: Engineered Planks

Windows: Aluminum Single Glazed (standard glass)

Lights/Switch: Operational

Electrical Sockets: All accessible sockets were operational

Hobs: Fisher & Paykel- Operational at time of inspection but thermostats are not verified.

Oven: Westinghouse- Operational at time of inspection but thermostats are not verified.

Ventilator: Brand Unknown (operational)

Dishwasher: Fisher & Paykel (operation not tested)

Refrigerator Space: 950mm wide X 1905mm high

Sink: Stainless Steel

Sink Waste: UPVC



Kitchen (Continued)

Waste Disposal: In-Sinkerator (operational)

Counter Tops: Granite / Formica - The splash back tiles should be silicone sealed against the bench top to create a water tight seal.



Cabinets: Melamine

Smoke Detector: Battery Operated (operation not tested)



Living Space

Open Plan Dining Living Space



Ceiling: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.




Walls: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.





Living Space (Continued)

Walls: (continued)

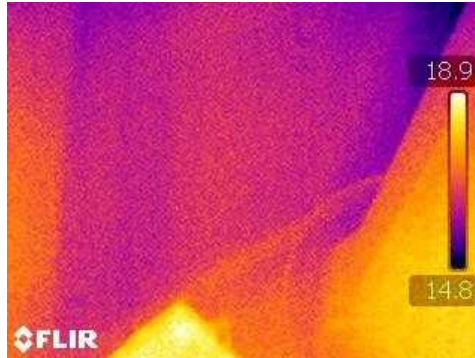

Floor: Engineered Planks

External Doors: Aluminum Single Glazed (standard glass) - The handles are broken but still lockable at time of inspection, this will need replacing in the near future.



Windows: Aluminum Single Glazed (standard glass)

Lights/Switch: Operational


Electrical Sockets: All accessible sockets were operational

Ventilation: HRV



Living Space (Continued)


Study (off dining area) Living Space

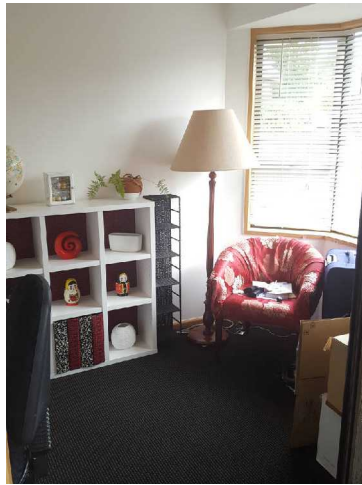

Ceiling: Plaster Board- Area of missing insulation as indicated in the thermal image.




Walls: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.

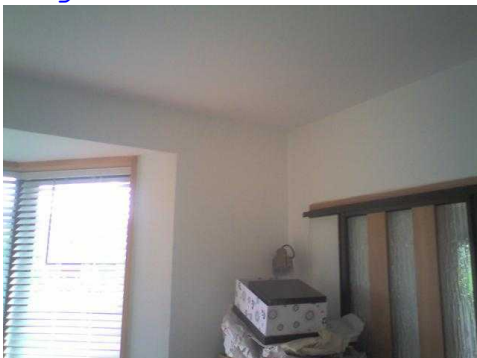



Living Space (Continued)

Walls: (continued)

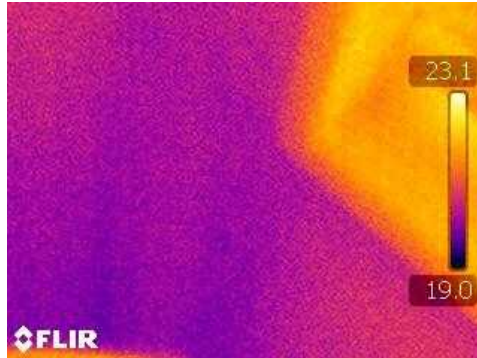

Floor: Carpet

Internal Doors: Aluminum Sliding (standard glass)

Windows: Aluminum Single Glazed (standard glass)

Lights/Switch: Operational

Electrical Sockets: All accessible sockets were operational





Living Space (Continued)

Separate Lounge Living Space





Ceiling: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.

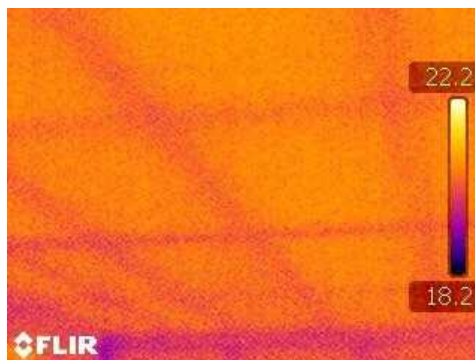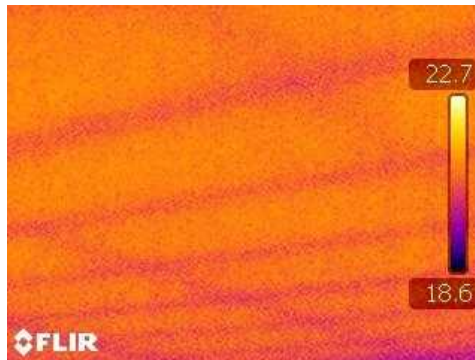



Living Space (Continued)


Walls: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.

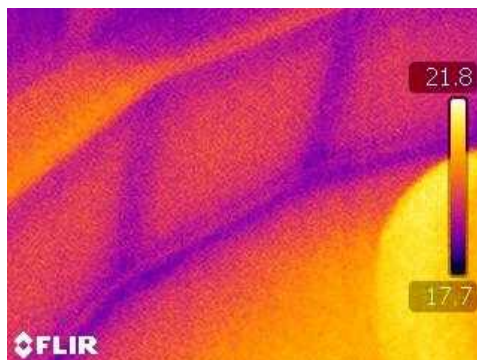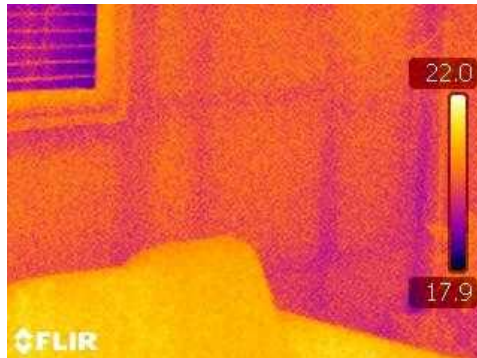



Living Space (Continued)

Walls: (continued)

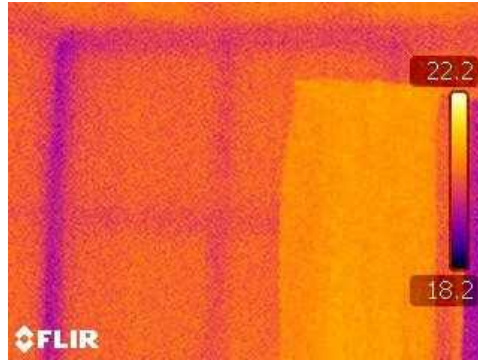

Floor: Carpet

Internal Doors: Aluminum Sliding (standard glass)

External Doors: Aluminum Single Glazed
(standard glass) - The handle is broken and
unable to lock, recommend replacing.



Windows: Aluminum Single Glazed (standard glass)

Lights/Switch: Operational

Electrical Sockets: All accessible sockets were operational

Ventilation: HRV



Living Space (Continued)

Sun Room Living Space



Please Note: This room is not a consented living space, the pergola over the deck has been nearly fully enclosed with some areas open to the elements.

Ceiling: Corrugated Plastic Roofing

Walls: Fiber Cement Board

Floor: Plywood (over decking)

External Doors: Timber Single Glazed (standard glass)

Windows: Aluminum Single Glazed (standard glass)





Common Area

Hallway Common Area



Ceiling: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.

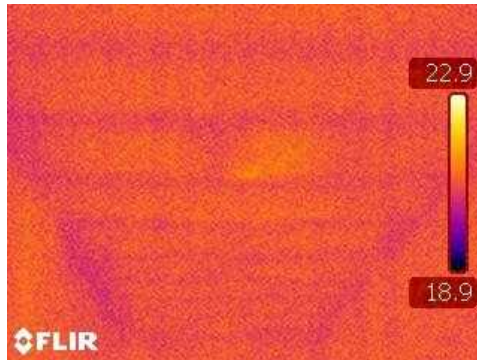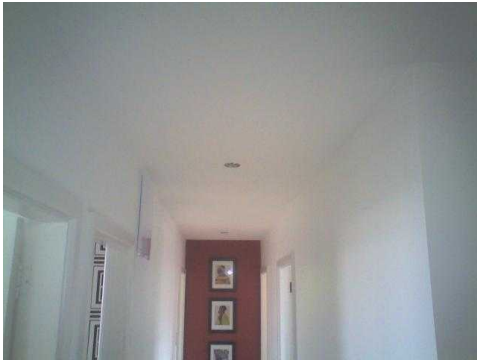

Walls: Plaster Board

Floor: Carpet

Internal Doors: Hollow Core

Lights/Switch: Operational

Electrical Sockets: All accessible sockets were operational



Common Area (Continued)

Smoke Detector: Battery Operated (operation not tested) - Recommend fitting a second smoke detector at the bedroom end of the hallway (smoke detectors should be no more than 3m from all bedroom doors).

Heating: Radiant Panel- Operational at time of inspection but thermostats are not verified.





Bedroom


1st Right Bedroom



Wardrobe: Double

Wardrobe Doors: Aluminum Sliding



Ceiling: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.

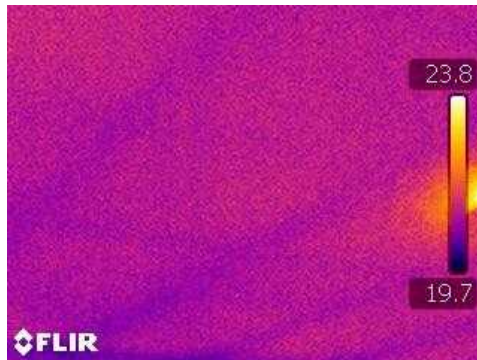



Bedroom (Continued)

Walls: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.

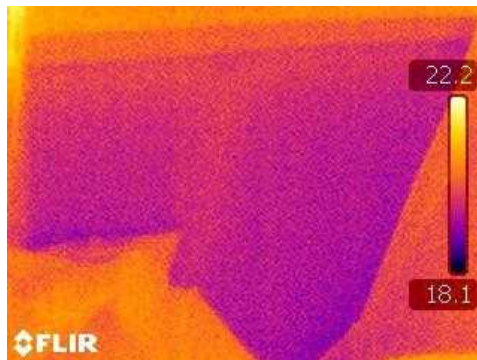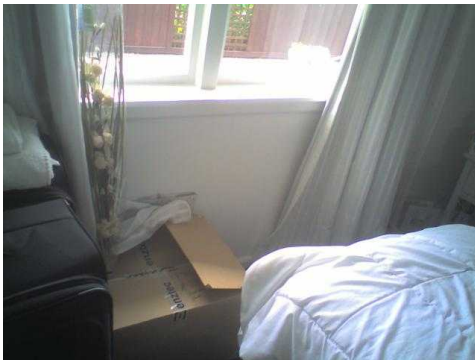

Floor: Carpet

Internal Doors: Hollow Core

Windows: Timber Single Glazed (standard glass)

Lights/Switch: Operational


Electrical Sockets: All accessible sockets were operational

Ventilation: HRV



Bedroom (Continued)



2nd Right Bedroom

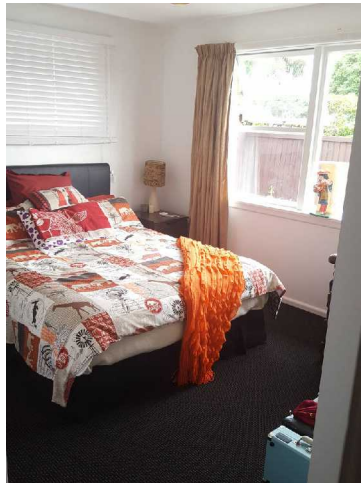

Wardrobe: Double

Wardrobe Doors: Aluminum Sliding





Ceiling: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.

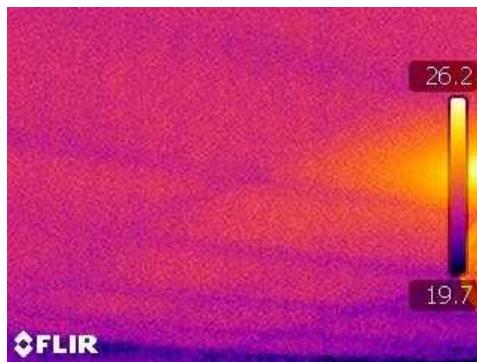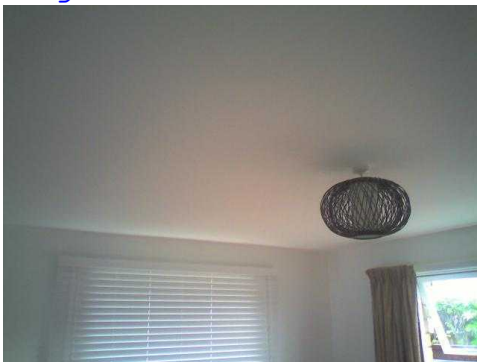



Bedroom (Continued)

Walls: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.

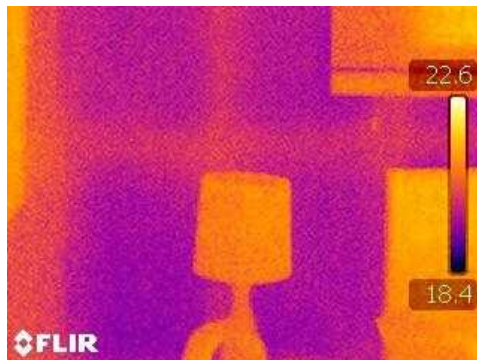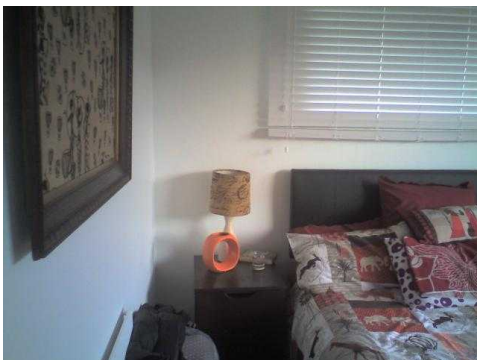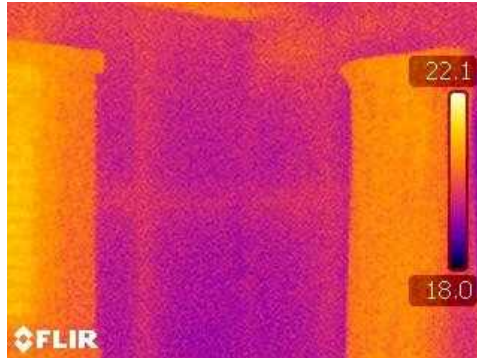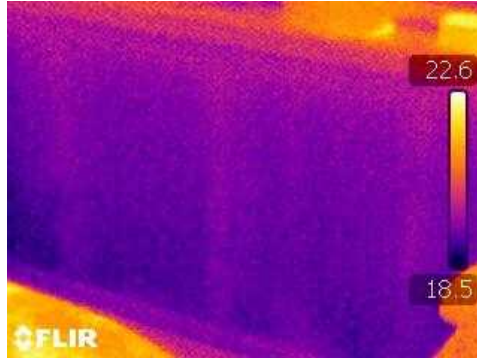

Floor: Carpet

Internal Doors: Hollow Core

Windows: Timber Single Glazed (standard glass)



Bedroom (Continued)

Lights/Switch: Operational

Electrical Sockets: All accessible sockets were operational

Heating: Radiant Panel (operation not tested)



Ventilation: HRV



Bedroom (Continued)

1st Left (master) Bedroom



Wardrobe: Double

Wardrobe Doors: Aluminum Sliding

Ceiling: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.





Bedroom (Continued)

Walls: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.



Floor: Carpet

Internal Doors: Hollow Core

Windows: Timber Single Glazed (standard glass)



Bedroom (Continued)

Lights/Switch: Operational

Electrical Sockets: All accessible sockets were operational

Heating: Radiant Panel- Operational at time of inspection but thermostats are not verified.



Ventilation: HRV




Bathroom


Family Bathroom



Ceiling: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.

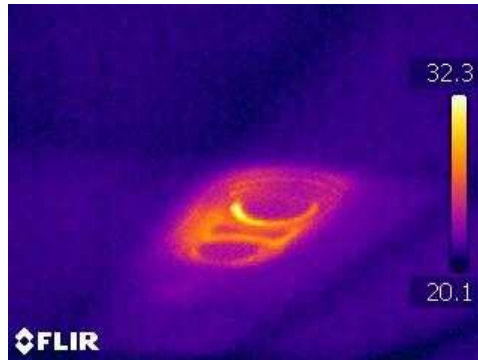


Walls: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.

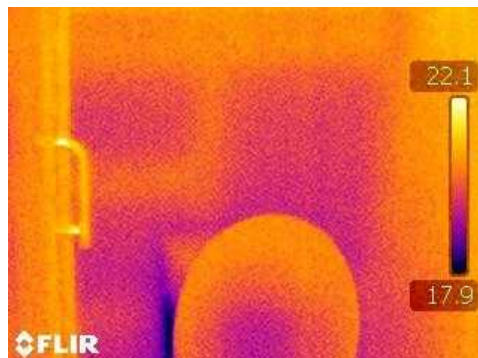



Bathroom (Continued)

Walls: (continued)

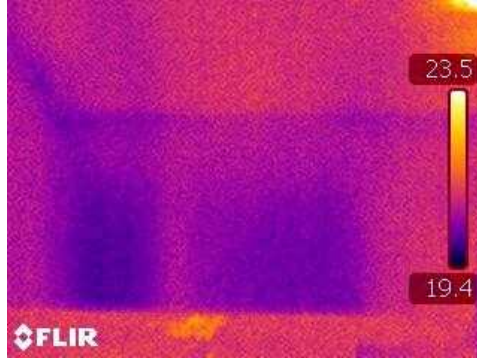

Floor: Vinyl

Internal Doors: Hollow Core

Windows: Timber Single Glazed (standard glass)

Lights/Switch: Operational

Vanity: Melamine (ceramic top) - The splash back tiles should be silicone sealed against the vanity top to create a water tight seal.





Bathroom (Continued)

Vanity Taps: Mixer

Vanity/Basin Waste: UPVC

Mirror: Picture Framed

Shower: Acrylic Cubicle (safety glass)

Toilets: Dual Flush

Ventilation: Electric Ventilation Fan (operational)

Heater: Heat Lamps (operational)



Bathroom (Continued)


Master Ensuite Bathroom



Ceiling: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.



Walls: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.

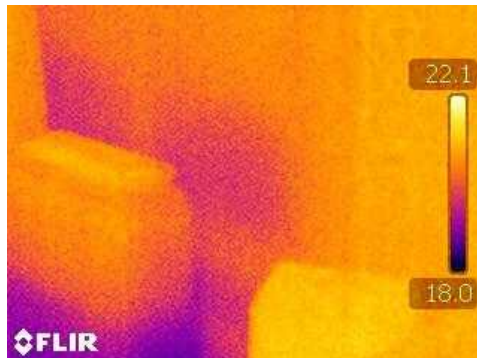



Bathroom (Continued)

Floor: Engineered Planks

Internal Doors: Hollow Core- The door needs to be adjusted as it will not fully close due to rubbing on the floor, the door hardware is missing also.



Windows: Timber Single Glazed (standard glass)

Lights/Switch: Operational

Electrical Sockets: All accessible sockets were operational

Vanity: Timber (ceramic bowl) - The bowl should be silicone sealed against the tiles to create a water tight seal.



Vanity Taps: Mixer

Vanity/Basin Waste: UPVC

Mirror: Picture Framed



Bathroom (Continued)

Shower: No Shower

Bath: Moulded Plastic (spa operation not tested) - The perimeter of the bath should be silicone sealed against the walls to create a water tight seal.



Bath Taps: Mixer

Toilets: Duel Flush

Ventilation: Window




Laundry Room/Area

Back Entrance Laundry Room/Area



Cupboard: Melamine

Ceiling: Plaster Board- No insulation over the access cover as indicated in the thermal image.

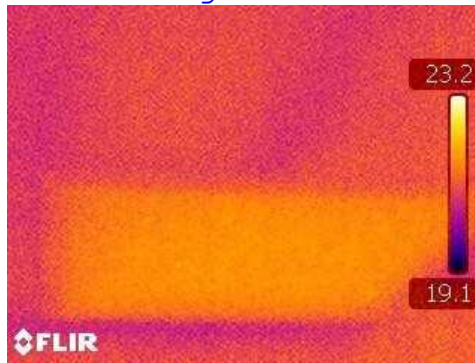

Walls: Plaster Board- Typical thermal image with no significant thermal abnormalities at time of inspection.



Laundry Room/Area (Continued)

Walls: (continued)



Floor: Vinyl

Internal Doors: Hollow Core

External Doors: Timber Single Glazed (standard glass)

Windows: Aluminum Single Glazed (standard glass)

Lights/Switch: Operational

Electrical Sockets: All accessible sockets were operational

Laundry Tub: Aquatica

Tub Taps: Mixer

Laundry Tub Waste: UPVC

Dryer Vent: No Dedicated Ventilation

Ventilation: Window



Heating System

Heating System

Type: Air Conditioning Heat Pump-
Operational at time of inspection but
thermostats are not verified.

Manufacturer: Fujitsu

Location: Dining Area

Exterior Unit:





Water Heating

Water Heater

Type: Gas- Operational at time of inspection
but thermostats are not verified.



Manufacturer: Rinnai

Location: Exterior **Capacity:** Continuous

Approximate Age: Unknown **Area Served:** Entire House



Electrical

Electric Panel

Power On Yes

Switch Board Location: Hallway- New switch board recently installed (electrical certificate was sighted).



Electrical Sockets: All accessible sockets throughout the house were tested at time of inspection, all the sockets that were tested were operational.





Ceiling Space

Ceiling Space

Access Location: Laundry



Method of Inspection: In The Ceiling Space

Access: 575mm X 580mm

Roof Framing: Rafter



Roof Cladding: Not Sighted

Roofing Underlay: Timber Sarking

Ceiling Construction: 4 x 2 Timber

Ventilation Unit: HRV- Filters recently changed as mentioned by the vendor during inspection.

Insulation: Vermiculite / Loose Fluff / Batts- Some areas of insufficient or missing insulation as well as some areas of good coverage. Recommend adding insulation where needed.

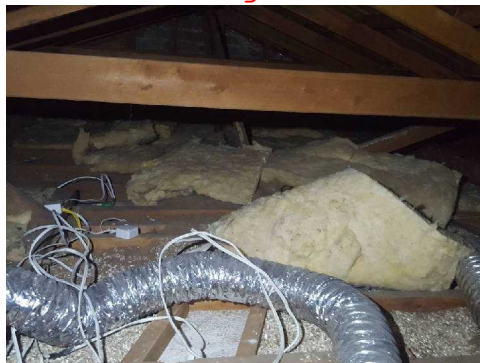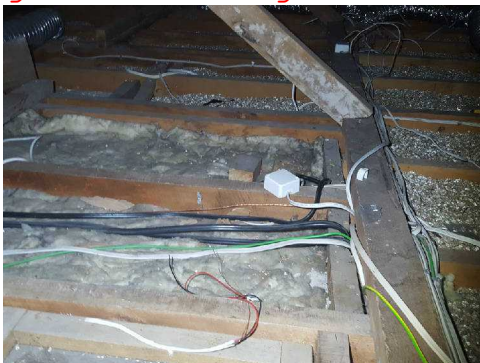



Ceiling Space (Continued)

Insulation: (continued)




Header Tank: Concrete (disconnected) –
Recommend securing in position or removing
from the ceiling space.



Electrical: Thermoplastic-Sheathed Cable (TPS) – The wiring
should be secured as not to be a trip hazard near the access
point.

Also noted electrical wiring in contact with polystyrene,
these two materials often react with each other.

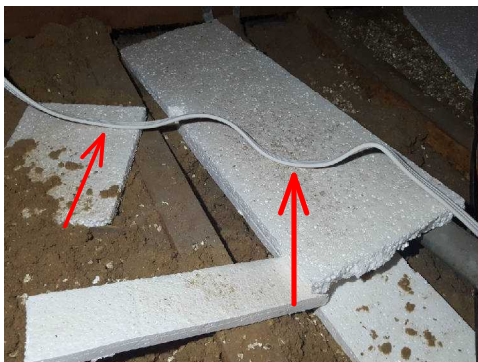



Ceiling Space (Continued)

Plumbing: None Sighted

Kitchen Fan Venting: Ducted To The Exterior

Bathroom Fan Venting: Ducted To The Exterior

Storage: No Storage Flooring

Pests: No Evidence Sighted



Sub Floor

Sub Floor

Access Location: 1st Right Bedroom
Wardrobe



Method of Inspection: In The Subfloor Space

Access: 330mm X 425mm (average ground clearance 350mm)

Ground Condition: Damp In Some Areas-
Recommend fitting a ground cover moisture
barrier to reduce any rising damp.



Ventilation: Vents

Insulation: Polystyrene- Small area of insulation below master
bedroom but has been fitted upside-down.
Insulating foil to the lounge extension.





Sub Floor (Continued)

Piles: Concrete (wire secured)

Flooring/Structure: Timber Structure/T&G Timber Flooring

Plumbing Waste: UPVC

Plumbing Water: Polybutylene / Galvanized

Electrical: Thermoplastic-Sheathed Cable (TPS)

Debris: Construction and renovation debris left on the ground may attract pests/insects such as but not limited to borer, recommend removing.



Pests: No Evidence Sighted

Foundation Perimeter: Concrete



Roof

Roof Surface

Method of Inspection: On Roof

Material: Original Corrugated Iron With Lead Head Nails- Tape covering old roof penetration hole, recommend repairing sufficiently.

A number of lifting nails typical for age.

Areas of significant rust (rust may be more extreme beneath the joints) recommend a qualified roofer to advise on repair or replace. (not all nails or rust spots photographed).





Roof (Continued)

Material: (continued)



Spouting: Plastic

Downpipes: Plastic



Exterior

Exterior Surface

Type: Summer Hill Stone



Exterior Surface

Type: Timber



Fascia: Timber

Soffits: Fiber Cement Board

Windows: Aluminum and Timber

Storm Water Risers: Clay- No storm water riser on the East corner, the downpipe discharges onto the garden.

No guarantees can be given in regards to the integrity of the under ground pipes (if any) due to seismic or historical damage.

Due to the seismic events it is advisable to have the under grounds drains cctv inspected.



Exterior (Continued)

Storm Water Risers: (continued)



Gully Traps: Clay- No guarantees can be given in regards to the integrity of the under ground pipes due to seismic or historical damage although no sign of blockage at time of inspection. Due to the seismic events it is advisable to have the under grounds drains cctv inspected.



Foundation: Concrete Ring Footing- Minor cosmetic cracking typical for age.





Garage

Limited internal inspection due vendors belongings.

Garage



Type of Structure: Separate **Car Spaces:** 2

Garage Doors: Metal Tilt

Garage Door Reveals: Timber

Door Operation: Mechanized

Door Opener: Dominator

Roof: Corrugated Iron

Roof Structure: Truss

Ceiling: Exposed Framing

Walls: Concrete Block

Floor/Foundation: Concrete- The garage floor is at the same level as the driveway with evidence of water pooling.





Garage (Continued)

Spouting: Plastic- No spouting on the boundary side.



Downpipes: Plastic

Storm Water Risers: Plastic



Lots and Grounds



Driveway: Asphalt

Paths: Concrete

Deck: Timber

Grading: Flat

Vegetation: Trees and Shrubs

Fences: Timber Paling (up to 1.8m) - Raised gardens and soil against the fence will accelerate deterioration (bottom rails below ground level in some areas).

Other areas of maintenance required typical for age.





Certificate Of Inspection

CERTIFICATE OF INSPECTION IN ACCORDANCE WITH NZS 4306:2005

File Name: 11 Dunster Street

Site Address: 11 Dunster Street, Christchurch

Inspection Company: THE Building Inspection Company Ltd

Inspector's Name: Chris Westeneng

Inspector's Qualifications: Qualified Carpenter With Over 18yrs Experience - Qualified Level 1 Thermographer

The Following Areas Of The Property Have Been Inspected -

Site: Yes

Subfloor: Yes

Exterior: Yes

Roof Exterior: Yes

Roof Space: Yes

Interior: Yes

Services: Yes

Accessory Units, Ancillary Spaces and Buildings: Yes

I hereby certify that I have carried out the inspection of the property site at the above address in accordance with NZS 4306:2005 Residential Property Inspection - and I am competent to undertake this inspection.

Signature

Date 11/01/17

An inspection carried out in accordance with NZS 4306:2005 is not a statement that the property complies with the requirements of any act, regulation or bylaws, nor is the report a warranty against any problems developing after the date of the property report. Refer to NZS 4306:2005 for full details.



Summary Of Features Inspected

Visual Inspection Only!

SITE :

Orientation Of Building Spaces Yes
Site Exposure, Contour & Vegetation Yes
Retaining Walls Not Applicable
Paths, Steps, Handrails & Driveways Yes
Fencing Yes
Surface Water Control Yes

SUBFLOOR :

Location Of Access Points Yes
Accessibility Yes
Foundation Type and Condition Yes
Foundation Walls Yes
Ground Condition Yes
Ground Vapour Barrier Not Applicable
Drainage Yes
Ventilation Adequacy Yes
Pile Type, Instability & Condition Yes
Pile To Bearer Connections Yes
Obvious Structural Alterations Yes
Ground Clearance Of Timber Framing Yes
Floor Type (timber or suspended concrete) Yes
Timber Framing & Bracing Yes
Insulation Type, Approx Thickness & Coverage Yes
Plumbing - Material, Types, Leaking & Support Yes
Electrical Types & Support Yes
Insect & Pest Infestation Not Applicable
Rotten Timbers Not Applicable
Debris Yes

Exterior :

Construction Type Yes
Cladding Yes
Chimneys Not Applicable

Interior :

Ceilings Yes
Walls Yes
Timber Floors Yes
Concrete Floors Not Applicable
Doors & Frames Yes
Electrical - Operation Of Switches, etc Yes
Heating Systems Yes
Kitchen Yes
- Bench Top Yes
- Cabinetry Yes
- Sink Yes
- Tiles Yes
- Air Extract Systems Yes
Bathrooms, WC, Ensuite Yes
- Floor Yes
- Cistern, Pan, Bidet Yes
- Tiles Yes
- Bath Yes
- Shower Yes
- Vanity/Washbasin Yes
- Ventilation Yes
- Special Features Not Applicable



Summary Of Features Inspected (Continued)

Laundry	Yes	Plumbing Types, Leaking, Support	Yes
- Location	Yes	Electrical Types & Support	Yes
- Floor	Yes	Tile Fixings	Not Applicable
- Tubs/Cabinet	Yes	Services :	
- Tiles	Yes	Fire Warning & Control Systems	Yes
- Ventilation	Yes	Heating Systems	Yes
Storage	Yes	Central Vacuum Systems	Not Applicable
Stairs	Not Applicable	Ancillary Spaces :	Garage
Exterior Windows & Doors	Yes	Exterior Cladding	Yes
Exterior Stairs	Not Applicable	Roofs	Yes
Balconies, Verandas & Patios, etc	Yes	Floors	Yes
Roof	Yes	Subfloor	Not Applicable
Roof Material	Yes		
Roof Construction	Yes		
Roof Water Collection	Yes		
Downpipes	Yes		
Eaves, Fascia & Soffits	Yes		
Roof Space :			
Accessibility	Yes		
Roof Cladding	No		
Thermal Insulation, Type, Clearance, Approx Thickness & Coverage	Yes		
Sarking	Yes		
Party Walls, Fire Protection	Not Applicable		
Roof Underlay & Support	Yes		
Roof Construction	Yes		
Ceiling Construction	Yes		
Obvious Structural Alterations	Yes		
Insects & Pest Infestation	Yes		
Rotting Timbers	Not Applicable		
Discharges into Roof Space	Yes		



Final Comments

All moisture readings taken during the inspection were taken using a 'Trotec T660' moisture meter. Readings are qualitative not quantitative, meaning measurements are comparative to surrounding surfaces and are not a percentage of moisture present. The Trotec T660 moisture meter reads up to 40mm deep.

Generally readings above 45.0 are regarded as damp and readings above 80.0 are regarded as wet depending on the density of the material being tested.

All non invasive moisture readings taken during inspection were regarded as dry.

The Flir T200 thermal imaging camera emissivity setting at time of inspection was 0.98

Please note it is not always easy to see the thermal abnormalities, if there are any issues noted it will be stated in the report and is not up to the reader to interpret the image.

Some areas of moisture ingress may go undetected due to the limitations of the tools used as well as the nature of some leaks and/or lack of sufficient rain fall.

No guarantee can be given in regards to the integrity of the timber framing due to past, present or future leaks as well as pest/insect infestation.



Executive Summary

This item needs to be brought to your attention! It may not be defective or require repair but is important to bring to your attention.

Living Space

Open Plan Dining Living Space External Doors: Aluminum Single Glazed (standard glass)- The handles are broken but still lockable at time of inspection, this will need replacing in the near future.

Separate Lounge Living Space External Doors: Aluminum Single Glazed (standard glass)- The handle is broken and unable to lock, recommend replacing.

Bathroom

Master Ensuite Bathroom Internal Doors: Hollow Core- The door needs to be adjusted as it will not fully close due to rubbing on the floor, the door hardware is missing also.

Ceiling Space

Ceiling Space Insulation: Vermiculite / Loose Fluff / Batts- Some areas of insufficient or missing insulation as well as some areas of good coverage. Recommend adding insulation where needed.

Ceiling Space Electrical: Thermoplastic-Sheathed Cable (TPS)- The wiring should be secured as not to be a trip hazard near the access point. Also noted electrical wiring in contact with polystyrene, these two materials often react with each other.



Executive Summary (Continued)

Sub Floor

Sub Floor Debris: Construction and renovation debris left on the ground may attract pests/insects such as but not limited to borer, recommend removing.

Roof

Roof Surface Material: Original Corrugated Iron With Lead Head Nails- Tape covering old roof penetration hole, recommend repairing sufficiently.

A number of lifting nails typical for age.

Areas of significant rust (rust may be more extreme beneath the joins) recommend a qualified roofer to advise on repair or replace. (not all nails or rust spots photographed).

Garage

Garage Floor/Foundation: Concrete- The garage floor is at the same level as the driveway with evidence of water pooling.