
Solar ESS Co. Ltd.
53 Moo 2 Tambon Nanglae, Amphoe Muang, Chiang Rai 57100
Tel 063 151 6694, 089 632 5829
www.solaress.org · www.โซลาร์เอสส์.com

INSTALLATION MANUAL

STR-02 Ground-Mount Structure — 45 Panels on 36 Screw Piles

Reference design · low ground mount for 45 × 650 W panels · Chiang Rai area

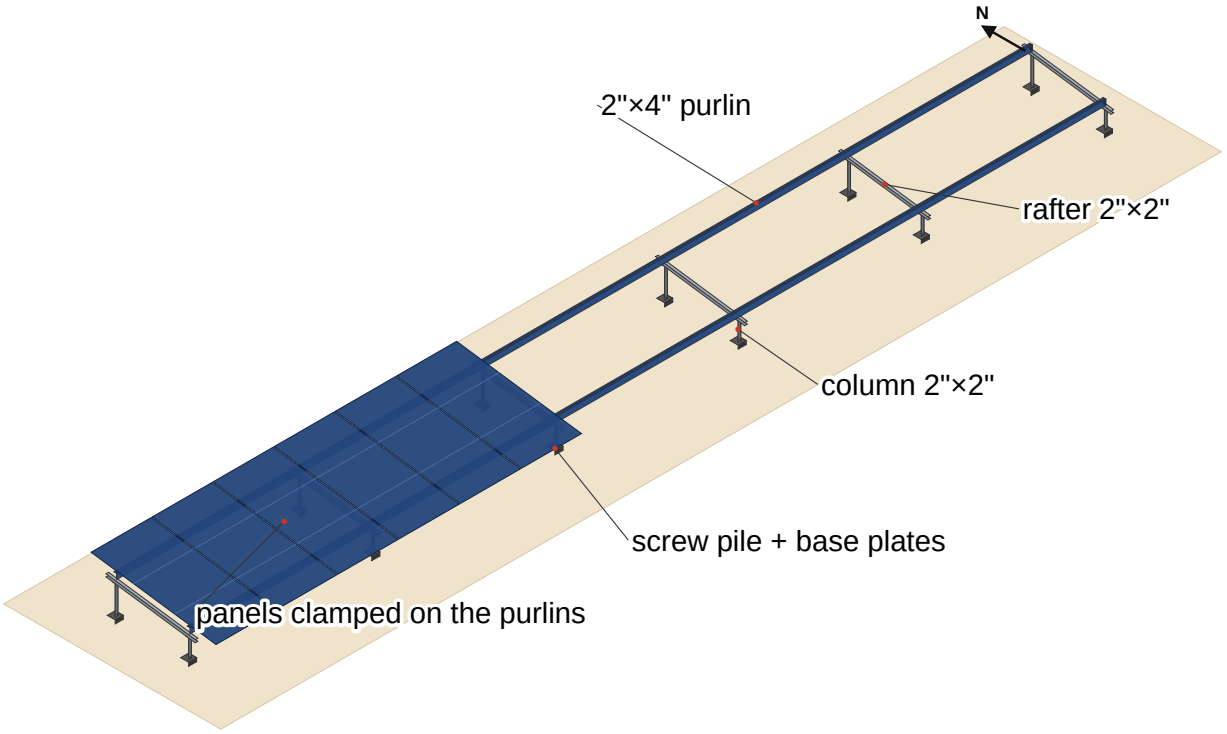


One row of 15 panels (6 shown) on 6 frames. Three rows make the full array.

Drawings	STR-02 drawings: Sheet 1 (footings), Sheet 2 (pile-to-column base), Sheet 3 (frame)
Array	3 rows × 15 panels, portrait, 8° facing south; panel edges 0.50 m (south) and 0.83 m (north)
Foundations	36 screw piles Ø 100 mm × 1.5 m, 6 per purlin line at 3.46 m; head plate 50 mm above ground
Frame	18 frames: 2"×2"×2.3 columns and rafters; 2"×4"×2.3 purlins (2 per row); panels clamped directly on the purlins
Document	MAN-STR02 · Rev02 · 31 October 2026 · issued by Solar ESS Working Group

Solar ESS Co. Ltd.
53 Moo 2 Tambon Nanglae, Amphoe Muang, Chiang Rai 57100
Tel 063 151 6694, 089 632 5829
www.solaress.org · www.โซลาร์เอสส์.com

1. System overview

Each support frame stands on two screw piles: a south column and a north column, joined at the top by a sloping rafter at 8°. A 2"×4" purlin runs east–west along the top of each line of columns, welded to every rafter. The panels are clamped straight onto the two purlins of their row. There are no concrete footings, rails or braces.

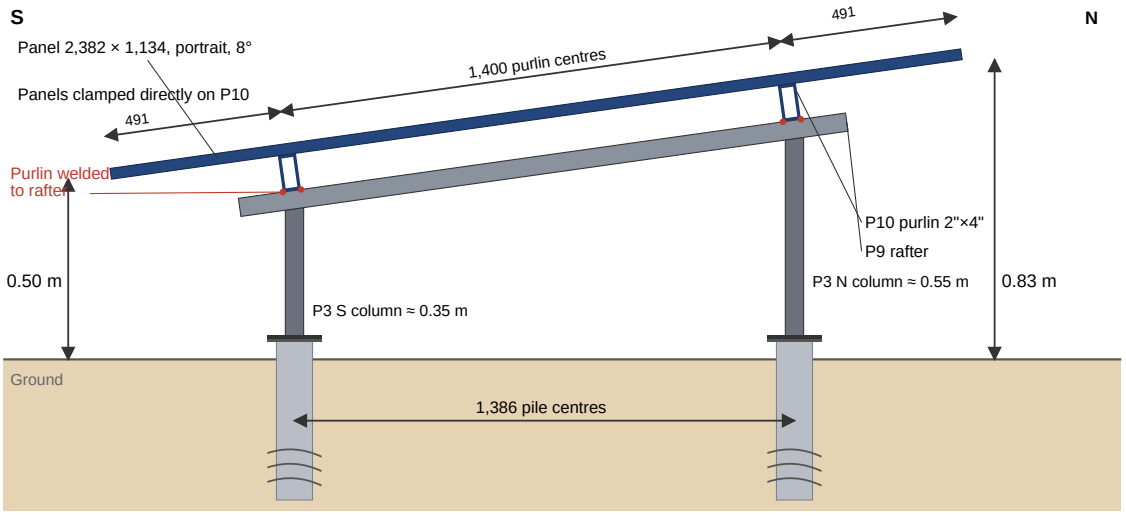

Section through one frame, looking west (Sheet 3, E5.1).

2. Parts

Ref	Part	Qty
A1/A2	Screw pile Ø 100 × 1,500 mm, 2.0 mm wall, HDG, with 150 × 150 head plate (4 slots Ø 15 × 30)	36
B1	Column base plate 150 × 150 × 10 mm, 4 slots 14 × 30	36
B2	Gusset 40 × 60 × 5 mm	144
B3–B5	M12 × 60 gr 8.8 HDG bolt + nut; plate washers 30 × 30 × 3 (2 per bolt); M12 spring washer	144 sets
B6	Levelling shims 150 × 150 × 1 / 2 / 3 mm	≈ 20
C1–C2	2"×2"×2.3 tube for columns (≈ 0.35 / 0.55 m) and rafters (1.70 m)	9 × 6 m
C3	2"×4"×2.3 tube for purlins (6 lines: 6.0 + 5.3 + 6.0 m)	18 × 6 m
C4	Backing strips for purlin butt welds, flat bar 40 × 3 × 100 mm (2 per joint, 12 joints)	24
D1–D4	Mid clamps; end clamps; M8 clamp bolts; M8 rivet nuts	84; 12; 96; 96
E1–E5	Zinc-rich paint; tube end caps 2"×2" and 2"×4"; E6013 electrodes; earthing lugs	2 L; 36 + 12; 5 kg; 3

3. Tools and safety

Tools


- Screw-pile driver with torque read-out, extension and adaptor
- Pull-out jack with frame and dial gauge; spring balance or load cell for the lateral test
- Laser level or water level, string lines, 30 m tape, spirit level
- Arc welder, E6013 2.6 mm electrodes, grinder with cutting and flap discs
- Drill with Ø 9 / 11 / 13 mm bits, M8 rivet-nut tool
- Torque wrench (25–80 N·m), spanners 13 / 17 / 19 mm

Safety


- Check for buried cables and pipes before setting out the piles
- Hard hat, safety shoes, gloves; welding mask and fire extinguisher at every welding point
- Keep hands clear of the pile driver while it turns; two people on the driver
- Paint welds only when cool; work in ventilated air
- Panels: lift by two people, never stand on panels, no work in strong wind or rain
- Keep the panel strings open-circuit until the system is commissioned

4. Step 1 — Set out the piles

1. Mark the array corners from the site plan (overall 17.3 m east–west × 8.3 m north–south, south at the bottom). Check the diagonals are equal.
2. Stretch one string line per pile line: two per row, 1.386 m apart north–south.
3. Mark 6 pile centres on each line at 3.46 m. Tolerance ± 20 mm along the line, ± 10 mm across it.

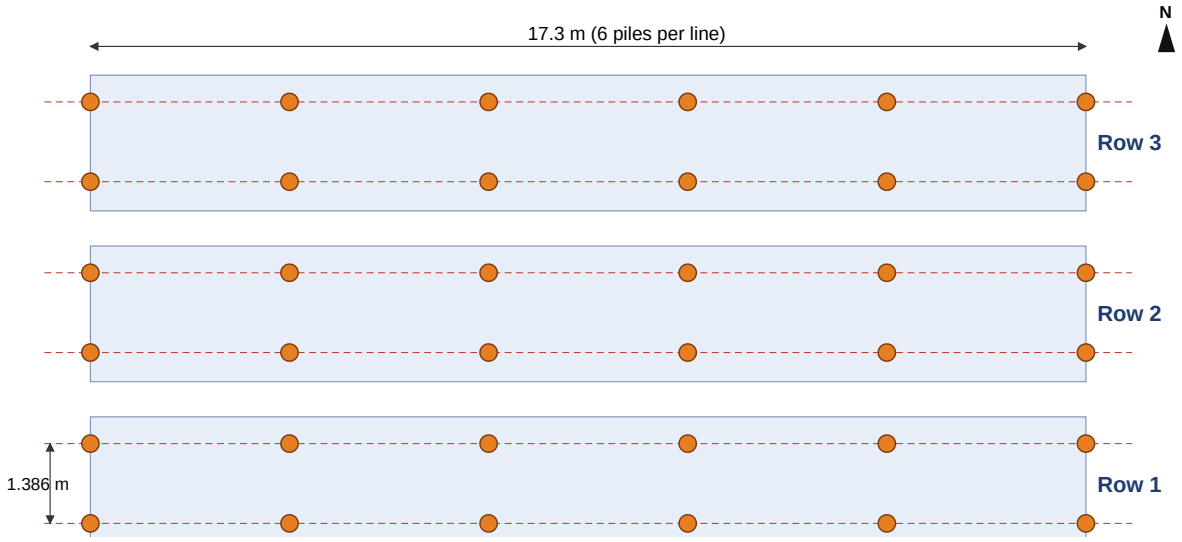


5. Step 2 — Install the screw piles

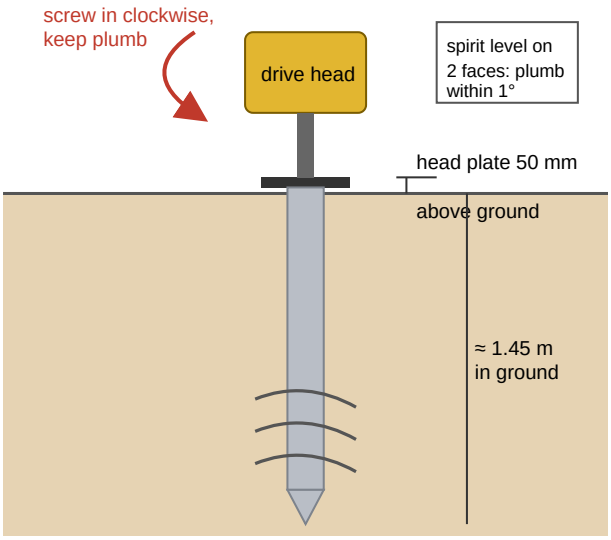


1. Start each pile on its mark with the driver, check it is plumb on two faces, then screw it in clockwise at a steady speed.
2. Stop when the head plate is 50 mm above finished ground (about 1.45 m in the ground). Do not back the pile out to adjust height; small differences are taken up when the columns are cut.
3. Turn the head plate so its slots lie on a diagonal of the row.
4. Write down the final torque of every pile.
5. If a pile stops early (rock or large stones), move it up to 100 mm along its line and try again. If it still stops, tell the site engineer: another pile or a concrete footing, designed by Solar ESS, is used at that support.


6. Step 3 — Site tests (before any panels)

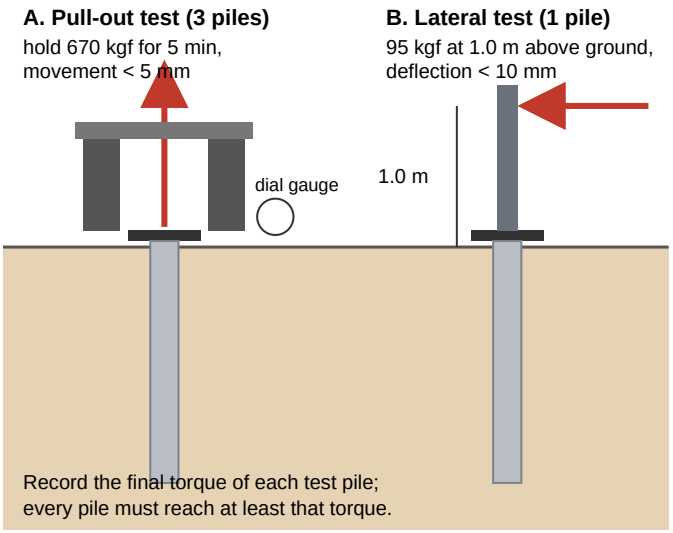

1. **Pull-out:** on at least three piles spread over the site, pull up with 670 kgf and hold for 5 minutes. Movement must be under 5 mm.
2. **Lateral:** on one pile, with a short post bolted on, push sideways with 95 kgf at 1.0 m above ground. Deflection must be under 10 mm.
3. Note the final torque of the test piles. Every other pile must reach at least that torque.
4. A failed test is solved by moving or adding a pile, or by a concrete footing designed by Solar ESS.


7. Step 4 — Base plates and columns

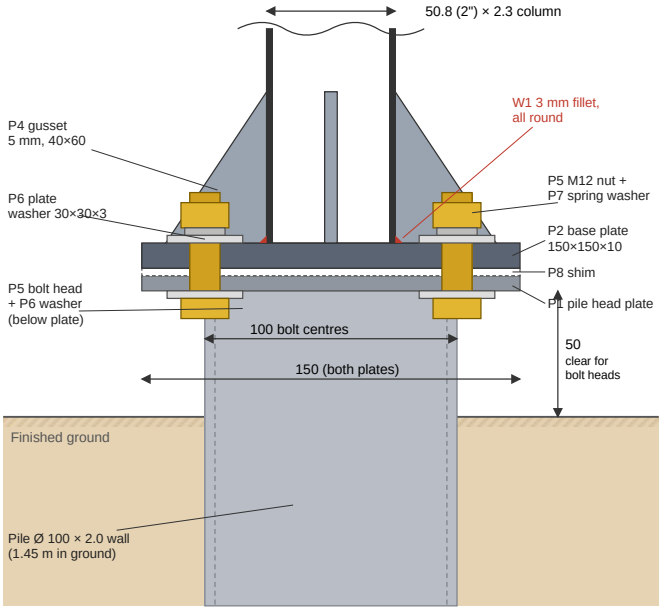

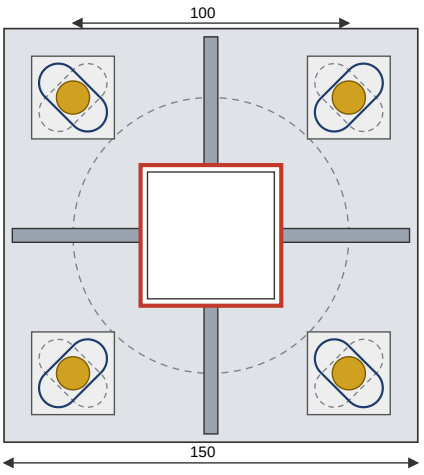


Plan on the base plate: base-plate slots at 90° to the pile slots give ± 7 mm adjustment both ways.

1. Measure the level of every head plate against the laser or string line.
2. Cut each column to its own length so its top meets the frame line: about 0.35 m (south) and 0.55 m (north). Cut the top at 8° to fit under the rafter.
3. Weld each column to the centre of a base plate (3 mm fillet all round) and add the 4 gussets.
4. Set the base plate on the head plate with shims if needed (6 mm total at most). Fit 4 × M12 × 60 bolts, heads below, with plate washers on both sides and a spring washer under the nut.
5. Line up the column on the string line, check it is plumb, then tighten the nuts to about 70 N·m.

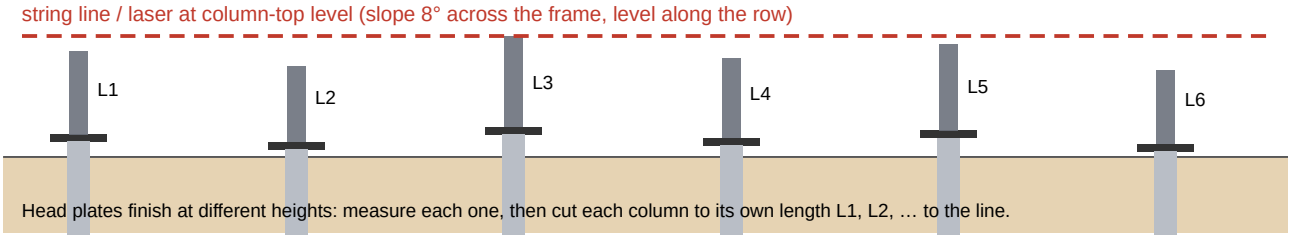

8. Step 5 — Rafters

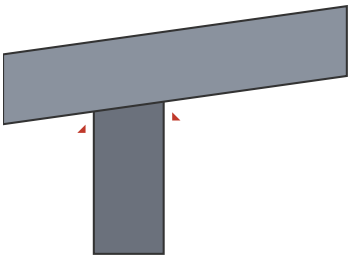

Column top cut at 8°; rafter welded on site, 3 mm fillet all round; zinc-rich paint, 2 coats

1. Cut 18 rafters of 1.70 m from 2"×2"×2.3 tube.
2. Lay each rafter across its south and north column tops, projecting 150 mm past each column, at 8°.
3. Tack-weld, check the slope and the frame line, then weld all round with a 3 mm fillet.
4. Fit end caps on the rafter ends.


9. Step 6 — Purlins



Purlin 2"×4"×2.3 continuous over 6 frames; panels clamped on top · vertical scale × 2.2

Row elevation looking south: 6 frames at 3.46 m, purlin weld joints at 6.0 m and 11.3 m (vertical scale × 2.2).

Purlin weld joint at 6.0 m and 11.3 m

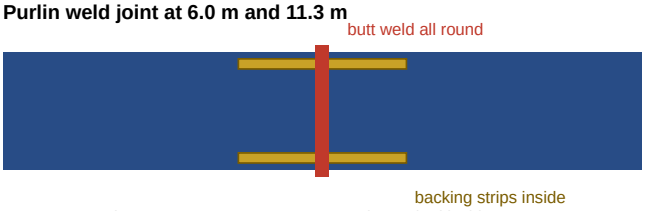


Square-cut ends, 2 mm gap, two 40 × 3 × 100 strips tacked inside on the long sides; full-penetration weld all round, grind flush, paint.

1. Cut each purlin line from three 6 m lengths: 6.0 + 5.3 + 6.0 m.
2. Lay the 2"×4" purlin with its long side upright on the rafters, directly above the columns, from end frame to end frame.
3. Join the lengths at 6.0 m and 11.3 m from the west end: square-cut the ends, set a 2 mm gap with two backing strips tacked inside, then make a full-penetration butt weld all round and grind it flush. Keep the joint straight with a straight-edge across it.
4. Check the purlin is straight (± 5 mm over the row), then weld it to each rafter with a 3 mm fillet on both sides of the crossing.


10. Step 7 — Corrosion protection and earthing

1. Chip and wire-brush every weld. Apply two coats of zinc-rich paint to all welds, cut ends and scratches.
2. Fit plastic end caps to all open tube ends (2"×2" rafters, 2"×4" purlins).
3. Bolt one earthing lug to a base plate in each row and connect it to the earth system.

11. Step 8 — Fix the panels

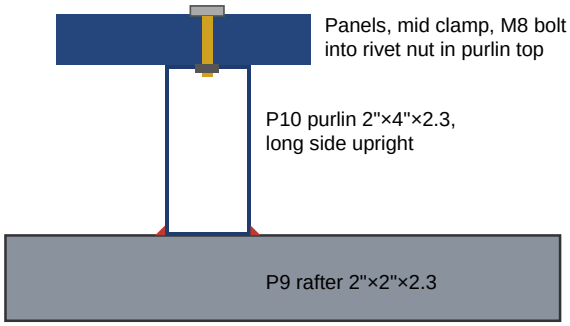

Purlin welded directly to the rafter: 3 mm fillet on both sides of the crossing (2 × 51 mm)

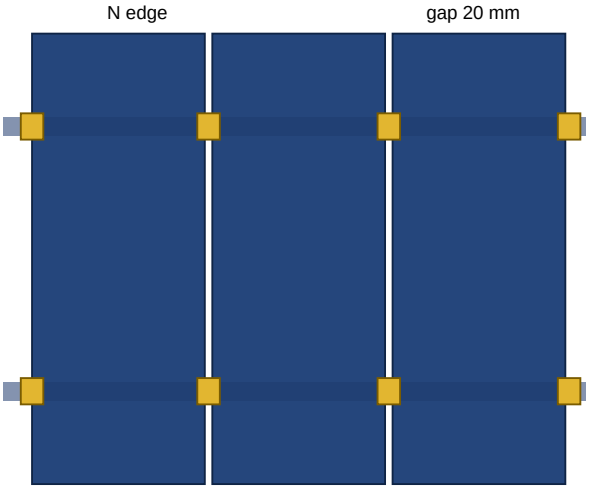

Yellow: clamps on the purlin lines (end clamps at row ends)

1. Mark the clamp positions on the top of each purlin: one at every panel joint and one at each row end (panel width 1,134 mm plus a 20 mm gap).
2. Drill Ø 11 mm (or as the rivet-nut maker says) and set an M8 rivet nut at each mark: 96 in total.
3. Lay the panels portrait, long sides north–south, with the purlins 491 mm from each panel end. Check this against the panel installation manual's clamping zone.
4. Fit the end clamps at the row ends and the mid clamps between panels. Tighten the M8 bolts to the clamp maker's torque (typically 14–18 N·m).
5. Check the panel edges finish at about 0.50 m (south) and 0.83 m (north) and that the row is straight.

12. Final inspection checklist

Item	Check	OK	Remarks
Pile positions	± 20 mm along the line, ± 10 mm across	☐	
Pile head plates	50 mm above ground; plumb within 1°; torque recorded	☐	
Site tests	3 pull-out (670 kgf, < 5 mm), 1 lateral (95 kgf at 1.0 m, < 10 mm)	☐	
Base bolts	4 per support, plate washers both sides, ≈ 70 N·m	☐	
Columns	Plumb within 1°; welds 3 mm all round; 4 gussets	☐	
Rafters	8° slope; 150 mm past each column; welds complete	☐	
Purlins	Straight ± 5 mm; welded at every rafter; butt welds at 6.0 / 11.3 m complete, ground and painted	☐	
Corrosion	All welds and cut ends painted twice; end caps fitted	☐	
Earthing	One lug per row connected	☐	
Panels	Clamps at every joint and end; bolts at torque; edges 0.50 / 0.83 m	☐	

13. Notes

- This manual follows the STR-02 drawings, Sheets 1–3. If the manual and the drawings differ, the drawings govern.
- All steel is SS400. All bolts are grade 8.8, hot-dip galvanized.
- Any change to pile positions, footing type or member sizes on site must be recorded and confirmed by Solar ESS.

Installed by _____

Checked by (Solar ESS) _____

Date ____ / ____ / _____