



INSPECTION STANDARD (HT LAB)



Page 01 of 01

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	12/09/2022
Part Name:- F D Pinion Shaft Left		Part No.:- 93646750	Inspection Standard Number	SIP/4524/160
Customer :- TMTL		Change Level.:-00	Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	ECD at 544HV (52 HRC)	*	1.1~1.4 mm	Micro Vicker / Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	ECD Below Undercuts	*	0.5 mm min.	Micro Vicker / Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	Core Hardness At PCD	*	42 HRC Max.	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
5.	Core Hardness At RCD	*	30 HRC Min.	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
6.	Case Micro	*	Tempered Martensite+ RA<15%, Carbide (Scattered) Upto 1%Max.	Microscope	1Pc/Lot	FMT-HT-39	A
7.	Core Micro	*	LCTM+Bainitic Structure Ferrite Upto 10% Max.	Microscope	1Pc/Lot	FMT-HT-39	A
8.	IGO/NMTP	*	20 Micron Max.	Microscope	1Pc/Lot	FMT-HT-39	A

Space For Sketch

Material:- 20MnCr5

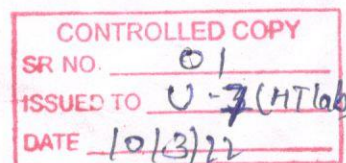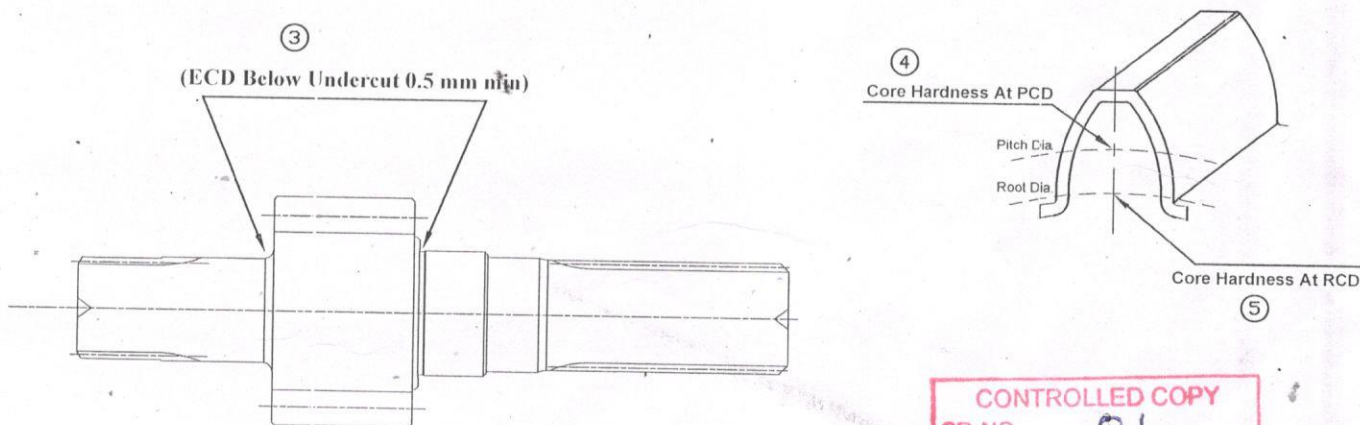

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends: ☒ Special Characteristics as Per Drawing ☒ Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change

Prepared By:

Checked By: