

Standard Operating Procedure

/s. Milestone Gears Pvt. Ltd.,
Unit - 4, Opp. Himachal Fibers Ltd.,
Ind. Area., Barotiwala, Distt. -
Jalandhar (HP)

Plate Carrier
453/30304
MS/SOP/3002/210
JCB
SAE8620H

OPERATION : ☐ Metallurgical Testing

CHD. BY: *Praveen*

APPD. BY: *Praveen*

TOOLS / CUTTERS DETAIL :


FIXTURE NUMBER :

DO & DON'T S.


Rockwell Well Tester, Vicker H. Tester, Microscope

NO.	MACHINE / EQUIPMENT PARAMETERS	VALUE	LOCATE ☐	CLAMP ☐	REST ☐	INSPECT ☒	MAJOR Mj	MINOR Mn	CRITICAL Cr
1.	_____	_____	_____	_____	_____	_____	_____	_____	_____
2.	_____	_____	_____	_____	_____	_____	_____	_____	_____
3.	_____	_____	_____	_____	_____	_____	_____	_____	_____
NO.	JIG / FIX. / CTG. TOOL PARAMETERS	VALUE	_____	_____	_____	_____	_____	_____	_____
1.	_____	_____	_____	_____	_____	_____	_____	_____	_____
2.	_____	_____	_____	_____	_____	_____	_____	_____	_____
3.	_____	_____	_____	_____	_____	_____	_____	_____	_____

OPTN. SKETCH

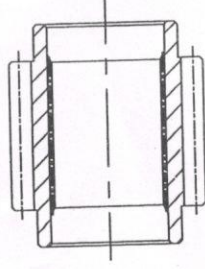

- 1 सभी Instrument साफ सुथरे होने चाहिये।
- 2 सभी Instrument का Leveling सही होना चाहिये।
- 3 सभी Instrument Calibrate होने चाहिये।

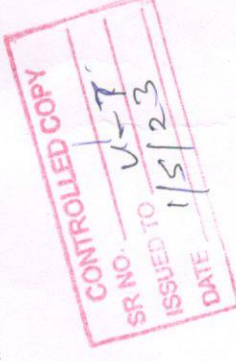

CONTROLLING OF DIEMENSION

S. No	Dimension	Specifications	Instrument	Operator	Inspector
1A.	Previous Operation	Shot Blasting	Visually	100%	100%
1.	Surface Hardness	58~63HRC	Rockwell Tester	1 piece per heat	1 piece per heat
2.	Core Hardness	350~412Vdh	Vicker H. Tester	--do--	--do--
3.	ECD (Cut off 51.7 HRC)	0.20~1.0mm	--do--	--do--	--do--
4.	Micro - Case	Tempered Martensite R.A. Less than 10%	Microscope	--do--	--do--
5.	Micro - Core	LCM+ Banite	Microscope	--do--	--do--
6.	For Other Details Refer. JCB Std. 00012/9995/0001 (Type 1)				

Note:-

- 1) Recording will be done by QA Inspector only.
- 2) If Any Doubt please ask Supervisor/QA Inspector.

WORKING INSTRUCTIONS

- Mettallurgical Testing के लिये नीचे लिखे Instruction को Follow करें :-
- 1) Rockwell Hardness Tester में Component की Surface Hardness चैक करें।
 - 2) Component को काट कर एक सैम्पल चैक करें।
 - 3) Rockwell/Vickers Hardness Tester में Sample की Core Hardness चैक करें।
 - 4) Vickers Hardness Tester में Sample की ECD चैक करें।
 - 5) Nital से Sample को Etching करें।
 - 6) Etching किये हुये Sample का Case & Core में Microstructure Microscope द्वारा चैक करें।

ENG. CHANGES.

A.

B.

C.

D.