

Kalibrering af udstyr – How to?

Gann Uni 1

- Tilslut den eksterne sensor til displayenheden, og sørg for at beslaget låser korrekt.
- Hold sensoren i den ene hånd og displayenheden i den anden. Bemærk, at du bør holde så langt tilbage på sensoren som muligt for at undgå, at hånden påvirker måleresultatet.
- Sæt omskifteren på displayenheden i position “M”, de øvrige positioner er beregnet til andre typer af sensorer.
- Tryk på den grå måleknap for at aflæse en måleværdi.
- Når sensoren med kuglen holdes frit i luften, bør der vises en værdi mellem -5,0 og 5,0.

Lufft XA1000



Calibration

The different sensors can be adjusted manually to compensate any measurement deviations.

Note!


Calibration should only be carried out by trained personnel working with suitable means!

Definitions

Concept	Meaning
Calibration	Detection of the measurement deviation of a sensor, see also calibration certificate
Adjustment	Setting of a sensor, approximation of a measured value to the real value


Activating the calibration function

1. In the Settings 3/3 menu, set the button (121) next to CAL to "On" (see page 25).

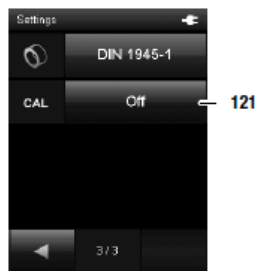


2. Press button 122 to activate the additional visualisation of measured values.

– You can, for example, select the average.

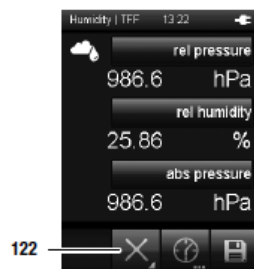

– In the advance measuring mode, the "CAL" button (120) is displayed.

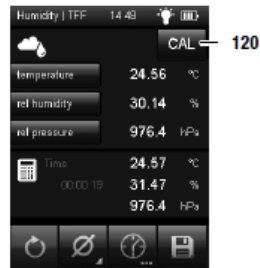

3. Press the "CAL" button (120) to call up the calibration function of the respective sensor.

Note!


The "CAL" button is only available for the primary measured values which are directly measured by the sensor.

Please note that the calibration menu indicated is always that of the top measurement channel.

Calibration humidity and temperature sensor 8120.TFF (XA1000, XP200 only)



- 120 Opens the calibration menu (see fig. B.).
Please note that the calibration menu indicated is always that of the top measurement channel, in this case the temperature (see fig. A.).
- 133 Current measured value indication
- 134 Offset:
Use this button to enter an offset value (see fig. C.).
Please observe the limit values.
- 135 Gain:
Use this button to enter a multiplying factor. The measured values are adjusted according to the following formula:
 $y = \text{offset} + x * \text{gain}$
where y is the indicated and x the measured value.
- 136 Returns to the "Measuring mode" screen.

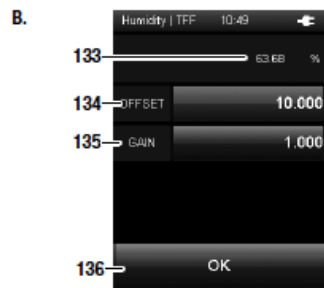

Note:

All values are stored in the sensor and are retained even if the device is exchanged.



Calibration humidity and temperature sensor 8120.TFF – calibration certificate

The following reminder appears 1 year after the first use of the probe:

D.




137

138

- 137 Press the OK key to confirm the reminder.
The reminder will appear again after 28 days.
- 138 Press the Cancel key to switch the reminder off.
The reminder will only appear again when the entire archive is deleted.

Calibration temperature/humidity probe SDI 9130.540 and 9130.520 (XA1000, XP200 only)

A.

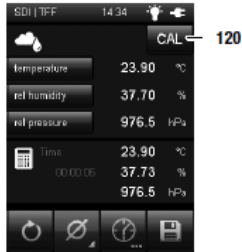

- 120 Opens the calibration menu (see fig. B.).
Please note that the calibration menu indicated is always that of the top measurement channel, in this case the temperature (see fig. A.).
For humidity calibration, see fig. D. on the following page.
- 139 Current measured value indication
- 140 CAL (offset/single-point calibration):
Use this button to enter an offset value (see fig. C.).
Please observe the limit values.
- 141 Returns to the "Measuring mode" screen.

B.



C.




D.



E.

Offset input for relative humidity

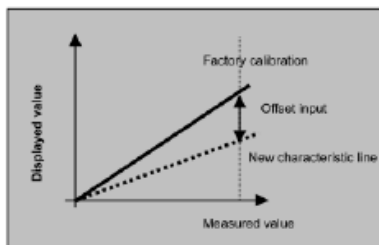

139 Current measured value indication

142 CAL (offset/single-point calibration) for humidity values from 30 %:
Use this button to enter an offset value (see fig. C.).
Please note that the input of this offset causes the characteristic curve to rotate around zero, see fig. E.

143 CAL L:
lower calibration value for the two-point calibration.
The range of values is between 10 % and 40 % RH (preferably 33 % RH). The offset values can be entered in steps of 0.1.

144 CAL H:
upper calibration value for the two-point calibration.
The range of values is between 60 % and 90 % RH (preferably 76 % RH). The offset values can be entered in steps of 0.1.

141 Returns to the "Measuring mode" screen.

Notes regarding two-point calibration:

Beyond the ranges indicated for CAL L and CAL H two-point calibration is not possible! The maximum offset per point is ± 10 % RH.

The factory settings can be restored by setting all three offset values to 0.0.

Note:

All values are stored in the sensor and are retained even if the device is exchanged.

Delmhorst J-2000

Knapfunktioner

- **(#1) Læseknapp:** Aflæser procentdelen af fugtindhold (%MC), korrigeret for temperatur og træsort.
- **(#2) Kalibreringstjekknapp:** Tjekker kalibreringen af måleren. Den viser også gennemsnittet af op til 100 akkumulerede aflæsninger; viser den maksimale gemte aflæsning; sletter aflæsningerne.
- **(#3) Træsortsknapp:** Indstiller koden for den træsort, du bruger. Træsorter er nummereret fra 1 til 50 og er listet på Træsortskodekortet. Denne knap fungerer også som en rulleknapp, afhængigt af funktionen.
- **(#4) Temperaturknapp:** Indstiller trætemperaturen. Denne knap fungerer også som en rulleknapp, afhængigt af funktionen.

—

Tjek Kalibrering

Tryk på kalibreringstjekknappen **#2** og læseknappen **#1** samtidig. Måleren er kalibreret, hvis den viser **12% (+ eller - 0,2%)**. Hvis du tjekker kalibreringen, og måleren ikke viser **12%**, er det sandsynligvis et tegn på et lavt batteriniveau. Hvis dette sker, skal du skifte batteriet med det samme. Fortsat brug med et lavt batteri kan få måleren til at miste sin kalibrering. Hvis du har et nyt batteri, og instrumentet stadig ikke indikerer en korrekt kalibrering, skal du returnere det til DELMHORST for service. Se afsnittet "Service for din måler."

Når batteriet fjernes og derefter genforbindes, viser måleren sin softwareversion i et sekund og slukker derefter. Efter udskiftning af batteriet skal du nulstille måleren som beskrevet i afsnittet "Nulstilling af måleren."