

RESIDENTIAL HOME INSPECTION REPORT

Prepared for application upload and document-processing testing

Property	1847 Maple Hollow Drive Riverton, Indiana 46113
Client	Jordan Taylor
Inspection Date	July 18, 2026
Inspector	Morgan Reed, CPI License No. FICTIONAL-48219
Weather	Partly cloudy, 82 F; recent light rain
Approximate Home Details	Built 1998; 2-story; 2,340 sq ft; attached 2-car garage

IMPORTANT: This entire report is fictitious and was generated solely as sample data. The address, client, inspector, license number, observations, costs, and recommendations are invented. Do not use this report to make real estate, safety, repair, insurance, or financial decisions.

Front Elevation

PHOTO PLACEHOLDER

Sample image slot for the inspected property.

Figure 1. Front exterior overview (placeholder).

1. Executive Summary

The home was generally serviceable for its age, but several items warrant repair or specialist evaluation. The most significant concerns involve roof flashing, active moisture staining beneath an upstairs bathroom, an unsafe electrical panel opening, and elevated wood-to-soil contact at the rear deck.

Priority Definitions

Immediate / Safety	Condition may present a safety hazard or allow rapid property damage. Address promptly.
Major	Significant defect, active leak, failed component, or condition likely to require substantial repair.
Maintenance	Routine repair, monitoring, servicing, or improvement recommended.

Summary of Notable Findings

Priority	Finding	Recommended Action
Immediate / Safety	Open knockout in the main electrical panel exposes the interior of the enclosure.	Have a licensed electrician install an approved filler plate and evaluate the panel.
Major	Moisture staining and elevated moisture readings were observed on the kitchen ceiling below the upstairs hall bathroom.	Have a qualified plumber identify and repair the leak; remove damaged material as needed and confirm the area is dry.
Major	Roof flashing at the rear chimney is lifted and sealant is deteriorated.	Have a qualified roofer repair or replace flashing and inspect adjacent sheathing.
Major	Rear deck support posts have direct soil contact and show early decay at the base.	Have a qualified deck contractor evaluate load-bearing members and install proper concrete footings or post bases.
Maintenance	The water heater is approximately 13 years old and lacks a drain pan.	Budget for replacement and add a properly drained pan where feasible.
Maintenance	Several exterior grading areas slope toward the foundation.	Regrade and extend downspouts to discharge water at least 6 feet from the foundation.

2. Scope and Limitations

This sample report follows the format of a visual, non-invasive residential inspection. Components are described as observed on the inspection date. Concealed conditions, code compliance, environmental hazards, engineering calculations, and destructive testing are outside the scope of this fictional report.

The inspection does not constitute a warranty or guarantee. Systems can fail at any time, and conditions may change after the inspection. Specialists should be consulted for further evaluation wherever recommended.

Systems Inspected

Site and drainage; exterior cladding and trim; roof surfaces and penetrations; attic; foundation and structure; basement/crawlspace; electrical; plumbing; heating and cooling; water heater; kitchen; bathrooms; interior rooms; windows and doors; garage; decks, porches, and visible safety features.

Not Inspected or Not Tested

Underground utilities, septic systems, wells, swimming pools, alarm systems, low-voltage wiring, cosmetic defects, appliances beyond basic operational checks, mold identification, asbestos, lead-based paint, radon, pests, and inaccessible concealed spaces.

Inspection Overview

PHOTO PLACEHOLDER

Sample slot for inspector photo or general site image.

3. Exterior and Site

Exterior wall coverings consisted primarily of vinyl siding with manufactured stone veneer at the front elevation. Trim, soffits, and fascia were visible from ground level. The lot was moderately sloped.

Observed Conditions

Priority	Finding	Recommended Action
Major	Soil at the north and rear elevations slopes toward the foundation in several locations.	Improve grading to create positive drainage away from the house.
Maintenance	The left rear downspout terminates beside the foundation.	Install an extension to discharge approximately 6 feet away.
Maintenance	Several siding joints have failed or missing sealant around utility penetrations.	Clean and reseal using an exterior-rated compatible sealant.
Maintenance	Minor settlement cracks are present in the front concrete walkway.	Monitor and repair if displacement creates a trip hazard.

Exterior Drainage

PHOTO PLACEHOLDER

Example: downspout discharging next to foundation.

Figure 2. Downspout extension recommended (placeholder).

4. Roof and Attic

The roof was observed from the ground, eaves, and accessible portions of the attic. The covering was architectural asphalt shingles, estimated to be 10-14 years old.

Priority	Finding	Recommended Action
Major	Rear chimney flashing is lifted at the upslope edge, and surrounding sealant is cracked.	Have a qualified roofing contractor repair flashing and inspect for concealed moisture damage.
Maintenance	Localized granule loss is visible on south-facing roof slopes.	Monitor annually and budget for future replacement.
Maintenance	Bathroom exhaust duct terminates in the attic near a soffit vent.	Extend the duct to an approved exterior termination.
Maintenance	Attic insulation is uneven and compressed near the access hatch.	Redistribute or add insulation after correcting ventilation and duct issues.

Roof Flashing

PHOTO PLACEHOLDER

Example: lifted chimney flashing and failed sealant.

Figure 3. Rear chimney flashing defect (placeholder).

5. Structure, Foundation, and Basement

The visible foundation was poured concrete. Floor framing was primarily dimensional lumber with engineered components in portions of the structure. No major displacement was visible during this limited inspection.

The foundation appeared generally serviceable in visible areas.

Priority	Finding	Recommended Action
Maintenance	A vertical shrinkage crack approximately 1/16 inch wide is visible on the east foundation wall.	Seal to limit moisture entry and monitor for movement.
Maintenance	White mineral deposits are present near the basement utility wall.	Improve exterior drainage and monitor for recurring moisture.
Maintenance	Stored belongings limited inspection of approximately 20 percent of the basement perimeter.	Reinspect concealed areas after items are moved, if desired.

6. Electrical System

The service was rated approximately 200 amps, 120/240 volts, with an overhead service entrance. The main panel was located in the basement utility area.

Priority	Finding	Recommended Action
Immediate / Safety	An unused breaker opening in the main panel is not covered, allowing access to energized components.	Have a licensed electrician install an approved filler plate immediately.
Major	Two conductors appear connected to a breaker designed for a single conductor.	Have a licensed electrician correct the double-tapped breaker and review panel loading.
Maintenance	One exterior receptacle did not trip using the test button.	Replace the GFCI receptacle and verify downstream protection.
Maintenance	Several receptacles are loose in their wall boxes.	Secure or replace the devices.

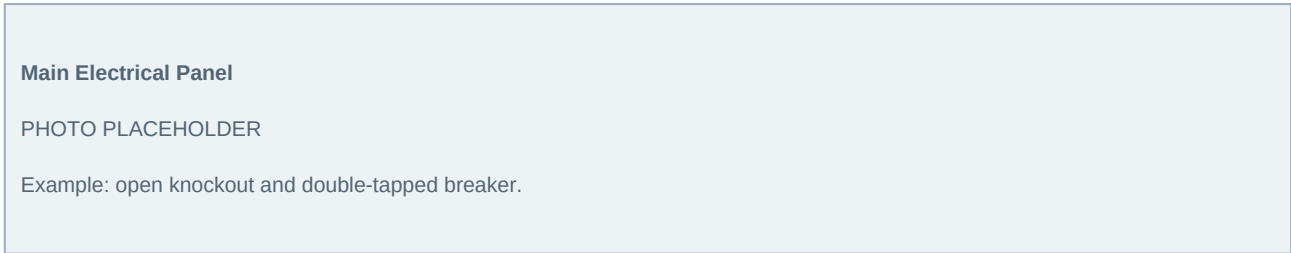


Figure 4. Electrical defects requiring electrician evaluation (placeholder).

7. Plumbing and Water Heater

Visible supply piping included copper and PEX. Visible drain piping was primarily PVC. Water flow was functional at tested fixtures.

Priority	Finding	Recommended Action
Major	Moisture staining is visible on the kitchen ceiling below the upstairs hall bathroom; moisture meter readings were elevated at the time of inspection.	Have a qualified plumber locate and repair the leak before closing or occupancy.
Maintenance	The hall bathroom toilet shifts slightly at the floor.	Reset the toilet with a new seal and secure it to the flange.
Maintenance	The water heater is approximately 13 years old and has no drain pan.	Budget for replacement and install a drained pan where practical.
Maintenance	Corrosion is present at the water heater cold-water connection.	Have a plumber service the connection and check for leakage.

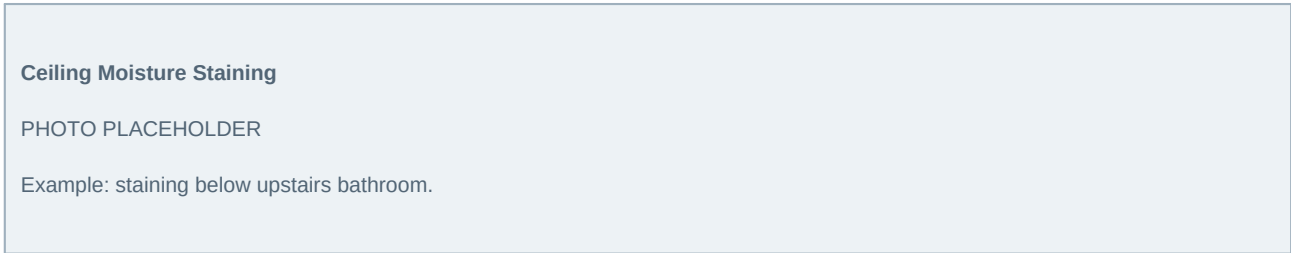


Figure 5. Active or recent leak suspected (placeholder).

8. Heating and Cooling

The home was served by a gas-fired forced-air furnace and central air-conditioning system. Basic operation was tested using normal controls.

Priority	Finding	Recommended Action
Maintenance	The HVAC filter was heavily soiled.	Replace the filter and maintain a regular replacement schedule.
Maintenance	The outdoor condenser is partially obstructed by shrubs.	Trim vegetation to maintain at least 18-24 inches of clearance.
Maintenance	The condensate drain lacks a visible service cleanout.	Have an HVAC contractor add a cleanout during the next service visit.

The systems responded to the thermostat during the inspection. A complete seasonal service by a qualified HVAC technician is recommended because service records were not available.

9. Interior, Kitchen, and Bathrooms

Priority	Finding	Recommended Action
Major	The kitchen ceiling below the hall bathroom has damaged drywall and moisture staining.	Repair only after the plumbing source is corrected and the cavity is verified dry.
Maintenance	The dishwasher drain hose lacks a high loop beneath the sink.	Secure the hose high under the countertop to reduce backflow risk.
Maintenance	The primary bathroom exhaust fan is noisy and has weak airflow.	Clean, repair, or replace the fan and verify exterior discharge.
Maintenance	Two windows have failed insulated-glass seals and visible fogging.	Replace insulated glass units as desired.
Maintenance	A stair handrail terminates before the final lower step.	Extend or replace the handrail for continuous graspable support.

Most interior doors, cabinets, counters, and accessible windows operated normally. Cosmetic wear was present but is not itemized in this report.

10. Garage, Deck, and Safety Features

Priority	Finding	Recommended Action
Major	Rear deck support posts are embedded directly in soil and show early decay near grade.	Have a qualified deck contractor evaluate structural adequacy and install approved footings/post bases.
Major	Deck guardrail openings exceed approximately 4 inches in two locations.	Modify the guard to reduce fall and child-entrapment risk.
Maintenance	The garage vehicle door did not reverse when resistance was applied.	Have a garage-door technician adjust or repair the auto-reverse system.
Maintenance	The door from the garage to the house does not self-close.	Install or adjust self-closing hinges where required or desired.
Maintenance	Smoke alarms were present but age labels were not visible.	Replace alarms older than 10 years and test all units monthly.

Rear Deck Support

PHOTO PLACEHOLDER

Example: post in soil with decay at grade.

Figure 6. Deck support repair recommended (placeholder).

11. Preliminary Repair Planning Range

The following ranges are fictional planning allowances only. Actual costs vary by location, contractor, concealed damage, material selection, permits, and scope. Obtain written estimates from qualified professionals.

Item	Illustrative Range
Electrical panel corrections	\$250 - \$900
Bathroom leak diagnosis and repair	\$400 - \$3,500+
Roof/chimney flashing repair	\$700 - \$2,500
Deck post/guard repairs	\$1,500 - \$8,000+
Drainage and downspout improvements	\$300 - \$2,000
Water heater replacement	\$1,300 - \$2,800

Suggested Next Steps

1. Contact a licensed electrician regarding the panel defects.
2. Have a plumber investigate the upstairs bathroom and kitchen ceiling moisture.
3. Obtain a roofing evaluation for chimney flashing.
4. Obtain a deck contractor evaluation before heavy use.
5. Request seller disclosures, permits, warranties, and maintenance records.
6. Conduct a final walk-through to confirm no new damage or leakage is present.

12. Sample Inspector Statement

I certify that this document is a fictional sample generated for software testing. No property was inspected, no professional services were rendered, and no person should rely on this report as evidence of a property condition.

Morgan Reed, CPI Fictional Home Inspection Services License No. FICTIONAL-48219	Date: July 18, 2026 Signature: <u>Sample - Not Valid</u>
--	---

END OF FICTIONAL SAMPLE REPORT