Recommended splicing method

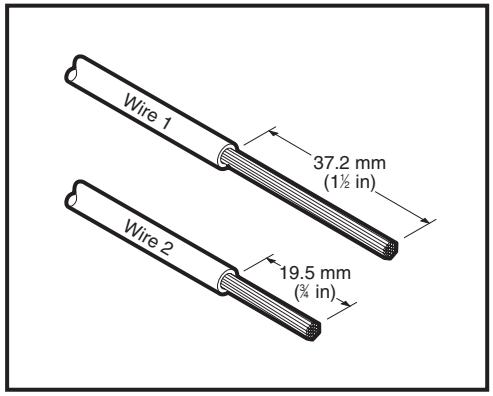

1. Disconnect battery ground cable.
2. Strip wires to appropriate length.

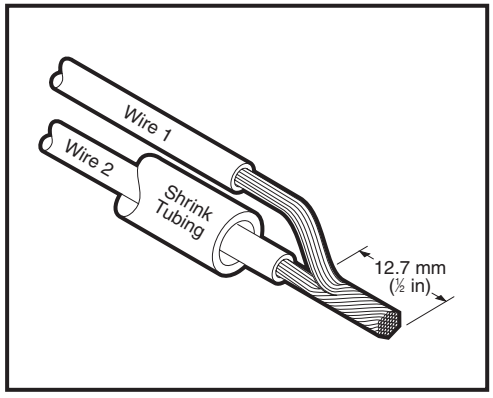

3. Install heat shrink tubing.
4. Twist wires together.
5. Solder wires together.

Note:
Use resin core mildly-activated (RMA) solder. Do not use acid core solder.

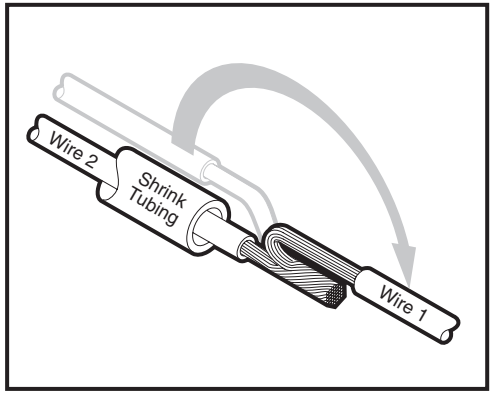

6. Bend Wire 1 back in a straight line.

Note:
Wait for solder to cool before moving wires.

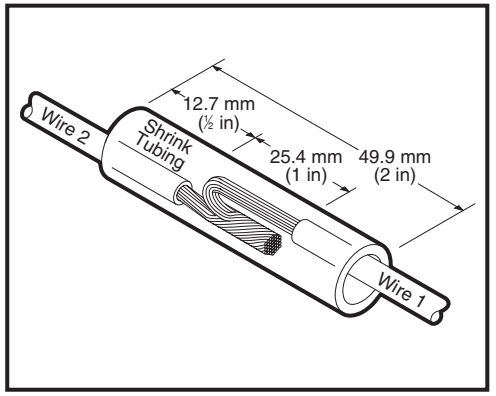

7. Evenly position heat shrink tubing over wire repair.

Note:
Overlab tubing on both wires

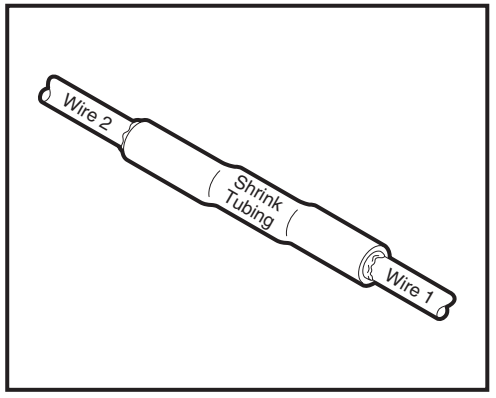

8. Use heat gun to heat the repaired area until adhesive flows out of both ends of heat shrink tubing.
9. Reconnect battery ground cable.