POWERTRAIN CONTROL MODULE REPROGRAMMING

AFFECTED VEHICLES: ALL 1999 AND 2000 MODEL YEAR WINDSTAR VEHICLES

NOTE:

SOME VEHICLES MAY HAVE HAD THE PCM REPROGRAMMED PREVIOUSLY. ON THESE VEHICLES, VERIFY CALIBRATION USING APPROPRIATE DIAGNOSTIC TOOL.

SERVICE PROCEDURE

1. Reprogram the Powertrain Control Module (PCM) to the latest calibration listed in the table below (only one of these calibrations will be selectable for each vehicle), using one of the following two (2) methods:
   - Worldwide Diagnostic system (WDS). Use B9 CD-ROM dated August 2000 or later.

     NOTE: If your WDS is connected to FordStar, your WDS already contains the latest calibrations. If your WDS is not currently connected to FordStar and the B9 CD-ROM has not arrived at your dealership, call 1-800-207-2444.
   - Service Bay Technical System (SBTS) and the New Generation STAR (NGS) Tester with Rotunda flash cable (007-00531) and Rotunda flash card (007-00532). Use R00SEP Calibration CD-ROM dated August 2000 or later.

     NOTE: If your SBTS is connected to FordStar, your SBTS already contains the latest calibrations. If your SBTS is not currently connected to FordStar and the R00SEP CD-ROM has not arrived at your dealership, call 1-800-207-2444.

PCM REPROGRAMMING INFORMATION

Application	Tear Tag Number *	Qualifier *
1999 Windstar 3.0L 50S/CAN/ALT	YELx,SANx	9LAA-BC CALIBRATION
1999 Windstar 3.0L EURO COMM	ZIEx,LNSx	Not Applicable
1999 Windstar 3.0L GCC	AETx, QLOx	Not Applicable
1999/2000 Windstar 3.8L FED/ALT/CAN	LWAx,BXGx, ZHTx	9LMA-BE or 0A31BS0B CALIB
1999/2000 Windstar 3.8L CAL	KFWx, WIKx, NQEx	9LMA-BD or 0A31CS0B CALIB
1999/2000 Windstar 3.8L 50S/CAN/ALT	FGJx, CSPx	0A31AS0B CALIBRATION
1999/2000 Windstar 3.8L SAO	BCBx, XSFx, RGYx	Not Applicable
1999/2000 Windstar 3.8L GCC	LMLx, YUUx, XAAx	Not Applicable

* The lower case “x” after each number is a variable digit or letter that can range from 0 to 9 or A to Z.

CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
08/00

2. Obtain and prepare the Authorized Modifications Label. Write the modification completed, your P & A Code, date of repair and the program type and program number as shown below.

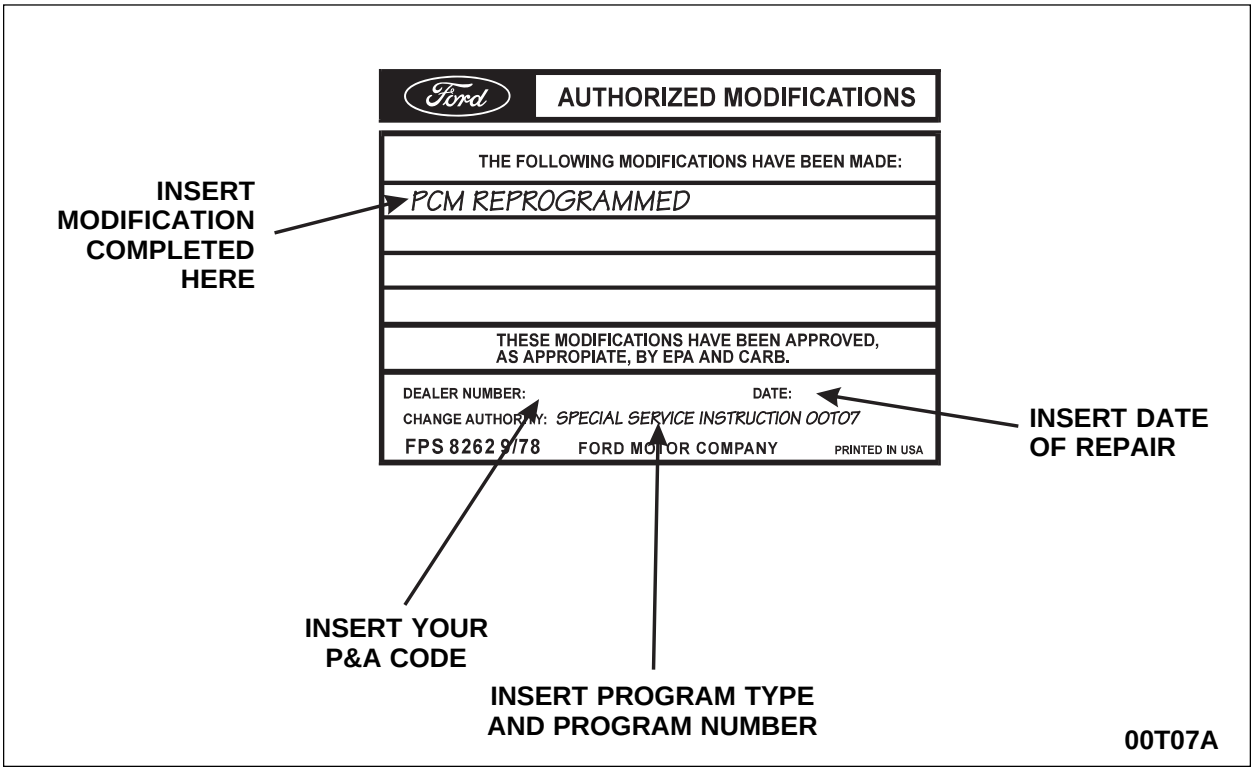


FIGURE 1

3. Apply label to clear area of the upper radiator support.

CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
08/00