Ford Motor Company

A. R. O'Neill
Director
Vehicle Service and Programs
48121
Ford Customer Service Division

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan

December 2001

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: Customer Satisfaction Program 01B85 – Supplement 1: Revised Technical Instructions and Parts Information

REFERENCE: Customer Satisfaction Program 01B85: Certain 2000 and 2001 Model Year Focus Vehicles – Replacement of Rear Wheel Bearings

OASIS : Yes
OWNER LIST: Yes
PROGRAM TERMS: This program will be in effect until December 31, 2002, regardless of mileage.

REASON FOR THIS SUPPLEMENT

The Technical Instructions and Parts Ordering Information have been revised to:

- Eliminate damage to the double-lip seal during installation by clarifying spindle preparation.
- Remove the requirement to replace the spindle if the double-lip seal is deformed during installation.
- Revise the parts ordering procedure for the disc brake kit (Attachment II).

AFFECTED VEHICLES

Certain 2000 and 2001 model year Focus vehicles built at the Wayne Assembly Plant from July 19, 1999 through February 20, 2001 and the Hermosillo Assembly Plant from October 4, 1999 through June 18, 2001, originally sold in or currently registered in the following U.S. states and Canadian provinces:

U. S. States	Connecticut	Kentucky	Minnesota	Ohio
	Delaware	Maine	Missouri	Pennsylvania
	Illinois	Maryland	New Hampshire	Rhode Island
	Indiana	Massachusetts	New Jersey	Vermont
	Iowa	Michigan	New York	West Virginia
				Wisconsin
Canadian Provinces:	Quebec	Nova Scotia	New Brunswick	
	Ontario	Newfoundland	Prince Edward Island	

REASON FOR PROGRAM

In high corrosion areas, where salt is used on roadways in the winter, the rear wheel bearing seal race may experience surface corrosion. If this condition occurs, the wheel bearing seals may become damaged and allow contamination to enter the wheel bearings. As a result, the wheel bearings may prematurely wear and cause a noticeable noise. If not repaired, this condition could progress to the point where the wheel begins to wobble.

© Copyright 2001 Ford Motor Company

SERVICE ACTION

Drum Brakes*: On these affected vehicles, the dealer will install a drum bearing kit. This kit contains the latest level wheel bearings and seals for both rear wheels. The kit also includes a new supplemental seal, which is to be installed (on both sides) in conjunction with the wheel bearing seal.

Disc Brakes*: On these affected vehicles, the dealer will install a disc brake bearing kit. This kit contains a new spindle and seal assembly and new wheel bearings and seals for both rear wheels.

*Vehicles with Anti-Lock Brakes (ABS), each wheel bearing kit includes new tone rings.

COMPLETION OF THIS PROGRAM (01B85) WILL CLOSE OUT SAFETY RECALL 00S31

In September 2000, a certain population of 2000 model year Focus vehicles was involved in Safety Recall 00S31, which directed the installation of a wheel retention cap and bolt on the left-hand rear spindle.

Since vehicles in the affected areas are part of the population included in this Customer Satisfaction Program (01B85), you may have vehicles arrive at the dealership with one of the two following scenarios:

- Vehicles with Safety Recall 00S31 performed – Remove and *discard* the wheel retention cap and bolt. These parts are not required, once 01B85 is performed.
- Vehicles with Safety Recall 00S31 OPEN – The components replaced in Customer Satisfaction Program 01B85 *eliminate the need to perform Safety Recall 00S31.* Advise the customer of this fact and close out 00S31 per the instructions below.

CLOSING OUT 00S31

It is important to close Safety Recall 00S31 (if shown open in OASIS). This will prevent unnecessary Safety Recall reminders from being sent to owners. For claiming procedures refer to Attachment I, page 1 of 1.


ATTACHMENTS

Attachment I: Administrative Information
Attachment II: Labor Allowances and Parts Ordering Information
Attachment III: Technical Information
Attachment IV: Q & A
Customer Notification Letter(s)

QUESTIONS?

Claims Information:……..…1-800-423-8851
Other (Dealer Only) Field Service Action Questions:……1-800-325-5621

Sincerely,

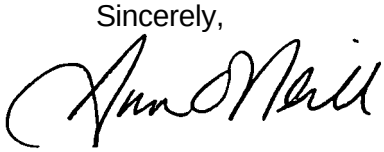

Ann O'Neill
Director
Vehicle Service and Programs

© Copyright 2001 Ford Motor Company

Customer Satisfaction Program 01B85-S1
Certain 2000 and 2001 Model Year Focus Vehicles
Replacement of Rear Wheel Bearings & Seals

OASIS

You must use OASIS to determine if a vehicle is eligible for this program.

PLEASE NOTE

Correct all vehicles in stock before delivery.

DEALER-OWNER CONTACT

Promptly correct all affected vehicles on your dealer Online Involved Unit Listing available on QCDealer.com. Also, correct other affected vehicles identified in OASIS which are brought to your dealership

NOTE: These dealer listings may contain customer names and addresses obtained from Motor Vehicle Registration Records. The use of such motor vehicle registration data for any purpose other than in connection with this field service action is a violation of law in several states/provinces/countries. Accordingly, limit the use of this listing to the follow-up necessary to complete this action.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII manual for claims preparation and submission information.

VEHICLES WHERE 00S31 IS OPEN IN OASIS

NOTE: 01B85 must be performed before a dealer can close the Safety Recall using Labor Op 00S31A

- Dealer claims Labor Op 00S31A, under Program Code 00S31, which will pay 0.1 Hr. in lieu of the Administration Allowance, to close out the Safety Recall.
- Please reference the 01B85 Claim and Line # in the tech comment area of the claim.
- Miscellaneous Expense Code "ADMIN" will not be accepted when used with 00S31A.

OWNER REFUNDS

Ford Motor Company will only refund owner-paid repairs made before the date of the Owner Letter (or after the date of the Owner Letter if an emergency repair was made away from the servicing dealer). Refer to ACESII manual for refund information.

Program Code:	01B85
Misc. Expense:	REFUND
Misc. Expense:	ADMIN
Misc. Expense:	0.2 Hr.

RENTAL CARS

Rental vehicles will not be provided for this program.

© Copyright 2001 Ford Motor Company

Customer Satisfaction Program 01B85-S1
Certain 2000 and 2001 Model Year Focus Vehicles
Replacement of Rear Wheel Bearings & Seals

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Rear wheel bearings & seal installation (Both Rear Drums, ALL)	01B85B	1.1 Hours
Rear wheel bearings & seal installation (Both Rear Discs)	01B85C	1.6 Hours

PARTS REQUIREMENTS

DRUM BRAKES:
Parts will not be direct shipped for this program. For Drum Non-ABS and Drum ABS Kits, order your parts requirement through normal order processing channels as noted below:

Stock and Interim Orders Effective immediately Normal order process
Emergency Orders……..First 30 days after launch……Call 1-800-325-5621
Emergency Orders……..31 days after launch……Normal order process

Part Number	Description	Approx. Volume	Qty. per Vehicle
1M5Z- 4A013-VV	Rear Wheel Bearing Kit (includes parts for both sides) – *Drum, Non-ABS*	170,000 Units (77%)	1
1M5Z-4A013-WW	Rear Wheel Bearing Kit (includes parts for both sides) – *Drum, ABS*	49,000 Units (22%)	1

DISC BRAKES:
To order the Disc Brake Kit, order your parts requirement through normal order processing channels as noted below:

All Order Types……First 60 days after launch……Call 1-800-325-5621
All Order Types……61 days after launch……Normal order process

Part Number	Description	Quantity per Vehicle	Approx. Volume
1M5Z-4A013-LD	Rear Wheel Bearing Kit (includes **spindles** & parts for both sides) – *Disc Brakes*	1	1,500 Units (1%)

© Copyright 2001 Ford Motor Company

Customer Satisfaction Program 01B85-S1
Certain 2000 and 2001 Model Year Focus Vehicles
Replacement of Rear Wheel Bearings & Seals

SPECIAL TOOLS *

Part Number	Description	Quantity
204-325	Installer, Seal	1
204-322	Installer, Water Seal Carrier (Drum)	1
204-323	Installer, Water Seal Carrier (Disc)	1

* One set of no-charge tools was shipped to dealerships in the designated states and provinces during the week of November 19, 2001. Additional tools can be ordered by calling 1-800-ROTUNDA, – press "4" for tools.

ORDER INFORMATION

The DOR/COR for this program is **50262**. This number identifies parts ordered for this Customer Satisfaction Program through the Special Service Support Center (1-800-325-5621).

DEALER PRICE

For latest prices, check DOES II or updated price book.

PARTS RETENTION

Follow the provisions of the Warranty and Policy Manual for “Parts Retention and Return Procedures”.

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

© Copyright 2001 Ford Motor Company

ATTACHMENT IV
Customer Satisfaction Program 01B85

Replacement of Rear Wheel Bearings & Seals

General Program Information

Q1. What do we do when 01B85 expires?
A1. When Customer Satisfaction Program 01B85 expires on December 31, 2002, any remaining vehicles that have not had Safety Recall 00S31 performed will once again be eligible for repairs on January 1, 2003. Dealers may resume the installation of the wheel retention cap and bolt, and will be reimbursed under the 00S31 Program.

Q2. Why don't we have to complete the Safety Recall 00S31?
A2.. The safety concern for the affected 2000 model year Focus vehicles was caused by insufficient clamp load of the rear wheel bearings as a result of a plant processing issue. This could allow the left-rear wheel to separate (the right-rear wheel was not affected because the wheel rotation naturally tightened the wheel bearing nut).

Customer Satisfaction Program 01B85 involves the complete replacement of both the rear wheel bearings and seals. These new components, when installed using normal Workshop procedures, eliminate the need for the installation of a wheel retention cap and bolt.

Q3. Can Labor Op 00S31A be claimed on the same RO as 01B85?
A3.. Yes, it can be claimed on the same RO as 01B85. Follow the claiming instructions on Attachment I.

Ford Motor Company

A.R. O'Neill
Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121

December 2001

(01B85 - 2000 Focus Owners who had 00S31 performed)

Important information about your vehicle enclosed.

Mr. Joe Anyman
123 Main Street
Anywhere, USA 12345

Your Vehicle Identification Number: 12345678901234567

Rough weather? Smooth Ride.

At Ford, we work hard to make sure that your Focus glides right through every season. Bad weather shouldn't wear on your car. We're here to help you take on the elements with one of the smoothest rides around.

Your Focus has already received repairs due to a possible rear wheel bearing condition caused by a manufacturing issue. However, it has recently come to our attention that the salt used on winter roadways may cause your rear wheel bearings to experience premature wear. If this condition occurs, you may hear a grinding, clunking or roaring noise coming from the rear of the vehicle.

Although your vehicle has already been serviced, Ford has taken additional steps to help keep your wheel bearings in top shape - even during rough weather. And to guarantee your driving satisfaction, we would like to make all necessary repairs to your Focus without delay.

What Ford Motor Company will do for you.

Your dealer will replace your rear wheel bearings, at no cost to you. Additional bearing seals will also be installed to ensure a smooth ride for your Focus.

This program will be in effect until December 31, 2002, regardless of mileage.

What we are asking you to do.

Please call your dealer without delay, and ask for a service date for Customer Satisfaction Program 01B85. If your dealer does not have parts in stock, they can be ordered before scheduling your service date. Parts would normally be expected to arrive within a week.

Keep this letter in a safe place, as it will be useful for your dealer to refer to at the time of service. However, if you misplace the letter, your dealer will still make all necessary repairs, free of charge.

If you do not already have a servicing dealer, you can access **www.dealerconnection.com** to find the dealer nearest you.

© Copyright 2001 Ford Motor Company

Any Questions?

Please contact us at **www.ownerconnection.com** if you have any questions about the information included in this letter.


You may also contact the Ford Motor Company Customer Relationship Center, toll free, at (866) 436-7332 or (800) 232-5952 (TDD for persons with hearing impairments). One of our representatives will be happy to assist you. Office hours are 8 a.m. to 11 p.m. Monday through Friday, and 8 a.m. to 6 p.m. Saturday (EST).

Quality Care service: a friend for all seasons.

At Ford Motor Company, customers are the top priority. And you can rest assured that from snowy days to clear, calm nights, our nationwide dealer network is there to provide you with Quality Care service.

While we regret any inconvenience caused by this program, we stand committed with our dealers to helping your vehicle maintain peak performance. The weather outside might be rough, but with Quality Care service, your Focus will always be ready for a smooth, smooth ride.

Sincerely,

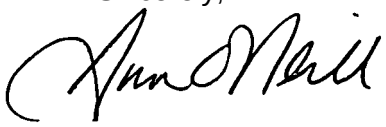

Ann O'Neill
Director
Vehicle Service and Programs

© Copyright 2001 Ford Motor Company

Ford Motor Company

A.R. O'Neill
Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121

December 2001

(01B85 - 2001 and 2000 Focus Owners who have *not* had 00S31 performed)

Important information about your vehicle enclosed.

Mr. Joe Anyman
123 Main Street
Anywhere, USA 12345

Your Vehicle Identification Number: 12345678901234567

Rough weather? Smooth ride.

At Ford, we work hard to make sure that your Focus glides right through every season. Bad weather shouldn't wear on your car. We're here to help you take on the elements with one of the smoothest rides around.

Recently, it has come to our attention that the salt used on roadways in winter may cause your rear wheel bearings to experience premature wear. If this condition occurs, you may hear a grinding, clunking or roaring noise coming from the rear of the vehicle.

Road salt is corrosive, and over a period of time - if the noises are ignored - your rear wheel bearings could be affected to the point where a wheel may begin to wobble. That's why we would like to make all necessary repairs to your Focus without delay.

What Ford Motor Company will do for you.

Your dealer will replace your rear wheel bearings, at no cost to you. Additional bearing seals will also be installed to ensure a smooth ride for your Focus.

This program will be in effect until December 31, 2002, regardless of mileage.

What we are asking you to do.

Please call your dealer without delay, and ask for a service date for Customer Satisfaction Program 01B85. If your dealer does not have parts in stock, they can be ordered before scheduling your service date. Parts would normally be expected to arrive within a week.

Keep this letter in a safe place, as it will be useful for your dealer to refer to at the time of service. However, if you misplace the letter, your dealer will still make all necessary repairs, free of charge.

If you do not already have a servicing dealer, you can access **www.dealerconnection.com** to find the dealer nearest you.

© Copyright 2001 Ford Motor Company

Any Questions?

Please contact us at **www.ownerconnection.com** if you have any questions about the information included in this letter.


You may also contact the Ford Motor Company Customer Relationship Center, toll free, at (866) 436-7332 or (800) 232-5952 (TDD for persons with hearing impairments). One of our representatives will be happy to assist you. Office hours are 8 a.m. to 11 p.m. Monday through Friday, and 8 a.m. to 6 p.m. Saturday (EST).

Quality Care service: A friend for all seasons.

At Ford Motor Company, customers are the top priority. And you can rest assured that from snowy days to clear, calm nights, our nationwide dealer network is there to provide you with Quality Care service.

While we regret any inconvenience caused by this program, we stand committed with our dealers to helping your vehicle maintain peak performance. The weather outside might be rough, but with Quality Care service, your Focus will always be ready for a smooth, smooth ride.

Sincerely,

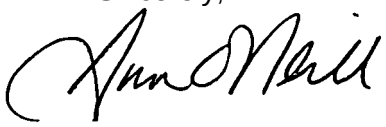

Ann O'Neill
Director
Vehicle Service and Programs

© Copyright 2001 Ford Motor Company