TRANSMISSION—5R55W—HARSH UPSHIFTS DURING LIGHT TO MEDIUM THROTTLE	Article No. 02-6-2

FORD: 2002 EXPLORER

MERCURY: 2002 MOUNTAINEER

ISSUE

Some vehicles produced through 2/15/2002 equipped with the 5R55W automatic transmission may exhibit harsh 1-2, 2-3, 3-4 upshifts at light to medium throttle. This may be caused by the calibration of the Powertrain Control Module (PCM).

ACTION

Verify the condition. If the condition exists, reprogram the PCM with an updated calibration. If the condition persists after the reprogram, continue with normal diagnostics to pinpoint the condition. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

Verify that at light to medium throttle positions, the 1-2, 2-3 or 3-4 shift is harsh. Prior to performing any service procedures, verify tear tag information. Refer to the PCM Calibration Information Chart in this article. If the calibration is not at the latest level, follow the procedures found in the Powertrain Control/Emissions Diagnosis (PC/ED) Service Manual to reprogram the PCM to latest calibration level.

After reprogramming has been completed, the transmission adaptive strategy for pressure control on engagements must be updated.

Install diagnostic equipment and monitor the Transmission Fluid Temperature (TFT).

Warm the transmission fluid to at least 54°C (130°F) as indicated by the TFT.

- Perform five (5) engagements from Park to Reverse. Each engagement must be 5 seconds apart.
- Perform five (5) engagements from Drive to Reverse. Each engagement must be 5 seconds apart.
- Perform five (5) engagements from Reverse to Drive. Each engagement must be 5 seconds apart.
- Perform five (5) engagements from Neutral to Drive. Each engagement must be 5 seconds apart.

NOTE

ALL OF THESE ENGAGEMENTS MUST BE PERFORMED IN ORDER FOR THE ENGAGEMENT PRESSURES TO PROPERLY ADAPT WITH THE NEW CALIBRATION.


Verify repair. If the condition is not corrected, continue with normal diagnostics and repair per the Workshop Manual.

Copyright © 2002 Ford Motor Company

Article No. 02-6-2 Cont'd.

PCM CALIBRATION INFORMATION				
Application	**Tear Tag**	**Old Calibration**	**New Calibration**	**NGS/WDS Qualifier**
4.6L/50S	CFL1	1U51A50B15	1U51A50B15	WDS B17.5 Release or Later
4.6L/MEXICO	HGZ1	1U51A50M15	1U51A50M15	WDS B17.5 Release or Later
4.6L/50S	PFF0	1U51A50B10	1U51A50B10	WDS B17.14 Release or Later
4.6L/MEXICO	REC0	1U51A50M10	1U51A50M10	WDS B17.14 Release or Later
4.0L/US	AUE1	1U51AF0B20	1U51AF0B20	WDS B17.6 Release or Later
4.0L/CANADA	XPB1	1U51BG0A20	1U51BG0A20	WDS B17.6 Release or Later
4.0L/MEXICO	EAB1	1U51AG0M20	1U51AG0M20	WDS B17.6 Release or Later
4.0L/LEADED	HAF1	1U51A40P20	1U51A40P20	WDS B17.6 Release or Later
4.0L/US	LAE1	1U51AF0B14	1U51AF0B14	WDS B17.5 Release or Later
4.0L/CANADA	CNK1	1U51BG0A14	1U51BG0A14	WDS B17.5 Release or Later
4.0L/MEXICO	SIM0	1U51AG0M14	1U51AG0M14	WDS B17.5 Release or Later
4.0L/LEADED	IKX4	1U51A40P12	1U51A40P12	WDS B17.5 Release or Later

Obtain an Authorized Modifications Decal (STAT 5941-2 - obtainable through the PDC) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

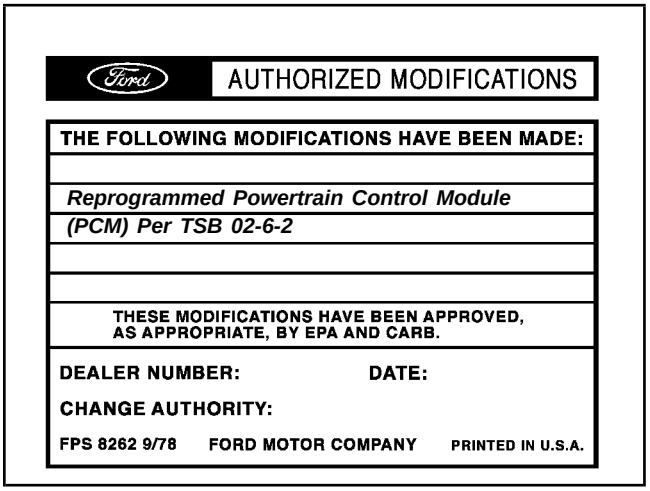

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	**DESCRIPTION**	**TIME**
020602A	Reprogram Powertrain Control Module (Includes Time To Update Transmission Adaptive Strategy)	1.6 Hrs.

DEALER CODING

	CONDITION CODE
BASIC PART NO.	
RECAL	42

OASIS CODES: 501000, 502000