TRANSMISSION—4R44E—4R55E—5R44E—5R55E—LOW LINE PRESSURE READING AT WIDE OPEN THROTTLE (WOT)—SLIPPING SHIFTS AND/OR DELAYED ENGAGEMENTS—POSSIBLE DIAGNOSTIC TROUBLE CODES P0732, P0733, P1762 SET—VEHICLES BUILT BEFORE 12/1/2001

Article No. 02-13-8

FORD: 1995-2001 EXPLORER
1995-2002 RANGER
1996-1997 AEROSTAR
1999-2002 EXPLORER SPORT
2001-2002 EXPLORER SPORT TRAC

MERCURY: 1997-2001 MOUNTAINEER

Article **02-8-2** is being republished in its entirety to update the DTC codes, build dates and to update the Service Procedure.

ISSUE

Some vehicles built prior to 12/1/2001 may exhibit the following shift and engagement conditions:

- Low line pressure readings while in DRIVE at WOT
- No 2nd gear
- No 3rd gear
- No engine braking in Manual 1st
- Slipping shifts and/or delayed engagements
- DTCs P0732, P0733 or P1762 may be present

This may be caused by improper pressures controlled by the Transmission Main Control assembly.

ACTION

If the conditions described are verified, the Main Control may need to be updated to the latest level or completely replaced. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

NOTE
THIS ARTICLE DOES NOT APPLY TO ANY OTHER CONDITIONS OR COMPONENTS THAT MAY CAUSE SIMILAR SYMPTOMS AND IS ONLY WRITTEN TO COVER THESE SPECIFIC CONDITIONS.

NOTE
AN IN-LINE SERVICE FILTER IS NOT REQUIRED TO BE ADDED OR REPLACED FOR THIS TSB.

Verify that one or more of the following conditions exist:

- Low line pressure while in Drive at WOT
- Slipping/delayed shifts
- Slipping/delayed engagements
- No 2nd and/or No 3rd gear
- No engine braking in Manual 1st
- OD Band failed OFF
- DTC P0732, P0733 or P1762 set

1. Verify that one of the conditions listed above exist with the vehicle.
2. If the condition exists, drain the transmission fluid from the pan.
3. Remove the fluid pan and fluid pan gasket, discard the gasket. Refer to Workshop Manual, In-Vehicle Service, Fluid Pan And Gasket Procedure.
4. Inspect the fluid in pan for major contamination.
   a. If major contamination IS present, refer to Procedure A, to replace the Main Control Assembly.
   b. If major contamination is NOT present, refer to Procedure B, to Update the Main Control Assembly.
5. After completing procedure A or B, verify the condition has been corrected.
6. Clear all DTCs.

Copyright © 2002 Ford Motor Company

Procedure A:

1. If major contamination is present, follow normal Workshop Manual procedures to repair internal transmission damage. If the transmission is repaired remember that the the Main Control (7A100), Fluid Pan Gasket (7A191) and Fluid Filter (7A098) must be replaced. Refer to the application chart for the correct Main Control assembly to use.

Procedure B:

CAUTION
A NEW SEPARATOR PLATE 7A008 OR 7Z490 MUST BE USED WHEN INSTALLING THE SPECIAL SERVICE KIT 7M203 OR ADDITIONAL TRANSMISSION DAMAGE MAY OCCUR.

1. To UPDATE the main control to the new level, follow the steps listed in the Service Kit 1L5Z-7M203-JA (ALL KIT CONTENTS MUST BE USED). A new separator plate (7A008 or 7Z490), upper/lower separator plate gaskets (7C155 and 7D100 used only with a 7A008 plate), fluid pan gasket (7A191), and a fluid filter (7A098) must be used. ALL NEW PARTS MUST BE USED. Refer to Parts Application Chart for parts selection.
2. Install the Special Service Tools 307-333 and 307-334 (1 each) onto the main control (Figure 1).
3. Install a new service Separator Plate (refer to chart), make sure that the new plate has hole #50 deleted, install the three (3) screw and tighten to 7 N•m (62 Lb-in).
4. Install a new separator plate to case gasket (7C155) if installing the 7A008 style separator plate. DO NOT INSTALL a 7C155 GASKET IF USING A 7Z490 Separator Plate.
5. Remove the special service tools.
6. Continue to follow the assembly steps as found in the assembly of sub-assemblied, main control valve body.
7. Reinstall the main control by continuing to follow the Installation steps listed in the Workshop Manual, In-Vehicle Service, Fluid Pan And Gasket Procedure.

Procedure A - Parts Application Chart			
Vehicle Application	**Engineering Description**	**Qty.**	**New Service Part**
	95/96 Models ONLY		
96 Aerostar 3.0L/4.0L	Control Assy - Main	1	F5TZ-7A100-CB
95/96 3.0L/4.0L Ranger/Explorer	Control Assy - Main	1	F5TZ-7A100-CB
95/96 2.3L Ranger	Control Assy - Main	1	F57Z-7A100-RA
	97 Models ONLY	1	
97 2.3L Ranger	Control Assy - Main	1	F77Z-7A100-FA
97 3.0L OHV Ranger/Aerostar	Control Assy - Main	1	F77Z-7A100-GA
97 4.0L OHV Ranger/Aerostar	Control Assy - Main	1	F79Z-7A100-AA
97 4.0L OHV Explorer/Mountaineer	Control Assy - Main	1	F77Z-7A100-HA
97 4.0L SOHC Explorer/Mountaineer	Control Assy - Main	1	F77Z-7A100-JA
	1998-2001 Models ONLY		
98/01 2.5L Ranger	Control Assy - Main	1	XL2Z-7A100-AB
98/00 3.0L Ranger	Control Assy - Main	1	XL2Z-7A100-BB
98/00 4.0L - EI Ranger	Control Assy - Main	1	XL2Z-7A100-CB
98/00 4.0L - EI Explorer	Control Assy - Main	1	XL2Z-7A100-DB
98/00 4.0L - SOHC	Control Assy - Main	1	XL2Z-7A100-EB
	2001-2002 Models ONLY		
2001/2002 2.3L Ranger	Control Assy - Main	1	1L5Z-7A100-AB
2001/2002 3.0L Ranger	Control Assy - Main	1	1L5Z-7A100-BC
2001/2002 4.0L-SOHC	Control Assy - Main	1	1L5Z-7A100-CC

Procedure B - Parts Application Chart			
Vehicle Application	**Engineering Description**	**Qty.**	**New Service Part**
	95/97 Models ONLY		
95/97 Models - ALL	Separator Plate to Case Gasket	1	2L5Z-7C155-AA
95/97 Models - ALL	Separator Plate to Main Control Gasket	1	2L5Z-7D100-BA
	95/96 Models ONLY		
95/96 Models - ALL	Plate - Valve Body Separator	1	F5TZ-7A008-CA
		1	
	97 Models ONLY		
97 2.3L Ranger	Plate - Valve Body Separator	1	F77Z-7A008-AB
97 3.0L OHV Ranger/Aerostar	Plate - Valve Body Separator	1	F77Z-7A008-AB
97 4.0L OHV Ranger/Aerostar	Plate - Valve Body Separator	1	F77Z-7A008-CB
97 4.0L OHV Explorer/Mountaineer	Plate - Valve Body Separator	1	F77Z-7A008-DB
97 4.0L SOHC Explorer/Mountaineer	Plate - Valve Body Separator	1	F77Z-7A008-EB
	1998-2001 Models ONLY		
98/01 2.5L Ranger	Plate - Valve Body Separator	1	1L5Z-7Z490-DA
98/00 3.0L Ranger	Plate - Valve Body Separator	1	1L5Z-7Z490-EA
98/00 4.0L - EI Ranger	Plate - Valve Body Separator	1	1L5Z-7Z490-FA
98/00 4.0L - EI Explorer	Plate - Valve Body Separator	1	1L5Z-7Z490-GA
98/00 4.0L - SOHC	Plate - Valve Body Separator	1	1L5Z-7Z490-HA
	2001-2002 Models ONLY		
2001/2002 2.3L Ranger	Plate - Valve Body Separator	1	1L5Z-7Z490-AA
2001/2002 3.0L Ranger	Plate - Valve Body Separator	1	1L5Z-7Z490-BA
2001/2002 4.0L-SOHC	Plate - Valve Body Separator	1	1L5Z-7Z490-CA

LABOR OPERATION CLAIMING CHART			
Operation	**Labor Description**	**Vehicle**	**Time**
021308A	Inspect, And Replace Transmission Main Control	1996-1997 Aerostar 4R44E	2.1
		1996-1997 Aerostar 4.0L MFI 5R55E/5R44E	2.2
		1995-2001 Ranger 4R44E	2.1
		1997-2000 Ranger 5R55E	2.2
		2001-2002 Ranger 5R55E	2.3
		1995-1996 Explorer 4R55E	2.1
		1997-1999 Explorer 4.0L MFI 5R55E/5R44E	2.2
		2000-2001 Explorer/Mountaineer 4.0L SOHC 5R55E/5R44E	2.2
		1997-1999 Explorer 4.0L SOHC 5R44E/5R55E	2.4
		2001-2002 Sport Trac 5R55E/5R44E	2.2
		1998-1999 Mountaineer 4.0L SOHC 5R55E/5R44E	2.4
021308B	Inspect And Install Service Kit In Transmission Main Control	1996-1997 Aerostar 4R44E	3.9
		1996-1997 Aerostar 4.0L MFI 5R55E/5R44E	4.0
		2001-2002 Ranger 5R55E	4.1
		1995-2001 Ranger 4R44E	3.9
		1997-2000 Ranger 5R55E	4.0
		1995-1996 Explorer 4R55E	3.9
		2000-2001 Explorer/Mountaineer 4.0L SOHC 5R55E/5R44E	4.0
		1997-1999 Explorer 4.0L SOHC 5R44E/5R55E	4.2
		2001-2002 Sport Trac 5R55E/5R44E	4.0
		1998-1999 Mountaineer 4.0L SOHC 5R55E/5R44E	4.2
		1997-1999 Explorer 4.0L 5R55E/5R44E	4.0

PART NUMBER	PART NAME
1L5Z-7M203-JA	Valve Body Service Kit

OTHER APPLICABLE ARTICLES: 02-8-3
SUPERSEDES: 02-8-2
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

DEALER CODING

BASIC PART NO.	CONDITION CODE
7A100	42

OASIS CODES: 501000, 502000, 503000

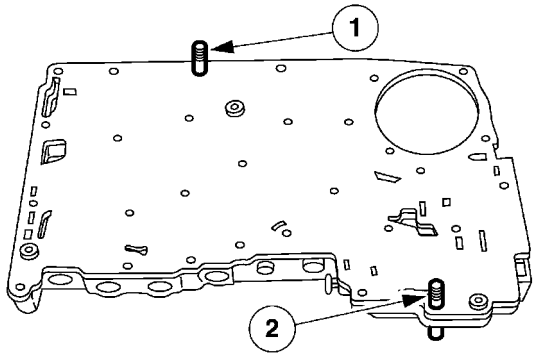


Figure 1 - Article 02-13-8