FRONT INNER WHEEL BEARING INSPECTION

AFFECTED VEHICLES: **CERTAIN 2001 MOTORHOME CHASSIS (MODEL F-53)**

OVERVIEW

1. On some of the affected vehicles, the inner wheel bearing did not receive lubrication during assembly.
2. Inspect/Repair procedure:

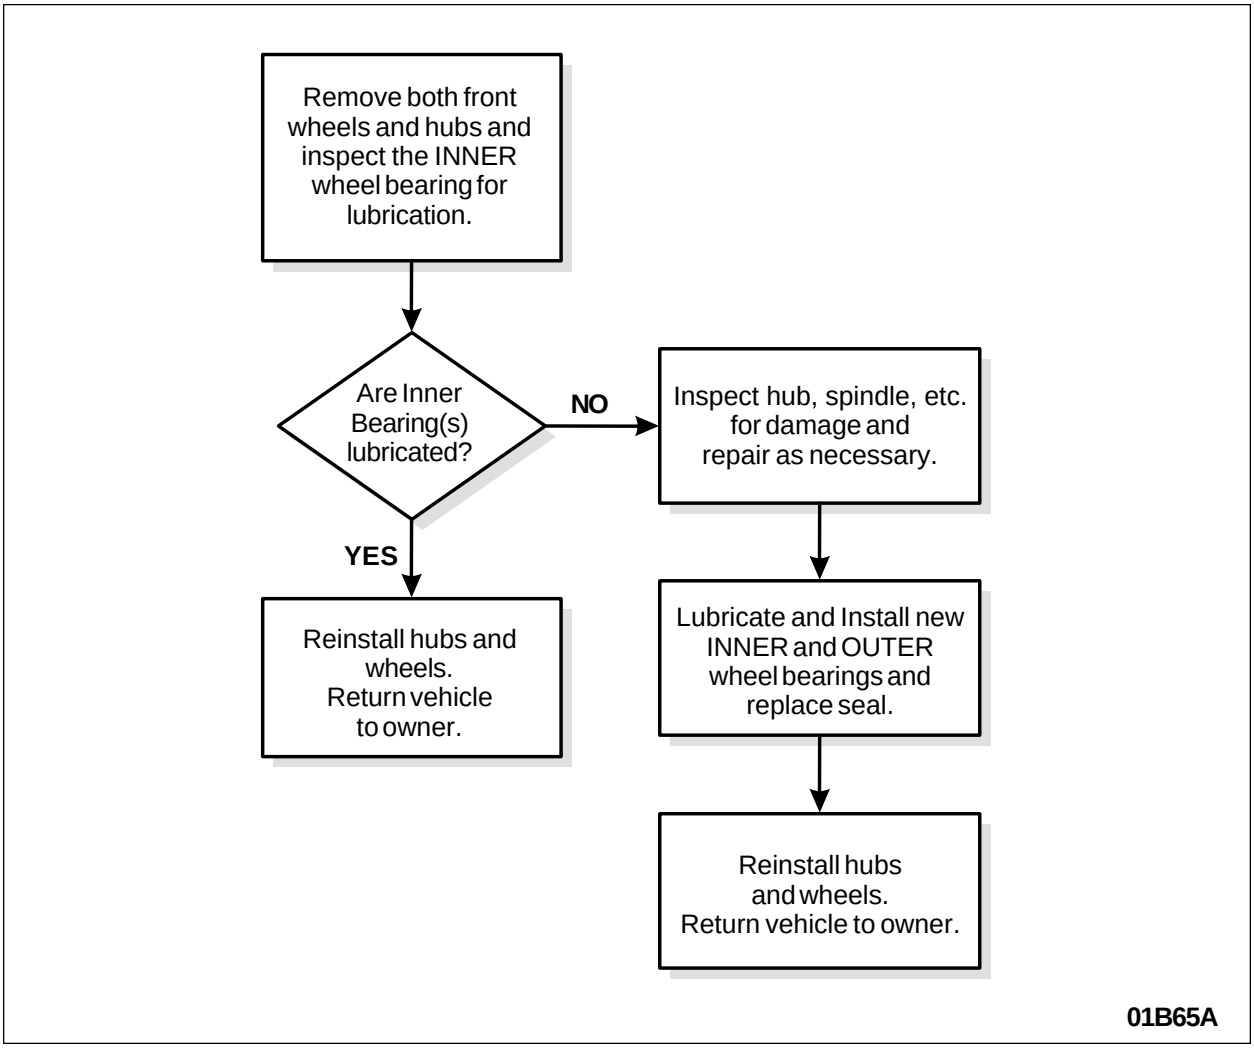


FIGURE 1

Ford Motor Company
CPR © 2001 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
02/01

REMOVAL/INSPECTION

1. Place chocks behind the rear wheels.
2. Raise and support the front end so that both wheels are off the ground.
3. Remove both front wheel and tire assemblies.
4. If equipped, remove the ABS sensor (F81Z-2C204-AB) and disconnect the clips that secure the sensor harness to the brake line, then position the sensor out of the way. Inspect the sensor for any damage and replace if necessary.
5. Remove the caliper and caliper anchor plate as an assembly and position it out of the way.
6. Remove the wheel bearing grease cap, cotter pin, nut, washer and outer bearing.
7. Remove the hub/rotor assembly from the vehicle and position it on a suitable work surface.
8. Inspect the inner wheel bearings for grease.
   - If grease is present, no other service is required. Go directly to Step 4 of the Bearing Installation procedure.
   - If grease is not present, proceed to Bearing Removal and Inspection.

Ford Motor Company
CPR © 2001 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
02/01

BEARING REMOVAL AND INSPECTION

1. Remove the inner bearing grease seal and inner bearing.
2. Using a bearing cup driver tool, or other suitable tool, remove the inner and outer bearing cups from the hub/rotor assembly. See Figures 1 and 2.

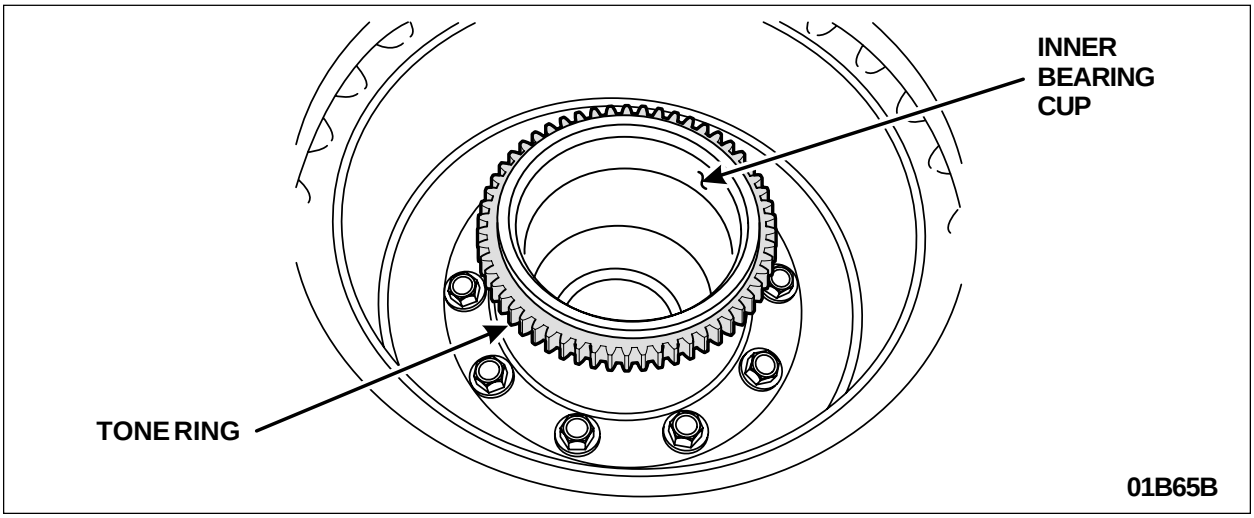


FIGURE 1

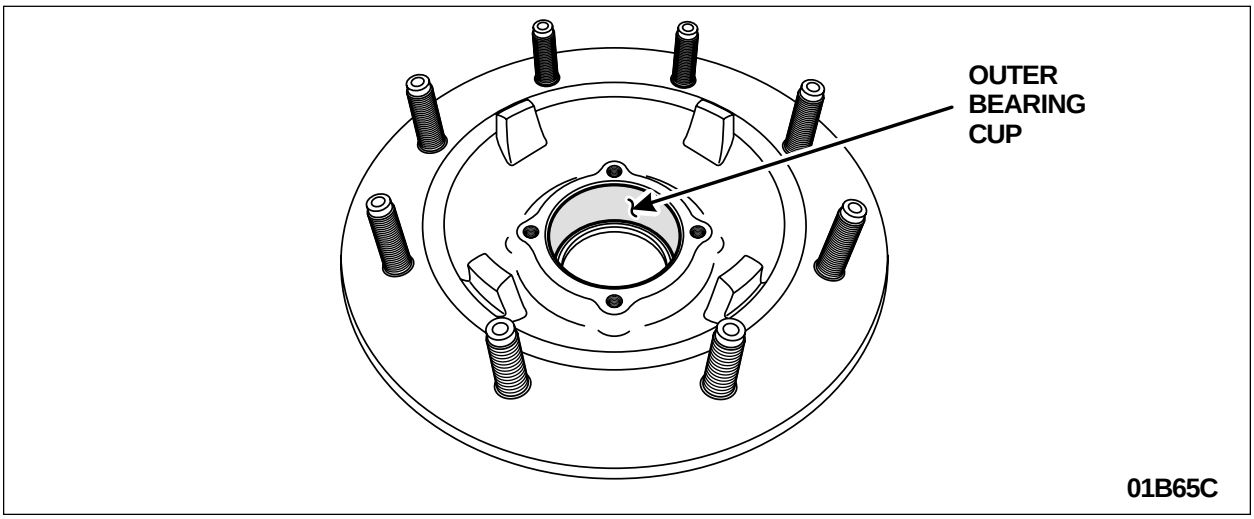


FIGURE 2

3. Clean and thoroughly inspect the wheel bearing area of the hub/rotor assembly and the ABS tone ring (F81Z-1104-AD) for damage (i.e., scoring, bluing, warping, etc.). If damage is present, replace the damaged component(s).
4. Inspect the spindle (F81Z-3105/3106-HA) for any damage (i.e., scoring, bluing, warping, etc.) and replace if necessary.

Ford Motor Company

CPR © 2001 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
02/01

BEARING INSTALLATION

1. NOTE: Remove any burrs or sharp edges from the bearing cup seat in the hub/rotor assembly before installing the bearing cup. After bearing cup installation, check for proper seating by trying to insert a .38-mm (.0015-inch) feeler gauge between the bottom face of the cup and the wheel hub seat. You should not be able to insert the feeler gauge.

   Using a bearing cup driver tool, or other suitable tool, install the ***new*** inner and outer wheel bearing cups into the hub/rotor assembly.
2. Pack both ***new*** wheel bearings and the inside of the hub/rotor assembly with Motorcraft Premium Long-Life Grease, XG-1-C or -K or equivalent, meeting Ford specification ESA-M1C75-B.
3. Install the ***new*** inner bearing and ***new*** grease gasket/seal into the hub/rotor assembly.
4. Position the hub/rotor assembly onto the spindle.
5. NOTE: If the inspection (Removal/Inspection Step 8) verified the presence of grease, reinstall all original parts except the cotter pin and grease cap gasket/seal.

   Install the ***new*** outer bearing, ***new*** washer and nut and adjust the wheel bearing as follows:
   - While rotating the hub/rotor assembly, tighten the nut to 114 Nm (85 lb-ft).
   - Back the nut off until loose.
   - Finger tighten the nut and line up the cotter pin hole.
6. Install a ***new*** cotter pin and the grease cap with a ***new*** gasket/seal.
7. NOTE: Make sure to use Threadlock E2FZ-19554-B, or equivalent, on the caliper anchor bolts to prevent them from loosening.

   Position caliper and caliper anchor plate onto the hub/rotor assembly and install the anchor plate bolts. Tighten to 400 Nm (295 lb-ft).
8. If equipped, install the ABS sensor and secure the sensor harness to the brake line. Tighten sensor bolt to 12 Nm (9 lb-ft).
9. Position the front wheel and tire assemblies and install the lug nuts. Tighten the nuts to 224 Nm (164 lb-ft).
10. Remove vehicle supports, then lower the vehicle and remove the wheel chocks.

Ford Motor Company
CPR © 2001 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
02/01