TRIM—REAR COAT HOOK/LAMP LOOSE IN HEADLINER	Article No. 03-1-2

FORD: 1999-2003 WINDSTAR

ISSUE

Some vehicles may exhibit a rear coat hook/reading lamp not secured properly in the headliner. This may be caused by the attachment procedure used.

ACTION

Remove the coat hook/reading lamp and trim excess material from the clip stop. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

To reinstall a coat hook/reading lamp that has fallen out of the headliner or will not remain tight to the headliner:

1. Remove the reading lamp from the headliner and unplug the wire connector.
2. Remove the clip from the back side of the lamp.
3. Measure 2-3 mm from the edge of clip support (along dotted line shown in Figure 1).
4. Cut/remove the 2-3 mm of material (as per dotted line in Figure 1). This will allow the clip to travel further down tab, and once engaged in sheet metal the gap will be reduced.
5. Reinstall the clip on the back of the lamp.
6. Reinstall the connector on the lamp and reinstall the lamp into the headliner. Make sure that it is flush against the headliner.

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
030102A	Remove Lamp From Headliner And Perform Repair Procedure - One Lamp Only	0.2 Hr.
030102B	Remove Both Lamps From Headliner And Perform Repair Procedure - Both Lamps	0.3 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
1751944	34

OASIS CODES: 107000, 201000, 201100

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by “do-it-yourselfers”. Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle.

Copyright © 2002 Ford Motor Company

Article No. 03-1-2 Cont'd.

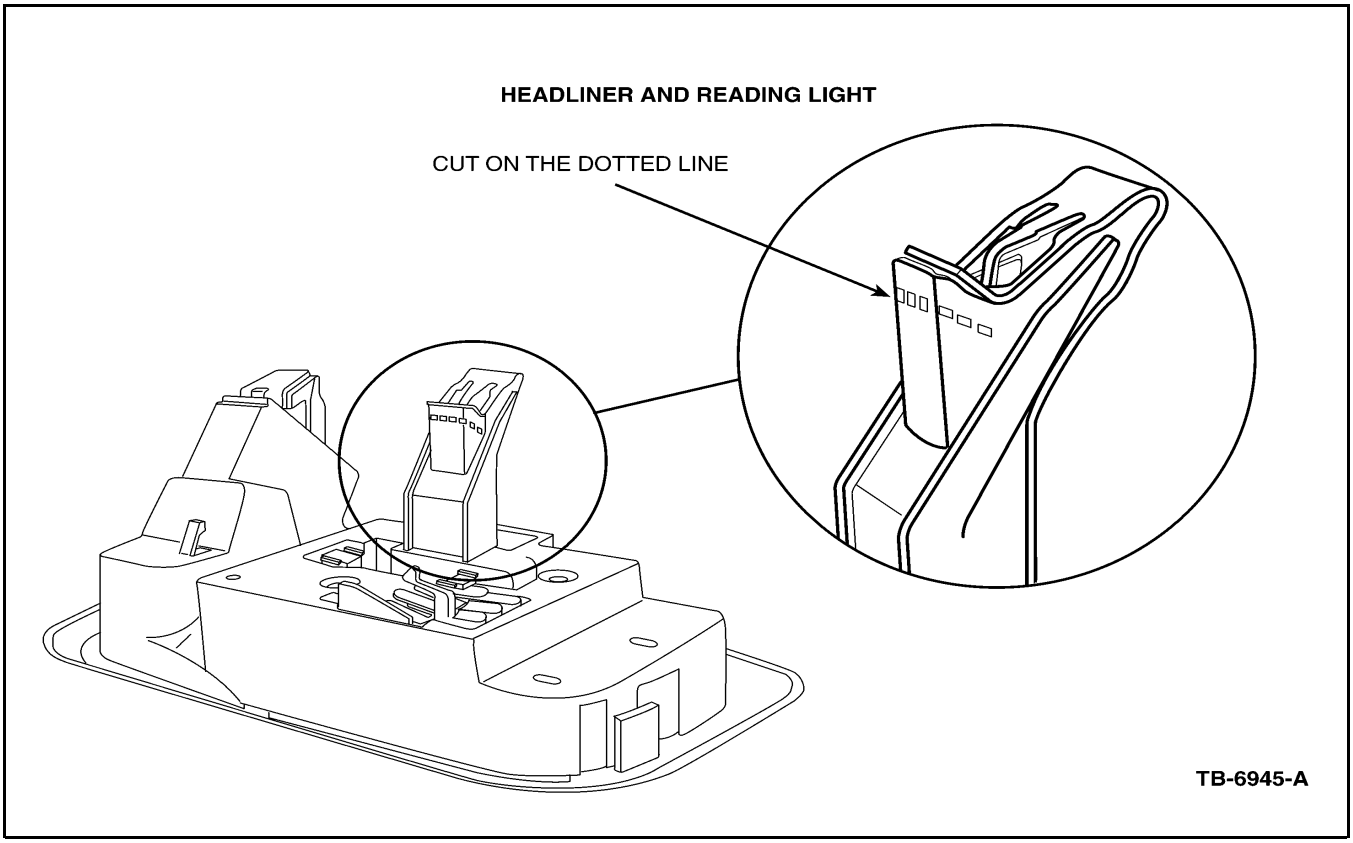


Figure 1 - Article 03-1-2