TRANSMISSION—5R55W—HARSH UPSHIFT AT LIGHT TO MEDIUM THROTTLE—VEHICLES EQUIPPED WITH 4.6L ENGINE—VEHICLES PRODUCED THROUGH 9/21/2001	Article No. 01-20-3

FORD: 2002 EXPLORER

MERCURY: 2002 MOUNTAINEER

ISSUE

Some vehicles equipped with a 4.6L engine and 5R55W automatic transmission built through 9/21/2001 may exhibit harsh 1-2, 2-3, 3-4 upshifts at light to medium throttle. This may be caused by calibration of the Powertrain Control Module (PCM).

ACTION

Verify the condition. If the condition exists, reprogram the PCM with an updated calibration. If the condition persists after the reprogram, continue with normal diagnostics to pinpoint the condition. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

Verify that at light to medium throttle positions, the 1-2, 2-3 or 3-4 shift is harsh. Prior to performing any service procedures, verify tear tag information. Refer to the PCM Calibration Information Chart in this article. If the calibration is not at the latest level, follow the procedures found in the Powertrain Control/Emissions Diagnosis (PC/ED) Service Manual to reprogram the PCM to latest calibration level.

After reprogramming has been completed, the transmission adaptive strategy for pressure control on engagements must be updated.

1. Install diagnostic equipment and monitor the Transmission Fluid Temperature (TFT).
2. Warm the transmission fluid to at least 54°C (130°F) as indicated by the TFT.
3. Perform five (5) engagements from Park to Reverse. Each engagement must be 5 seconds apart.
4. Perform five (5) engagements from Drive to Reverse. Each engagement must be 5 seconds apart.
5. Perform five (5) engagements from Reverse to Drive. Each engagement must be 5 seconds apart.
6. Perform five (5) engagements from Neutral to Drive. Each engagement must be 5 seconds apart.

NOTE

ALL OF THESE ENGAGEMENTS MUST BE PERFORMED IN ORDER FOR THE ENGAGEMENT PRESSURES TO PROPERLY ADAPT WITH THE NEW CALIBRATION.

Verify repair. If the condition is not corrected, continue with normal diagnostics and repair per the Workshop Manual.

Copyright © 2001 Ford Motor Company

Article No. 01-20-3 Cont'd.

PCM CALIBRATION INFORMATION						
Application	Old Part Number (-12A650-)	Tear Tag	New Part Number (-12A650-)	Old Calibration	New Calibration	NGS/WDS Qualifier
2002 Explorer, 4.6L	1L2F-ARE	HMJ5	1L2Z-ARF	1U51A50B08	1U51A50B10	B15.6 WDS Release or Later
2002 Explorer, 4.6L	1L2A-CD	EGQ4	1L2Z-CE	1U51A50M07	1U51A50M10	B15.6 WDS Release or Later
2002 Explorer, 4.6L	1L2F-VE	MCU5	1L2Z-VF	1U51A50E08	1U51A50E10	B15.6 WDS Release or Later
2002 Explorer, 4.6L	1L2F-YE	DTV5	1L2Z-YF	1U51A50J08	1U51A50J10	B15.6 WDS Release or Later

Obtain an Authorized Modifications Decal (STAT 5941-2 - obtainable through the PDC) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

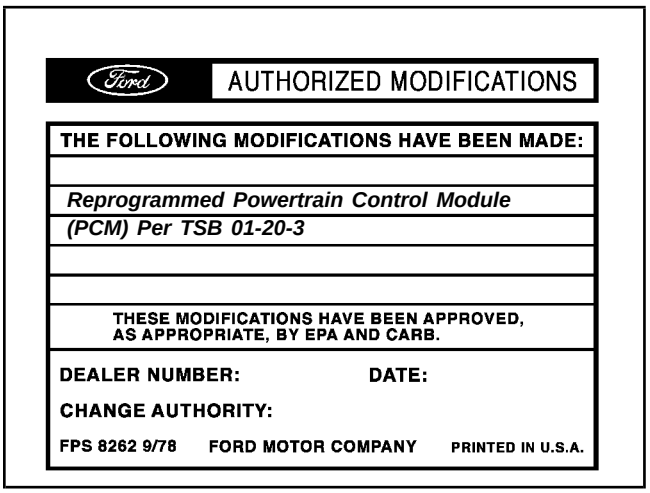

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
012003A	Reprogram Powertrain Control Module (Includes Time To Verify Tear Tag Information And Perform Transmission Adaptive Strategy Update)	1.5 Hrs.

DEALER CODING

	CONDITION CODE
BASIC PART NO.	
RECAL	42

OASIS CODES: 501000, 501200