NO START—IN DAMP WEATHER WHEN WIPER SWITCH IS LEFT IN INTERMITTENT OR LOW SPEED POSITION—CONTOUR/MYSTIQUE EQUIPPED WITH V6 ENGINE AND ALL COUGARS	Article No. 00-18-6

FORD: 1998-2000 CONTOUR

MERCURY: 1998-2000 MYSTIQUE
1999-2000 COUGAR

ISSUE

Some vehicles may exhibit a no start condition when the wiper switch is in the INTERMITTENT or LOW-SPEED setting during vehicle start-up. This no start condition does not occur if the wipers are set to OFF or HIGH-SPEED during vehicle start-up. This may be caused by the wiper motor wiring being routed too close to the Passive Anti-Theft System (PATS) module.

ACTION

Inspect wiper motor wire routing near PATS transceiver module. If the wire routing is close to the PATS transceiver module as shown in Figure 1, tie strap the wiring to the steering column as shown in Figure 2. Verify that vehicle starts with wiper motor set to INTERMITTENT and LOW-SPEED. If vehicle does not start under these two conditions after moving the wire harness, replace Wiper Motor -17508- with F7RZ-17508-AA. Refer to the appropriate Workshop Manual for wiper motor replacement procedure.

PART NUMBER	PART NAME
F7RZ-17508-AA	Windshield Wiper Motor

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
001806AB	Extra Time To Replace Wiper Motor - 1998-2000 Contour/Mystique	0.6 Hr.
001806AC	Extra Time To Replace Wiper Motor - 1999-2000 Cougar	0.5 Hr.
001806A	Inspect And Reposition Passive Anti-Theft System (PATS) Module Wiring	0.2 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
15607	43

OASIS CODES: 203000, 203200, 499000, 601300, 603300

Copyright © 2000 Ford Motor Company

WIPER MOTOR WIRING HARNESS ROUTING
RELATIVE TO PATS TRANSCEIVER MODULE


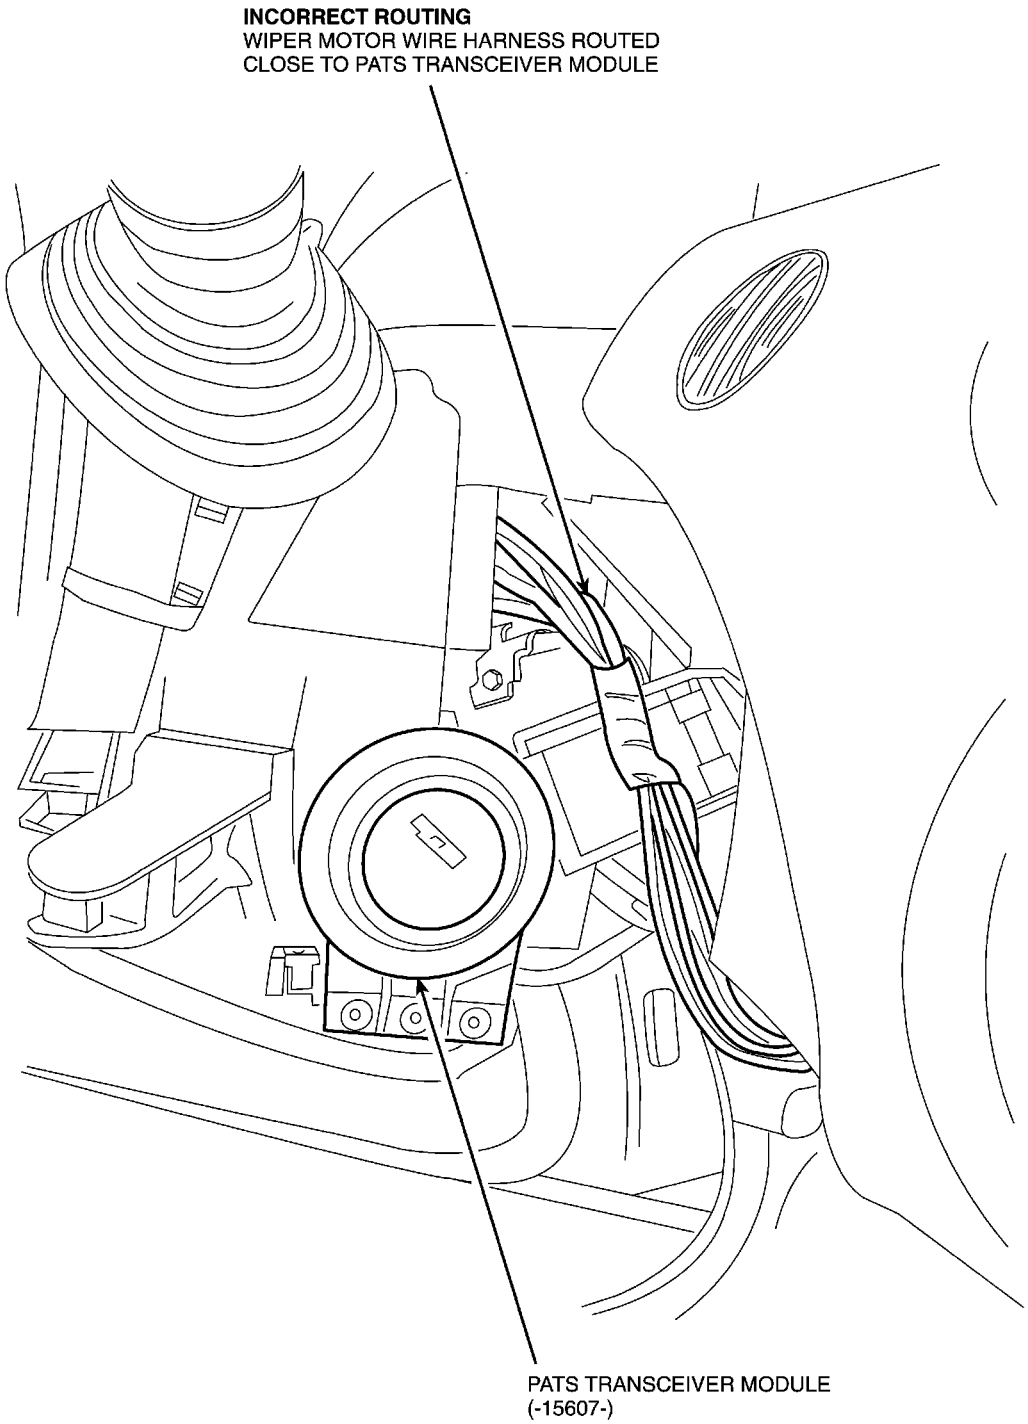


Figure 1 - Article 00-18-6

WIPER MOTOR WIRING HARNESS ROUTING RELATIVE TO PATS TRANSCEIVER MODULE

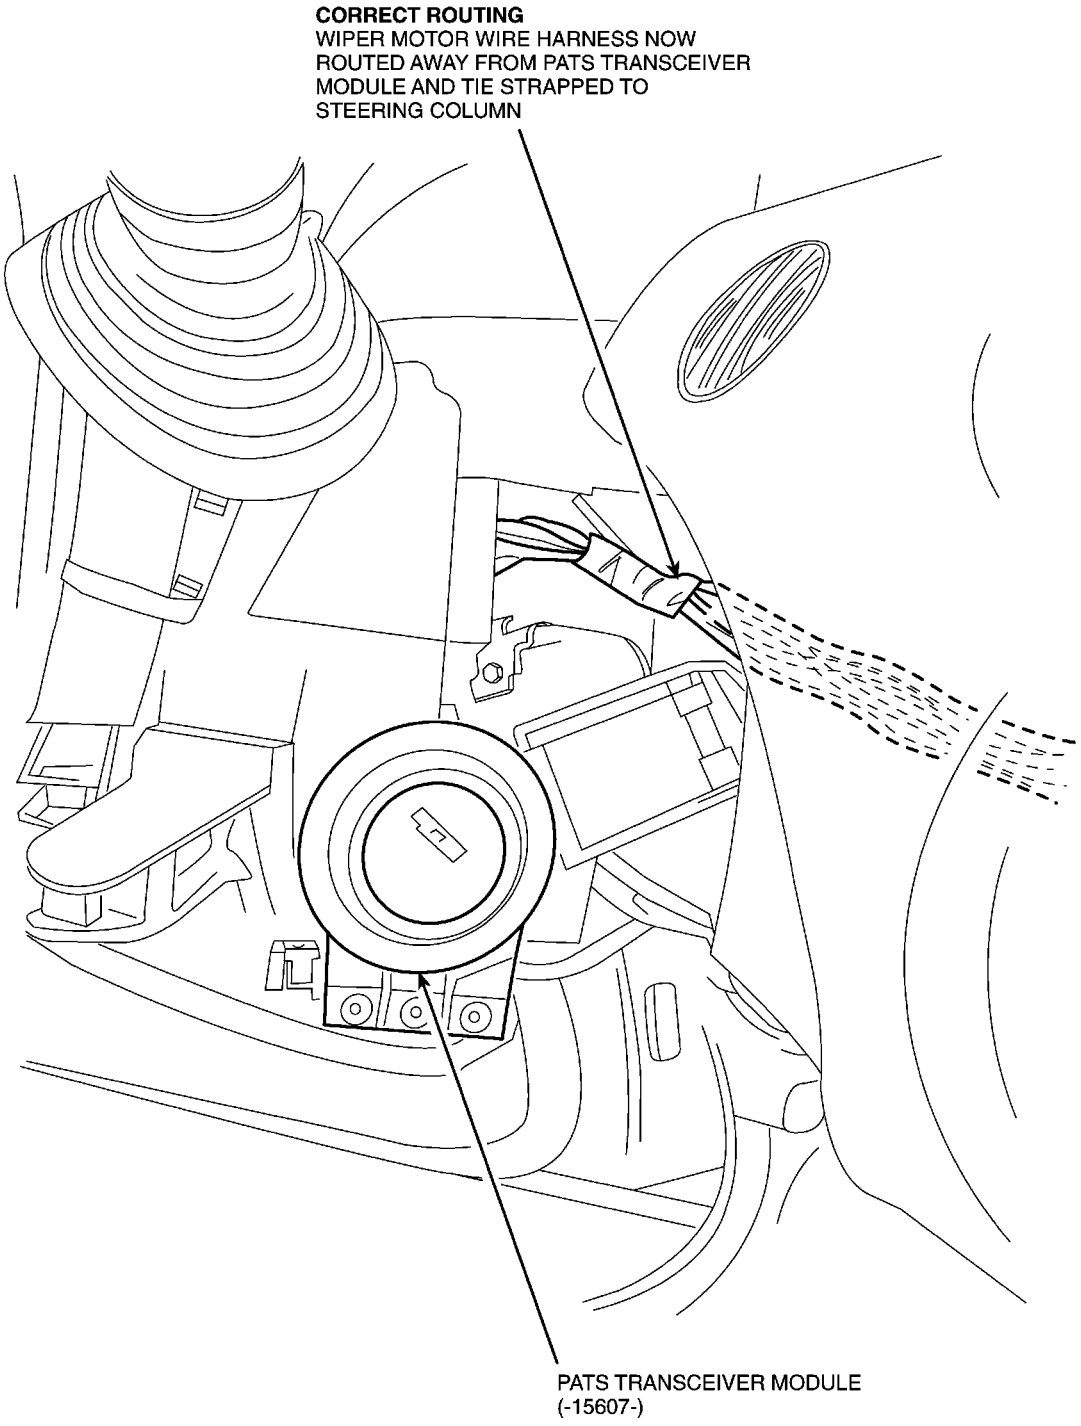

CORRECT ROUTING

TB-6067-A

Figure 2 - Article 00-18-6