F-SERIES DRIVESHAFT INSPECTION

AFFECTED VEHICLES: **CERTAIN 2000 AND 2001 F-250 AND F-350 4X4 SRW MODELS EQUIPPED WITH GAS ENGINES AND 5-SPEED MANUAL TRANSMISSIONS**

OVERVIEW

Certain F-250 and F-350 4x4 SRW (single rear wheel) vehicles may have been assembled with front driveshafts that are too long. This procedure will provide the detail to correctly identify an affected driveshaft and refer you to the appropriate workshop manual section if replacement is necessary.

INSPECTION

1. Raise and support the vehicle on a hoist.
2. Inspect to see if the entire front driveshaft is painted black. If necessary, wipe it clean.
3. If the driveshaft is black, no service is required. Lower and release the vehicle.
4. If the driveshaft is not painted black, measure the length of the tube from the centers of the welds. See Figure 1.

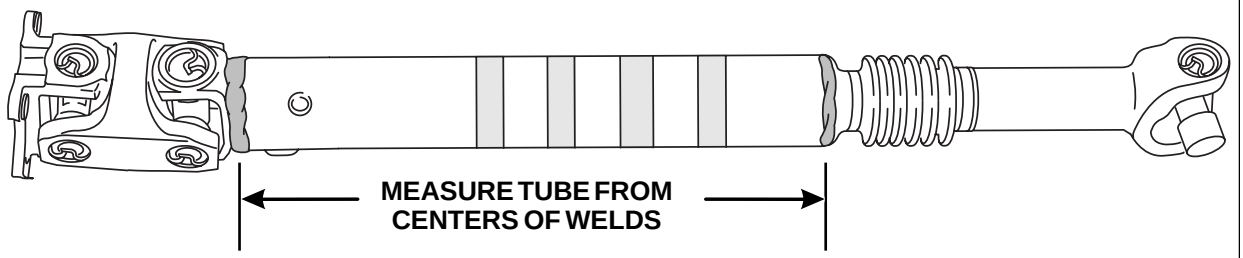

00B53A

FIGURE 1

CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
09/00

5. If the driveshaft tube measures less than 524 mm (20 5/8 inches), no service is required. Lower and release the vehicle.
6. If the driveshaft tube measures 524 mm (20 5/8 inches) or greater, the drive shaft must be replaced. Refer to Section 205-01 of the appropriate workshop manual for replacement instructions.

IMPORTANT REPAIR INFORMATION

The torque specification for the bolts at the driveshaft-to-transfer case connection (rear bolts) is listed incorrectly in the workshop manual. Please refer to the specifications listed below when installing the ***new*** driveshaft.

- Tighten the four (4) **rear bolts** to **111 Nm** (82 lb-ft).
- Tighten the four (4) **front bolts** to **35 Nm** (26 lb-ft).

CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
09/00