DRIVEABILITY—HESITATION, BUCKING OR SURGE FELT DURING STEADY SPEEDS BETWEEN 40-60 MPH (64-96 KM/H)	Article No. 02-13-5

LINCOLN: 1999-2002 CONTINENTAL

ISSUE

Some vehicles may exhibit a hesitation, buck or surge during a steady state operation at 40-60 MPH (64-96 KM/H). This may be caused by the Powertrain Control Module (PCM) calibration.

ACTION

Reprogram the Powertrain Control Module (PCM) with a revised calibration. The revised calibration should reduce the possibility of hesitation, bucking or surge. Refer to the following Calibration Information Chart for details.


SERVICE PROCEDURE

Reprogram the Powertrain Control Module (PCM) with a revised calibration. The revised calibration should reduce the possibility of hesitation, bucking or surge. Refer to the following Calibration Information Chart.

PCM CALIBRATION INFORMATION

Application	Old Part Number (-12A650-)	Old Tear Tag	New Tear Tag	New Part Number (-12A650-)	Old Calibration	New Calibration	NGS/WDS Qualifier
1999 Continental	XF3F-CD	YPT3	KRS0	2U7Z-BKA	9VWA-BCD	9VWA-BCD	WDS B19A.5 or Later
2000 Continental	YF3F-AA	HGM0	KRS0	2U7Z-BKA	0J1BN0B10	0J1BN0B10	WDS B19A.5 or Later
2001, 2002 Continental	1F3F-CC	RWZ2	KRS0	2U7Z-BKA	1JC1BN0511	1JC1BN0511	WDS B19A.5 or Later

Obtain an Authorized Modifications Decal (STAT 5941-2 - obtainable through the PDC) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

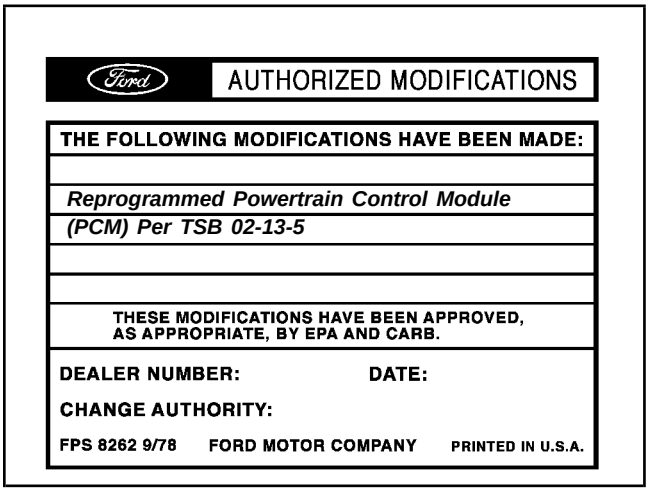

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 608000, 608600, 609000, 609600, 610000, 610600, 611000, 611500, 612000, 612600

Copyright © 2002 Ford Motor Company