INTERIOR—A-PILLAR TRIM WARPED—VEHICLES BUILT FROM 8/7/1998 THROUGH 8/26/1999	Article No. 99-21-6

FORD: 1999-2000 WINDSTAR

ISSUE

The A-pillar trim may become warped as a result of stress from the expansion and contraction of the material due to temperature changes.

ACTION

Replace the A-pillar trim piece, eliminate the lower retaining clip, and cut a slit in the base of the middle retaining clip. This should reduce the possibility of warpage. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Remove the warped A-pillar trim from vehicle.
2. Obtain a new A-pillar trim from service stock.
3. Remove the #3 retaining clip (bottom of trim piece) by cutting off the plastic sail area (Figure 1).
4. Cut two slits approximately 10mm long into the plastic base of #2 clip (#2 clip is located middle of trim piece) at the two areas indicated (Figure 2).
5. Install the reworked trim piece onto the A-pillar.

PART NUMBER	PART NAME
XF2Z-1603598-AAB	A-Pillar Trim
XF2Z-1603598-AAA	A-Pillar Trim

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
992106AB	Replace Both A-Pillar Trim Pieces	0.3 Hr.
992106A	Replace One A-Pillar Trim Piece	0.2 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
1603598	34

OASIS CODES: 107000

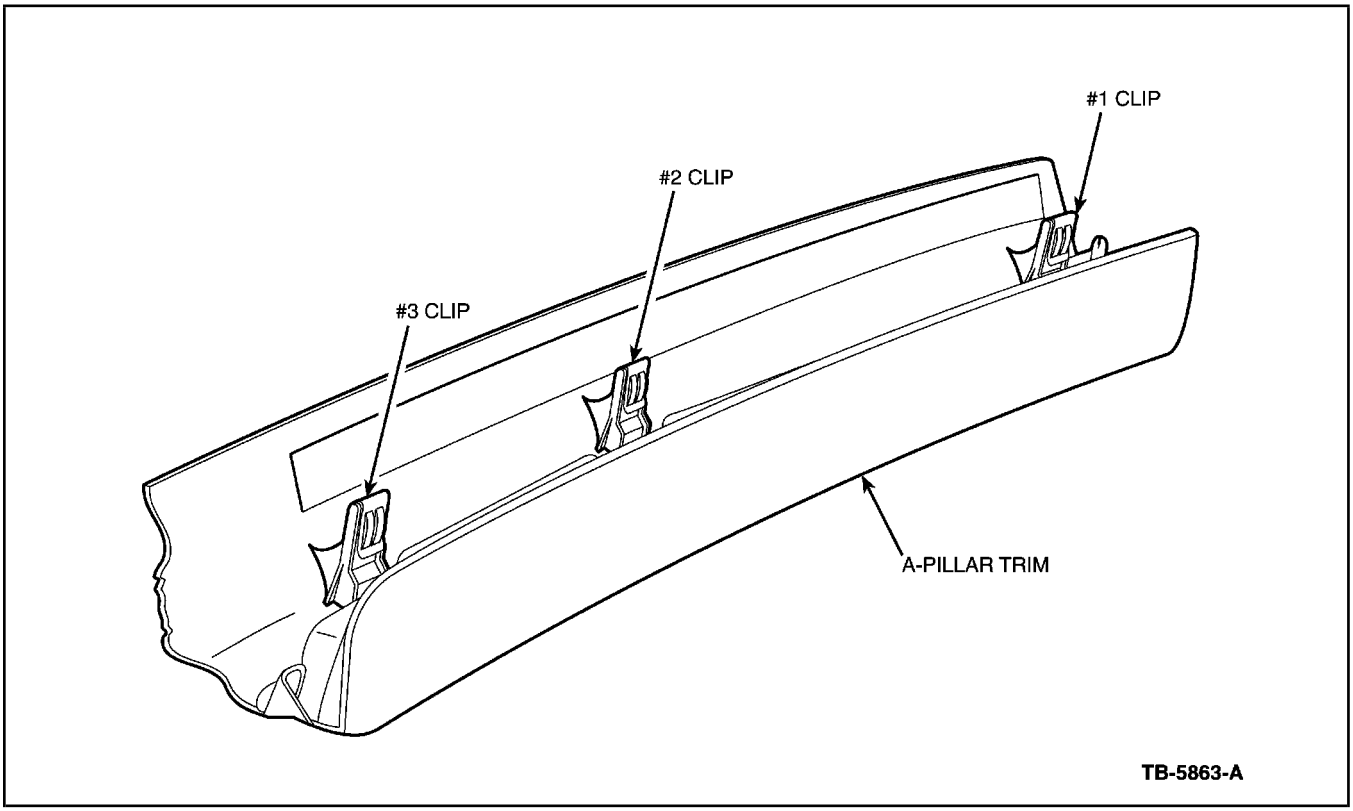

Figure 1 - Article 99-21-6

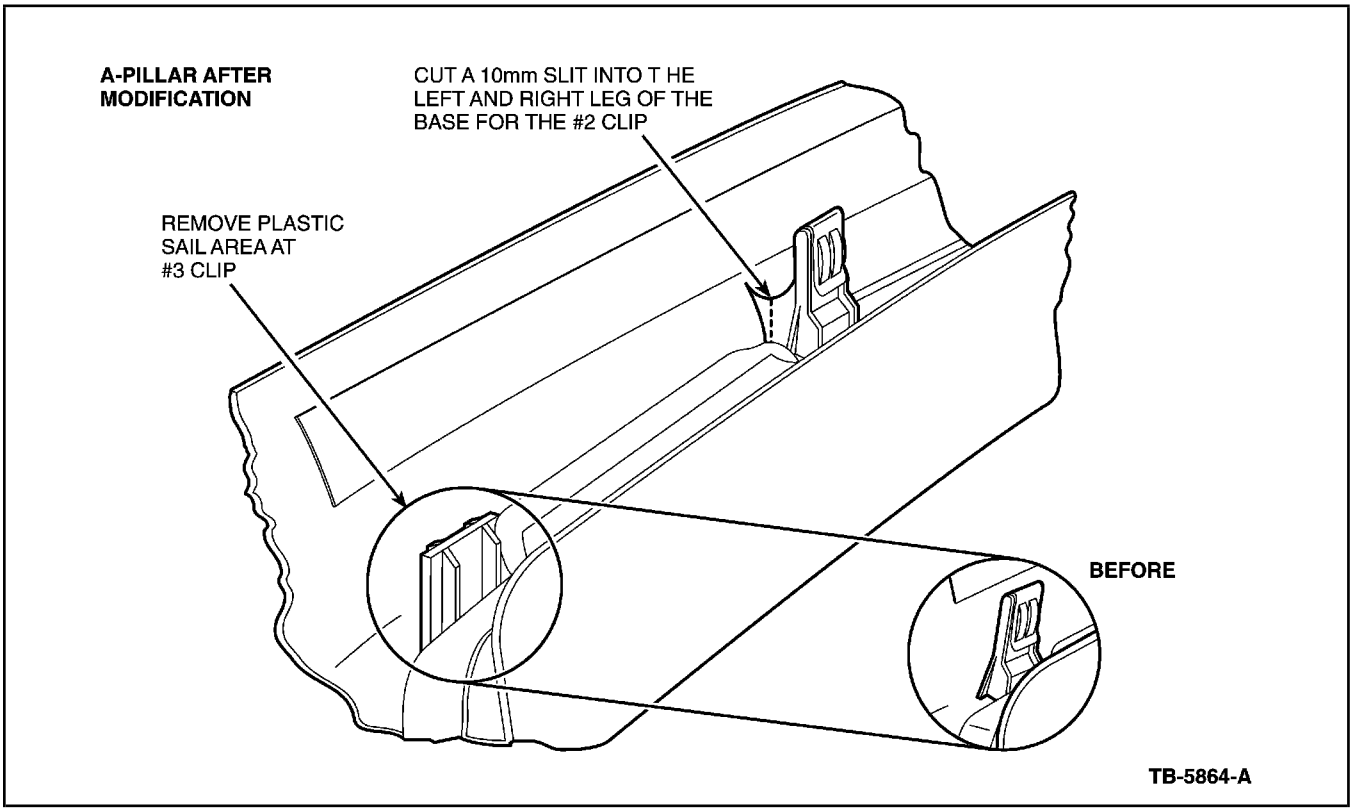

Figure 2 - Article 99-21-6